



Expertise

Protocol number: 46850071
Order No. / Reference: 26644712
Inspection date: 3 Aug 2026

Manufacturer: Opel

Model: Grandland 1.5 D Automatik Elegance

VIN: W0VZCYHZ1P6003714



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Grandland 1.5 D Automatik Elegance

Vehicle Identification number	W0VZCYHZ1P6003714
Mileage (Read)	84,145 km
First registration	14 Mar 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Vertigo Blau Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	25,900 km
Last service on / at	05/2026 at 80,063 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ366445
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1844 / AHG 00256		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 103H	Winter tyres on Light alloy	Bridgestone	2mm / 2mm
2)	215/65 R17 103H	Winter tyres on Light alloy	Bridgestone	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 ignition keys, both foldable
- Driver and passenger side airbags
- Airbag: Head airbags, front and rear outer
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirrors, electrically adjustable and heated, electrically folding
- Roof design line in chrome
- Decorative strips, Erino/Palladium Medium
- Tachometer
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Luggage compartment cover
- Transmission: 8-speed automatic
- Interior lighting, front and rear
- Child safety lock in the rear doors, manual
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- Leather steering wheel, flat-bottomed, with steering wheel remote control
- Center armrest, sliding, front, including storage compartment and cup holder
- Park & Go
- Front and rear parking sensors
- Radio: Multimedia Radio Pro
- Rain sensor
- Wheels: Light alloy 7.5 J x 18 with 5 double spokes in bicolor/black
- Speed-sensitive power steering
- Seats: Ergonomic active seat with AGR seal of approval, driver
- Lane Assist
- 12-volt power outlet
- Phone: Wireless Charging
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer
- Storage compartments
- Airbag: Front and side airbags
- Ambient lighting, center console and in the front door pockets
- Automatic activation of the hazard warning lights
- Hill Start Assist
- On-board computer
- Decor: Opel Vizor with chrome frame
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Front collision warning
- Cruise control with intelligent speed limiter
- Rear window wiper
- Interior rearview mirror, automatically dimming
- Dual-zone automatic climate control including rear footwell heating
- LED headlights
- Steering wheel, height and reach adjustable
- Illuminated makeup mirror in sun visor, for driver and front passenger
- Package: Comfort Package
- Automatic parking assistant
- Quickheat heating system
- Radio accessories: Digital radio reception DAB+
- Tire pressure warning
- Wheels: Tire repair kit
- Rear view camera
- Seat belts
- Seats: Rear seat backrest split 40:60 and foldable
- Solar Protect thermal insulation glazing
- Start/Stop System
- Bumpers and side panels in high-gloss black
- Blind spot warning system
- Immobiliser
- Central locking with remote control and interior switches



Extra equipment

- Package: Business Premium Package (IntelliLux LED Pixel Matrix Light: Adaptive LED matrix headlights with individual light distribution and the following functions: City light, motorway light, country road light, static cornering light, turning light, parking function light, high beam: traffic-dependent dimming taking into account preceding and oncoming road users, automatic headlight range control, fog lights - Navi 5.0 Intellilink)
- Seats: Ergonomic active seats with AGR seal of approval, driver and front passenger (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electro-pneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in Taxa fabric, black - FlexFold rear seat backrest split and foldable in a 40:60 ratio, rear center armrest with pass-through - winter equipment with seat heating, heated windshield in the wiper area, heated steering wheel)
- Detachable trailer hitch (trailer stability program)
- Forward Collision Warning (monitors the distance (close, medium, far) to the vehicle ahead; if the vehicle approaches a vehicle ahead or a pedestrian too quickly, a warning tone sounds and a message appears in the driver information display. - with automatic emergency braking and pedestrian detection - Lane Keeping Assist: warns if the vehicle unintentionally leaves its lane - Traffic Sign Recognition - Driver Drowsiness Detection - Automatic Speed Assist with Stop&Go function - Automatic Headlights)
- Paint finish: Metallic
- safety net
- Wheels: Winter tires 215/65 R17 on LMF

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - rear left side	Door - Scratch(es) - Cover / polish
2	2nd wheel set	Tyres - complete set (215,65,17 w.) - Worn - Replace
3	Door - rear right side	Door - Scratch(es) - Paint
4	Door - front left side	Door - Scratched - Paint
5	Door - front right side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Side panel - rear right side

Paint coat thickness measurement

Side panel - rear right side	150 µm
------------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Comments

- Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

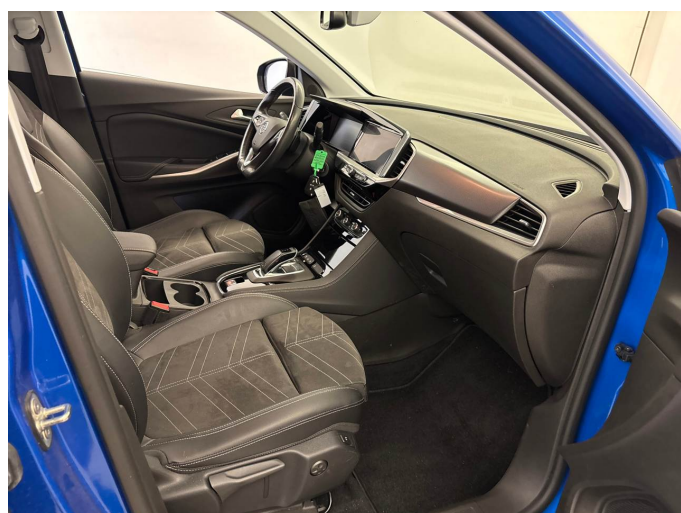


Figure 5: Interior - front

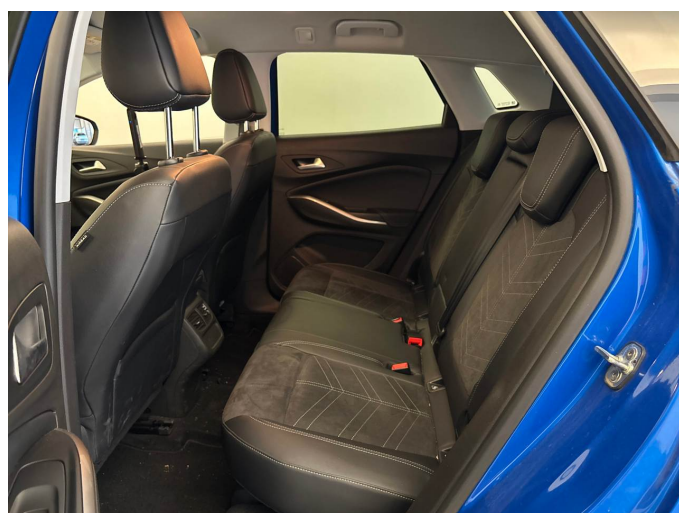


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

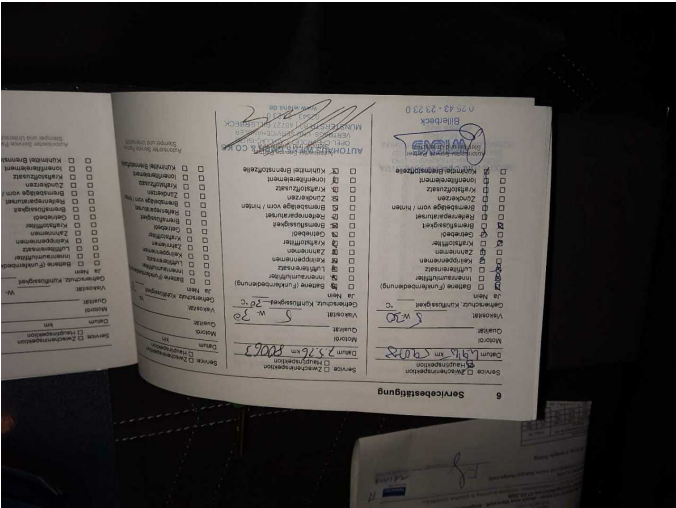


Figure 15: Documents

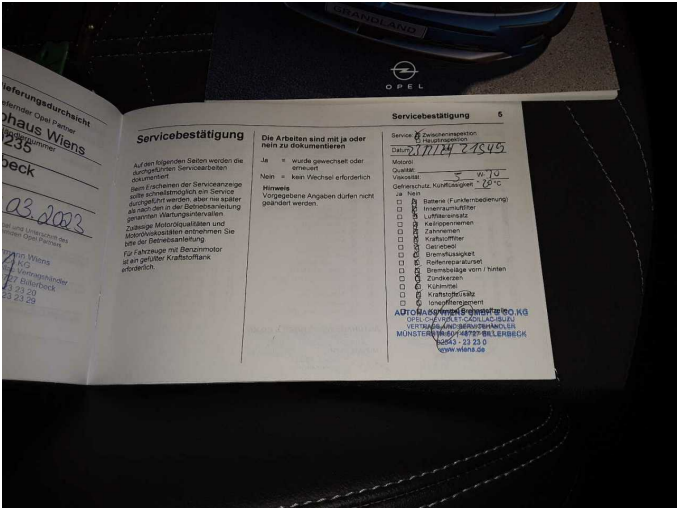


Figure 16: Documents

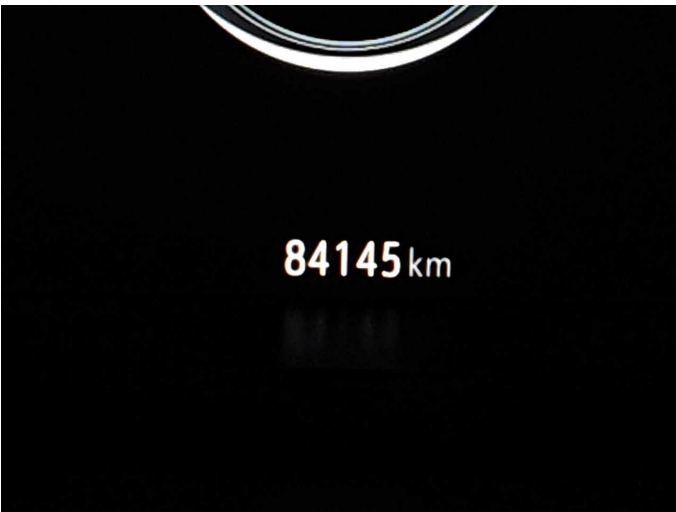


Figure 17: Documents



Figure 18: Documents



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.

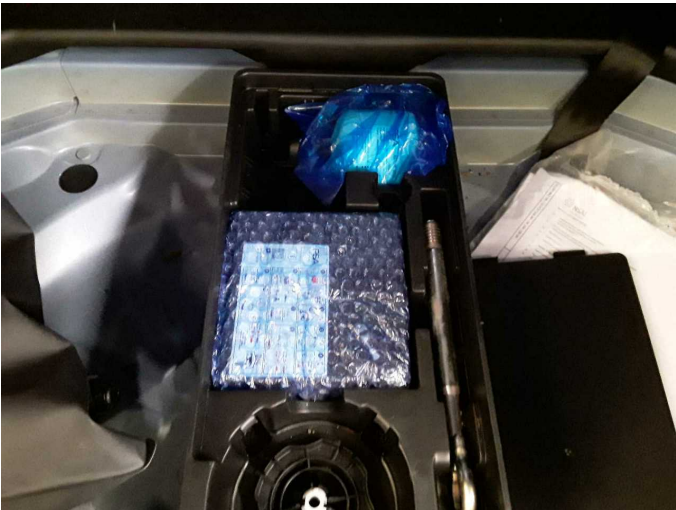


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

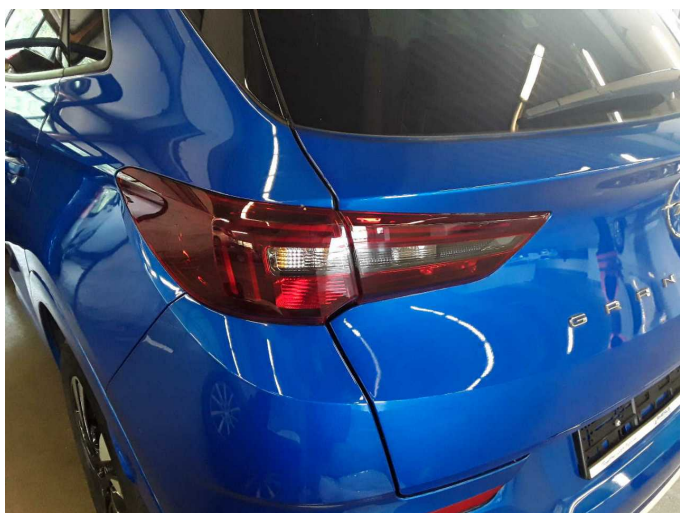


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

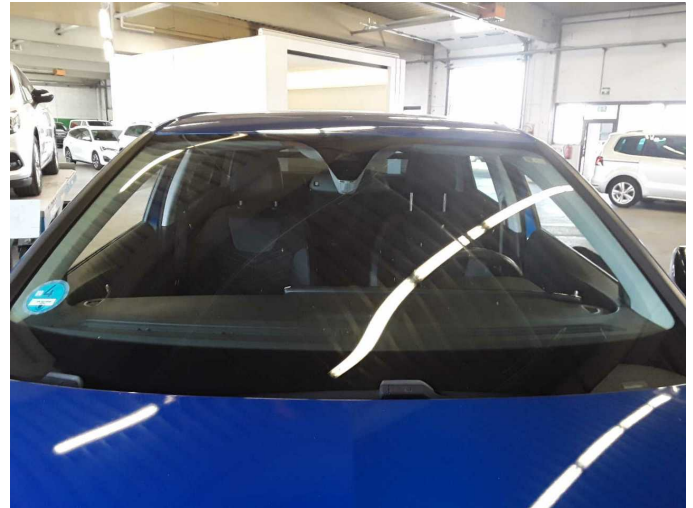


Figure 32: Misc.

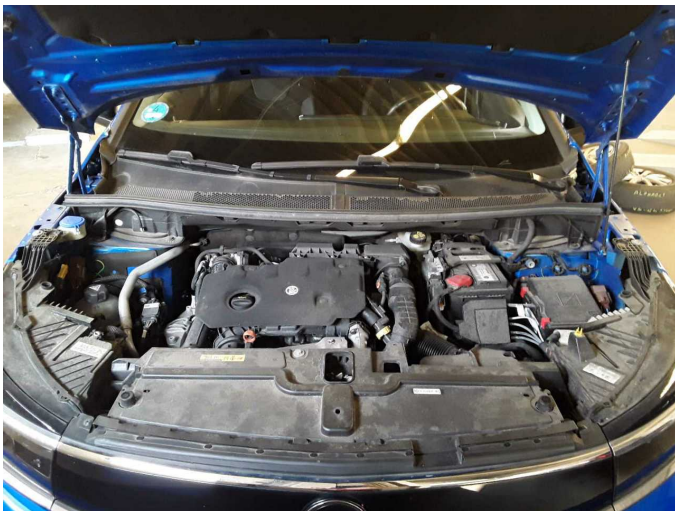


Figure 33: Misc.

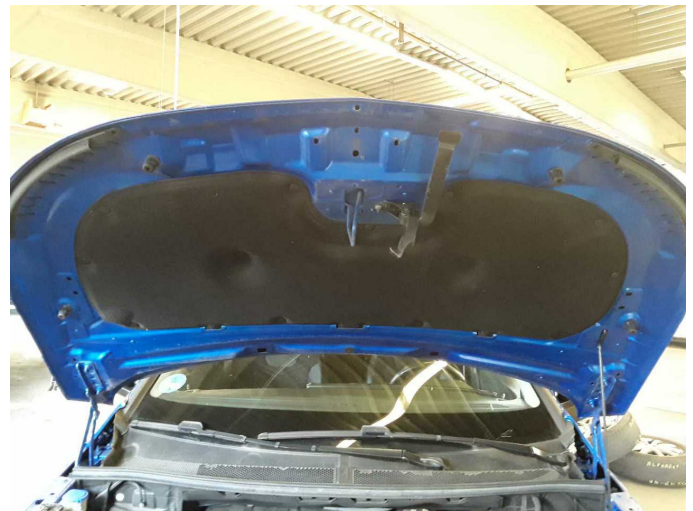


Figure 34: Misc.



Figure 35: Misc.




Figure 36: Misc.



Figure 37: Misc.



Damage 1: Door - rear left side: Door - Scratch(es) - Cover / polish

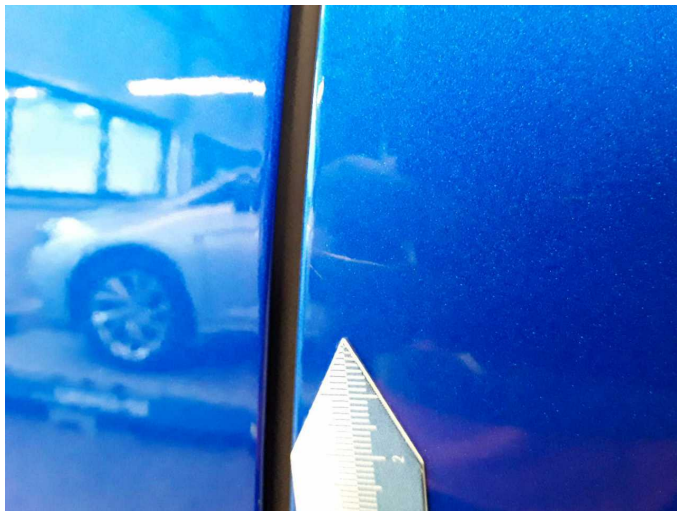

Damage 1: Door - rear left side: Door - Scratch(es) - Cover / polish



Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace



Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace




Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace



Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace



Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace

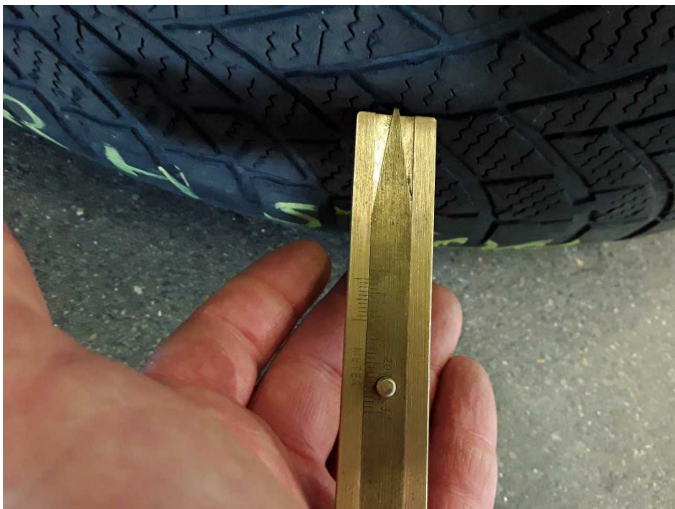


Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace




Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace



Damage 2: 2nd wheel set: Tyres - complete set (215,65,17 w.) - Worn - Replace

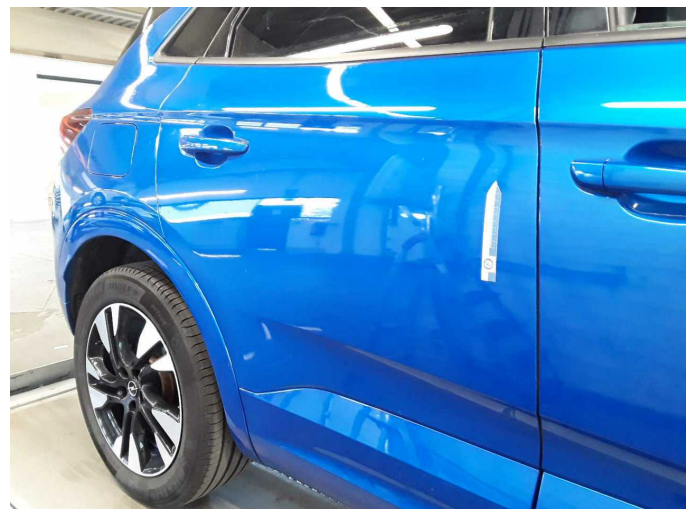


Damage 3: Door - rear right side: Door - Scratch(es) - Paint

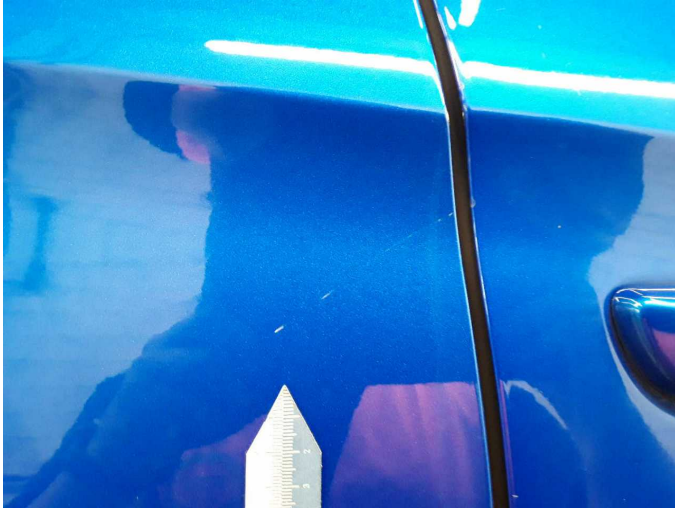


Damage 3: Door - rear right side: Door - Scratch(es) - Paint




Damage 3: Door - rear right side: Door - Scratch(es) - Paint

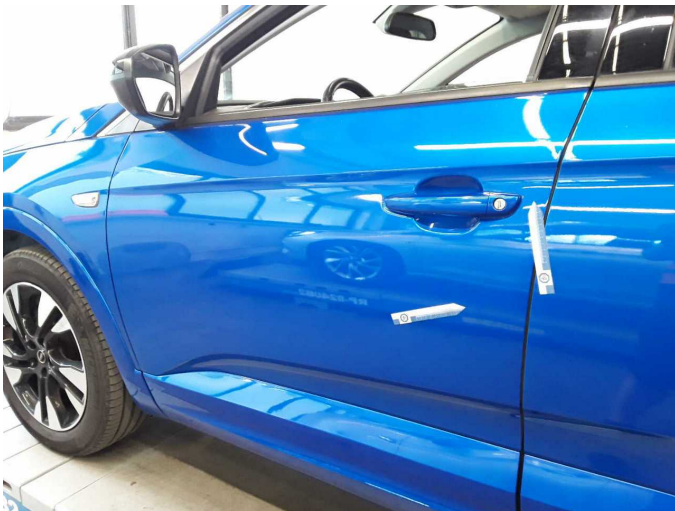

Damage 4: Door - front left side: Door - Scratched - Paint

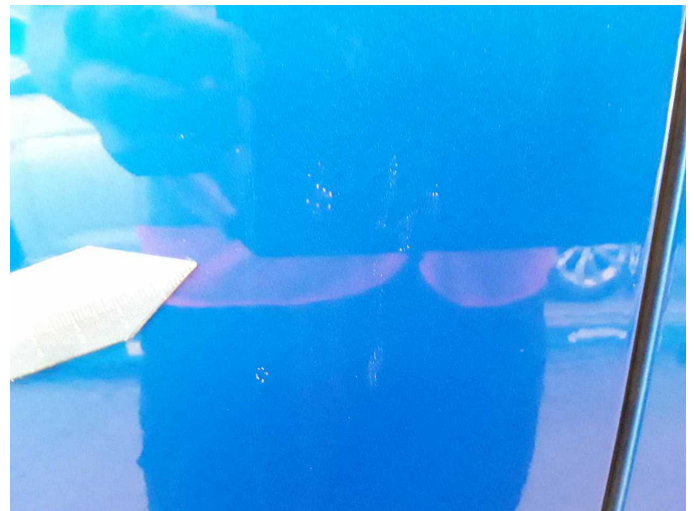

Damage 4: Door - front left side: Door - Scratched - Paint

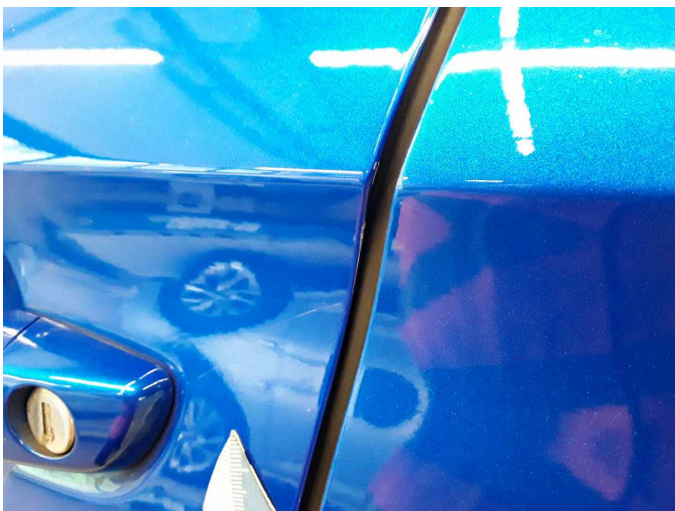

Damage 4: Door - front left side: Door - Scratched - Paint




Damage 4: Door - front left side: Door - Scratched - Paint



Damage 5: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 5: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

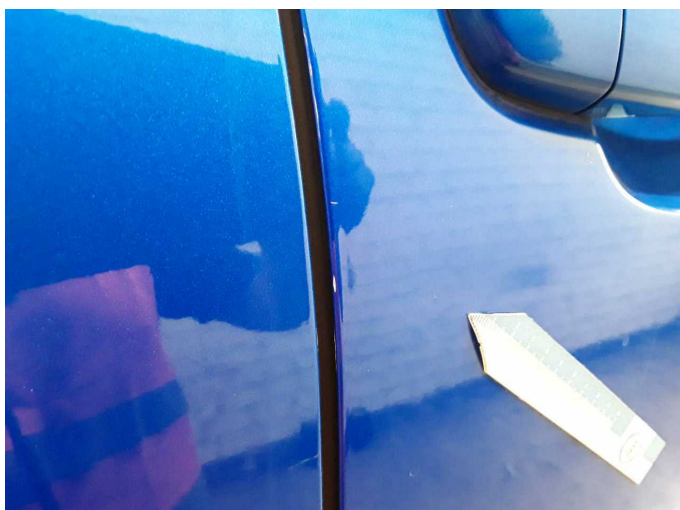

Damage 5: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 5: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZCYHZ1P6003714

Hersteller / Modell: OPEL OPEL Grandland 1.5 D Automatik Elegance

Datum	KM-Stand	Beschreibung
07.05.2026	80.063	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
04.09.2025	59.078	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.02.2024	21.949	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges