



Expertise

Protocol number: 46282085
Order No. / Reference: 26698763
Inspection date: 2 Jul 2026

Manufacturer: Ford	Model: Transit Custom 320 L2H1 LKW VA Autm. Trend
VIN: WF0ZXXTTGZNP05177	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Custom 320 L2H1 LKW VA Autm. Trend	
Vehicle Identification number	WF0ZXXTTGZNP05177
Mileage (Read)	205,053 km
First registration	10 Oct 2022
Number of holders	1
Next periodical technical inspection	10/2026
(Report on hand)	
Power / Engine displacement	96 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frozen White
Doors / Seats	4 / 6
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	30,000 km
Last service on / at	10/2025 at 161,308 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP438989
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMU 08015		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Pirelli	9mm / 9mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109R	Winter tyres on Steel	Pirelli	7mm / 7mm
2)	215/65 R16 109R	Winter tyres on Steel	Pirelli	10mm / 10mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	Summer tyres on Steel	Goodyear	9 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- Headliner in driver's cab
- Third brake light
- Windows, 2nd row: Side windows fixed, right and left
- Front electric windows
- FordPass Connect (including live traffic information, information about the current status or location of the vehicle, and control of selected vehicle functions via smartphone with the FordPass app. Real-time traffic information (in conjunction with audio systems 24 and 25). Further information about FordPass Connect can be found at <https://www.ford.de/fordpass-connect>.)
- Interior lighting with delay circuit
- Fuel tank 70 l
- Cargo area lighting with activatable switch-off delay
- Emergency brake assist including emergency brake light
- Front and rear parking pilot system including fog lights
- Particulate filter: diesel particulate filter
- Wheels/Tires: Spare wheel, steel wheel
- Headlights: Halogen projector headlights (with LED daytime running lights and fog lights with static cornering lights)
- Sliding door: Sliding door, right
- Side protection strips
- Power steering
- Seats: 2nd row, 3-seater bench (incl. height-adjustable headrests, 2 ISOFIX mounts (each on the outer seat) and open under-seat storage compartment (rear seat cover always the same as front seat cover))
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric
- Driver's side airbag
- On-board computer
- roof, flat
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- Ford Easy Fuel
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Generator, 240 A
- Cruise control including imitation leather steering wheel
- Transmission: 6-speed automatic
- Grab handle on the B-pillar of the passenger side
- Lockable glove compartment with lid
- Front air conditioning
- Paint finish: Solid color paint
- Steering column, adjustable in height and reach
- Package: Style color package (front and rear bumpers and exterior mirror caps painted in body color)
- Wheel trims
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 R tires (6.5 J x 16 with 215/65 R 16 R tires)
- Sliding door entry light automatically illuminates when the door is opened
- Mud flaps front and rear
- Half-height side wall cladding
- Seat belts
- Start-stop system
- Power outlet: 12-volt connection
- Lashing eyes 4
- Immobiliser
- Central locking with remote control



Extra equipment

- BOTT: DED019H0000787 Left 2 without pipe
- Package: Visibility Package II (Trend) (Heated windscreen - Electrically folding exterior mirrors - Adjustable instrument lighting - Windscreen wipers with rain sensor - Headlight assistant with day/night sensor)
- Reversing camera (reversing camera with image transmission of the rear driving path in the multifunction display and coupling aid)
- Rubber, protective cover
- Seats: Seat Package 15 (Custom DOKA Trend) (Driver's seat, 4-way adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Integrated tray in the double passenger seat (foldable) - Heated driver's seat - Heated passenger seat (outer seat) - Inner armrest for driver - Manual lumbar support (driver's seat) - TREND seat cover: fabric - Double cab partition with window)
- Tire Pressure Monitoring System (TPMS)
- Airbag (passenger side)
- Blind spot assist including cross traffic alert and trailer function (electrically adjustable and heated exterior mirrors, also electrically foldable)
- BOTT: DED019H0000787
- BOTT: DED019H0000787 Right 2 without workbench
- Radio: Audio system 25: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+, navigation (Radio (FM/AM) 8" touchscreen multifunction display, FordPass Connect integrated control panel and audio remote control, Ford SYNC 3 with touchscreen (hands-free system with voice control, SMS readout/sending function, Bluetooth, Emergency Assistance...), AppLink (advanced voice control, privacy mode, support for Android Auto and Apple CarPlay, capacitive touchscreens...), lane guidance, adaptive cruise control, lane keeping assist, traffic sign recognition, Park Pilot front/rear)
- Rear swing door without window (without interior mirror)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Body	Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise
3	Side panel - rear left side	Side panel - dent(s) - Smart repair
4	Mudguard - left side	Mud flap - Missing - Replace
5	Mudguard - right side	Mud flap - Missing - Replace
6	Door - front right side	Door - Dent / paintcoat damage - Smart repair
7	Roof	Roof - dent(s) - Smart repair
8	Sliding door, right	Trim washable - lower - Broken / torn - Replace
9	Boot lid / rear door	Trim hard fibre - lower - Broken / torn - Replace
10	Bonnet	Bonnet (Steinschläge) - Scratch(es) - Paint
11	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - repair according to calculation



Wear and tear

No.	Component group	Description
1	Sliding door, right	Sliding door with glass panel - Dent / paintcoat damage - No deduction
2	Boot lid / rear door	Boot lid - dent(s) - No deduction
3	Mudguard - left side	Mudguard - left side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

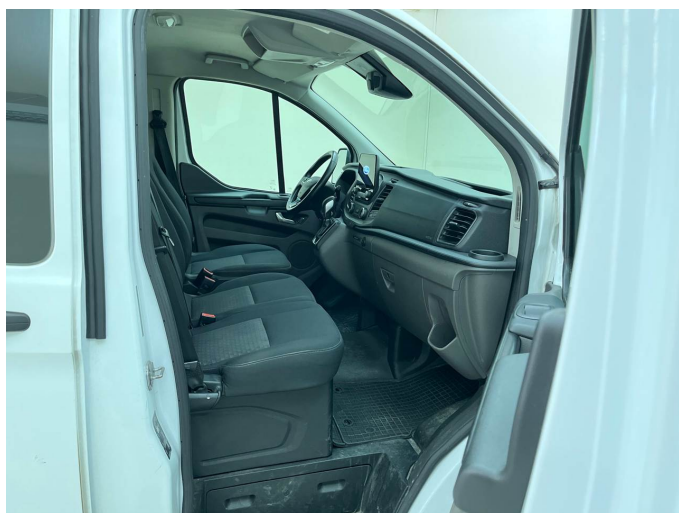


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

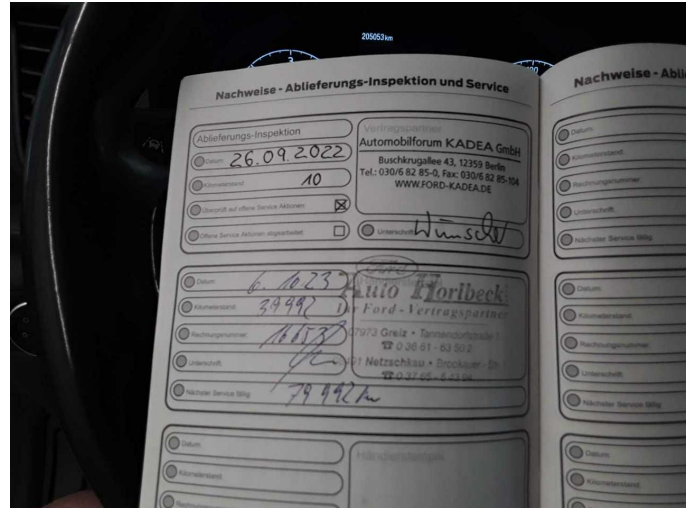


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

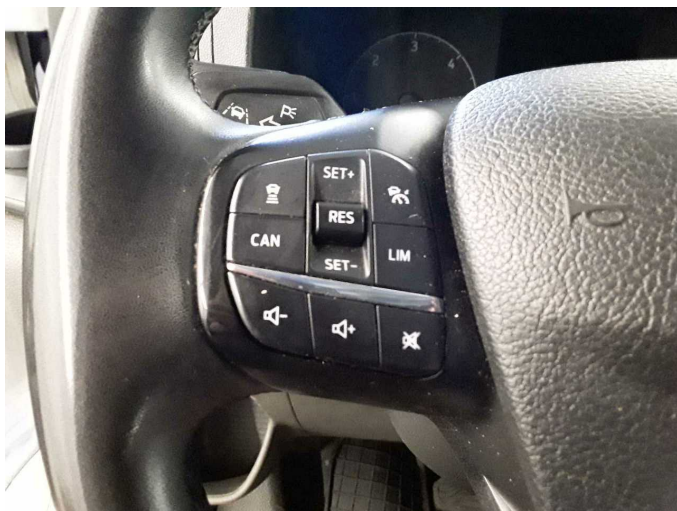


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

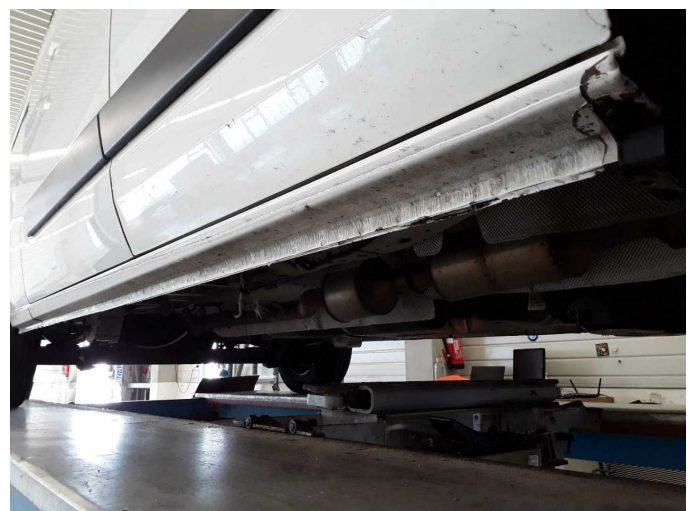


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 2: Body: Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise

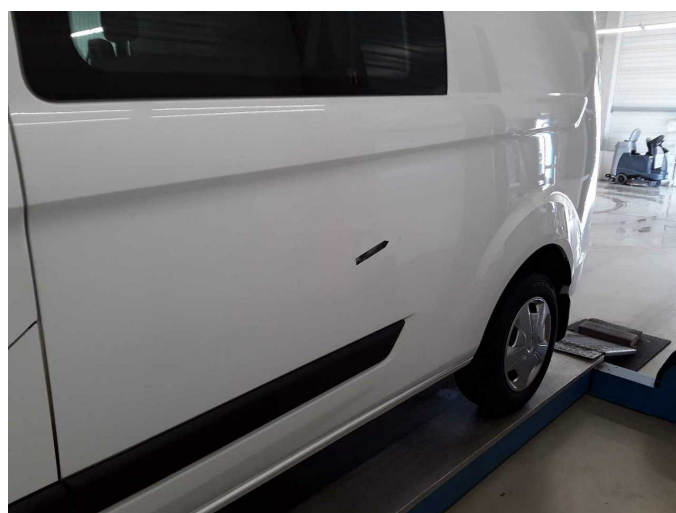

Damage 3: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smart repair

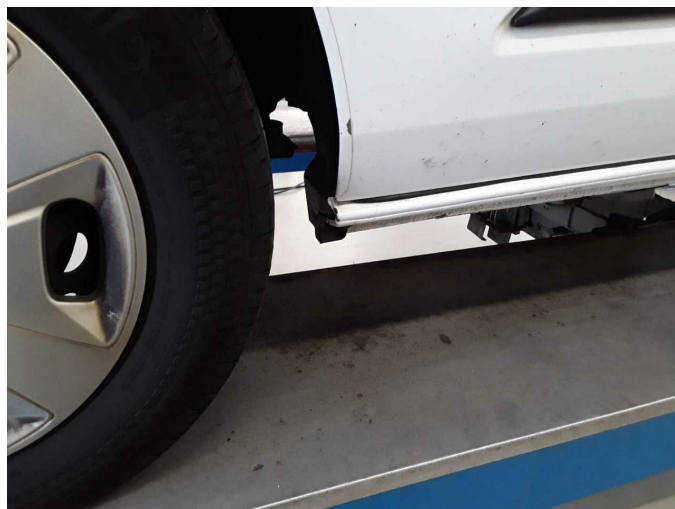

Damage 4: Mudguard - left side: Mud flap - Missing - Replace




Damage 5: Mudguard - right side: Mud flap - Missing - Replace



Damage 6: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 6: Door - front right side: Door - Dent / paintcoat damage - Smart repair

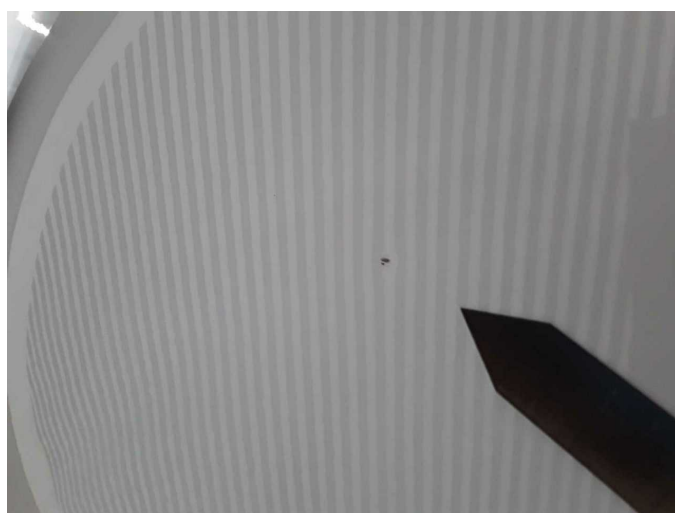


Damage 6: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Roof: Roof - dent(s) - Smart repair



Damage 7: Roof: Roof - dent(s) - Smart repair

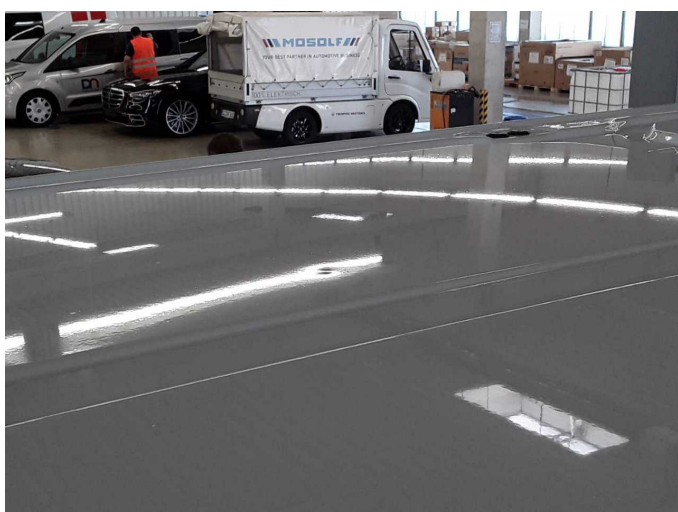


Damage 7: Roof: Roof - dent(s) - Smart repair



Damage 7: Roof: Roof - dent(s) - Smart repair



Damage 7: Roof: Roof - dent(s) - Smart repair

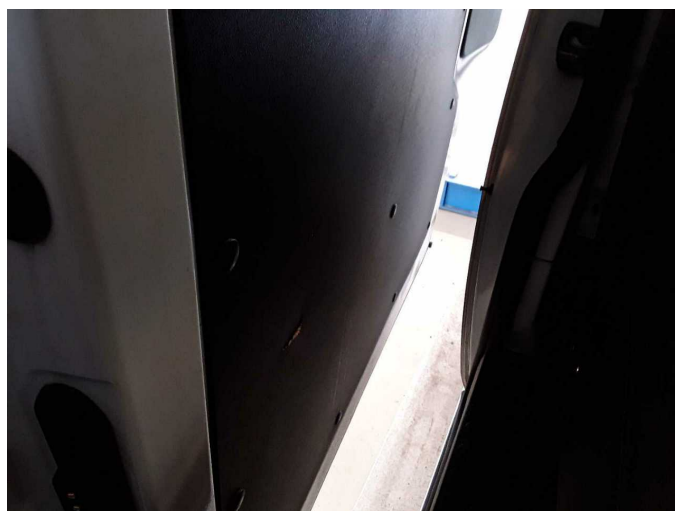


Damage 8: Sliding door, right: Trim washable - lower - Broken / torn - Replace



Damage 8: Sliding door, right: Trim washable - lower - Broken / torn - Replace



Damage 9: Boot lid / rear door: Trim hard fibre - lower - Broken / torn - Replace

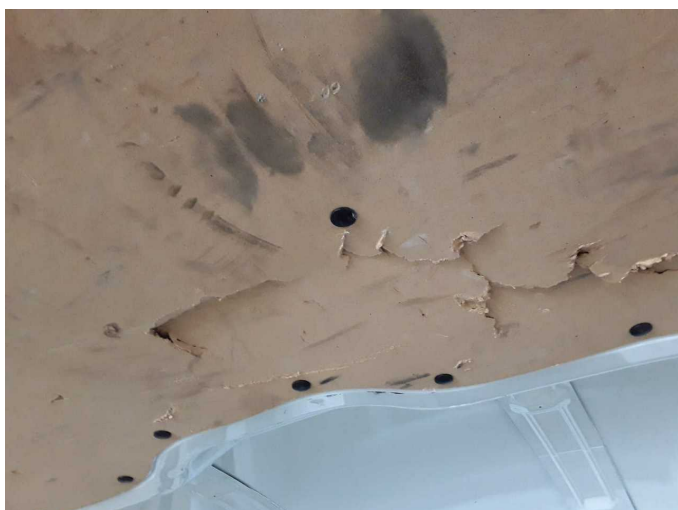


Damage 9: Boot lid / rear door: Trim hard fibre - lower - Broken / torn - Replace



Damage 10: Bonnet: Bonnet (Steinschläge) - Scratch(es) - Paint



Damage 10: Bonnet: Bonnet (Steinschläge) - Scratch(es) - Paint

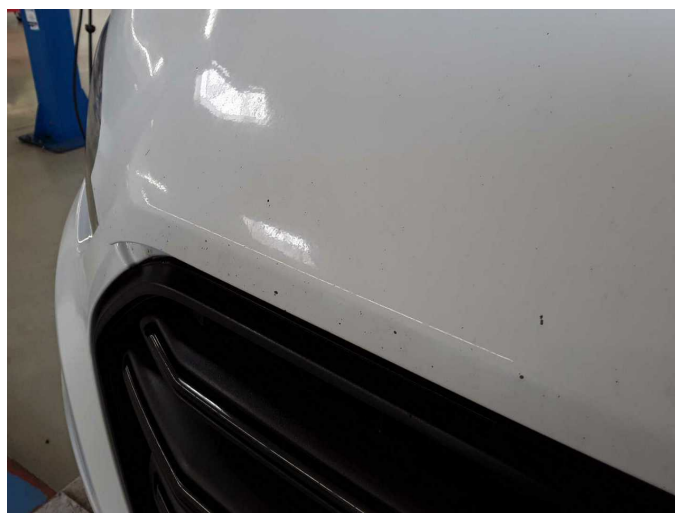

Damage 10: Bonnet: Bonnet (Steinschläge) - Scratch(es) - Paint



Damage 11: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - repair according to calculation



Damage 11: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - repair according to calculation



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0ZXXTTGZNP05177
Hersteller / Modell: FORD FORD Transit Custom 320 L2H1 LKW VA Autm. Trend

Datum	KM-Stand	Beschreibung
02.04.2026	190.764	Bremsklötze vorne
29.10.2025	161.308	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Keilrippenriemen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zahnriemen/Steuerkett ern
11.10.2025	159.047	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
16.06.2025	135.620	Bremsklötze vorne
28.03.2025	121.573	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.10.2024	103.865	AU
16.07.2024	89.116	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
01.06.2024	81.787	Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
16.11.2023	46.744	Bremsklötze vorne; Systemtest/Eigendiagnose
07.10.2023	39.992	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst