



Expertise

Protocol number: 46902477
Order No. / Reference: 26734139
Inspection date: 5 Aug 2026

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR DSG Business

VIN: WVGZZZ3CZPE029296



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 2.0 TDI SCR DSG Business	
Vehicle Identification number	WVGZZZ3CZPE029296
Mileage (Read)	200,610 km
First registration	4 May 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,300 km
Last service on / at	04/2026 at 187,059 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP907853
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BQS 04363		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	215/60 R16 99V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 95H	Winter tyres on Steel	Pirelli	5mm / 5mm
2)	215/60 R16 95H	Winter tyres on Steel	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Cup holders (2) front
- third brake light
- Headliner in Mistral Grey
- Diesel particulate filter
- Parking aid - warning signals for obstacles in the front and rear area
- Electronic stability program and electromechanical brake booster
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- rear window wiper
- ISOFIX mounting points
- Front headrests
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- "Premium" multifunction display with multicolor screen
- Fatigue detection
- Non-smoking version
- Emergency call service
- Package: Light and Sight Package "Plus"
- Proactive occupant protection system in conjunction with "Front Assist"
- Tire pressure monitoring system (passive)
- Wheels: Tire Mobility Set
- Gearshift knob in leather
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12V power outlet on the rear of the center console
- Textile floor mats
- Warning tone and light for unfastened seat belts front and rear
- Airbag, head airbag system for front and rear passengers
- App-Connect
- Electrically adjustable and heated exterior mirrors, ambient lighting
- Hill start assist
- Chrome trim on the side windows
- black roof rails
- Tachometer
- Entry/warning lights in LED technology in the front doors
- Electronic parking brake including auto-hold function
- Automatic headlight control
- Remote release for luggage compartment lid
- Pedestrian detection
- Adjustable luggage compartment floor
- Rear window heated
- Interior lights with delayed shut-off and dimming function
- Rear headrests (3)
- LED fog lights and cornering lights
- LED headlights with daytime running lights
- Headlight range control
- Front center armrest, height and length adjustable, with storage box
- Mesh partition
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery: "Business" fabric
- Radio "Composition"
- Radio accessories: Digital radio reception DAB+
- Wheels: 4 light alloy wheels "Sepang" 6.5 J x 16
- Rear bench seat, undivided, backrest asymmetrically split and foldable, with center armrest
- Power steering
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Start-stop system
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control



Extra equipment

- Towbar, foldable (with electric release)
- Removable luggage compartment protective mat (back of the rear seat backrest with black rubber coating)
- Navigation system "Discover Media" incl. "Streaming & Internet" (4x20 watts, user interface with proximity sensor, dual tuner with phase diversity, vehicle menu, speed, volume adjustment, map, 2D display, tone control, 3-way TFT display with touchscreen operation, navigation "Discover Media" incl. "Streaming & Internet", MP3 radio, telephone contact addresses for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition "VW Media Control", We Connect Plus, 3 years, incl. We Connect route guidance, dynamic RDS, TMC tuner)
- Proactive occupant protection system and lane change assistant "Side Assist" (Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist" - lane change assistant "Side Assist" and parking assistant)
- Chassis: Rear suspension with fully automatic level control
- Paint finish: Pearl effect
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, USB-C charging socket in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping assist system, Air Care Climatronic with 3-zone temperature control, active combination filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Rear side windows and rear window tinted
- Voice control
- "Comfort" telephone interface with inductive charging function (hands-free system)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Documents	Service book (sporadisch durchgeführt) - Incomplete - No deduction
2	Sill - right side	Sill - dent(s) - Smooth repair work
3	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
4	Side panel - rear right side	Sill - dent(s) - Smooth repair work
5	Roof	Roof rail - right side - dent(s) - Smooth repair work
6	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
7	Rear bumper	Rear bumper - Scratched - Paint
8	Door - rear left side	Door - Scratched - Paint
9	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
10	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
11	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
12	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
13	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
14	Vehicle glazing	Rear window - Scratch(es) - Replace



Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratched - No deduction
2	Front bumper	Front bumper - Scratched - No deduction
3	Roof	Roof - dent(s) - No deduction
4	Door - front left side	Door edge - Scratched - Cover / polish

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer	3.395,69 €

Repainting

No.	Repainting
1	Mudguard - left side

Paint coat thickness measurement

Mudguard - left side	162 µm
----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Fahrzeug weist dem Alter und Laufleistung entsprechende Gebrauchspuren auf.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

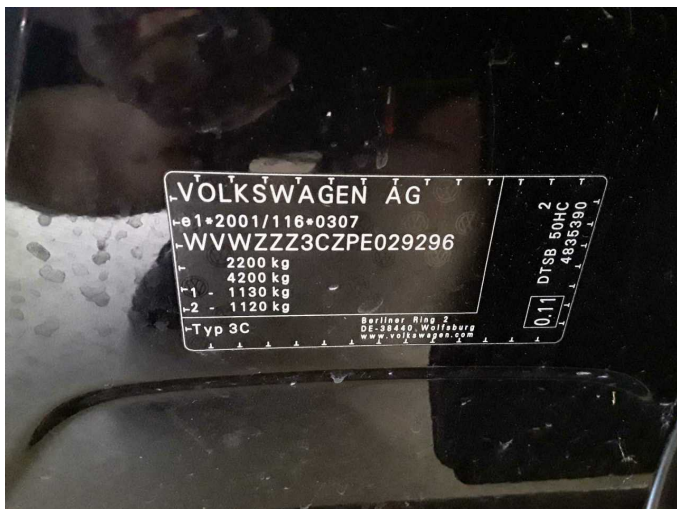


Figure 11: VIN



Figure 12: Mounted tyres

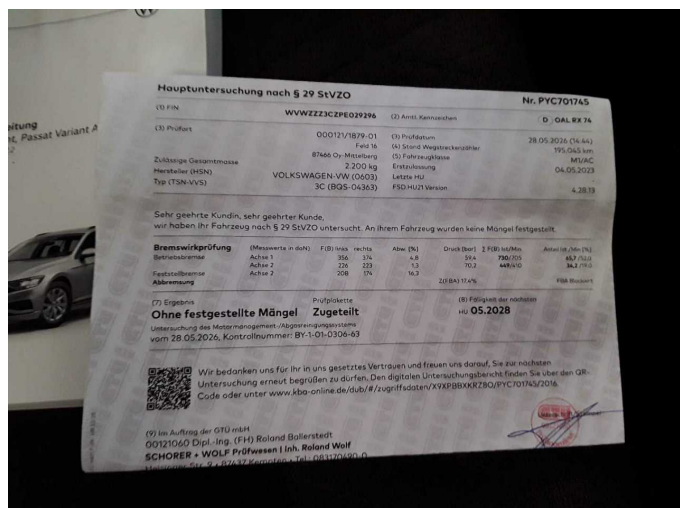


Figure 13: Documents

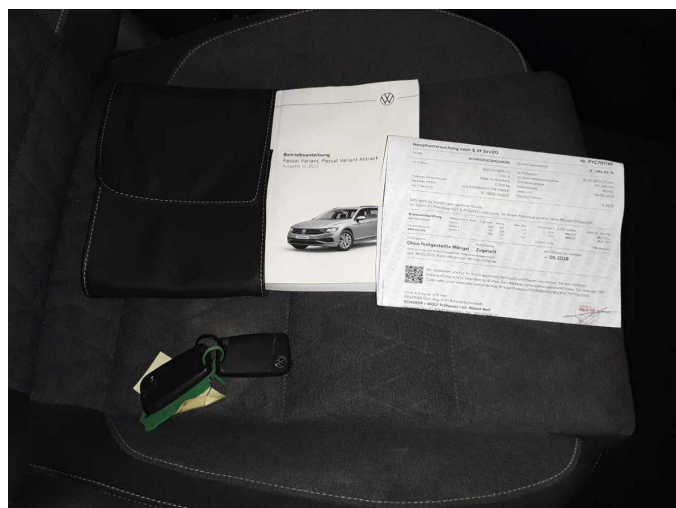


Figure 14: Documents



Figure 15: Documents

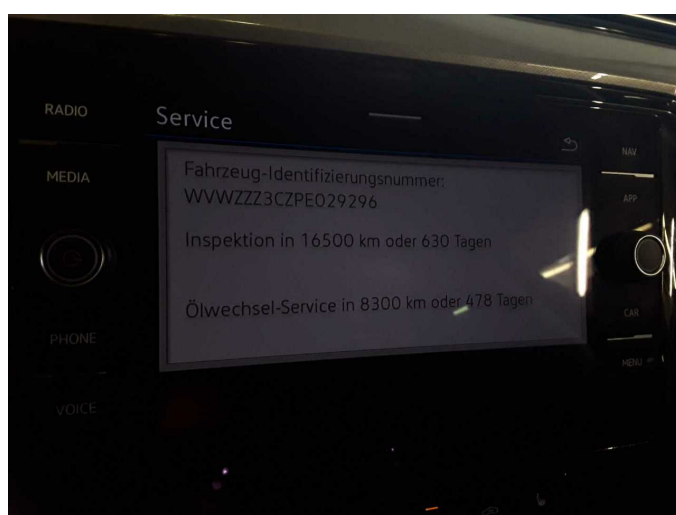


Figure 16: Documents



Figure 17: Additional tyres

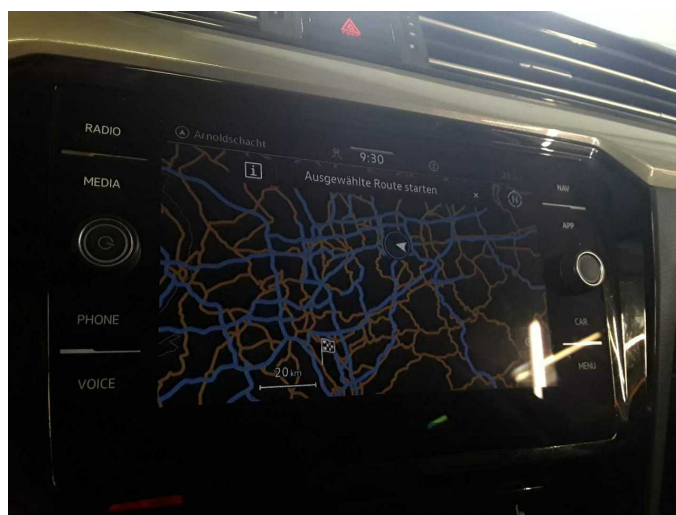


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

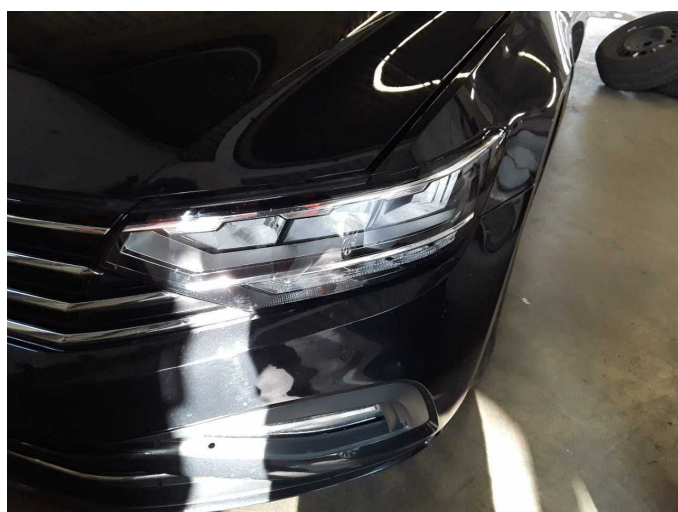


Figure 22: Misc.



Figure 23: Misc.

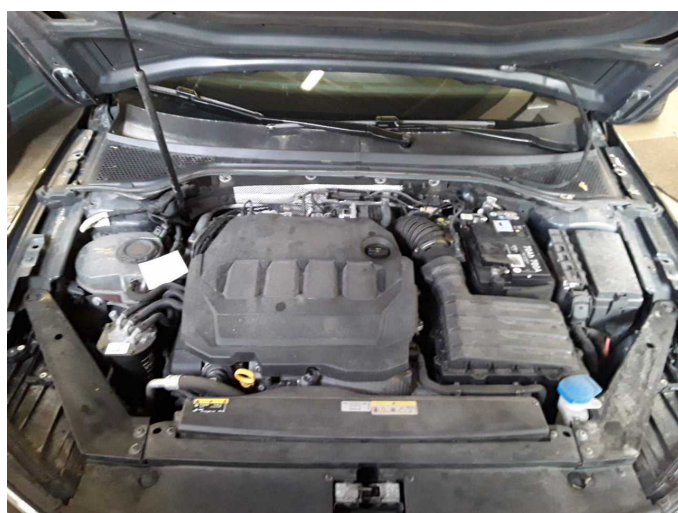


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

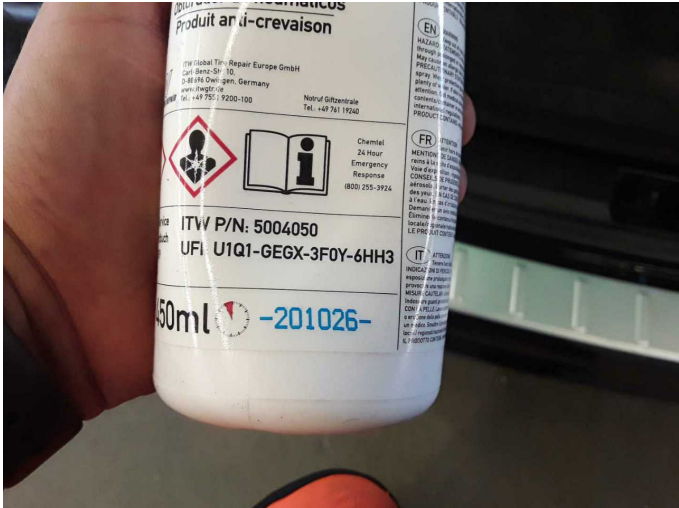


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 2: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 2: Sill - right side: Sill - dent(s) - Smooth repair work




Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

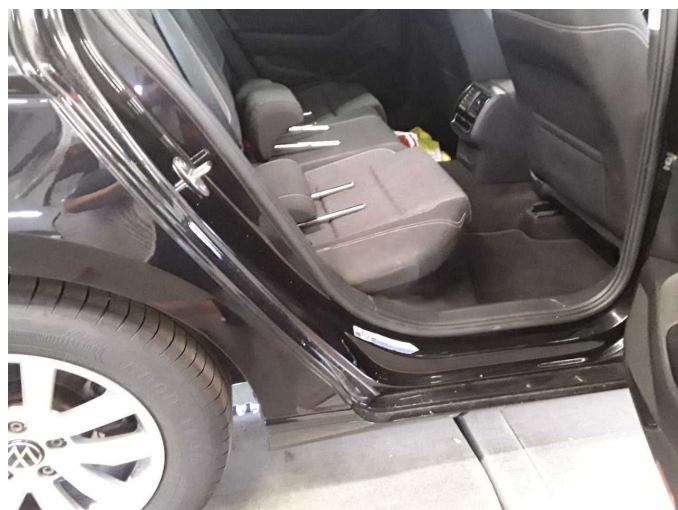


Damage 4: Side panel - rear right side: Sill - dent(s) - Smooth repair work

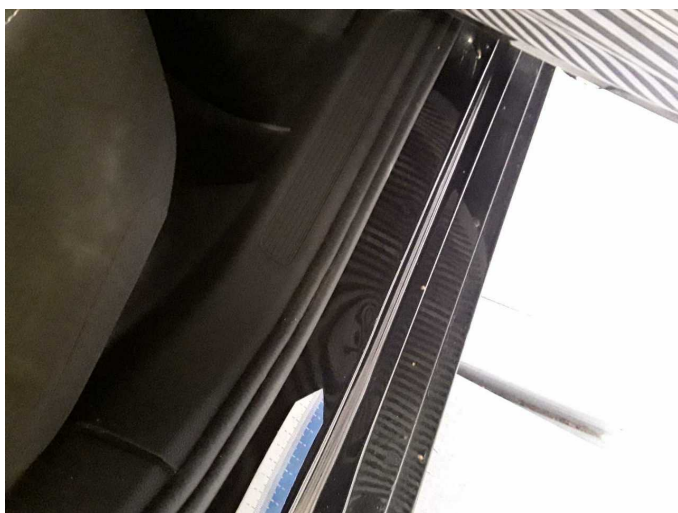

Damage 4: Side panel - rear right side: Sill - dent(s) - Smooth repair work



Damage 4: Side panel - rear right side: Sill - dent(s) - Smooth repair work

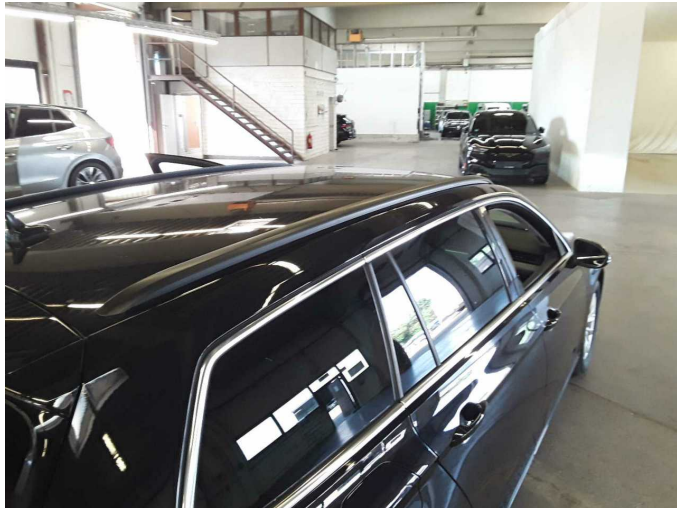

Damage 5: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 5: Roof: Roof rail - right side - dent(s) - Smooth repair work




Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

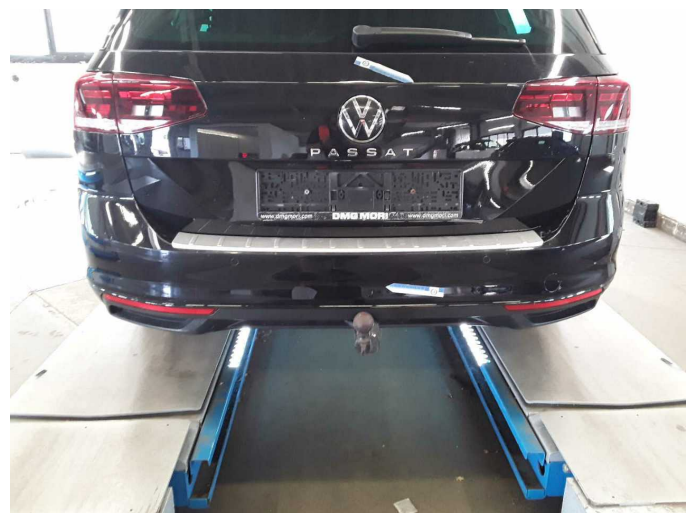


Damage 7: Rear bumper: Rear bumper - Scratched - Paint




Damage 7: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Rear bumper: Rear bumper - Scratched - Paint

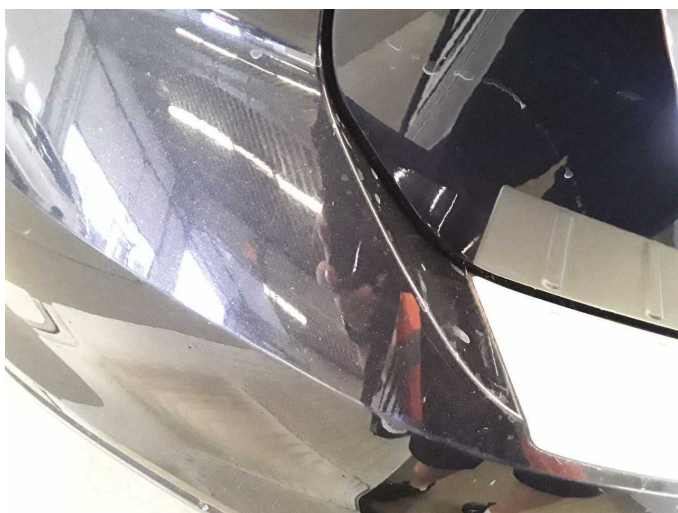

Damage 7: Rear bumper: Rear bumper - Scratched - Paint

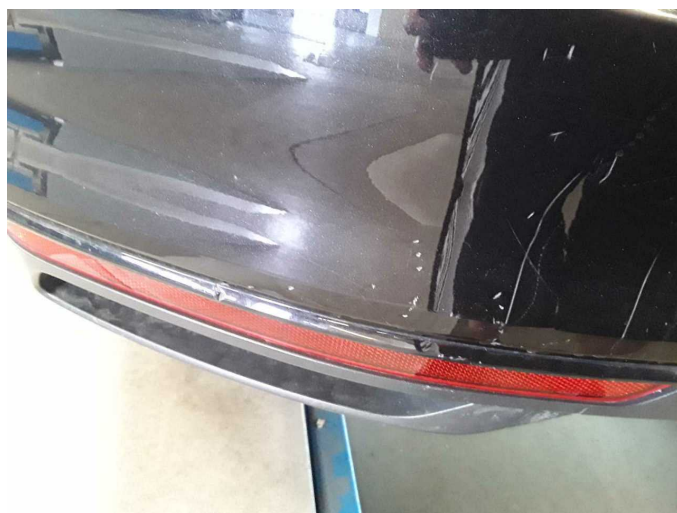


Damage 7: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Door - rear left side: Door - Scratched - Paint



Damage 8: Door - rear left side: Door - Scratched - Paint

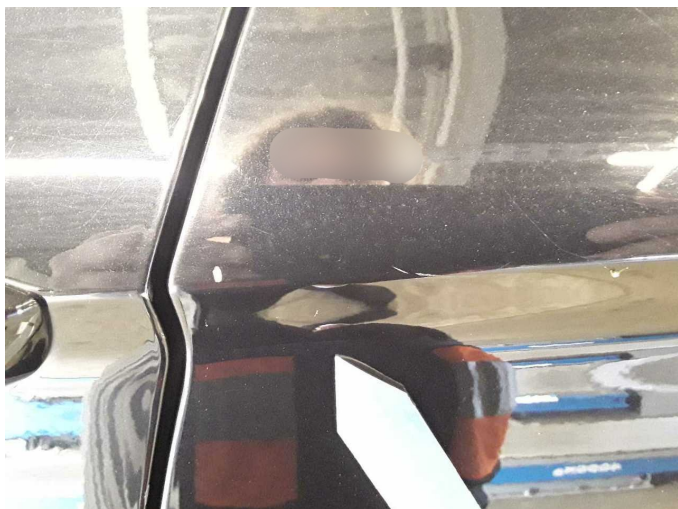


Damage 8: Door - rear left side: Door - Scratched - Paint




Damage 9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

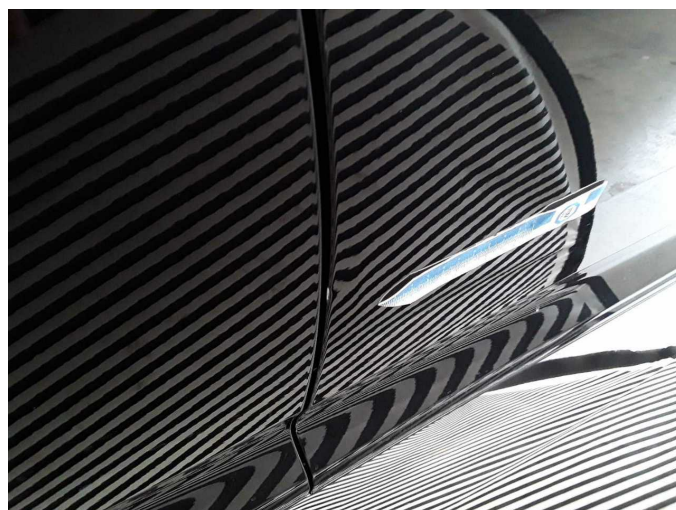


Damage 9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

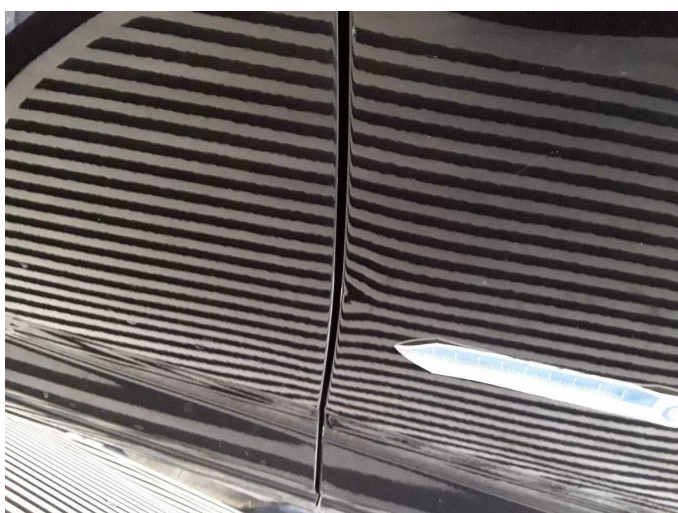


Damage 9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

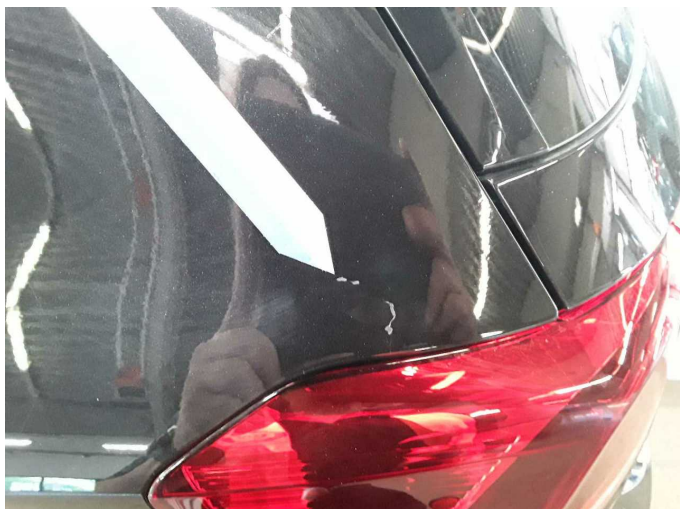

Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

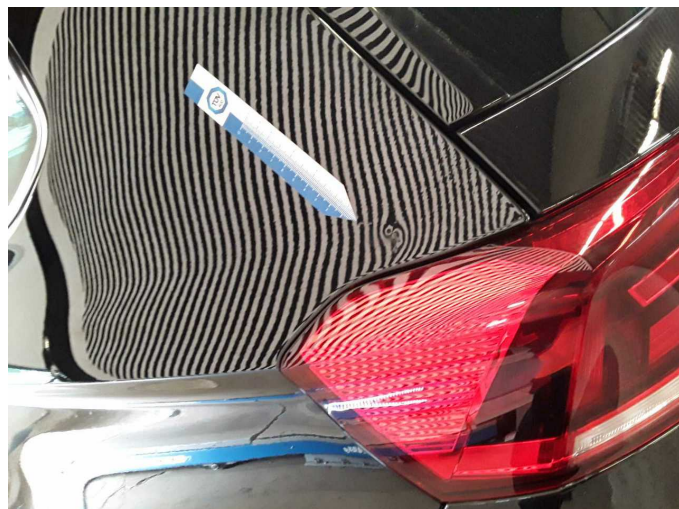


Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

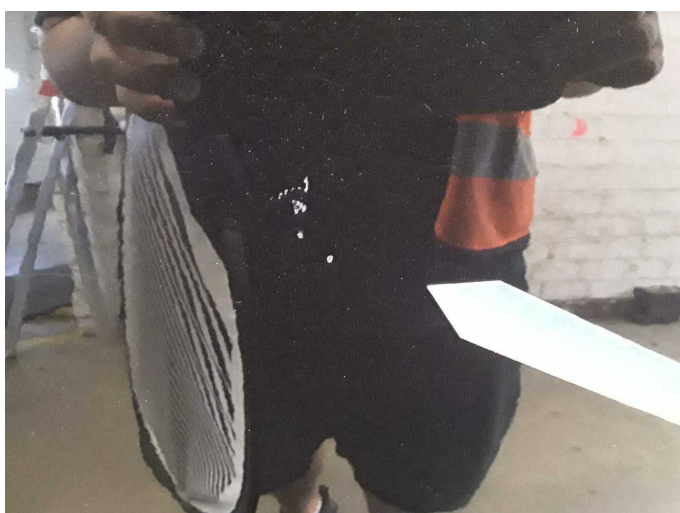

Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

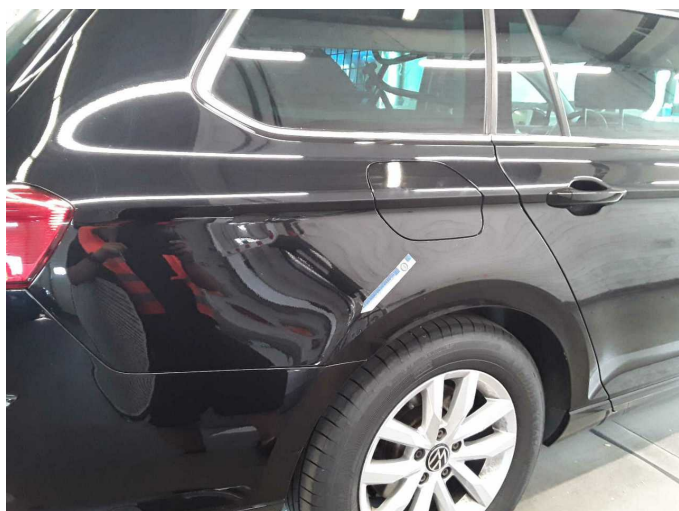


Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

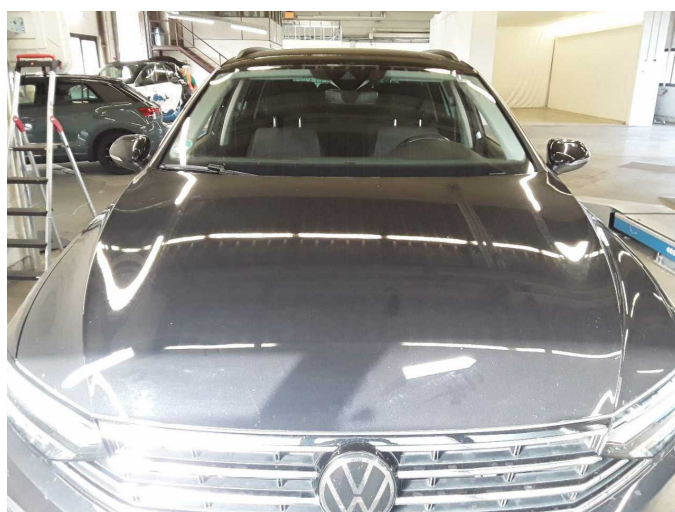


Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

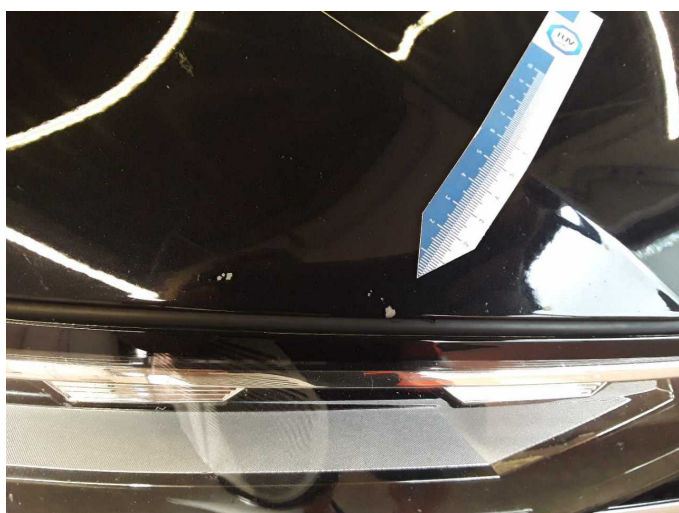


Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

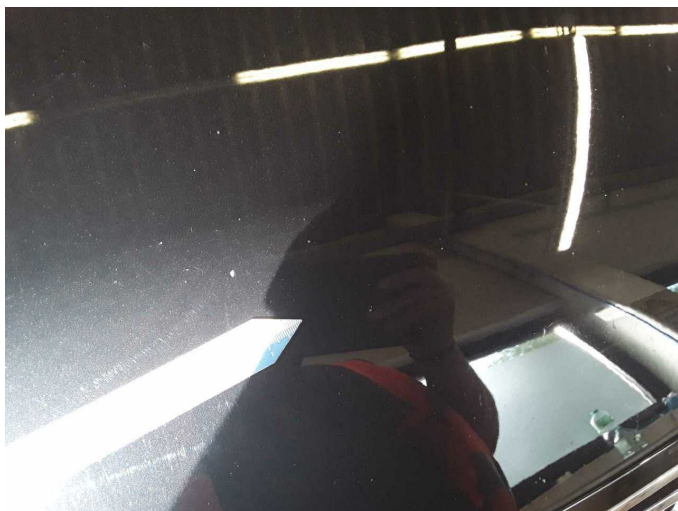

Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

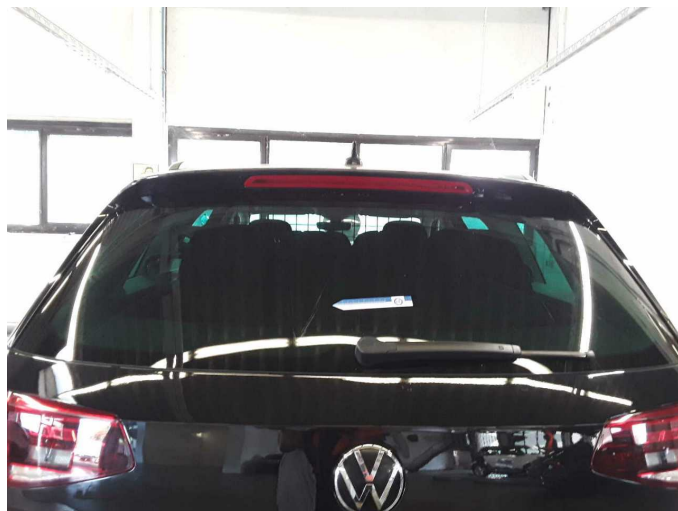

Damage 14: Vehicle glazing: Rear window - Scratch(es) - Replace

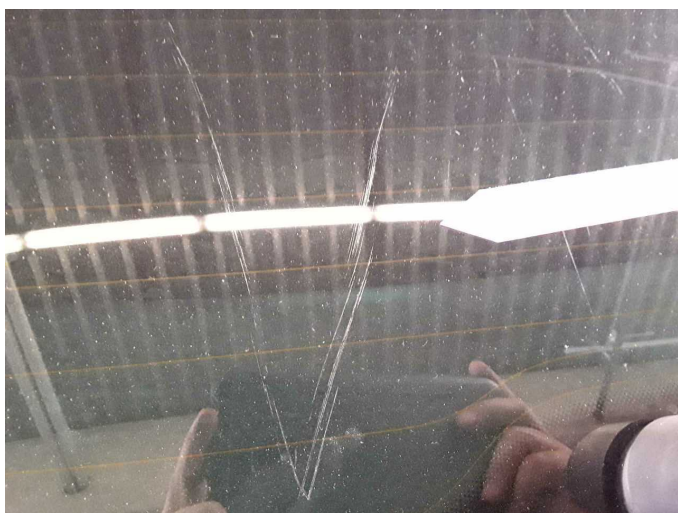

Damage 14: Vehicle glazing: Rear window - Scratch(es) - Replace



Wear and tear 1: Body: Underbody panelling - Scratched - No deduction



Wear and tear 1: Body: Underbody panelling - Scratched - No deduction



Wear and tear 1: Body: Underbody panelling - Scratched - No deduction



Wear and tear 2: Front bumper: Front bumper - Scratched - No deduction



Wear and tear 2: Front bumper: Front bumper - Scratched - No deduction



Wear and tear 3: Roof: Roof - dent(s) - No deduction



Wear and tear 3: Roof: Roof - dent(s) - No deduction



Wear and tear 4: Door - front left side: Door edge - Scratched - Cover / polish



Wear and tear 4: Door - front left side: Door edge - Scratched - Cover / polish



Repainting 1: Mudguard - left side



Repainting 1: Mudguard - left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZ3CZPE029296

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Passat Variant 2.0 TDI SCR DSG
Business

Datum	KM-Stand	Beschreibung
28.05.2026	195.046	AU
27.04.2026	187.059	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Kraftstofffilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
10.04.2026	184.391	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.02.2026	173.780	Batterie ern; Systemtest/Eigendiagnose
17.11.2025	156.763	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.07.2025	132.100	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
16.05.2025	120.895	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges
20.01.2025	106.474	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
30.08.2024	89.106	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
26.06.2024	79.068	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
18.01.2024	44.417	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges