



Expertise

Protocol number: 46653862
Order No. / Reference: 26621839
Inspection date: 22 Jul 2026

Manufacturer: Opel

Model: Zafira Life 2.0 D M Aut. Edition

VIN: VXEEVHZ7NZ024899



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Zafira Life 2.0 D M Aut. Edition

Vehicle Identification number VXEEVHZ7NZ024899

Mileage (Read) 107,957 km

First registration 14 Apr 2022

Number of holders 1

Fuel type Diesel

Engine displacement / Cylinder 1,997 ccm / 4

Power 130 kW

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle Van

Colour / colour code Diamant Schwarz

Doors / Seats 5 / 8

Upholstery type Cloth

Colour of upholstery Black

Vehicle with smoke odor no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	20 Monat(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ652114
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / BBA 00345		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,800 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Low beam automatically
- Airbag for driver and passenger side
- Airbag: Curtain airbags, in the 2nd and 3rd rows of seats
- Automatic activation of the hazard warning lights
- Exterior mirror housings in black
- On-board computer
- Diesel particulate filter
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Luggage compartment cover
- Manual handbrake
- Child safety lock, mechanical
- Paint finish: Solid
- Steering wheel: Comfort steering wheel
- Fog light
- Package: Driver Assistance Package 1
- Rear parking pilot
- Radio: Multimedia radio with 7" touchscreen color display
- Tire repair kit
- Wheels: Alloy wheels in bicolor, 7J x 17
- Side impact protection
- Power steering
- Safety steering column, height and length adjustable
- Heated seats for driver and front passenger
- Sun visors driver and passenger side
- Traction Control (TC) Plus
- Exterior door handles, in car color
- Central locking with remote control

Extra equipment

- Navigation system: Multimedia Navi Pro with 7" color touchscreen, voice control for audio, telephone, and navigation (automatic music recognition for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, display of phonebook and call lists, image display via USB interface, navigation system with integrated memory, European road map, 3D map display, dynamic route guidance, TMC messages, smartphone integration via Apple CarPlay and Android Auto, 1 USB interface, 8 speakers, head-up display)

- Storage compartments
- Airbag: Head airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Exterior mirrors, electrically adjustable, heated and folding
- Hill Start Assist
- Third brake light
- Tachometer
- Window: Window, driver's side in the 2nd row of seats, fixed
- Transmission: 8-speed automatic transmission
- Glazed tailgate, with rear window wiper and heater
- Air conditioning: Auxiliary air conditioning, rear
- LED daytime running lights
- Headlight range adjustment, manual
- Rear fog lights with reversing lights
- Package: Driver Assistance Package 2
- Radio: Digital radio reception DAB+
- Rain sensor
- Tire pressure warning
- Sliding door trim with cover, in vehicle color
- Side protection strips in vehicle color
- Seat belts: Three-point seat belts in all seats
- Seats: 8 seats in fabric, Harlequin Black
- Solar Protect thermal insulation glazing
- 12V socket
- Door: Sliding door, driver and passenger side
- Immobiliser
- Ignition keys (2), both foldable

- Automatic climate control: Dual-zone automatic climate control (front, with particle and odor filter - manual recirculation - automatic air distribution - sun position sensor - activated carbon filter)
- Detachable trailer hitch
- Interior mirror, additional, for interior monitoring
- Interior mirror, automatically dimming
- Paint finish: Metallic
- Sunshades in the 2nd row of seats
- Xenon headlights with LED daytime running lights



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Misc.	Main inspection - No evidence - No deduction
3	Equipment	Tirefit filler - Expired - Replace
4	Trim / covers	Roof lining - Soiled - Clean
5	Body	B-pillar - right side - Scratch(es) - Smart repair
6	Door - front left side	Door - Scratch(es) - Smart repair
7	Trim / covers	Boot lid - interior trim - Scratched - Smart repair
8	Sliding door - left side	Trim (Außen) - Scratch(es) - Replace
9	Sill - left side	Sill - Dent / paintcoat damage - Smart repair
10	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
11	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
12	Bonnet	Bonnet - Stone chips - Paint
13	Front bumper	Front bumper (+ Blende) - Scratched - Paint
14	Sliding door - left side	Sliding door - Dent / paintcoat damage - Repair and paint
15	Sliding door, right	Sliding door - Dent / paintcoat damage - Repair and paint
16	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
17	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint

Missing parts

Description

Documents - Main inspection certificate
Documents - Log book

Repainting

No. Repainting

1 Boot lid / rear door

Paint coat thickness measurement

Boot lid / rear door 190 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

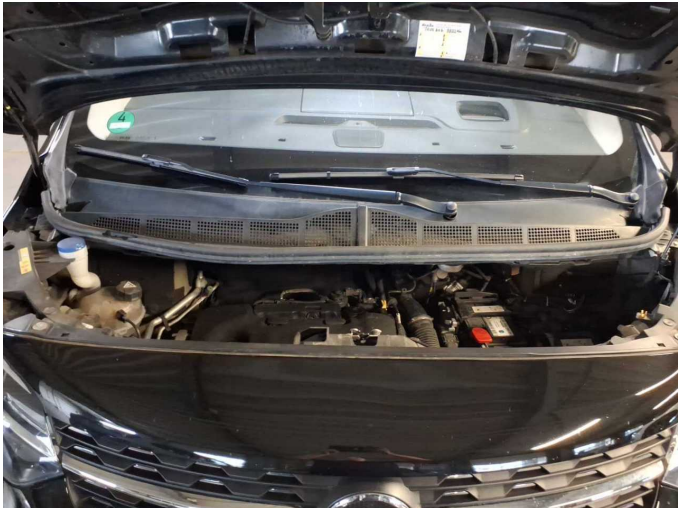


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

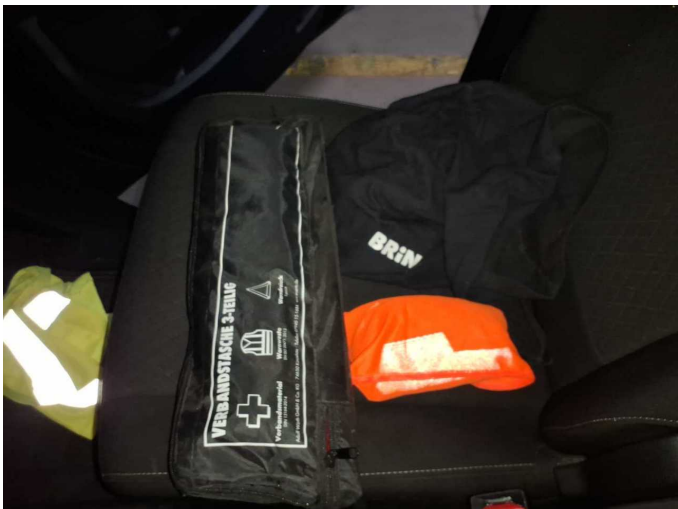


Figure 24: Misc.

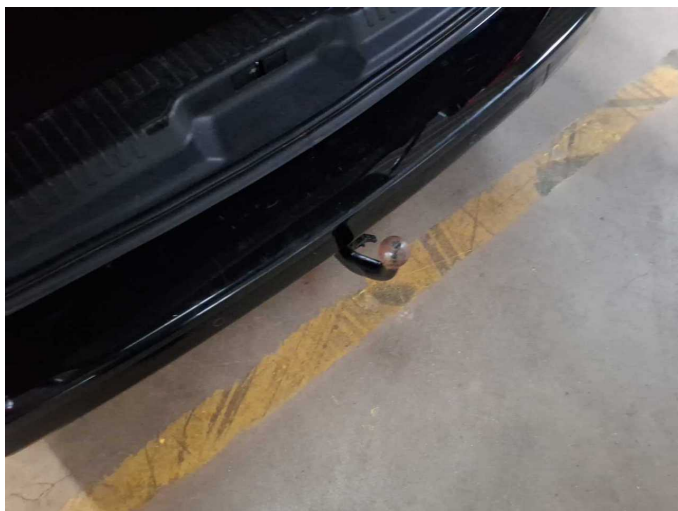


Figure 25: Misc.

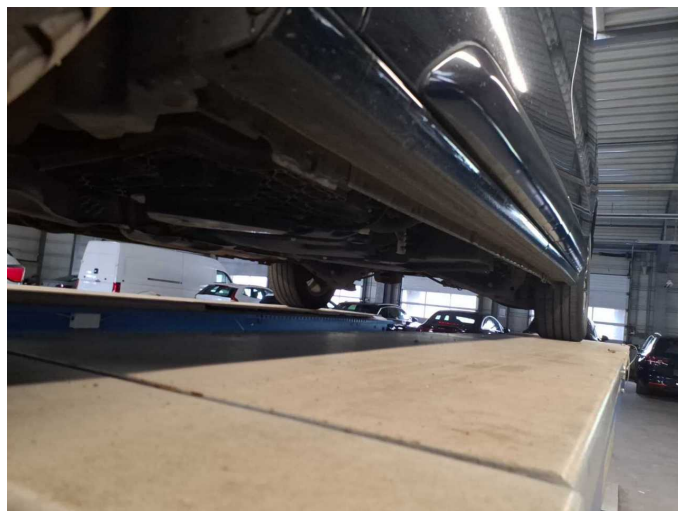


Figure 26: Misc.

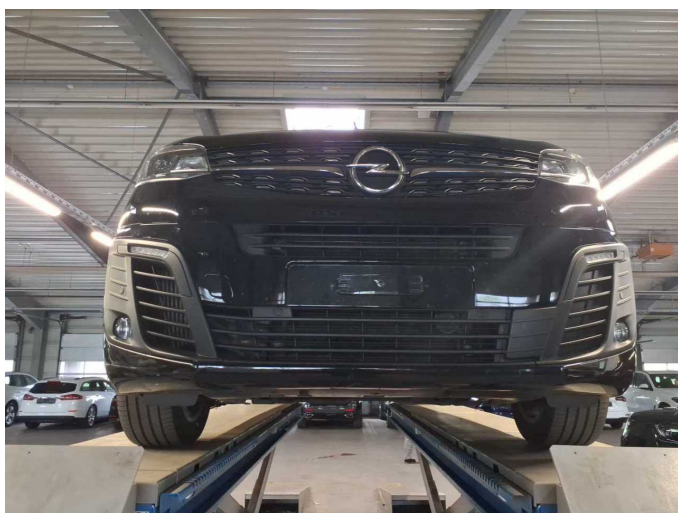


Figure 27: Misc.

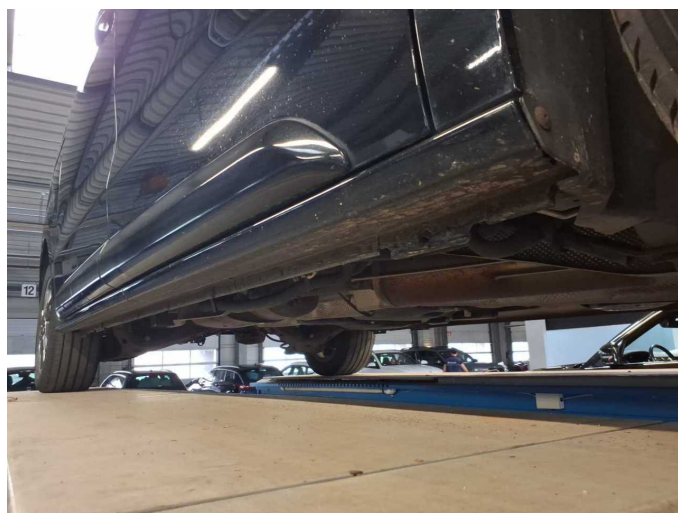


Figure 28: Misc.

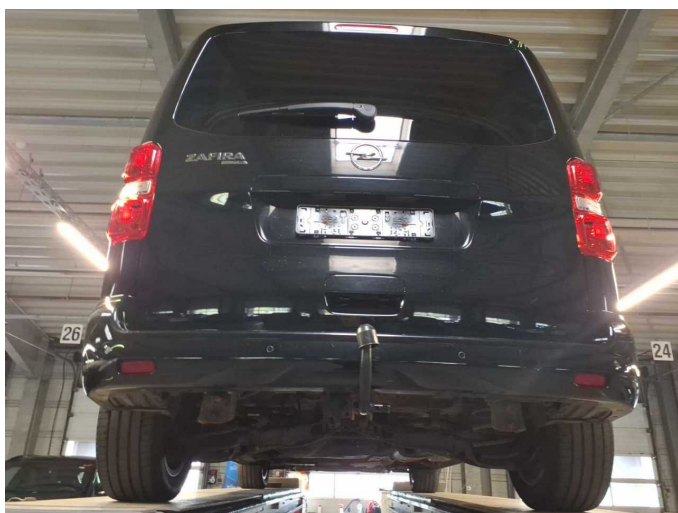


Figure 29: Misc.



Damage 4: Trim / covers: Roof lining - Soiled - Clean




Damage 4: Trim / covers: Roof lining - Soiled - Clean




Damage 5: Body: B-pillar - right side - Scratch(es) - Smart repair



Damage 5: Body: B-pillar - right side - Scratch(es) - Smart repair

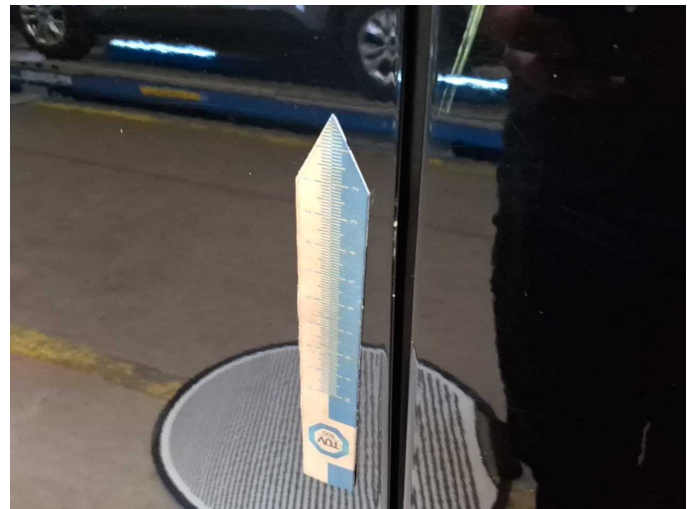

Damage 6: Door - front left side: Door - Scratch(es) - Smart repair

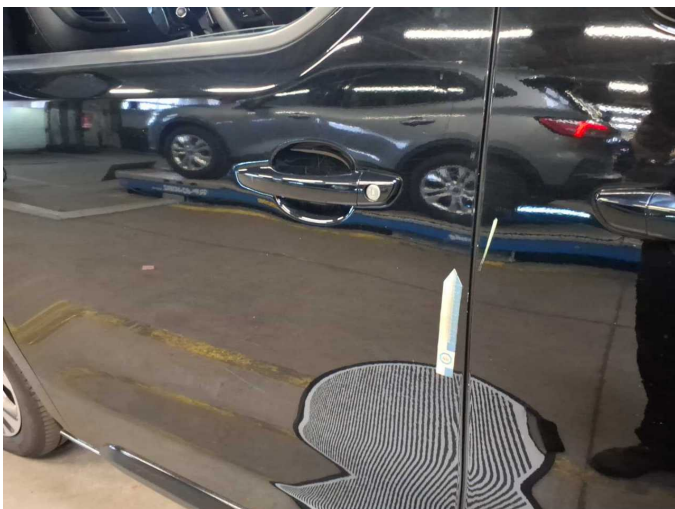

Damage 6: Door - front left side: Door - Scratch(es) - Smart repair



Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Smart repair




Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Smart repair




Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Smart repair




Damage 8: Sliding door - left side: Trim (Außen) - Scratch(es) - Replace

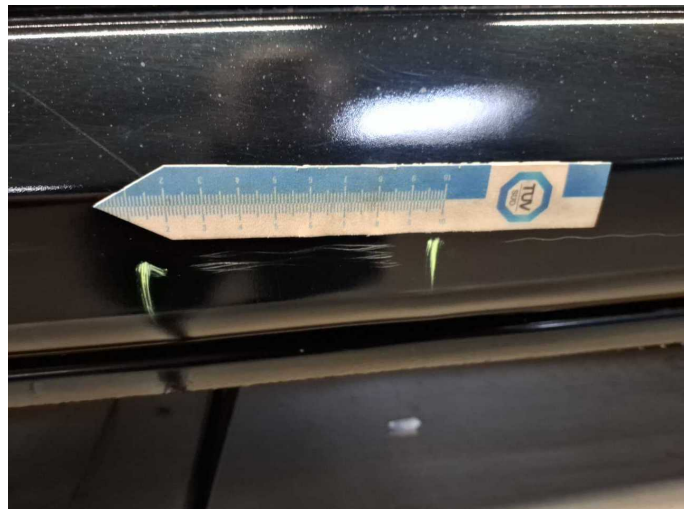


Damage 8: Sliding door - left side: Trim (Außen) - Scratch(es) - Replace

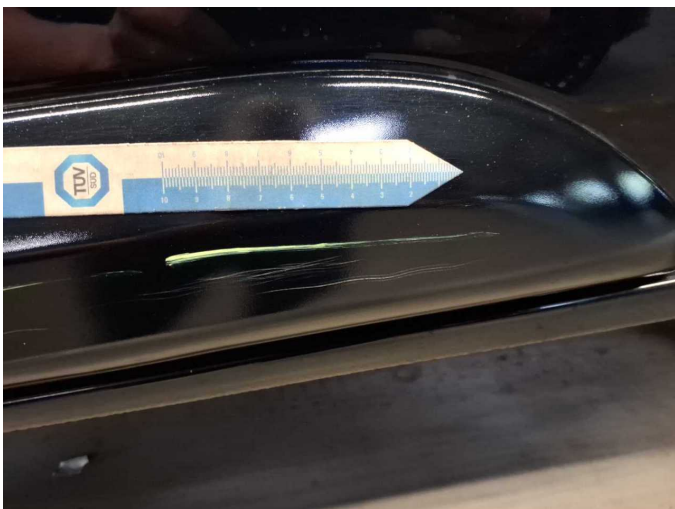

Damage 8: Sliding door - left side: Trim (Außen) - Scratch(es) - Replace

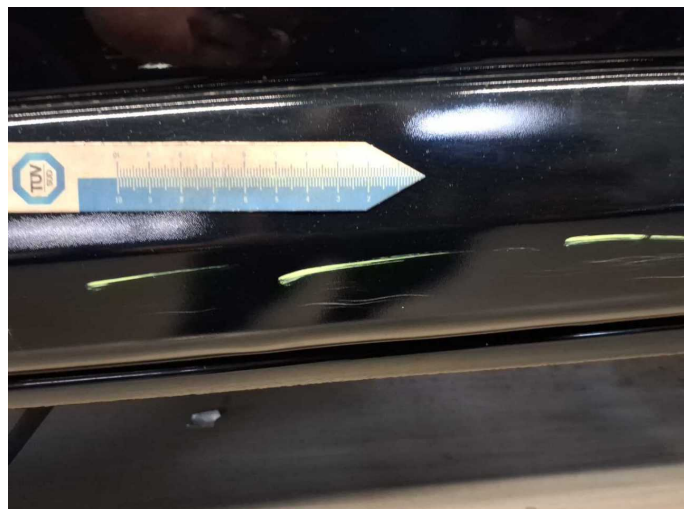

Damage 8: Sliding door - left side: Trim (Außen) - Scratch(es) - Replace

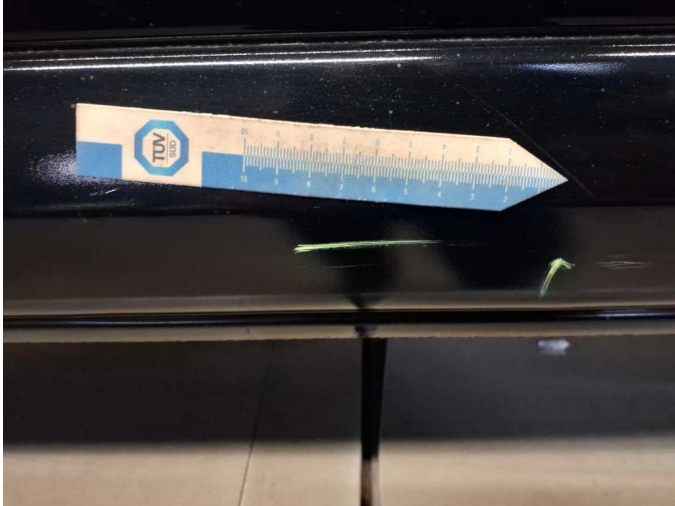

Damage 8: Sliding door - left side: Trim (Außen) - Scratch(es) - Replace



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair




Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair




Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair




Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

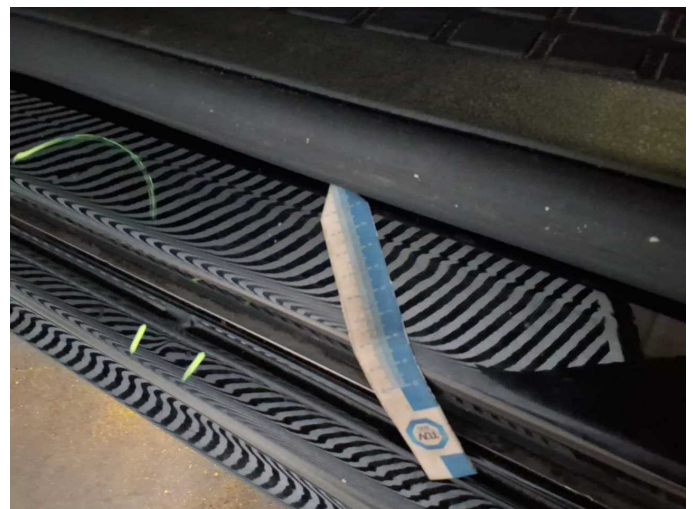


Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

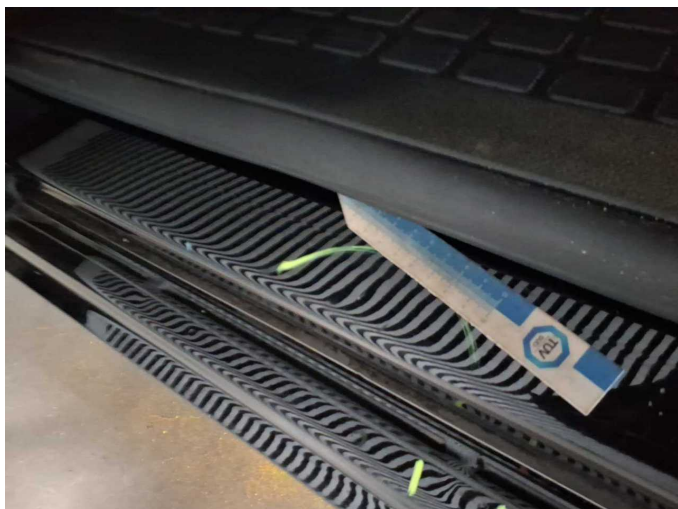

Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

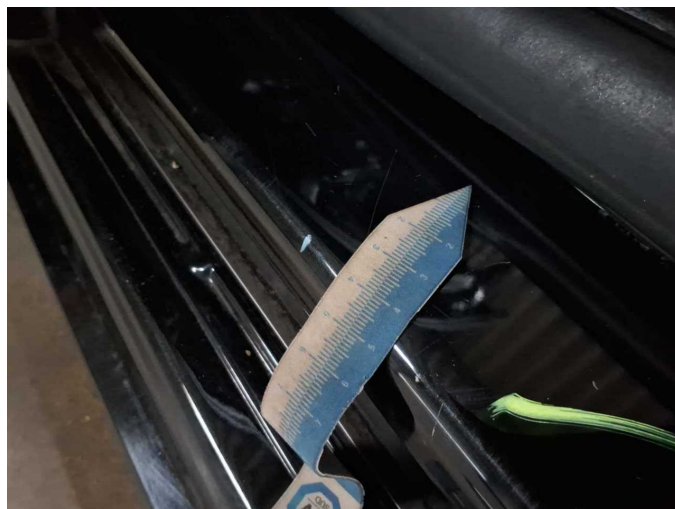

Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

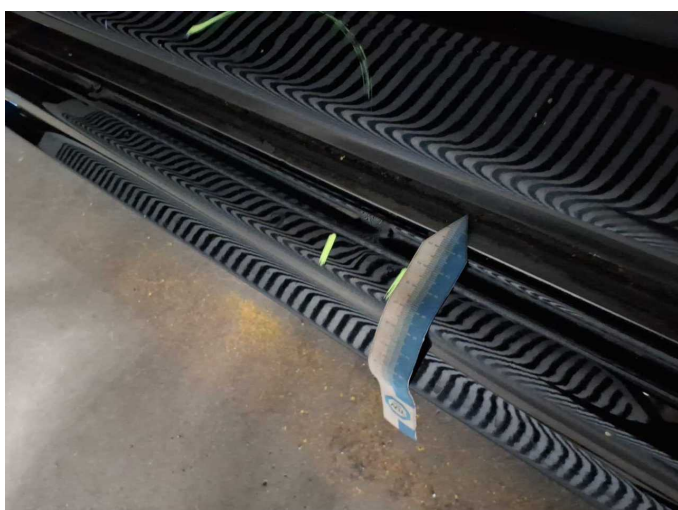

Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

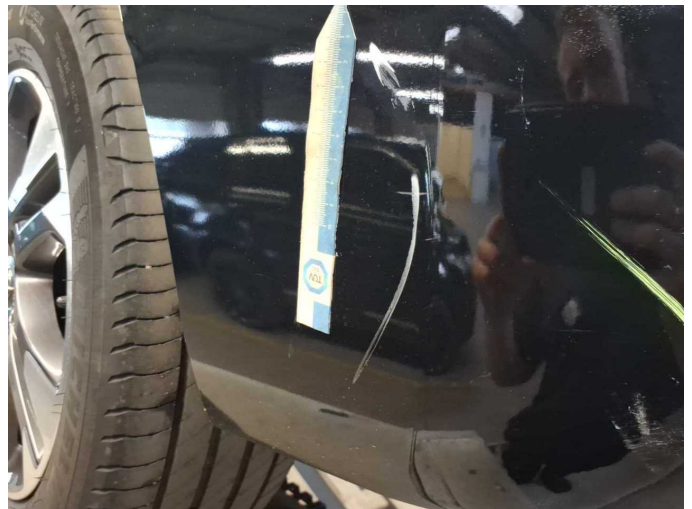


Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

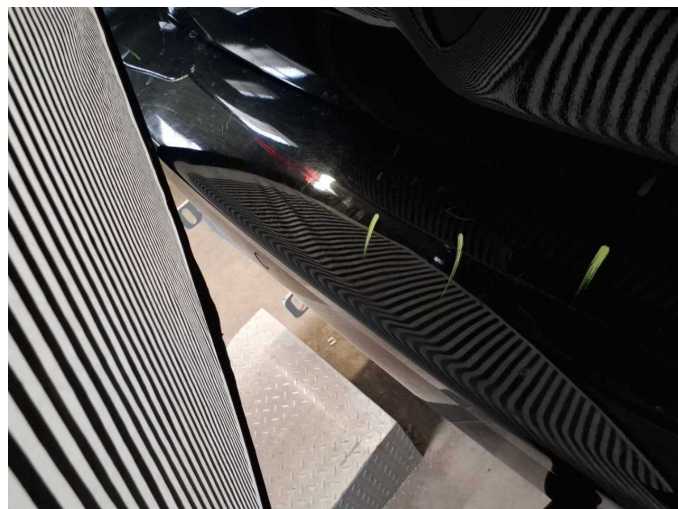


Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

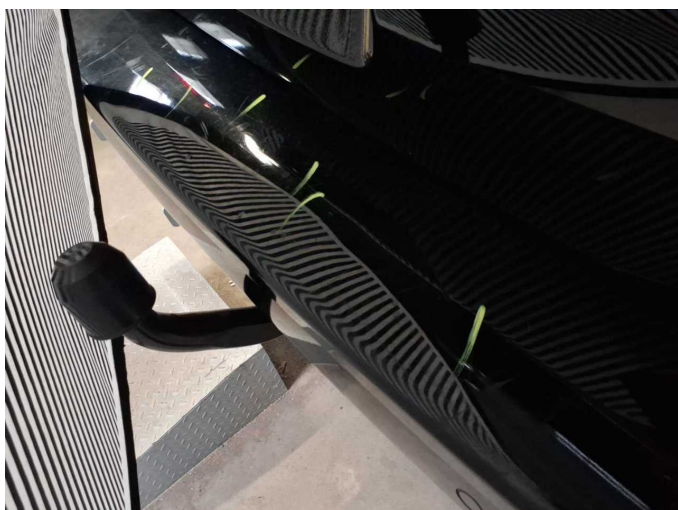

Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

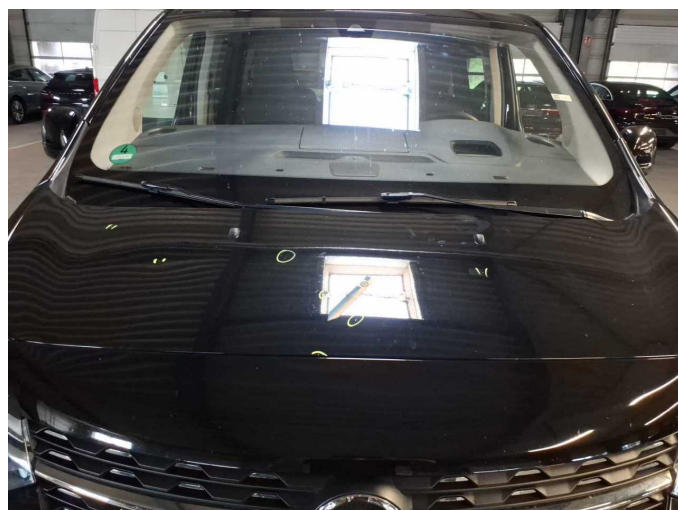


Damage 12: Bonnet: Bonnet - Stone chips - Paint

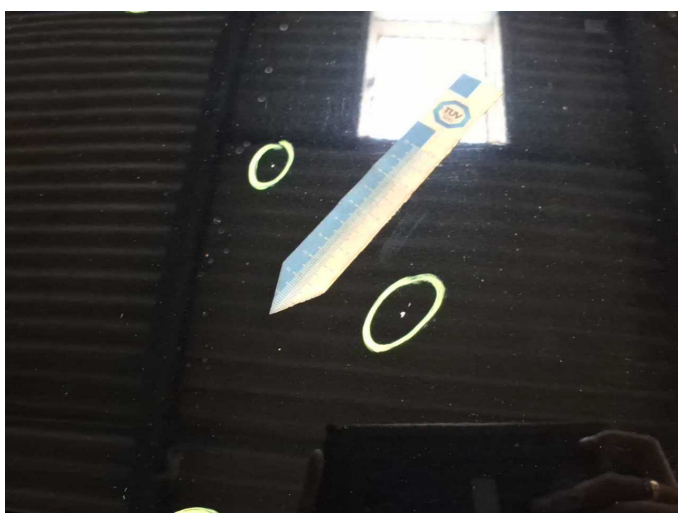


Damage 12: Bonnet: Bonnet - Stone chips - Paint




Damage 12: Bonnet: Bonnet - Stone chips - Paint

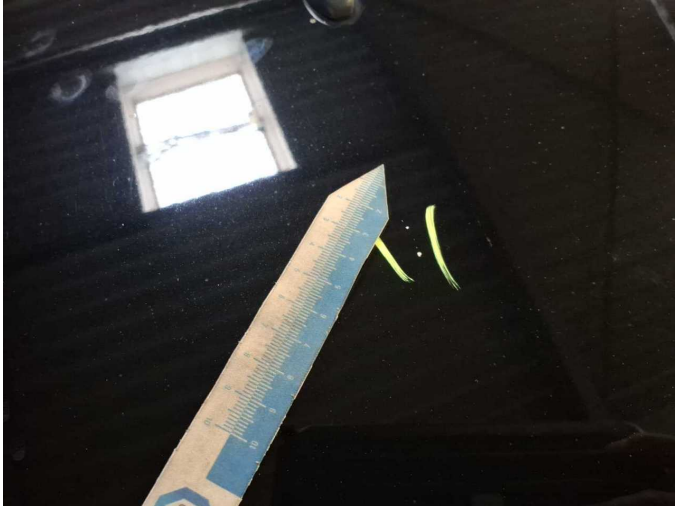


Damage 12: Bonnet: Bonnet - Stone chips - Paint

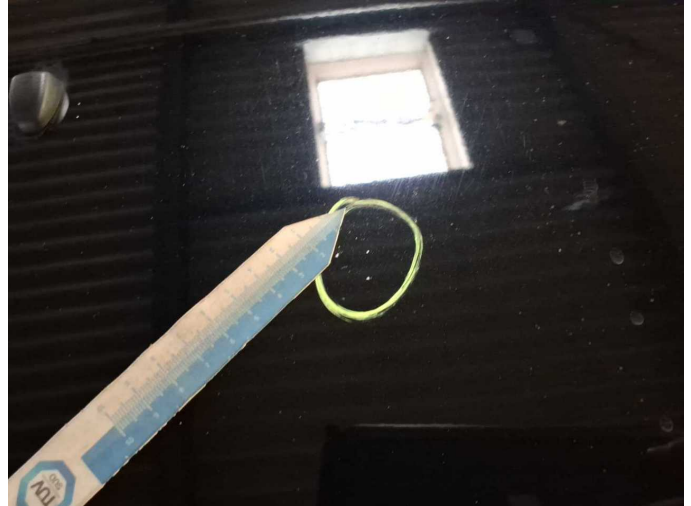


Damage 12: Bonnet: Bonnet - Stone chips - Paint

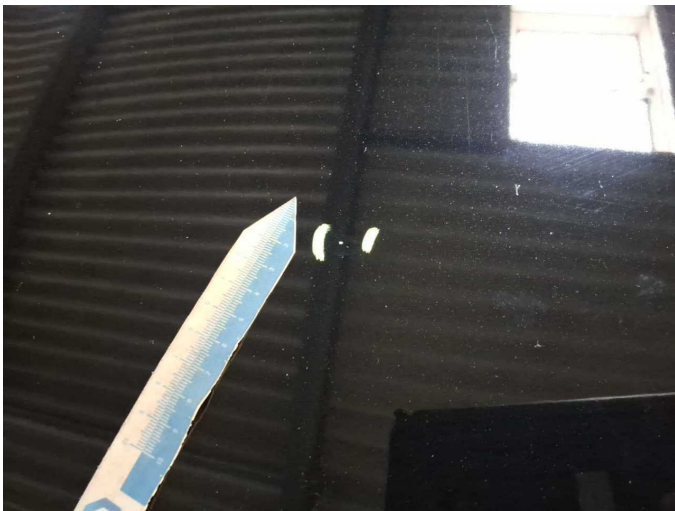

Damage 12: Bonnet: Bonnet - Stone chips - Paint

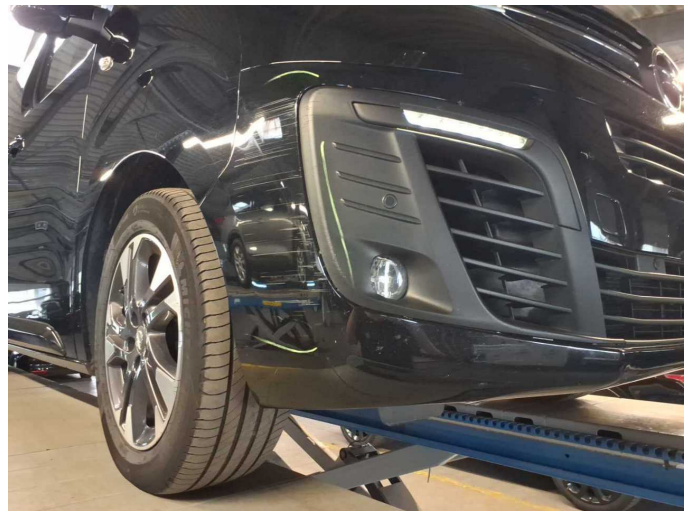


Damage 13: Front bumper: Front bumper (+ Blende) - Scratched - Paint

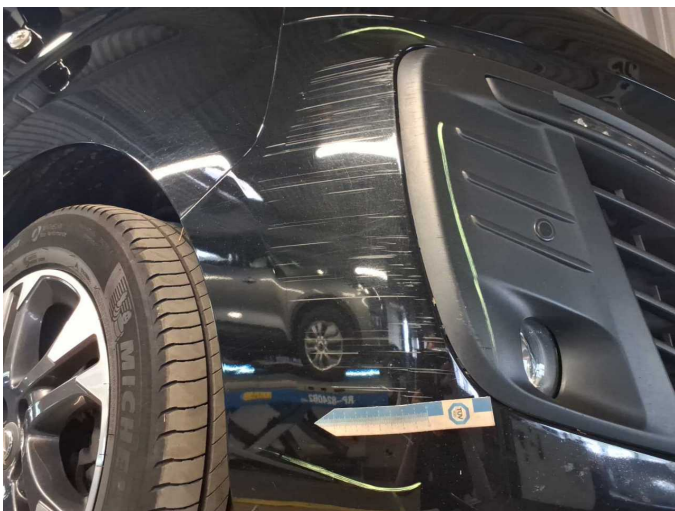

Damage 13: Front bumper: Front bumper (+ Blende) - Scratched - Paint



Damage 13: Front bumper: Front bumper (+ Blende) - Scratched - Paint

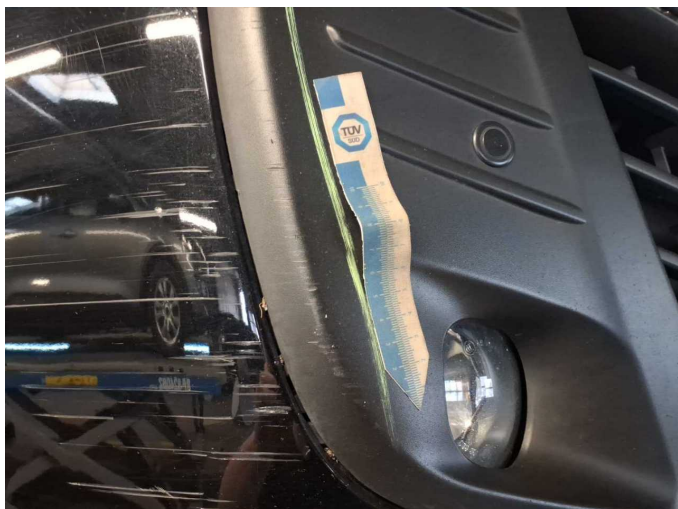

Damage 13: Front bumper: Front bumper (+ Blende) - Scratched - Paint



Damage 14: Sliding door - left side: Sliding door - Dent / paintcoat damage - Repair and paint




Damage 14: Sliding door - left side: Sliding door - Dent / paintcoat damage - Repair and paint




Damage 14: Sliding door - left side: Sliding door - Dent / paintcoat damage - Repair and paint



Damage 14: Sliding door - left side: Sliding door - Dent / paintcoat damage - Repair and paint

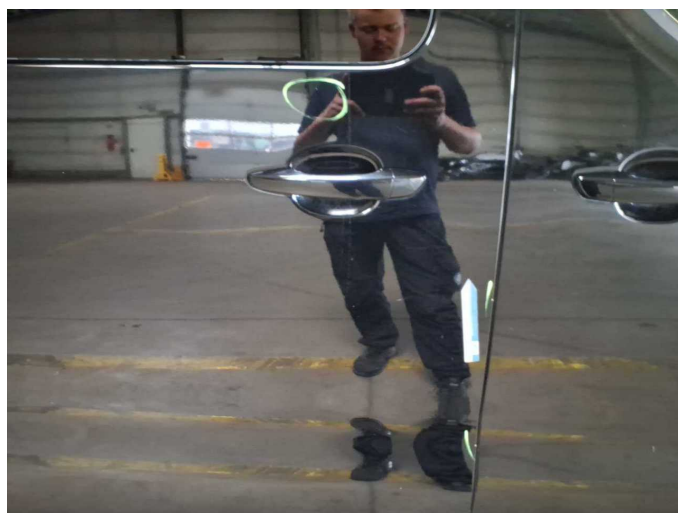

Damage 15: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint

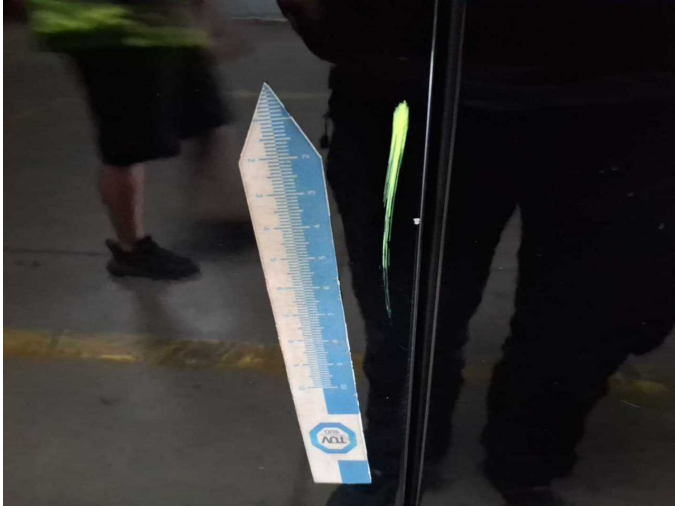

Damage 15: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint




Damage 15: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint




Damage 15: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint



Damage 16: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

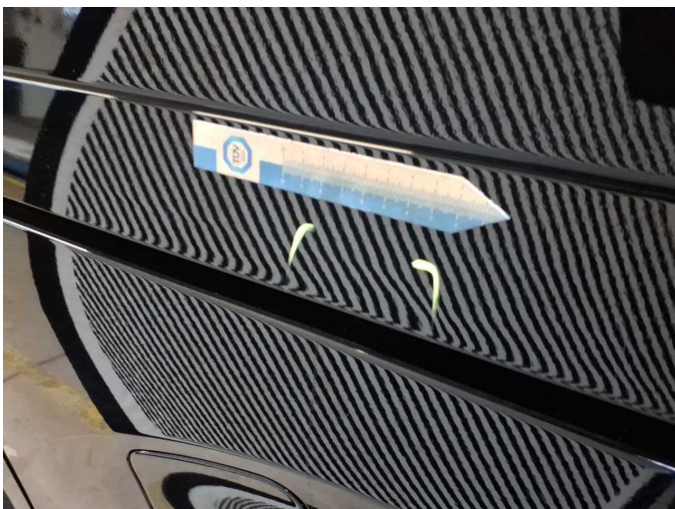


Damage 16: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

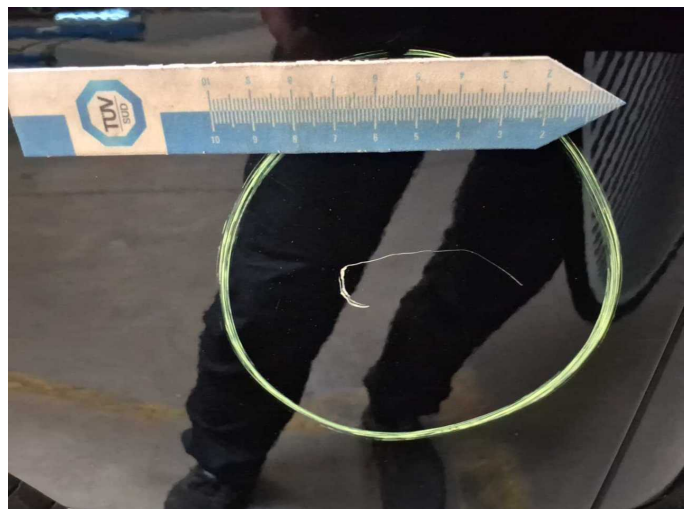


Damage 16: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

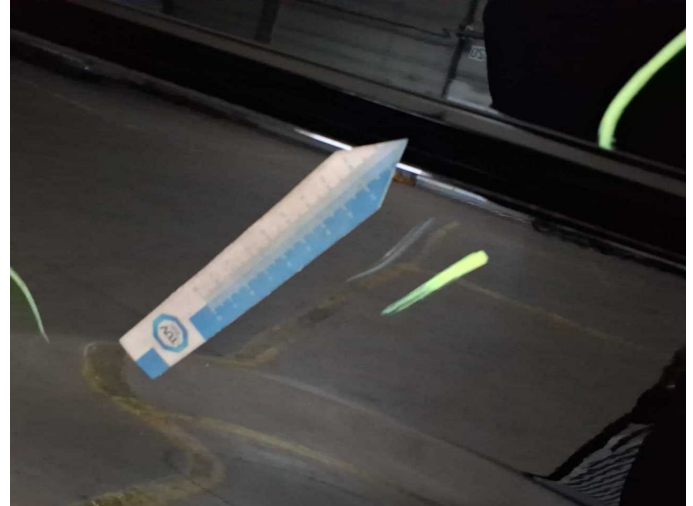

Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

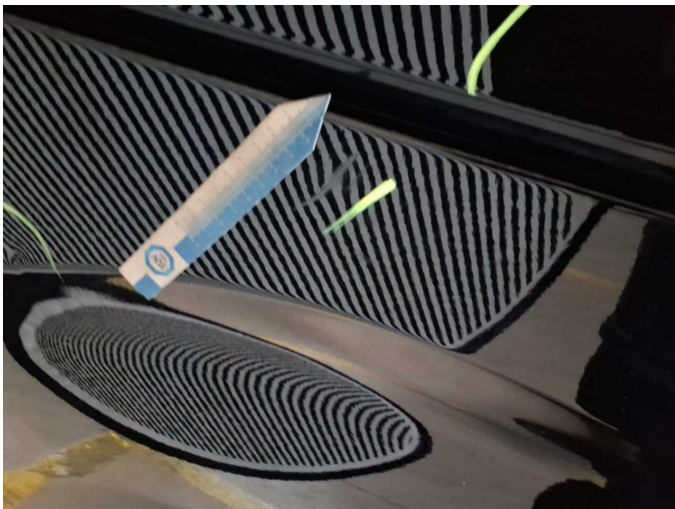


Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

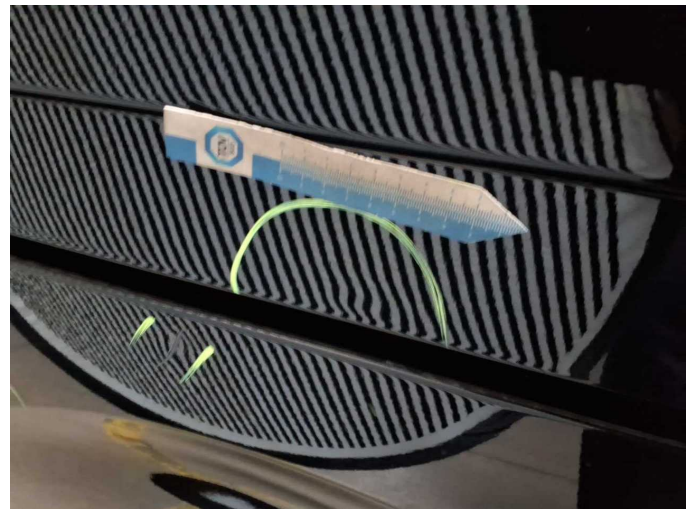

Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

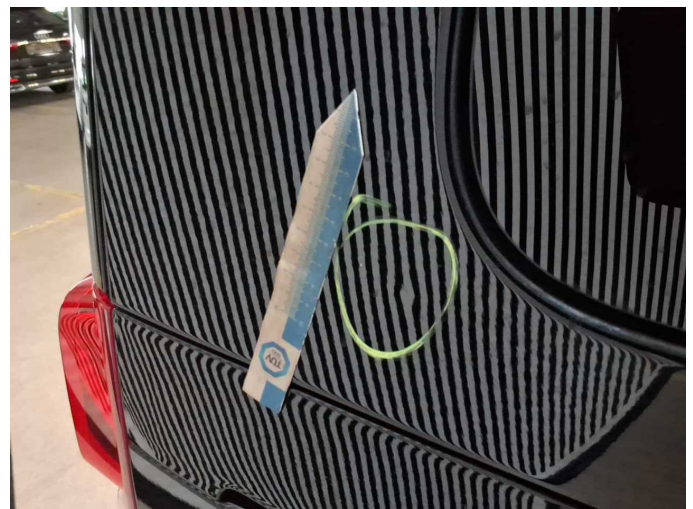

Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door



Boot lid / rear door: 190 µm