



Expertise

Protocol number: 46610897
Order No. / Reference: 26777014
Inspection date: 17 Jul 2026

Manufacturer: Skoda
VIN: TMBJJ7NS7P8510149

Model: Kodiaq 2.0 TDI DSG Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI DSG Ambition	
Vehicle Identification number	TMBJJ7NS7P8510149
Mileage (Read)	105,095 km
First registration	14 Nov 2022
Number of holders	1
Next periodical technical inspection	12/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,500 km
Last service on / at	05/2026 at 103,946 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN430820
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / ART 03443		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,350 kg	Empty weight	
Dimensions	4697 x 1882 x 1675		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Hankook	4mm / 4mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Hankook	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	215/65 R17 99V	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 08/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- Decorative inlay, brushed aluminum
- Tachometer
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger including humidity sensor and odor and allergen filter)
- LED taillights in crystal glass look & LED license plate lights
- Reading lights at the front of the headliner
- Rear center armrest with cup holders
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster, color
- Fog lights with integrated LED daytime running lights
- Upholstery: Cloth
- Radio: Swing 6.5" music system
- Radio accessories: 8 speakers
- Tire mobility kit (tire repair spray incl. compressor)
- Wheels: 17" Mytikas alloy wheels (7Jx17 tires 215/65 R17 99V ET40)
- Heated windshield washer nozzles, front
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Seats: Height-adjustable front seats
- Skoda Care Connect (SOS emergency call function (eCall, including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection for rapid assistance in case of breakdown) - Information service (connection to the hotline for all questions regarding vehicle functions) - Free remote vehicle access for one year with access to vehicle data/functions via smartphone, e.g., parking position, activating hazard warning lights, current fuel level, etc.)
- Central locking with remote control (two vehicle keys)
- Storage compartment on the left wheel arch
- front aero windshield wipers
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist (HBA)
- Grey headliner
- Roof rails, black
- Diesel particulate filter
- Third brake light (in the rear spoiler (LED))
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Closed storage compartment on the driver's side
- Cruise control
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Boot cover, roll-up and removable
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters (height and reach adjustable)
- Engine drag torque control (MSR)
- Multi-collision brake
- Rear parking sensors
- Wheel arch cover (front and rear, made of plastic, black textured)
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Headlights washer / wiper system
- Kodiaq safety belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Belt fastening indicator in the front and in the second row of seats)
- Sun visor on driver and passenger side with illuminated vanity mirror
- Speed limiter
- Telephone: Comfort hands-free telephone system (without connection to the external antenna)
- Variable fastening concept in the trunk
- Lashing eyes in the trunk
- Immobiliser



Extra equipment

- Package: Business Amundsen (Amundsen dynamic radio navigation system - 8" capacitive color display - Digital Cockpit Plus (10") - SmartLink - Wireless SmartLink - Voice control - Phonebox with inductive charging function (connection via external antenna) - Driver fatigue detection - 230V socket and a USB charging port (Type-C) on the back of the front center armrest - Sunset - Acoustic glazing in the front doors - Luggage net partition - Infotainment Online (3-year subscription))
- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Luggage net partition
- Paint finish: Metallic / Pearl effect
- Radio: Bolero infotainment system
- Rear view camera
- Seats: Heated front seats
- Traveller Plus (DSG) assistance system (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist - Adaptive Lane Guidance - Park Assist - Traffic Jam and Emergency Assist - Traffic Sign Recognition)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door - dent(s) - Smooth repair work
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
3	Body	Wheel well - front left side - Broken / torn - Replace
4	Rear bumper	Spoiler - Scratch(es) - Replace
5	Front bumper	Spoiler - Broken / torn - Replace
6	Roof	Roof rail - right side - Dent / paintcoat damage - Repair and paint
7	Side panel - rear right side	Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint
8	Door - rear left side	Door - Scratch(es) - Paint
9	Boot lid / rear door	Boot lid - Scratch(es) - Paint
10	Door - rear right side	Door (Wellig) - Unprofessionally repaired - Repair and paint
11	Front bumper	Front bumper - Scratch(es) - Paint
12	Bonnet	Bonnet (Anätzung) - Paint defect - Repair and paint
13	Roof	Roof - Paint defect - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Rear window - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Missing parts

Description
Equipment - Umbrella

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 6 Aug 2025	8.506,84 €

Repainting

No.	Repainting
1	Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	264 µm	Door - rear right side	173 µm
------------------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

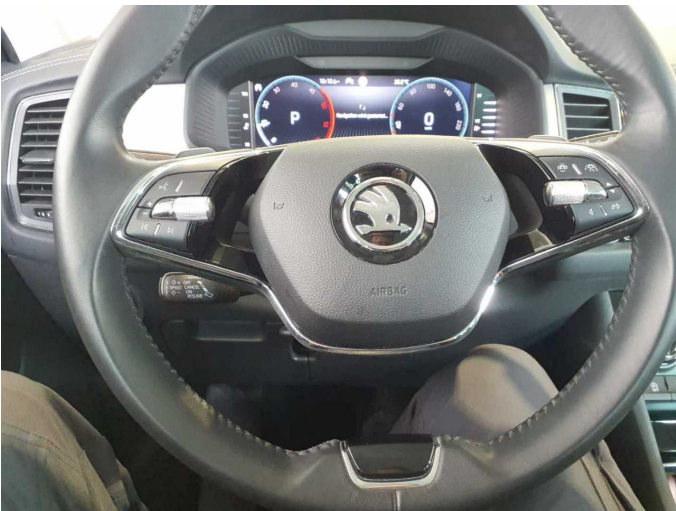


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

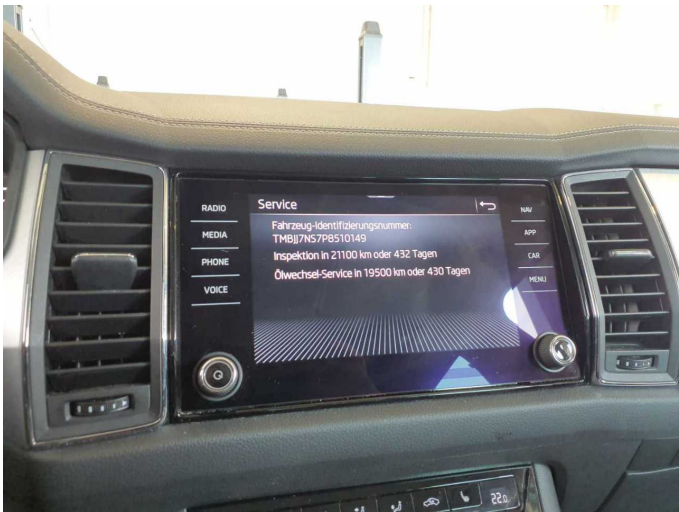


Figure 24: Misc.



Figure 25: Misc.

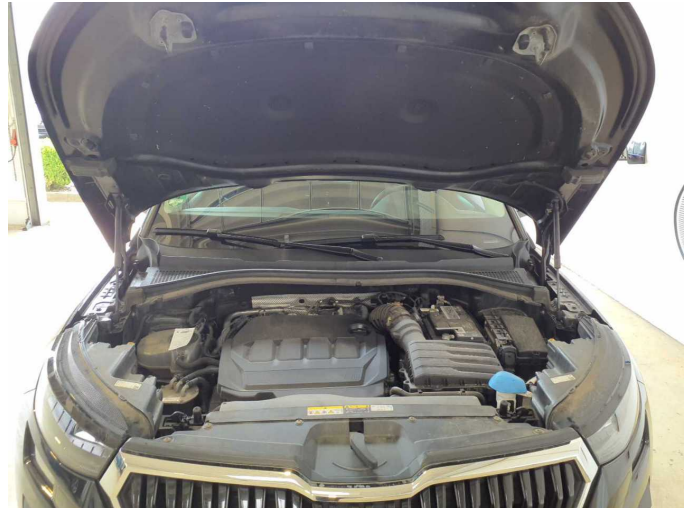


Figure 26: Misc.

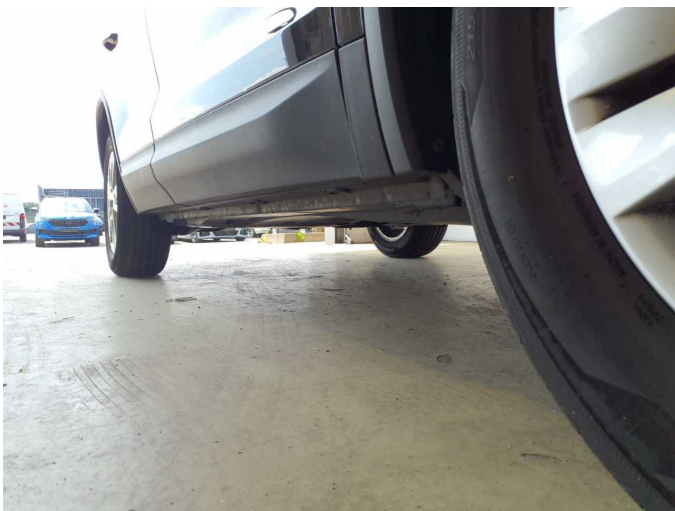


Figure 27: Misc.

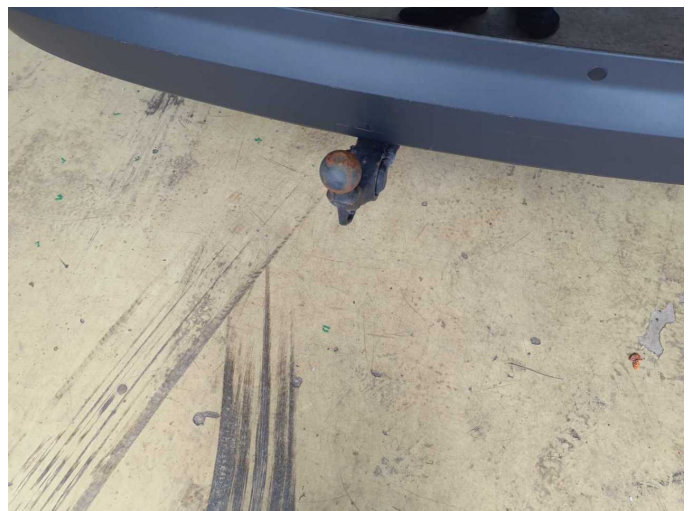


Figure 28: Misc.

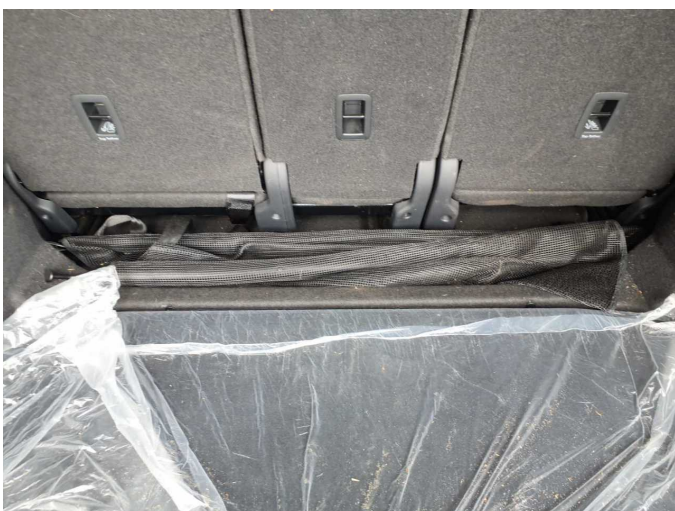


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Door - front left side: Door - dent(s) - Smooth repair work



Damage 1: Door - front left side: Door - dent(s) - Smooth repair work



Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 3: Body: Wheel well - front left side - Broken / torn - Replace



Damage 3: Body: Wheel well - front left side - Broken / torn - Replace

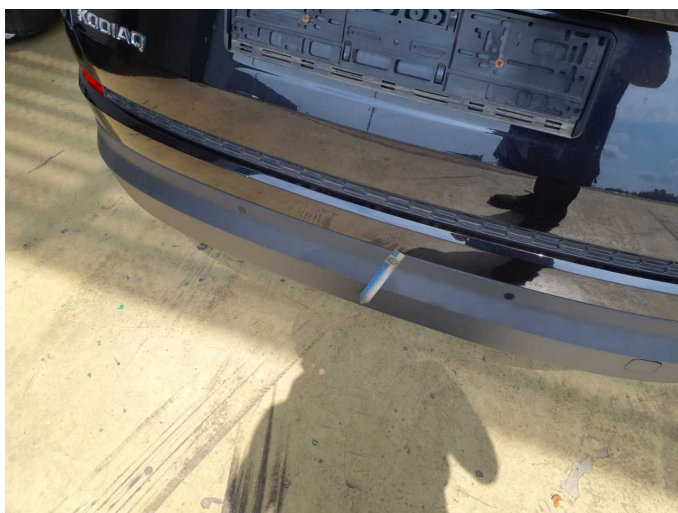

Damage 4: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 4: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 4: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 5: Front bumper: Spoiler - Broken / torn - Replace



Damage 5: Front bumper: Spoiler - Broken / torn - Replace




Damage 6: Roof: Roof rail - right side - Dent / paintcoat damage - Repair and paint



Damage 6: Roof: Roof rail - right side - Dent / paintcoat damage - Repair and paint




Damage 6: Roof: Roof rail - right side - Dent / paintcoat damage - Repair and paint

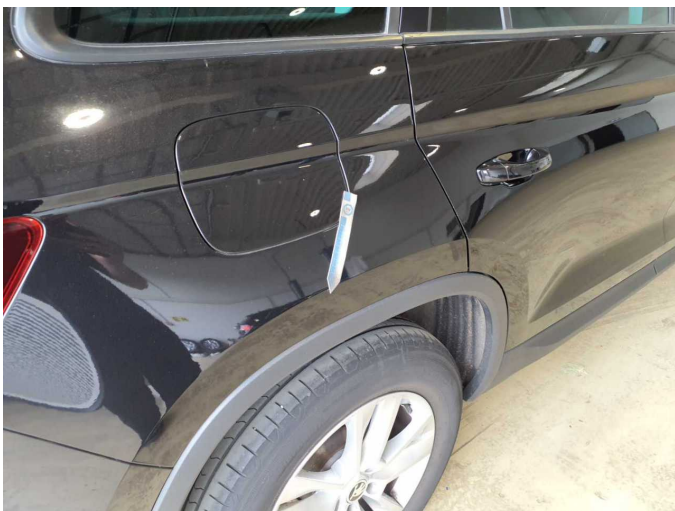

Damage 7: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint




Damage 7: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

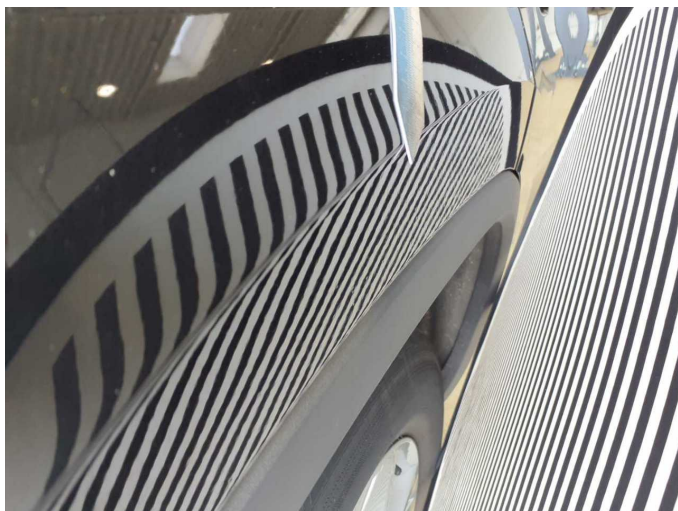

Damage 7: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint



Damage 8: Door - rear left side: Door - Scratch(es) - Paint

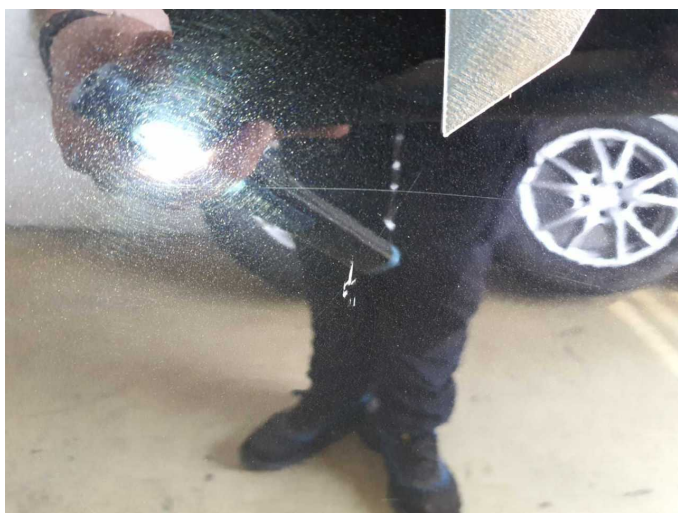


Damage 8: Door - rear left side: Door - Scratch(es) - Paint



Damage 9: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 9: Boot lid / rear door: Boot lid - Scratch(es) - Paint

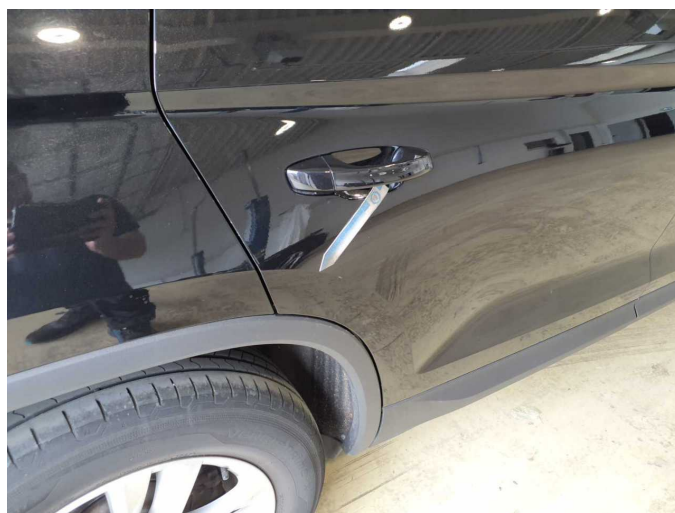

Damage 10: Door - rear right side: Door (Wellig) - Unprofessionally repaired - Repair and paint



Damage 10: Door - rear right side: Door (Wellig) - Unprofessionally repaired - Repair and paint

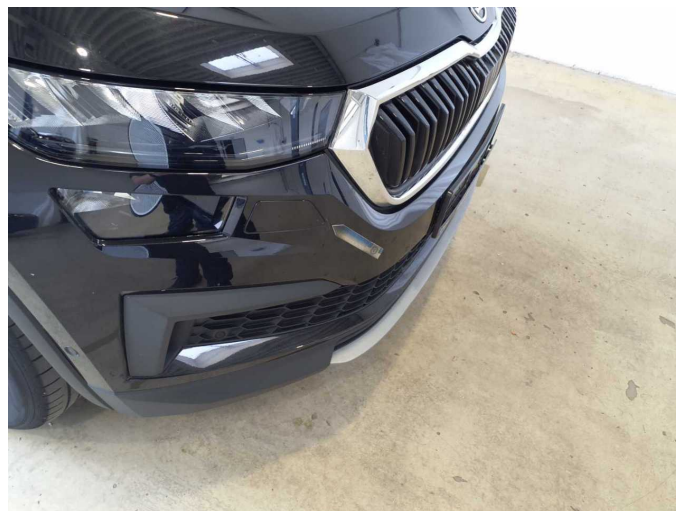

Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Damage 11: Front bumper: Front bumper - Scratch(es) - Paint




Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

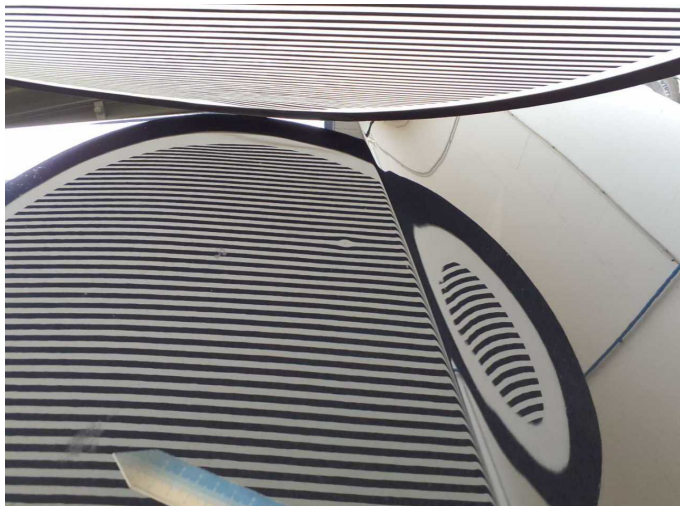

Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint




Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Damage 13: Roof: Roof - Paint defect - Repair and paint

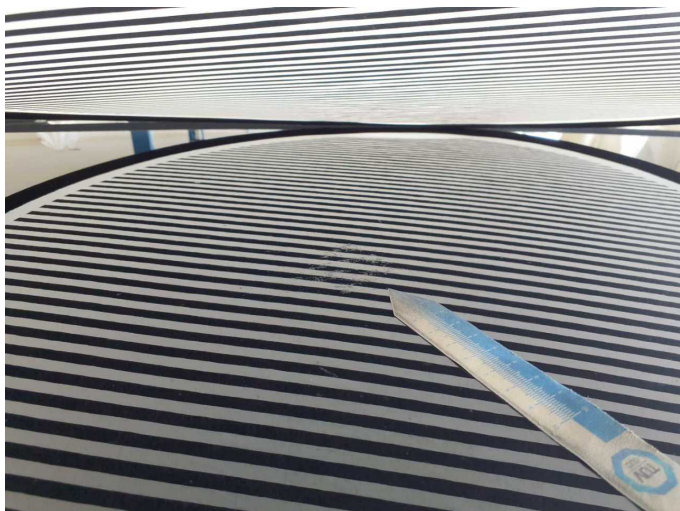

Damage 13: Roof: Roof - Paint defect - Repair and paint




Damage 13: Roof: Roof - Paint defect - Repair and paint



Damage 13: Roof: Roof - Paint defect - Repair and paint




Missing part 1: Equipment: Umbrella - Missing - Replace

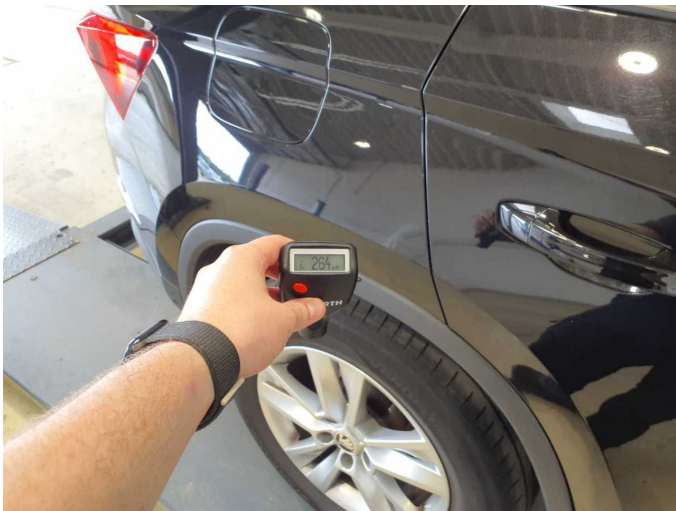

Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side

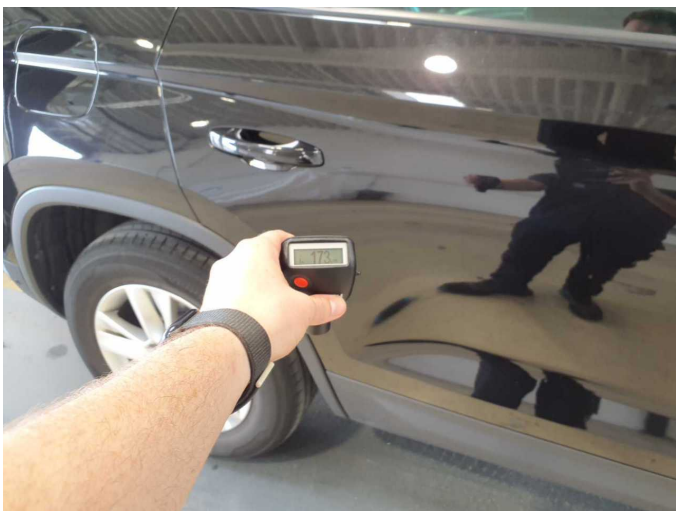

Repainting 2: Door - rear right side



Repainting 2: Door - rear right side