



Expertise

Protocol number: 46385288
Order No. / Reference: 26512547
Inspection date: 2 Jul 2026

Manufacturer: Skoda
VIN: TMBJC7NY9NF019119

Model: Enyaq iV 80



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Enyaq iV 80	
Vehicle Identification number	TMBJC7NY9NF019119
Mileage (Read)	93,900 km
First registration	14 Oct 2021
Number of holders	1
Next periodical technical inspection	11/2026
(Report on hand)	
Power / Engine displacement	70 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Grey-Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	462 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD080695
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWS 00028		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,649 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105W	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
2)	255/50 R19 107W	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Summer tyres on Light alloy	Hankook	5mm / 5mm
2)	255/50 R19 103T	Summer tyres on Light alloy	Hankook	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2023		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments
- Airbag, driver and passenger
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Evasive steering assist including turn assist
- Outdoor temperature display
- Hill start assist
- Digital instrument cluster (Virtual Cockpit)
- E-Sound
- ESC Electronic Stability Control
- Front radar assistant with pedestrian and cyclist detection and city emergency braking function
- Tinted windows
- rear window wiper
- Isofix anchorage on the front passenger seat
- Child safety locks on the rear doors
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- LED taillights
- Steering wheel adjustable for height and reach
- Package: Chrome
- Front and rear parking sensors
- Radio accessories: SmartLink
- Radio accessories: Wireless SmartLink
- Tire Mobility Kit
- Tire pressure monitoring
- Rear view camera
- Power steering
- Safety lights in the front side doors
- Skoda Care Connect
- Speed limiter
- 12V socket - in the trunk
- Immobiliser
- Airbag, center airbag front
- Airbag, front and rear head airbags
- acoustic windscreen
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Design Selection Loft
- Third brake light
- Electronic parking brake including auto-hold function
- Electric windows front and rear
- Cruise control
- Transmission: 1-speed (EV)
- Heated rear window
- Automatic interior mirror dimming
- Isofix anchorage on the outer rear seats including top tether
- Removable boot cover
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) (Fast charging connector (CCS / Combo 2))
- Manual headlight range adjustment
- Package: Drive BASIC
- Radio: Infotainment system with capacitive 13" color display
- Rain sensor and driving light assistant with coming and leaving home function
- Wheels: 19" Proteus Silver alloy wheels
- Rear seat backrest split 60:40, foldable
- Seat belts
- Seats: Front seats are height-adjustable, including manually adjustable lumbar support.
- Lane keeping assistant (Lane Assist)
- Traffic sign recognition
- Central locking including remote control integrated into the key



Extra equipment

- Increased battery charging power max. 125 kW incl. 1 year free monthly basic fee at Ionity
- Paint finish: Pearl effect
- Package: Drive SPORT BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel in sport design with multifunction buttons - steering wheel with hands-off detection - progressive steering)
- Package: Infotainment BASIC (Navigation system - Infotainment Online 3 years (Online map updates for navigation; display of weather data, news, headlines; charging station and parking space search))
- Package: Light & Sight BASIC (LED matrix headlights incl. AFS and dynamic high beam assist; in rain and bad weather conditions, the cornering and curve lights illuminate the area directly in front of the car better - headlight cleaning system - full LED taillights with animated turn signals)
- Package: Transport (Net program in the trunk incl. charging cable bag - Variable loading floor in the trunk - Remote release of the rear seat backrests in the trunk - Cargo elements in the trunk)
- Wheels: 19" Regulus AERO alloy wheels, anthracite polished (8Jx19, tires 235/55 R19 101T front, 255/50 R19 103T rear)
- Lockable bicycle carrier
- Chassis: Sport chassis
- Package: Convenience BASIC (KESSY (Keyless Entry and Start-Stop System) - Phonebox with inductive charging function (connection via the external antenna) - Sunset including acoustic side glazing at the front - Extended acoustic measures - Driver fatigue detection)
- Package: Driving Assistance BASIC (Adaptive Distance Assist (ACC) - Lane Change and Parking Assist - Proactive Occupant Protection)
- Package: Basic climate control (Heated front seats - Heated windscreen washer nozzles - Climatronic air conditioning (3-zone), fully automatic, separately adjustable for driver, front passenger and rear passengers, including odor and particle filter)
- Package: Parking PLUS (front and rear parking sensors - reversing camera incl. 360° surround view camera)
- Package: Seating comfort BASIC (electrically adjustable driver's seat with memory function - electrically adjustable lumbar support in the driver's seat)
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Universal holder for multimedia devices
- winter tires
- heat pump

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Electronic systems	Electronic systems (SOS) - Non-operational - Perform diagnosis
4	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
5	2nd wheel set	1 tyre (Flanke) - Damaged - Replace
6	Wheel / tyres	Tyre - front right side (nicht fahrbereit,) - Damaged - Replace
7	Front axle	Axles / undercarriage (wegen der beschädigten Felge und dem Reifen) - Specify findings - Measure
8	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
9	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
10	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
11	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
12	Equipment	Vehicle key with remote control - Damaged - Replace
13	Front bumper	Spoiler - Scratched - Replace
14	Bonnet	Radiator grille (Rahmen) - Paint defect - Replace
15	Door - front left side	Door - Scratch(es) - Paint
16	Bonnet	Bonnet (Rostbildung) - Stone chips - Repair and paint
17	Wing mirror - right side	Wing mirror - Damaged - repair according to calculation

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Front, Side - left
2	Rear, Side right

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
2	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
4	Bonnet, Professionally carried out, Invoice of repair done Non-existent
5	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
6	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
7	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
8	Door - front left side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Boot lid / rear door	172 µm	Mudguard - left side	167 µm
Mudguard - right side	173 µm	Bonnet	174 µm
Side panel - rear left side	170 µm	Side panel - rear right side	197 µm
Door - rear left side	178 µm	Door - front left side	181 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

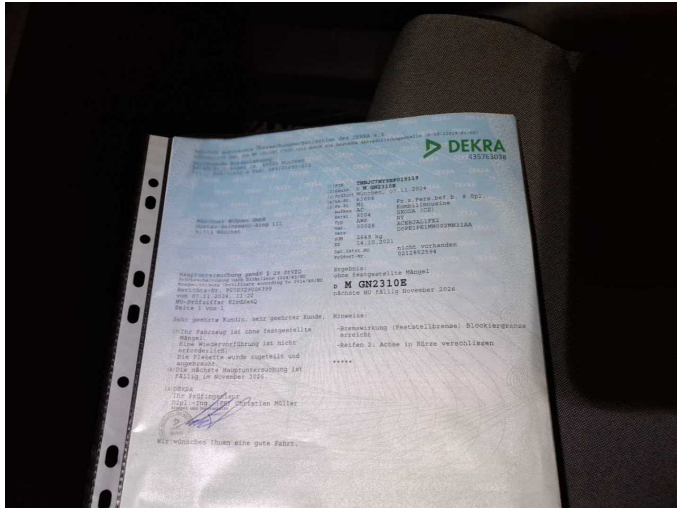


Figure 13: Documents

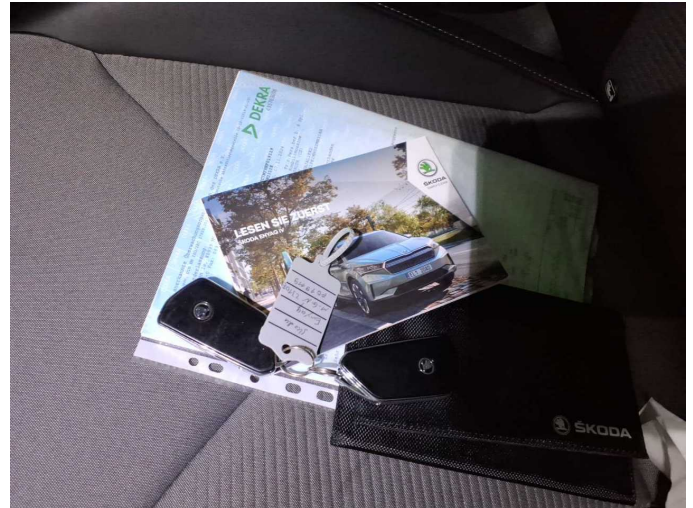


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

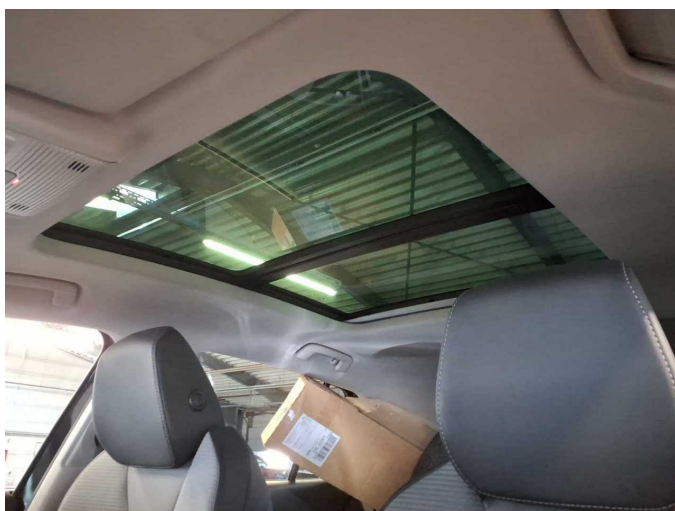


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

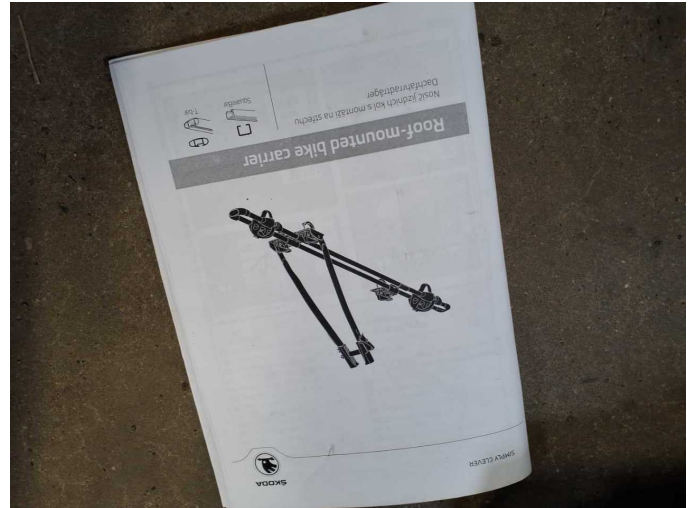


Figure 32: Misc.

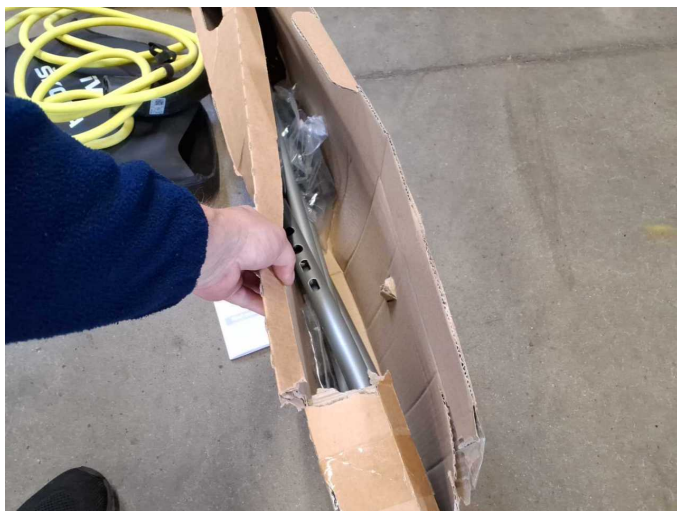


Figure 33: Misc.


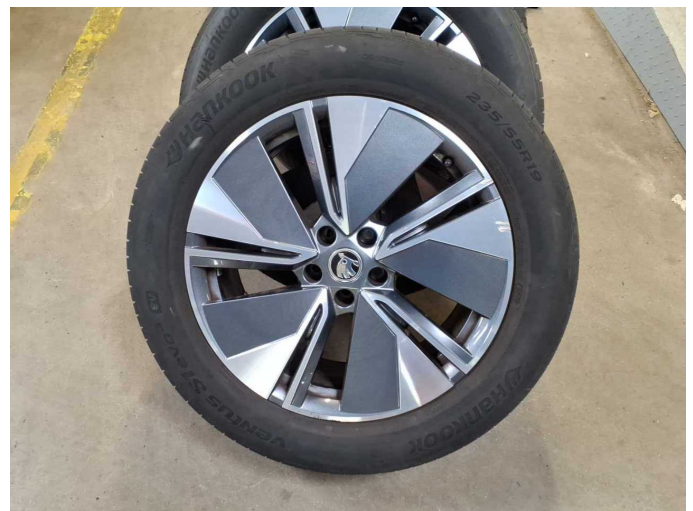


Figure 34: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace

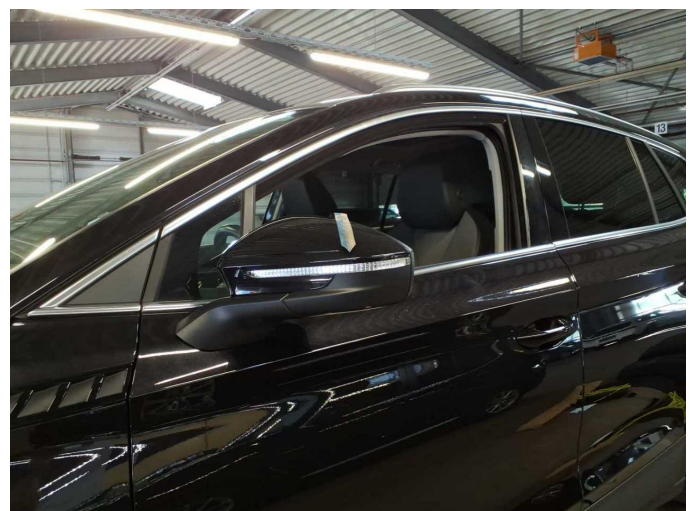


Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair

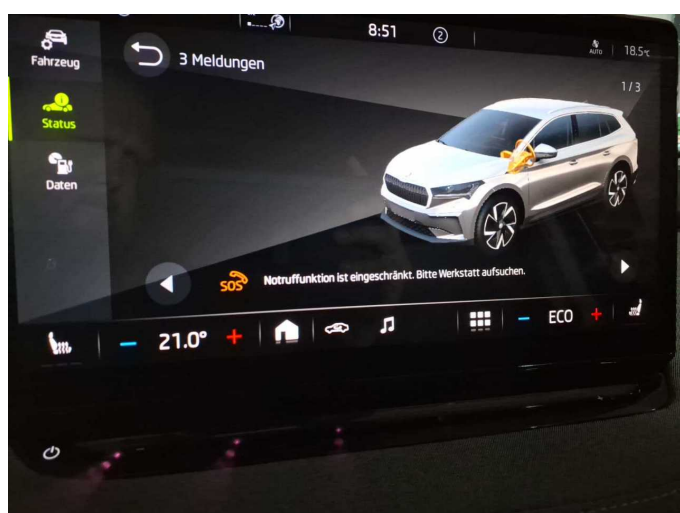

Damage 3: Electronic systems: Electronic systems (SOS) - Non-operational - Perform diagnosis



Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair




Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 5: 2nd wheel set: 1 tyre (Flanke) - Damaged - Replace




Damage 5: 2nd wheel set: 1 tyre (Flanke) - Damaged - Replace

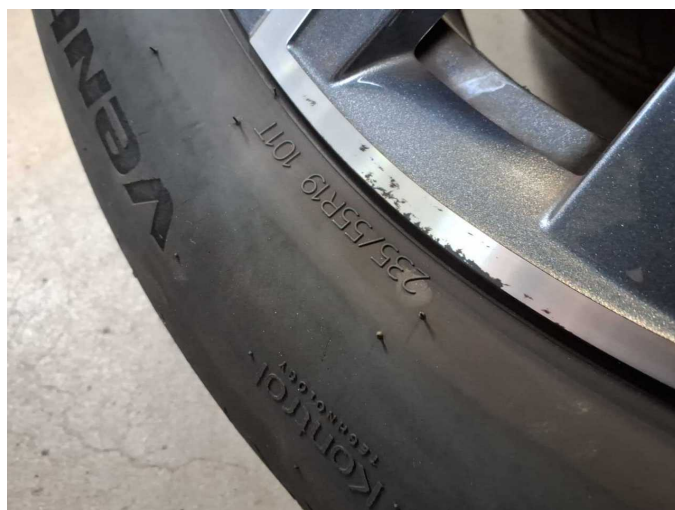

Damage 5: 2nd wheel set: 1 tyre (Flanke) - Damaged - Replace



Damage 6: Wheel / tyres: Tyre - front right side (nicht fahrbereit.) - Damaged - Replace

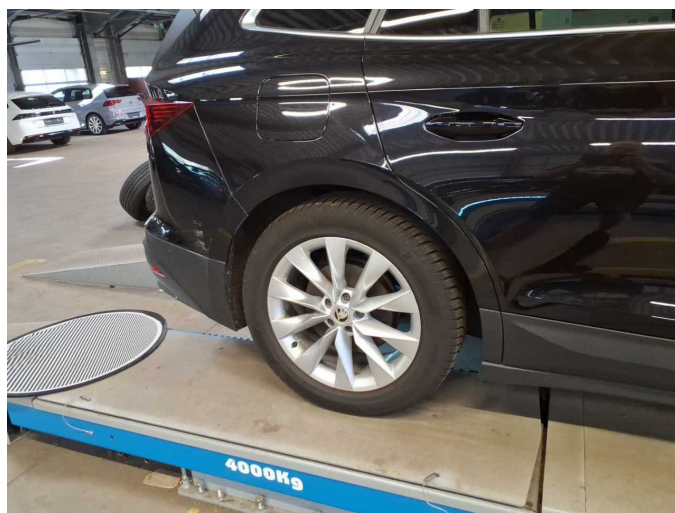

Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value




Damage 11: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 11: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 11: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value

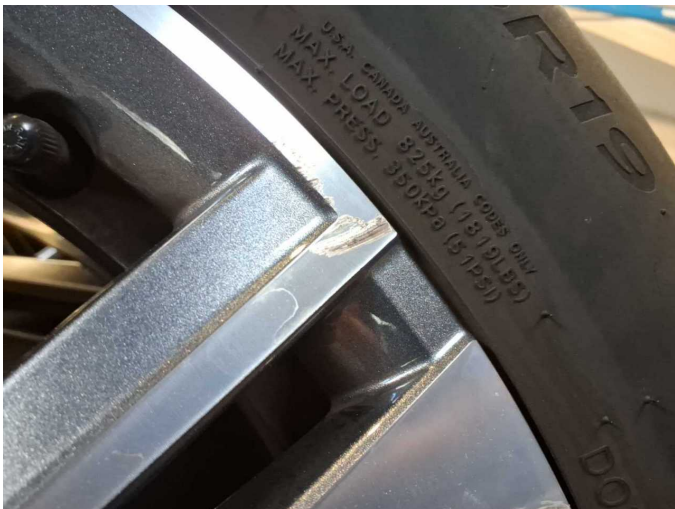

Damage 11: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 12: Equipment: Vehicle key with remote control - Damaged - Replace

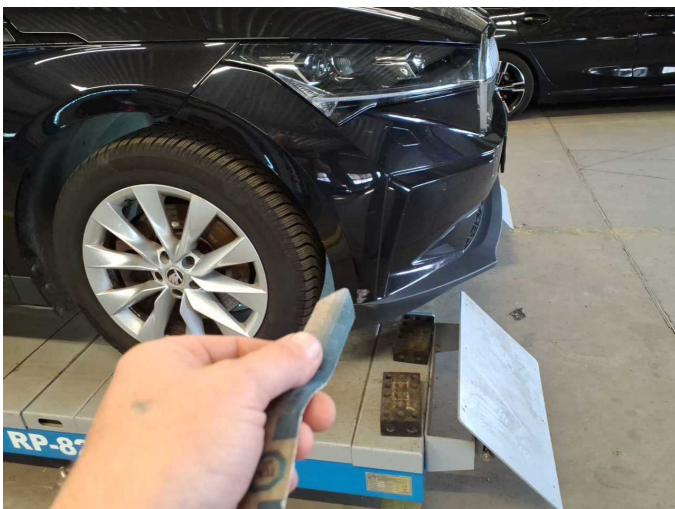


Damage 13: Front bumper: Spoiler - Scratched - Replace




Damage 13: Front bumper: Spoiler - Scratched - Replace



Damage 13: Front bumper: Spoiler - Scratched - Replace

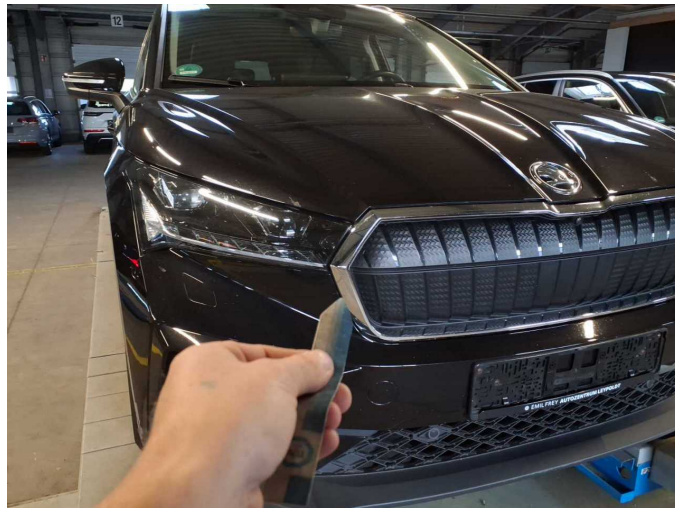

Damage 14: Bonnet: Radiator grille (Rahmen) - Paint defect - Replace

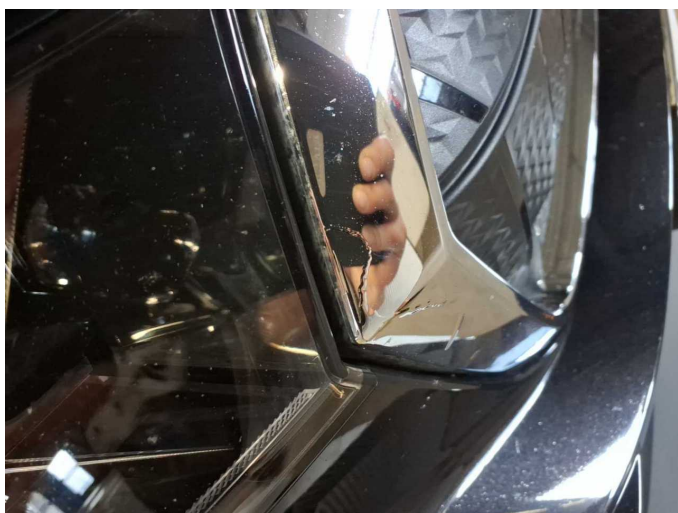

Damage 14: Bonnet: Radiator grille (Rahmen) - Paint defect - Replace



Damage 14: Bonnet: Radiator grille (Rahmen) - Paint defect - Replace



Damage 15: Door - front left side: Door - Scratch(es) - Paint



Damage 15: Door - front left side: Door - Scratch(es) - Paint



Damage 15: Door - front left side: Door - Scratch(es) - Paint




Damage 15: Door - front left side: Door - Scratch(es) - Paint



Damage 16: Bonnet: Bonnet (Rostbildung) - Stone chips - Repair and paint




Damage 16: Bonnet: Bonnet (Rostbildung) - Stone chips - Repair and paint

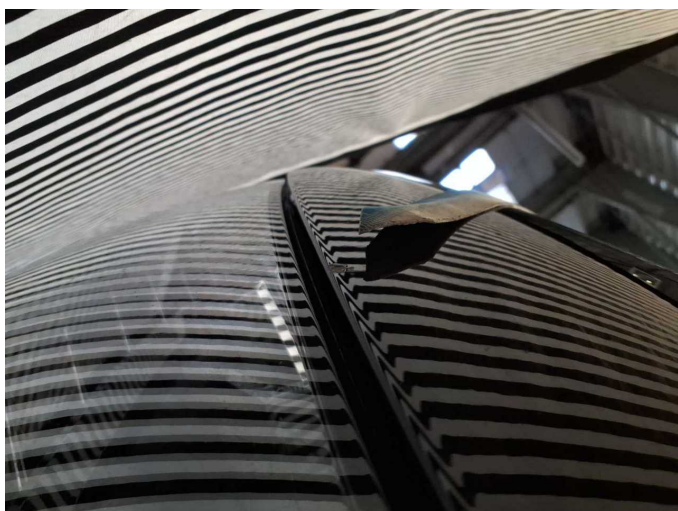

Damage 16: Bonnet: Bonnet (Rostbildung) - Stone chips - Repair and paint



Damage 16: Bonnet: Bonnet (Rostbildung) - Stone chips - Repair and paint

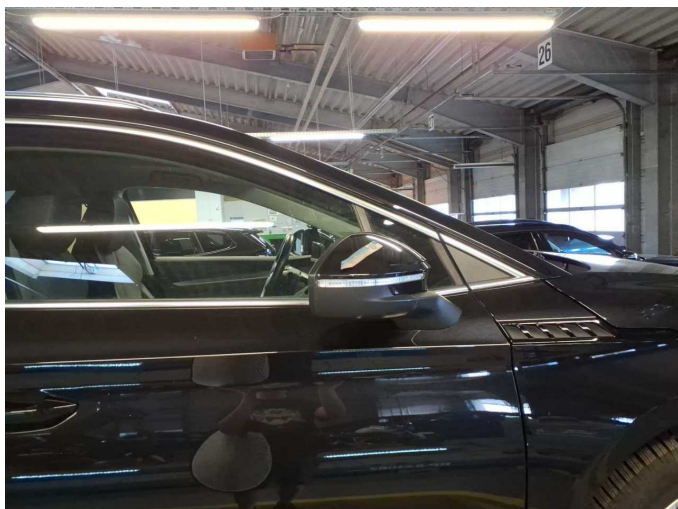


Damage 17: Wing mirror - right side: Wing mirror - Damaged - repair according to calculation




Damage 17: Wing mirror - right side: Wing mirror - Damaged - repair according to calculation



Damage 17: Wing mirror - right side: Wing mirror - Damaged - repair according to calculation

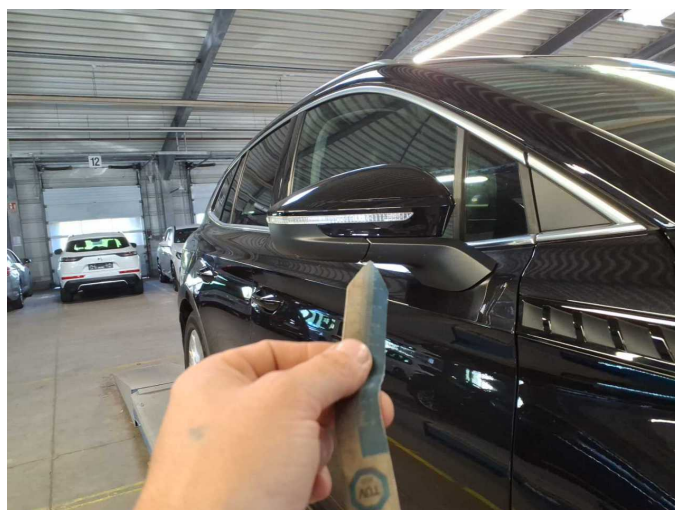

Damage 17: Wing mirror - right side: Wing mirror - Damaged - repair according to calculation

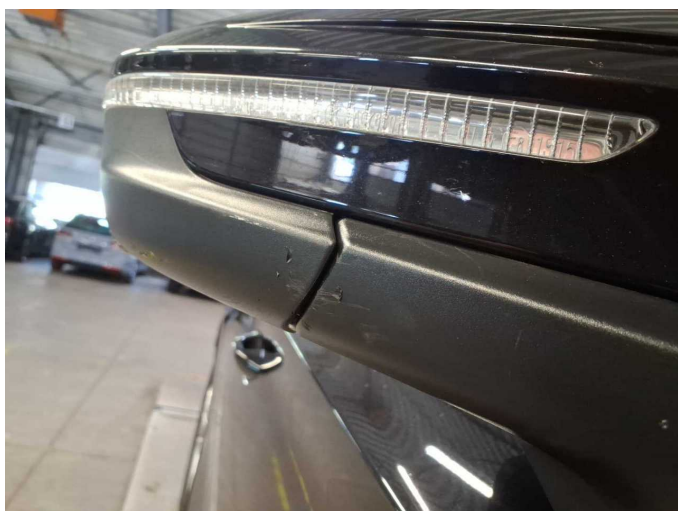

Damage 17: Wing mirror - right side: Wing mirror - Damaged - repair according to calculation




Damage 17: Wing mirror - right side: Wing mirror - Damaged - repair according to calculation



Accident 1: Front, Side - left




Accident 1: Front, Side - left

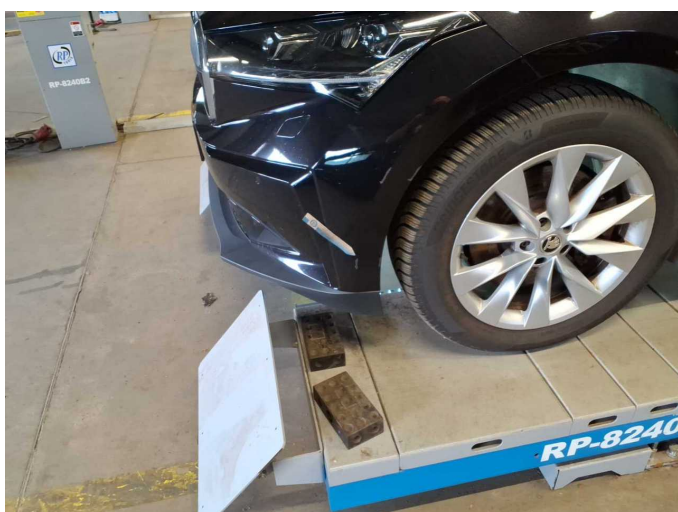


Accident 1: Front, Side - left



Accident 1: Front, Side - left

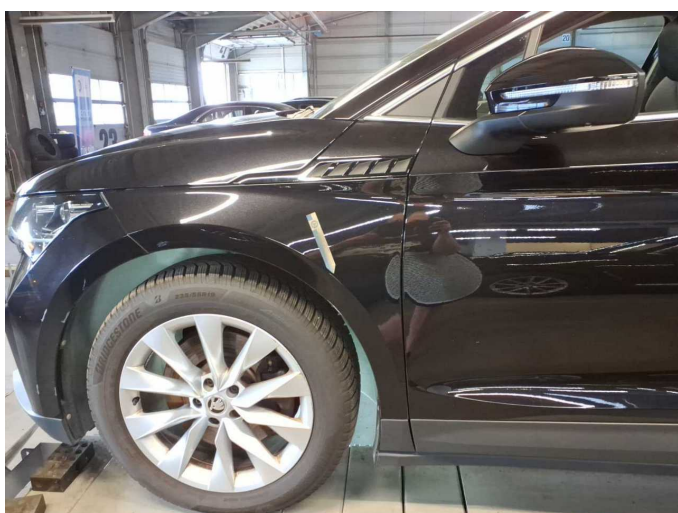

Accident 1: Front, Side - left

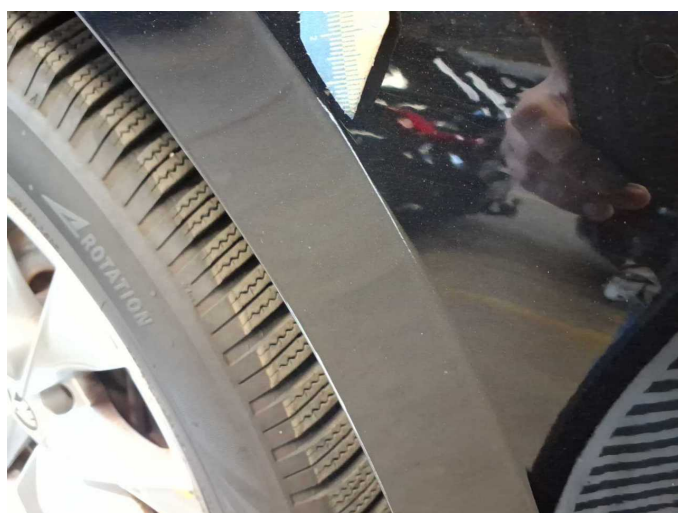

Accident 1: Front, Side - left




Accident 1: Front, Side - left




Accident 2: Rear, Side right



Accident 2: Rear, Side right

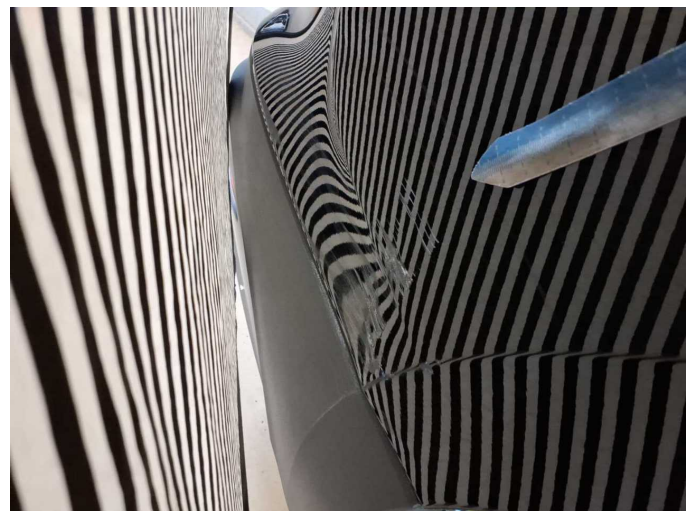


Accident 2: Rear, Side right

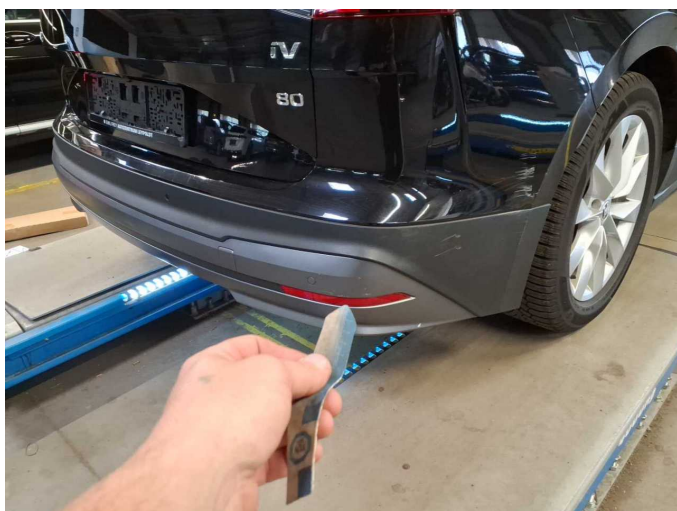


Accident 2: Rear, Side right



Accident 2: Rear, Side right

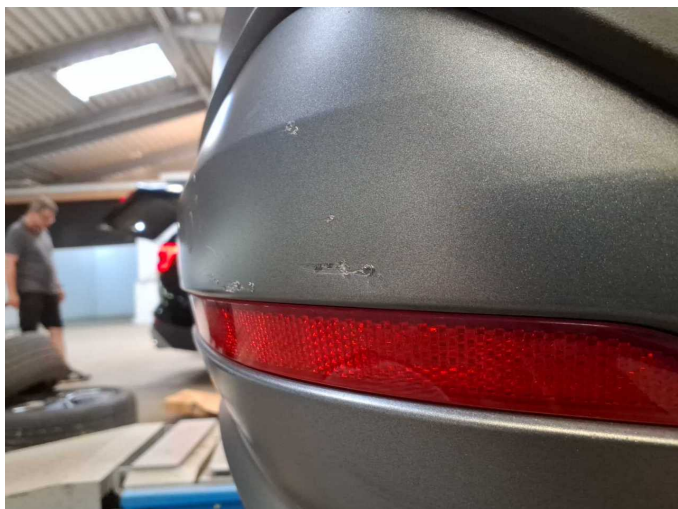

Accident 2: Rear, Side right

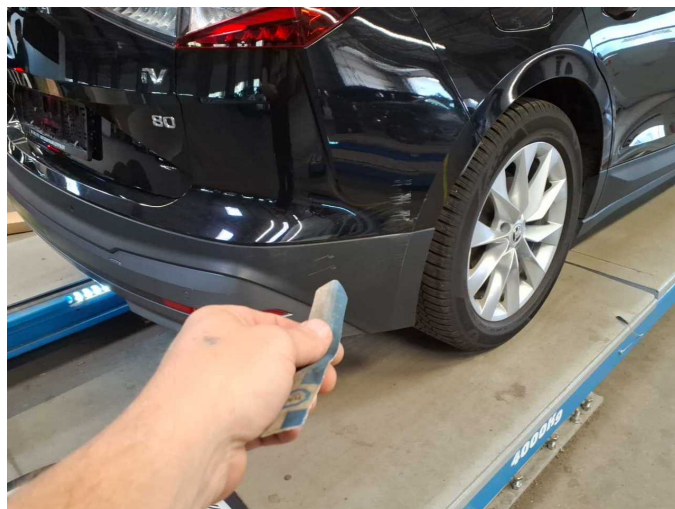

Accident 2: Rear, Side right




Accident 2: Rear, Side right




Accident 2: Rear, Side right



Accident 2: Rear, Side right

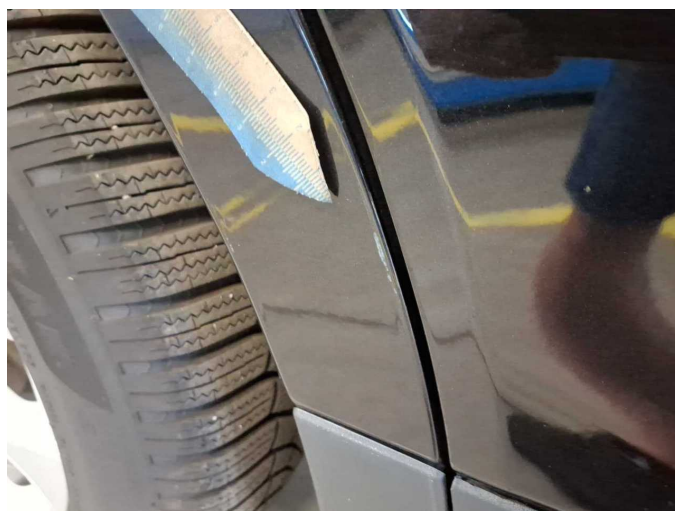

Accident 2: Rear, Side right

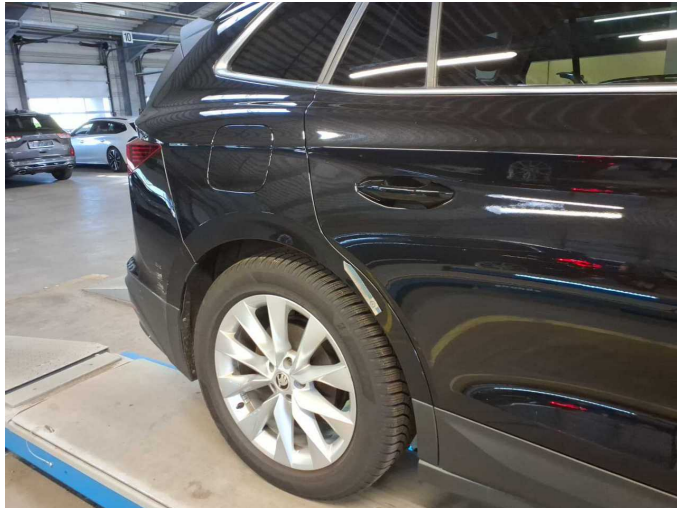

Accident 2: Rear, Side right



Accident 2: Rear, Side right



Repainting 1: Boot lid / rear door



Repainting 2: Mudguard - left side



Repainting 3: Mudguard - right side



Repainting 4: Bonnet



Repainting 5: Side panel - rear left side



Repainting 6: Side panel - rear right side



Repainting 7: Door - rear left side



Repainting 8: Door - front left side