



Expertise

Protocol number: 46147712
Order No. / Reference: 26591553
Inspection date: 24 Jun 2026

Manufacturer: Volkswagen

Model: Tiguan 2.0 TDI SCR DSG Life

VIN: WVGZZZ5NZMW546820



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZ5NZMW546820
Mileage (Read)	101,575 km
First registration	17 Jun 2021
Number of holders	1
Next periodical technical inspection	06/2026
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	MONDSTEINGRAU (A7C)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	13,500 km
Last service on / at	08/2025 at 83,148 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC209057
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0603 / BZG 15540		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,090 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Hankook	5mm / 5mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Bridgestone	3mm / 4mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side
- Adaptive Cruise Control (ACC) (DSG)
- third brake light
- Diesel particulate filter
- Parking assistance
- Electronic Stability Program with counter-steering support
- Electric windows front and rear
- High beam control Light Assist
- Pedestrian detection
- Transmission: 7-speed DSG
- rear window wiper
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Rear headrests (3)
- Front headrests
- LED reading lights, 2 in the front and 2 in the rear
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Fatigue detection
- Emergency call service
- Radio "Composition"
- Rain sensor
- Wheels: Light alloy (4) "Tulsa" 7 J x 17
- Wheels: Tire Mobility Set
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Rear bench seat asymmetrically split
- Lane keeping assistant "Lane Assist"
- 12-volt socket
- Textile floor mats front and rear
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Electrically adjustable and heated exterior mirrors
- black roof rails
- Tachometer
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights
- Windscreen made of laminated safety glass, heat and sound insulating
- Rear window heated
- Interior mirror automatically dimming
- LED license plate lighting
- Combination instrument cluster with electronic speedometer
- Paint finish: Solid
- LED headlights with LED daytime running lights
- Light in the front footwell
- Manual headlight range adjustment
- Multifunction display "Premium"
- Non-smoking version
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire pressure monitoring system
- Wheels: Tires 215/65 R 17, rolling resistance class A
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- First aid kit, warning triangle and high-visibility vest
- Green thermal insulation glazing, sides and rear



Extra equipment

- Electrically adjustable, folding, and heated exterior mirrors, ambient lighting, passenger-side mirror lowering function
 - Mesh partition
 - Package: Business Premium (DSG) (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated front windscreen washer nozzles - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
 - Paint finish: Solid color special paint finish
 - Rear View reversing camera
 - Tailgate with electric opening and closing, adjustable opening angle
 - Windows: Rear side windows and rear window tinted
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - Map with 2D display - 3-band sound control - Telephone interface - Traffic sign recognition - Points of interest - DAB+ digital radio reception)
 - Seats: ergoActive front seats (ergoActive front seats height-adjustable, seat and backrest tilt adjustable, thigh support longitudinally adjustable - lumbar support in front electrically adjustable and with massage function - seat center panels of the front seats and the outer rear seats in microfleece "ArtVelours" - top comfort seats in front)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Side panel - rear right side	Sill - dent(s) - Smart repair
3	Wing mirror - right side	Cap - Scratched - Paint
4	Wing mirror - left side	Cap - Scratched - Paint
5	Door - rear left side	Door - dent(s) - Smooth repair work
6	Side panel - rear left side	Sill - dent(s) - Smooth repair work
7	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
8	Wheel / tyres	Tyre - front right side - Damaged - Replace
9	Front bumper	Spoiler - Scratched - Replace
10	Door - rear right side	Door - Scratched - Repair and paint
11	Door - front right side	Door - Deformed - Repair and paint



Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Rear bumper	Rear bumper (Ladekante) - Scratch(es) - No deduction
4	2nd wheel set	1 alloy rim (Kein Teil der Ausstattung) - Scratched - No deduction
5	2nd wheel set	2 tyres (Profiltiefe 1x 3mm 1x 4mm) - Does not meet the leasing specifications - No deduction
6	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 8 Aug 2023	1.052,43 €
2	Side right, Provided by user / customer, from 24 Apr 2025	2.180,63 €

Repainting

No.	Repainting
1	Side panel - rear right side
2	Door - rear left side

Paint coat thickness measurement

Side panel - rear right side	164 µm	Door - rear left side	249 µm
------------------------------	--------	-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

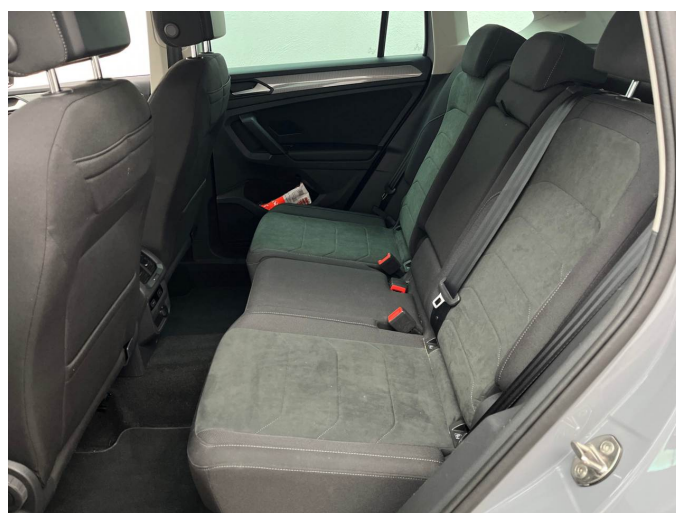


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

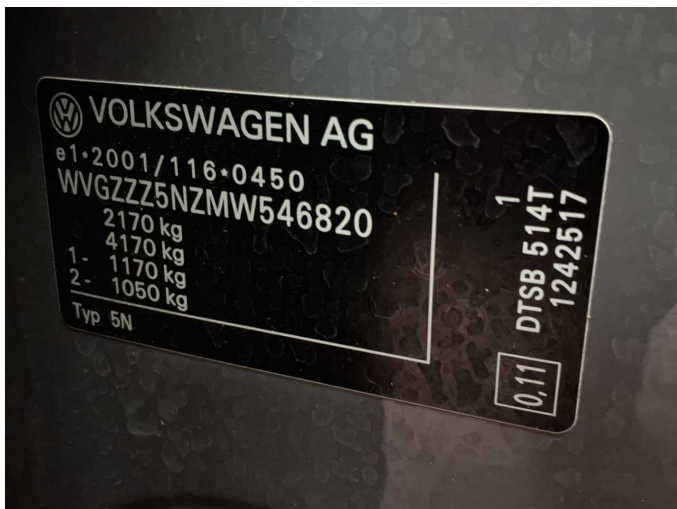


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

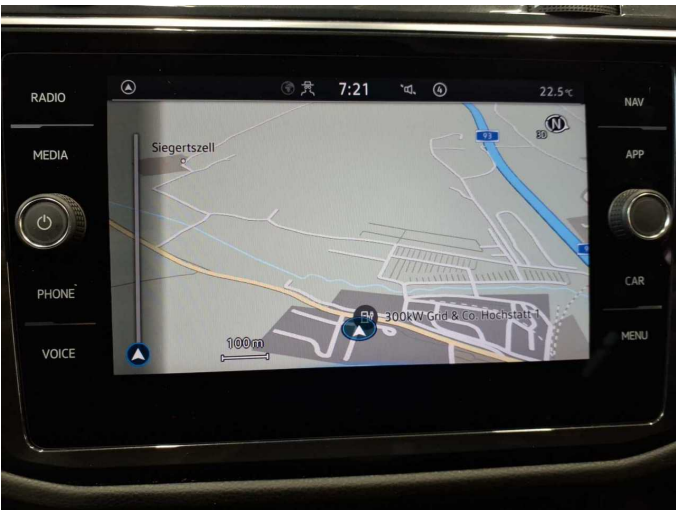


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

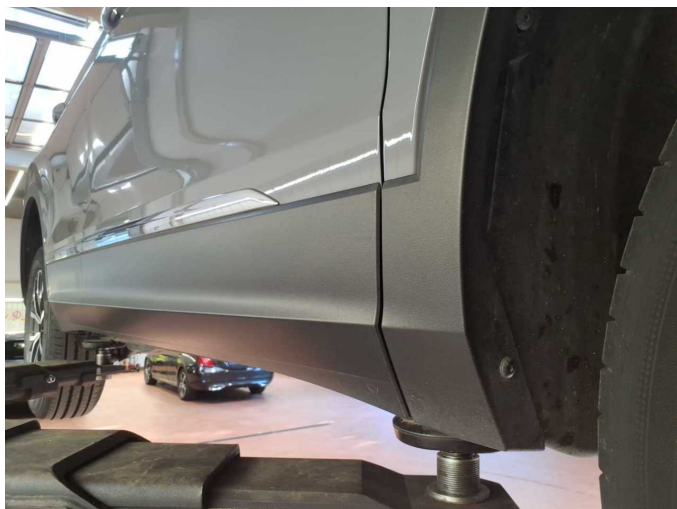


Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

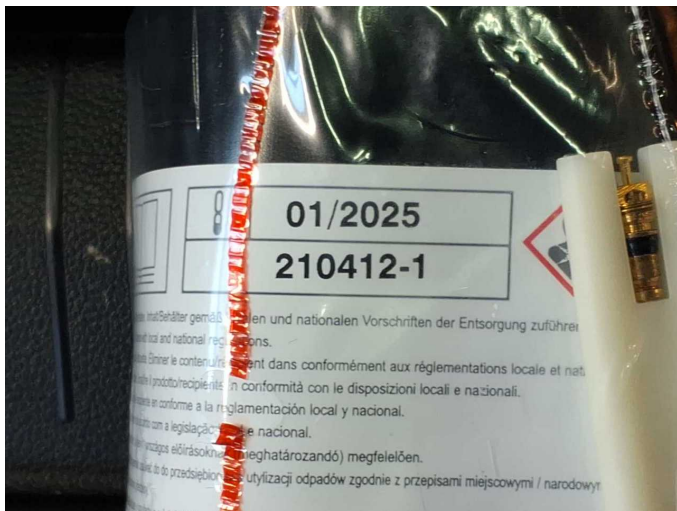

Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 2: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 3: Wing mirror - right side: Cap - Scratched - Paint



Damage 3: Wing mirror - right side: Cap - Scratched - Paint




Damage 4: Wing mirror - left side: Cap - Scratched - Paint




Damage 4: Wing mirror - left side: Cap - Scratched - Paint



Damage 5: Door - rear left side: Door - dent(s) - Smooth repair work

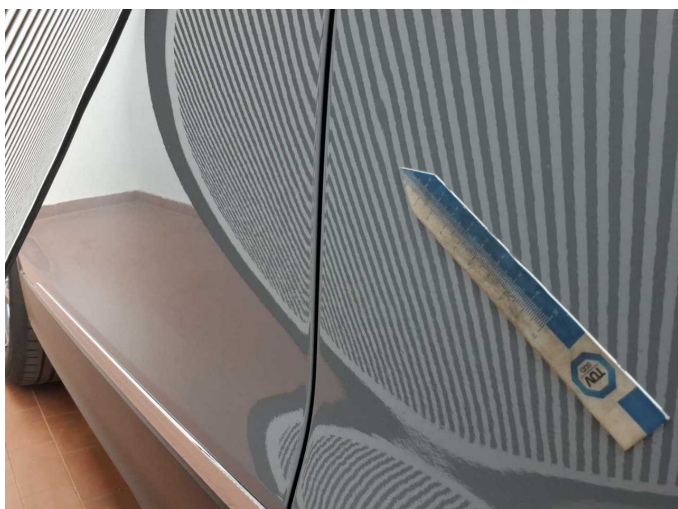

Damage 5: Door - rear left side: Door - dent(s) - Smooth repair work

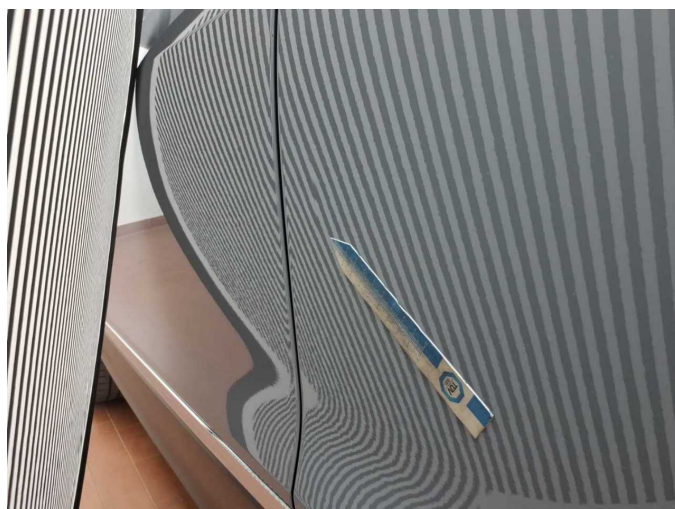

Damage 5: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 6: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 6: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 6: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 8: Wheel / tyres: Tyre - front right side - Damaged - Replace



Damage 8: Wheel / tyres: Tyre - front right side - Damaged - Replace



Damage 9: Front bumper: Spoiler - Scratched - Replace



Damage 9: Front bumper: Spoiler - Scratched - Replace



Damage 9: Front bumper: Spoiler - Scratched - Replace



Damage 9: Front bumper: Spoiler - Scratched - Replace



Damage 10: Door - rear right side: Door - Scratched - Repair and paint



Damage 10: Door - rear right side: Door - Scratched - Repair and paint



Damage 10: Door - rear right side: Door - Scratched - Repair and paint




Damage 10: Door - rear right side: Door - Scratched - Repair and paint




Damage 10: Door - rear right side: Door - Scratched - Repair and paint



Damage 11: Door - front right side: Door - Deformed - Repair and paint

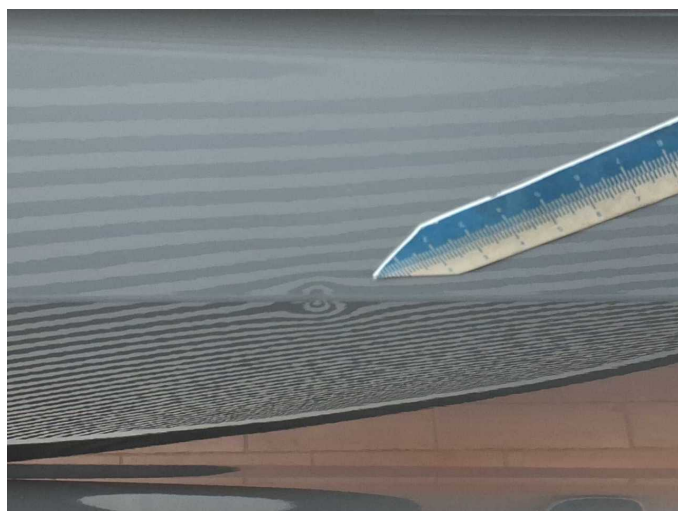

Damage 11: Door - front right side: Door - Deformed - Repair and paint

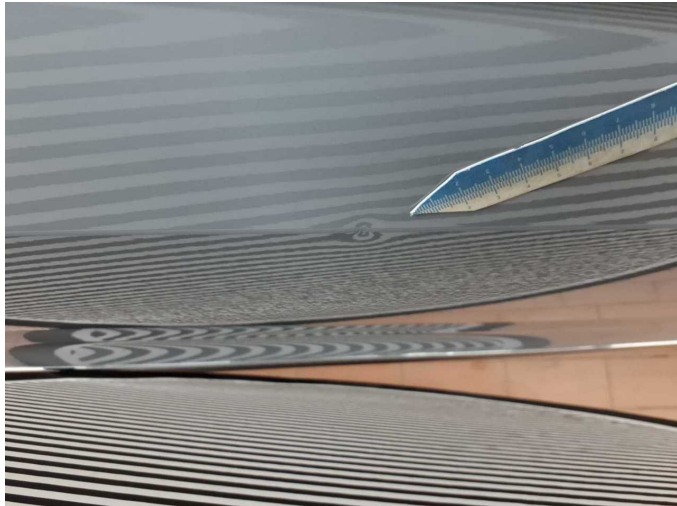

Damage 11: Door - front right side: Door - Deformed - Repair and paint



Repainting 1: Side panel - rear right side



Repainting 2: Door - rear left side



Side panel - rear right side: 164 µm



Door - rear left side: 249 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZMW546820

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan 2.0 TDI SCR DSG Life

Datum	KM-Stand	Beschreibung
12.08.2025	83.148	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
03.03.2025	74.127	Systemtest/Eigendiagnose
17.06.2024	59.150	AU
23.05.2024	57.750	Bremsflüssigkeit ern; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Motoröl b. Wartung; Regelwartungsdienst
02.12.2022	27.240	Motoröl b. Wartung; Regelwartungsdienst