



Expertise

Protocol number: 43183177
Order number / reference: 25661187
Inspection date: 2 Jan 2026

Manufacturer: Opel

Model: Combo Cargo XL 1.5 D EHZ Edition

VIN: W0VEFYHYCMJ524732



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Combo Cargo XL 1.5 D EHZ Edition

Vehicle Identification number W0VEFYHYCMJ524732
Mileage (Read) 45,742 km
First registration 25 Mar 2021
Number of holders 1
Next periodical technical inspection 03/2025
(Report not on hand)

Power / Engine displacement 75 kw / 1,499 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Manual / 5
Type of drive Front drive
Type of vehicle Van

Colour / colour code Jade Weiß
Doors / Seats 4 / 3
Upholstery type Cloth
Colour of upholstery Black-Grey

Re/Import no
Vehicle with smoke odor no
readiness to drive Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / incomplete	Next maintenance in	-25,740 km
Last maintenance on / at	03/2023 at 20,746 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FW980047
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	1844 / AIQ 00503		
Emission standard	EURO6;WLTP;AN;PI/CI; N1 II	Fine dust sticker	
Permitted total weight	2,355 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 98V	All-season tyres on Steel rim with wheel cover	Sonstige	5mm / 5mm
2)	215/65 R16 98H	All-season tyres on Steel rim with wheel cover	Falken	4 mm
	215/65 R16 98V	All-season tyres on Steel rim with wheel cover	Sonstige	5 mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 11/2025		

Legend: Tread depth for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Cover strip sliding door rail
- ABS including brake assist and adaptive brake light
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirror housings in body color
- Battery discharge protection
- Floor covering: cargo area floor, painted
- Diesel particulate filter, maintenance-free
- Three-point seat belts on all seats
- Electronic Stability Program (ESP Plus)
- Speed limiter
- Transmission: 5-speed transmission
- Air conditioning, front, with particle and odor filter
- Headrests (2), front, height adjustable
- Steering wheel: Comfort steering wheel (PU), flattened at the bottom
- Upholstery: Cloth
- Wheels: Tire repair kit
- Wheels: Steel wheels 6.5 J x 16
- Side impact protection
- Side protection strips
- Power steering, speed-dependent
- Seats: Driver's seat 6-way adjustable, length, height and backrest angle
- Traction control with engine and brake intervention (TC Plus)
- Immobiliser
- Central locking with radio remote control
- Storage compartments (edition)
- Driver's side airbag
- Automatic low beam
- Exterior mirrors, electrically adjustable, heated and manually folding
- Hill Start Assist
- On-board computer
- tachometer
- Third brake light
- Electric front windows
- Cruise control
- Heating and ventilation system with particle and odor filter, front
- Paint finish: Solid paint
- Steering column, adjustable for reach and height
- Parking pilot, rear
- Radio BT with Graphic Info Display (Audio: - Bluetooth audio streaming Telephone: - Hands-free system via Bluetooth interface - Display of phone book and call lists - Up to 5 mobile phones can be paired General: - Use of the voice control of the paired smartphone possible (e.g. Siri, Google Voice Control) - USB interface - 4 speakers)
- 12-volt power outlet in the center console
- Daytime running light
- Doors: Sliding door, passenger side, sheet metal
- Lashing eyes (6) in the cargo area
- Heat-insulating glazing, tinted
- Central locking: ignition keys (2), one of which is foldable

Extra equipment

- All-season tyres
- Package: Grip & Go (IntelliGrip (Adaptive traction system with 5 selectable modes): - ESP off - ESP standard - Snow mode - Mud mode - Sand mode - Hill descent control - Metal underbody protection - 215/65 R 16 SL 98H off-road tires - Raised suspension)
- Seats: Double passenger seat (seatbelt warning, single passenger seat - electric parking brake - storage compartment on the backrest of the middle seat of the double passenger seat)
- Rear wing doors, asymmetrically split, glazed, 180° opening angle (rear window wiper - rear window heater)
- Package: Professional (folding passenger bench seat with storage table, movable on the backrest of the middle seat of the passenger bench seat - seat belt warning, single passenger seat - electric parking brake - FlexCargo partition, without window, with through-loading function below the passenger bench seat - wooden floor in the cargo area)
- FlexCargo partition wall with window (with pass-through function below the passenger double seat including protective bag for the load - interior rearview mirror, manually dimmable)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front right side	Door - dent(s) - Smart repair
3	Misc.	Main inspection - Due - Perform
4	Misc.	Main inspection - Due - Perform
5	Sill - left side	Sill - Scratched - Paint
6	Wheel / tyres	Tyre - rear left side (poros, rissig) - Does not meet the leasing specifications - Replace
7	Side panel - rear right side	Side panel - dent(s) - Smart repair
8	Side panel - rear left side	Side panel - Dent / paintcoat damage - Smart repair
9	Front bumper	Front bumper (Unterteil) - Deformed - Replace
10	Misc.	Inspection / maintenance - Due - Perform
11	Rear bumper	Support - Deformed - Replace
12	Rear of vehicle	Rear panel - Deformed - Repair and paint
13	Sill - left side	Sill - Unprofessionally repaired - Repair and paint
14	Boot lid / rear door	Rear door glazed - left side - dent(s) - Repair and paint
15	Trim / covers	Floor covering - front left side - Broken / torn - Replace
16	Seat - front	Seat cover - left side (inkl. Polster) - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Door - front left side	Door - dent(s) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Repainting

No.	Repainting
1	Roof, Roof rail - left side, Professionally carried out
2	Sill - left side, Unprofessionally carried out

Paint coat thickness measurement

Roof	172 µm	Roof rail - left side	173 µm
Sill - left side	708 µm		



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects that can no longer be attributed to normal use or wear and tear according to the underlying standard are listed in the product under value-reducing factors.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

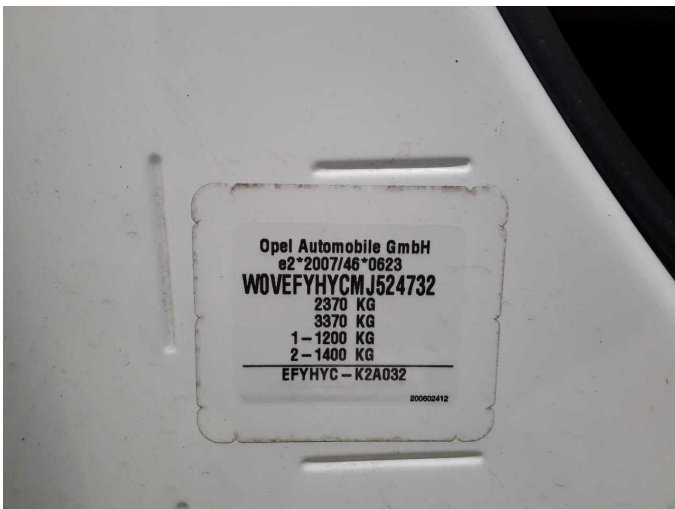


Figure 11: VIN



Figure 12: Mounted tyres

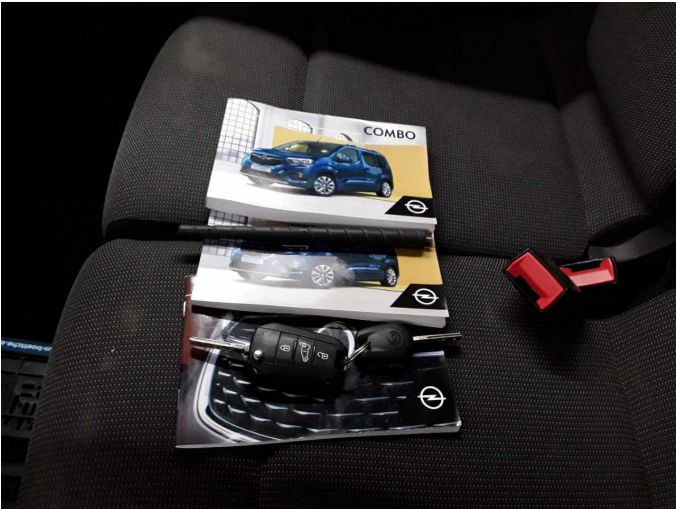


Figure 13: Documents

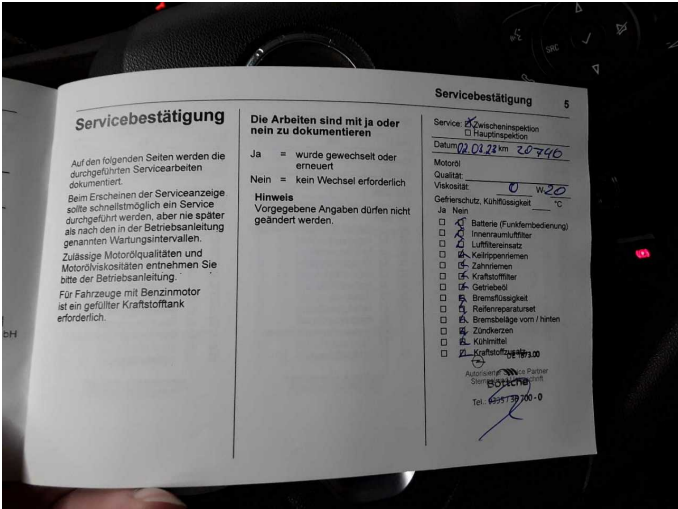


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

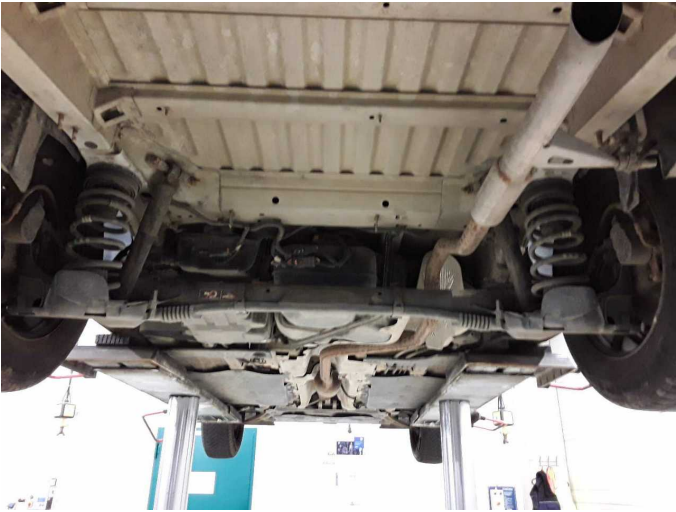


Figure 23: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - front right side: Door - dent(s) - Smart repair



Damage 2: Door - front right side: Door - dent(s) - Smart repair



Damage 5: Sill - left side: Sill - Scratched - Paint



Damage 5: Sill - left side: Sill - Scratched - Paint



Damage 6: Wheel / tyres: Tyre - rear left side (poros, rissig) - Does not meet the leasing specifications - Replace



Damage 6: Wheel / tyres: Tyre - rear left side (poros, rissig) - Does not meet the leasing specifications - Replace




Damage 7: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 7: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 7: Side panel - rear right side: Side panel - dent(s) - Smart repair

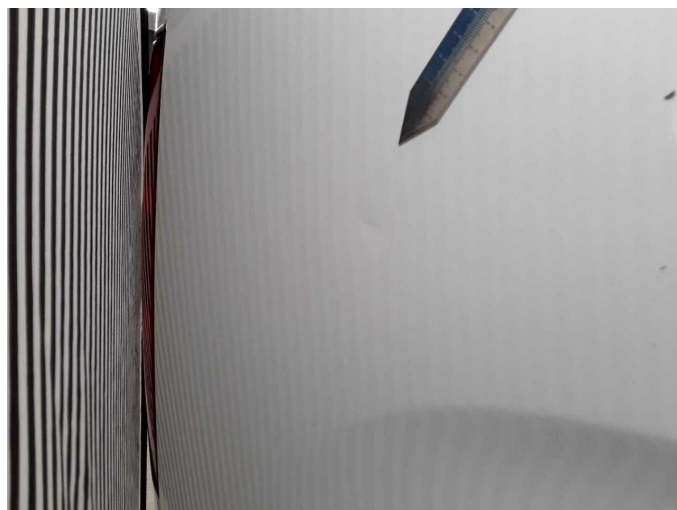


Damage 7: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 7: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair

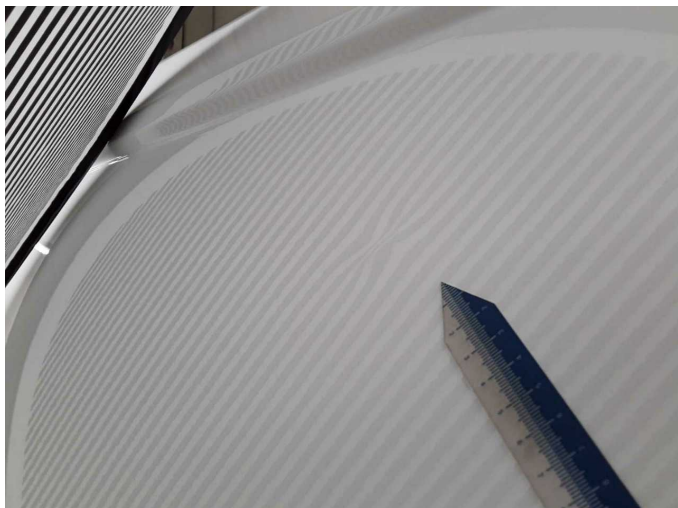


Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair



Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair



Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair

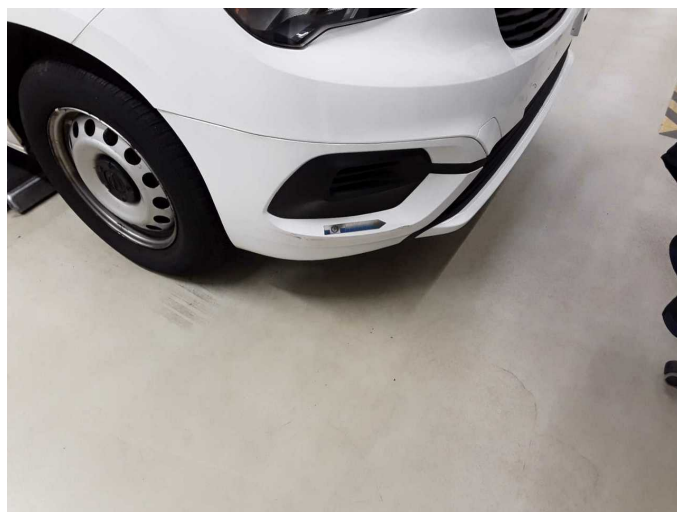


Damage 9: Front bumper: Front bumper (Unterteil) - Deformed - Replace



Damage 9: Front bumper: Front bumper (Unterteil) - Deformed - Replace



Damage 9: Front bumper: Front bumper (Unterteil) - Deformed - Replace

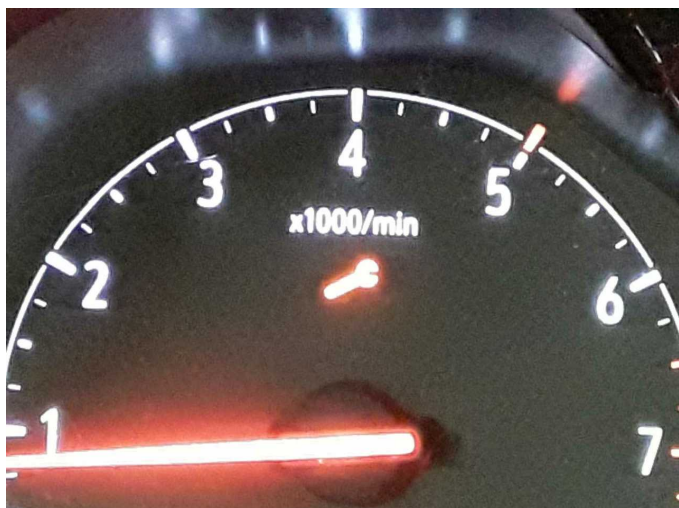

Damage 10: Misc.: Inspection / maintenance - Due - Perform




Damage 10: Misc.: Inspection / maintenance - Due - Perform




Damage 11: Rear bumper: Support - Deformed - Replace



Damage 11: Rear bumper: Support - Deformed - Replace

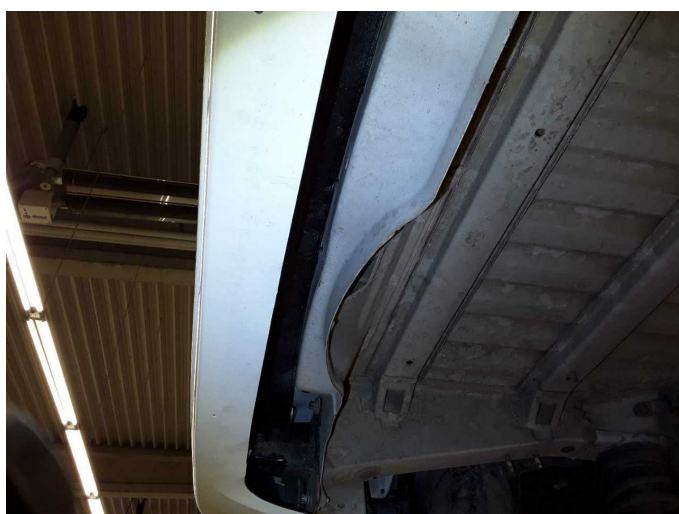


Damage 12: Rear of vehicle: Rear panel - Deformed - Repair and paint

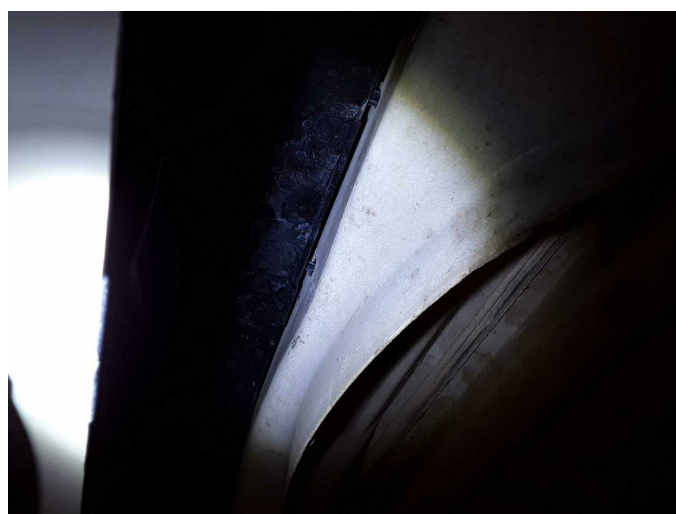

Damage 12: Rear of vehicle: Rear panel - Deformed - Repair and paint




Damage 12: Rear of vehicle: Rear panel - Deformed - Repair and paint

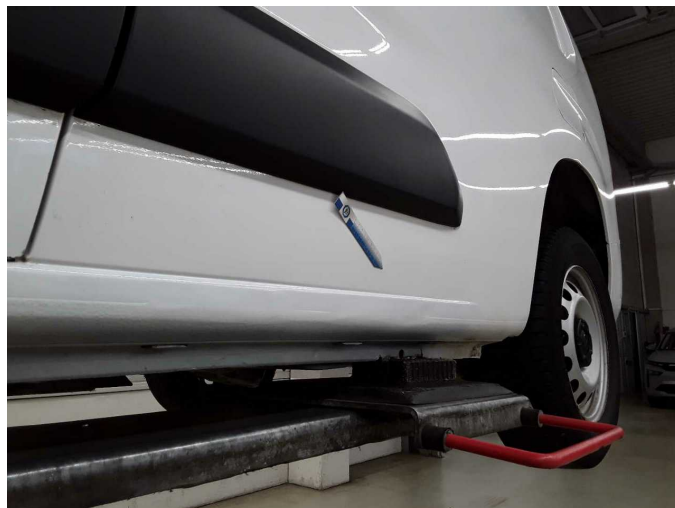

Damage 13: Sill - left side: Sill - Unprofessionally repaired - Repair and paint




Damage 13: Sill - left side: Sill - Unprofessionally repaired - Repair and paint

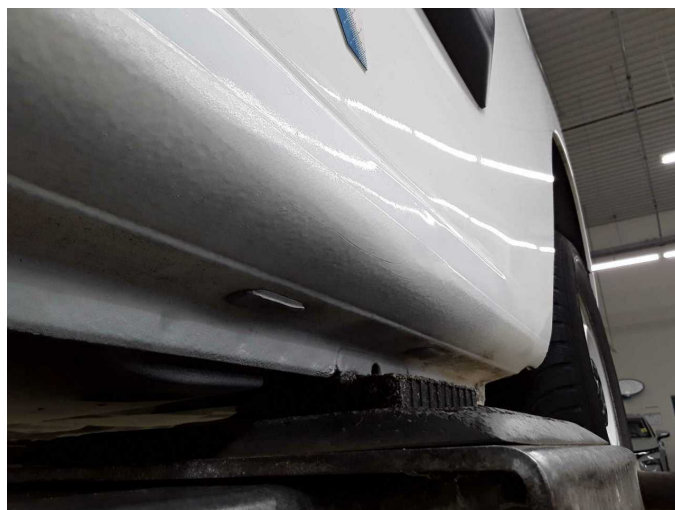


Damage 13: Sill - left side: Sill - Unprofessionally repaired - Repair and paint



Damage 13: Sill - left side: Sill - Unprofessionally repaired - Repair and paint

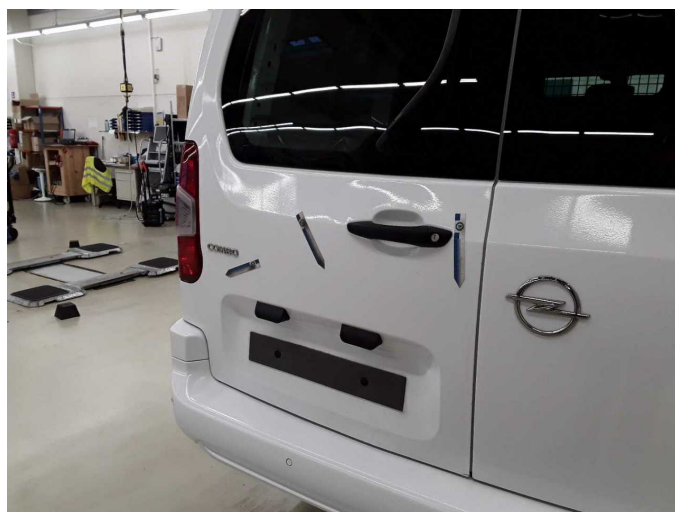


Damage 14: Boot lid / rear door: Rear door glazed - left side - dent(s) - Repair and paint

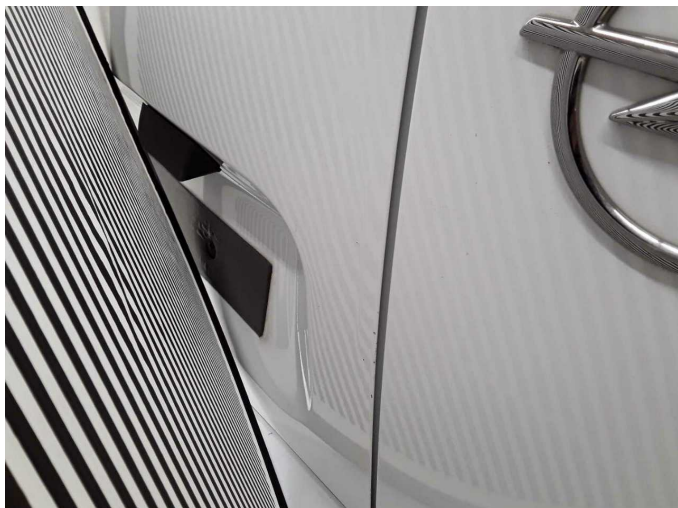

Damage 14: Boot lid / rear door: Rear door glazed - left side - dent(s) - Repair and paint




Damage 14: Boot lid / rear door: Rear door glazed - left side - dent(s) - Repair and paint

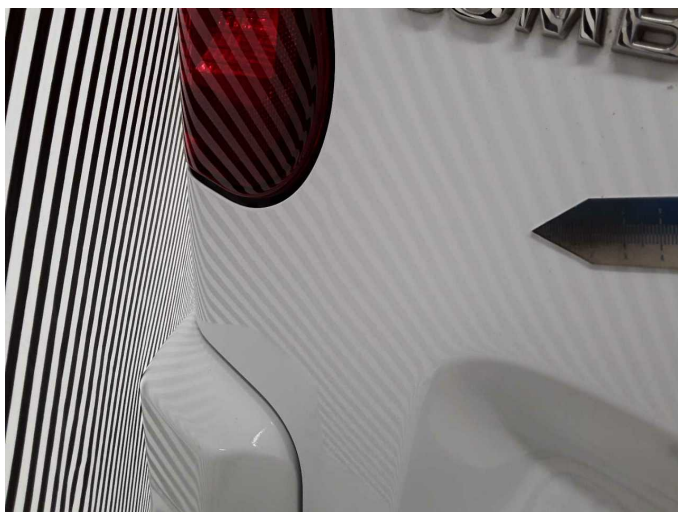

Damage 14: Boot lid / rear door: Rear door glazed - left side - dent(s) - Repair and paint



Damage 15: Trim / covers: Floor covering - front left side - Broken / torn - Replace

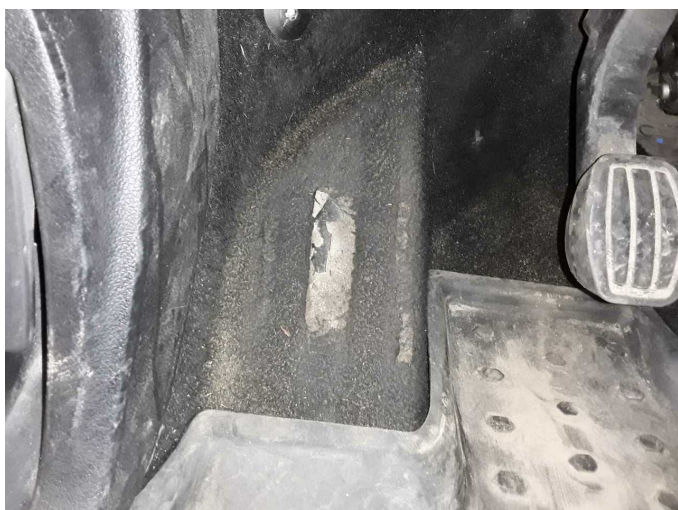

Damage 15: Trim / covers: Floor covering - front left side - Broken / torn - Replace



Damage 16: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 16: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 16: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Roof: 172 µm



Roof rail - left side: 173 µm



Sill - left side: 708 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHYCMJ524732

Hersteller / Modell: OPEL OPEL Combo Cargo XL 1.5 D EHZ Edition

Datum	KM-Stand	Beschreibung
06.11.2024	36.621	Batterie ern; Systemtest/Eigendiagnose
15.02.2024	36.621	Bremsklötze vorne
28.04.2023	23.474	Reparatur Sonstiges
21.03.2023	21.618	AU
02.03.2023	20.746	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges