



Expertise

Protocol number: 46602773
Order No. / Reference: 26719983
Inspection date: 14 Jul 2026

Manufacturer: Skoda
VIN: TMBLN7NSXP8052121

Model: Kodiaq 2.0 TDI 4x4 DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI 4x4 DSG Style	
Vehicle Identification number	TMBLN7NSXP8052121
Mileage (Read)	166,188 km
First registration	24 May 2023
Number of holders	1
Next periodical technical inspection	05/2026
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Velvet-Rot Premium Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	12,200 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT100442
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / AVW 00617		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,410 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Continental	3mm / 3mm
2)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist (HBA)
- Grey headliner
- Roof rails, anodized (including chrome trim strips on the side windows)
- Digital Cockpit (8")
- Third brake light (in the rear spoiler (LED))
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Front radar assistant including city emergency braking function with pedestrian detection
- Cruise control
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Boot cover, roll-up and removable
- Front and rear headrests are height-adjustable.
- LED matrix headlights and dynamic high beam assist (Light Assist)
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters (height and reach adjustable)
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Wheel arch cover (front and rear, made of plastic, black textured)
- Radio accessories: 8 speakers
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Headlights washer / wiper system
- Kodiah safety belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Belt fastening indicator in the front and in the second row of seats)
- Seats: Height-adjustable front seats
- Storage compartment on the left wheel arch
- front aero windshield wipers
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, front side airbags
- Permanent all-wheel drive
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- Decorative inlay Linear Diamonds
- Diesel particulate filter
- Tachometer
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- High Beam Assist (Light Assist)
- Front footwell lighting
- Closed storage compartment on the driver's side
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Kessy - keyless entry and start-stop system
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger including humidity sensor and odor and allergen filter)
- LED taillights in crystal glass look with animated turn signals
- Reading lights at the front of the headliner
- Rear center armrest with cup holders
- Front center armrest, including storage compartment
- Multi-collision brake
- Upholstery: Fabric-leather
- Radio: Bolero infotainment system (Bolero music system - 8" capacitive color display - voice control)
- Radio accessories: Digital radio reception DAB+
- Tire mobility kit (tire repair spray incl. compressor)
- Wheels: 18" Elbrus alloy wheels (7Jx18 tires 235/55 R18 100V ET43)
- Heated windshield washer nozzles, front
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats with memory function
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- Sun visor on driver and passenger side with illuminated vanity mirror
- Speed limiter



- Skoda Care Connect (SOS emergency call function (eCall, including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection for rapid assistance in case of breakdown) - Information service (connection to the hotline for all questions regarding vehicle functions) - Free remote vehicle access for one year with access to vehicle data/functions via smartphone, e.g., parking position, activating hazard warning lights, current fuel level, etc.)
- Lashing eyes in the trunk
- Central locking with remote control (two vehicle keys)

- Telephone: Comfort hands-free telephone system including phone box (with inductive charging function (connection via external antenna))
- Front door sill trims
- Variable fastening concept in the trunk
- Immobiliser

Extra equipment

- Package: Business Columbus (Style) (Dynamic radio navigation system Columbus - 9.2" capacitive color display - Digital Cockpit Plus (10") - Driver fatigue detection - 230V socket and one USB charging port (Type-C) - Electric tailgate operation including comfort opening - Sunset - Luggage net partition - Infotainment Online (3-year subscription))
- Swiveling trailer hitch (with electric release, including trailer stabilization)

- Paint finish: Premium metallic paint
- Rear view camera
- Traveller assistance system (DSG) (Predictive Adaptive Cruise Control pACC (control range up to 210 km/h) - Lane Assist - Adaptive Lane Guidance - Traffic Jam and Emergency Assist - Traffic Sign Recognition)
- Variable loading floor in the trunk
- Windscreen, wirelessly heated

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Vehicle glazing	Rear window - Glued / labelled - De-glue / neutralise
3	Roof	Roof - dent(s) - Smooth repair work
4	Door - rear left side	Door - dent(s) - Smooth repair work
5	Misc.	Main inspection - No evidence - Perform
6	Door - rear left side	Brightware - lower - Scratch(es) - Replace
7	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
8	Side panel - rear right side	Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint
9	Door - rear right side	Door (Einschlüsse) - Unprofessionally repaired - Repair and paint
10	Door - front right side	Door (Orangenhaut, Einschlüsse) - Unprofessionally repaired - Repair and paint
11	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
12	Bonnet	Bonnet (Anätzung) - Paint defect - Repair and paint



Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction
2	Front bumper	Front bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Owner's manual

Repainting

No. Repainting

- 1 Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
- 2 Bonnet, Professionally carried out, Invoice of repair done Non-existent
- 3 Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
- 4 Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
- 5 Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
- 6 Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent
- 7 Door - front right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	199 µm	Bonnet	357 µm
Side panel - rear left side	209 µm	Side panel - rear right side	302 µm
Door - rear left side	168 µm	Door - rear right side	204 µm
Door - front right side	242 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

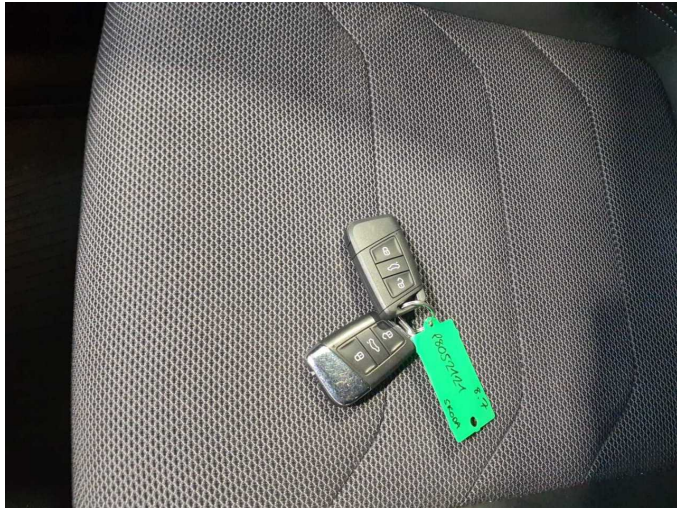


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

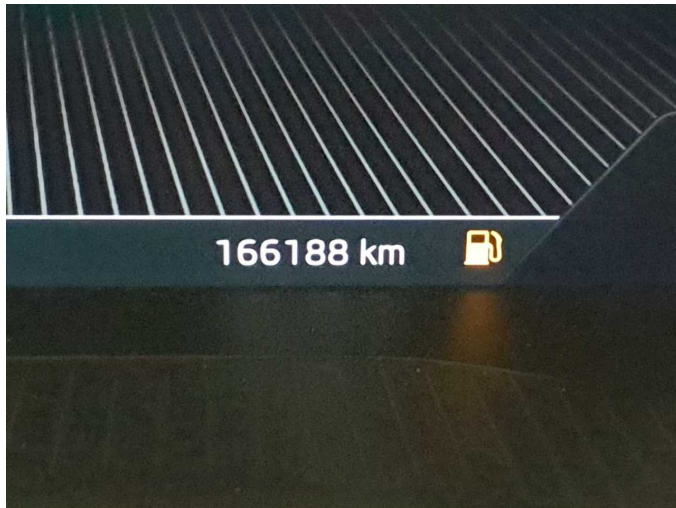


Figure 19: Misc.

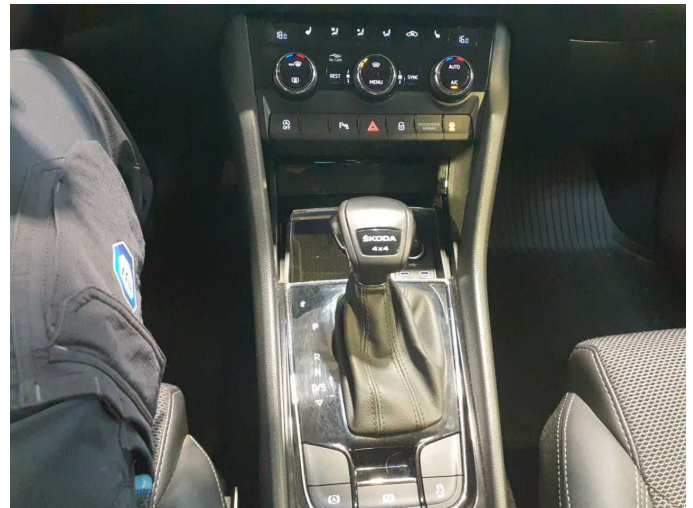


Figure 20: Misc.

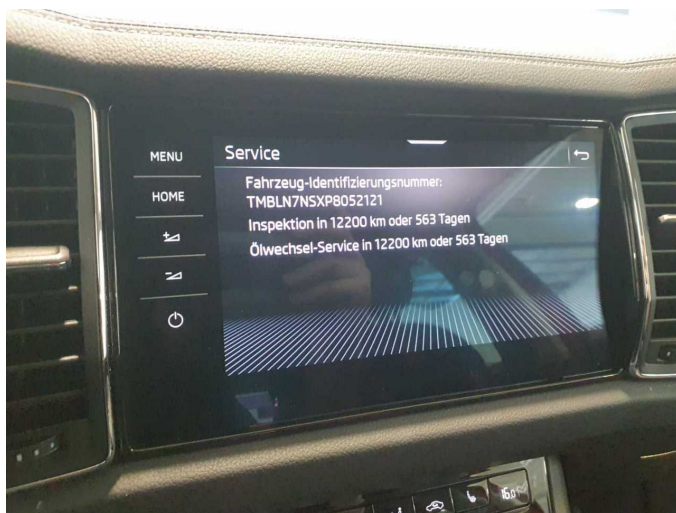


Figure 21: Misc.

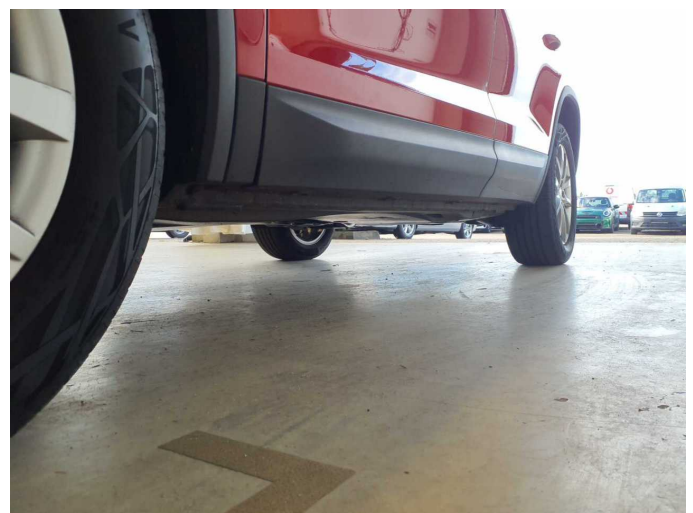


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Damage 2: Vehicle glazing: Rear window - Glued / labelled - De-glue / neutralise

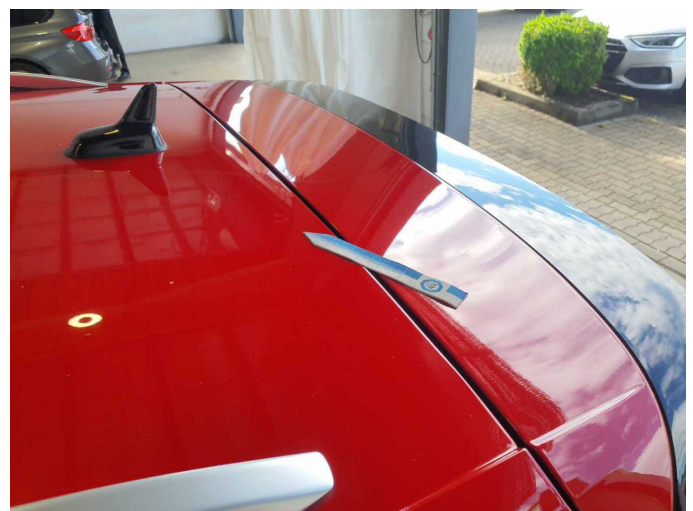

Damage 3: Roof: Roof - dent(s) - Smooth repair work




Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 4: Door - rear left side: Door - dent(s) - Smooth repair work

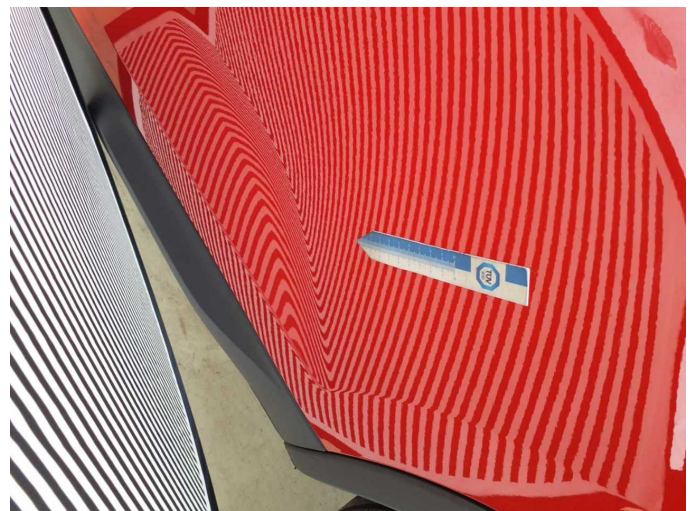


Damage 4: Door - rear left side: Door - dent(s) - Smooth repair work




Damage 6: Door - rear left side: Brightware - lower - Scratch(es) - Replace



Damage 6: Door - rear left side: Brightware - lower - Scratch(es) - Replace

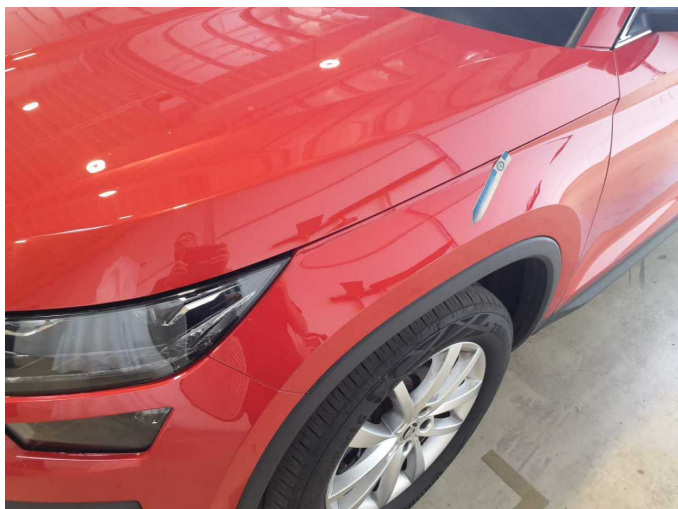


Damage 7: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

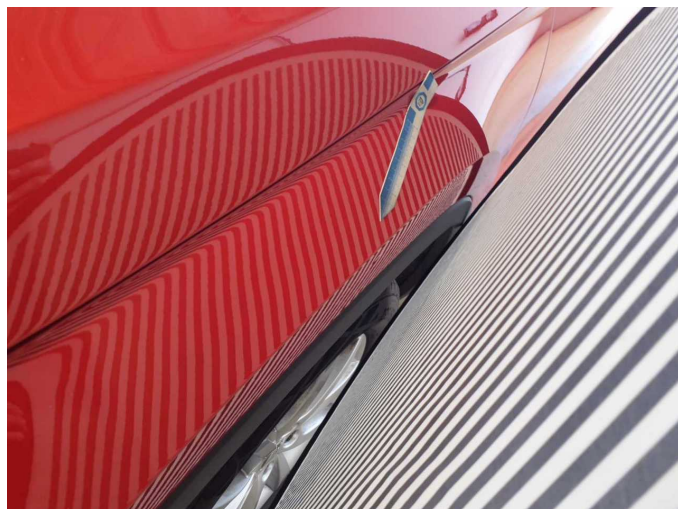


Damage 7: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint




Damage 7: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

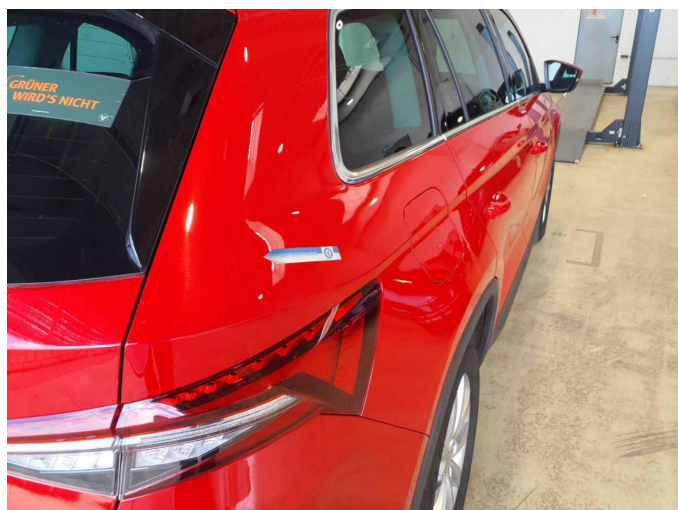

Damage 8: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

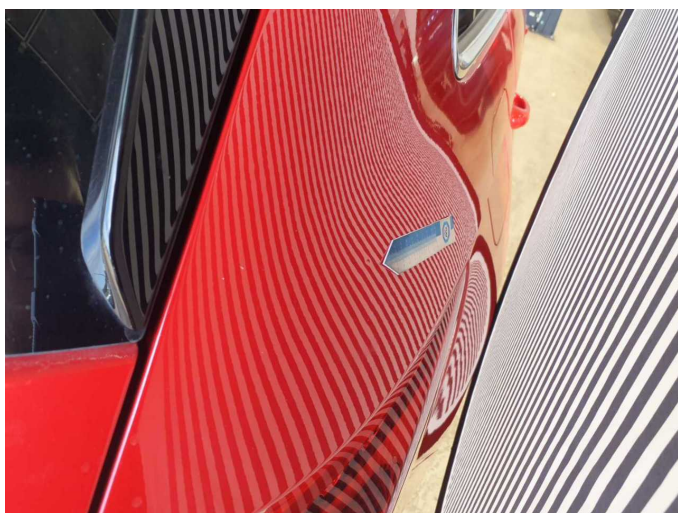


Damage 8: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

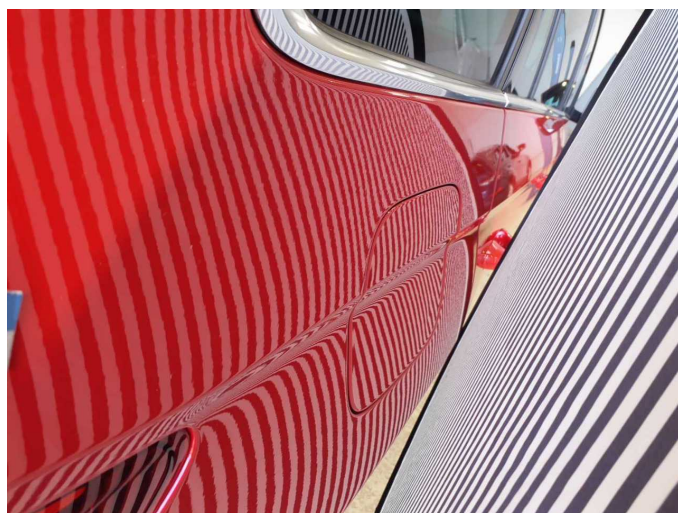


Damage 8: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint




Damage 9: Door - rear right side: Door (Einschlüsse) - Unprofessionally repaired - Repair and paint

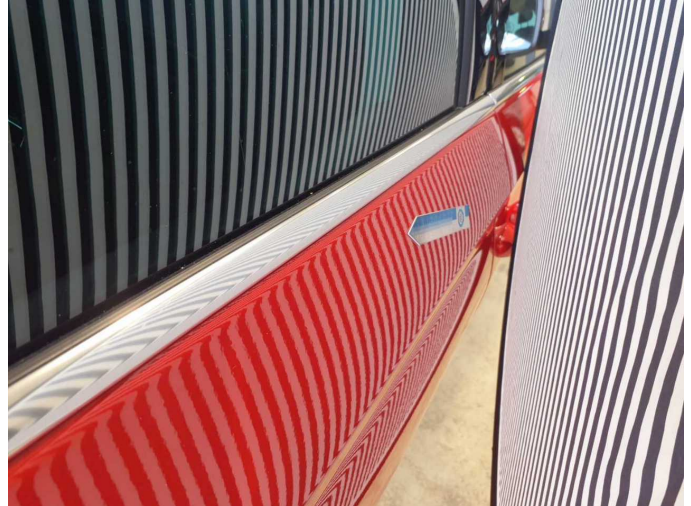


Damage 9: Door - rear right side: Door (Einschlüsse) - Unprofessionally repaired - Repair and paint

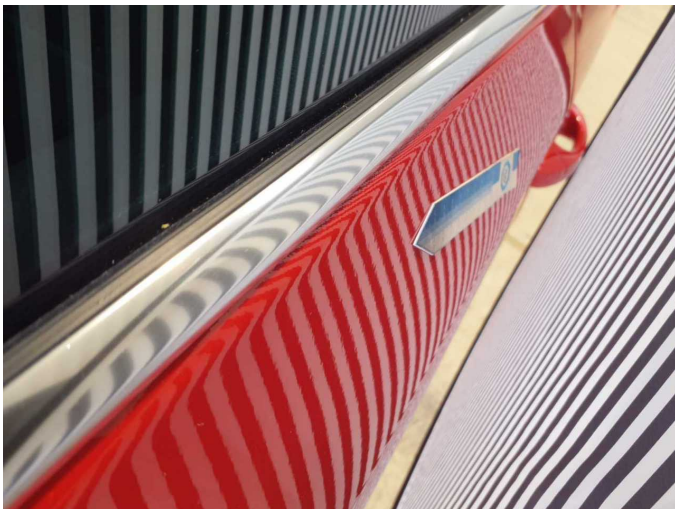


Damage 9: Door - rear right side: Door (Einschlüsse) - Unprofessionally repaired - Repair and paint

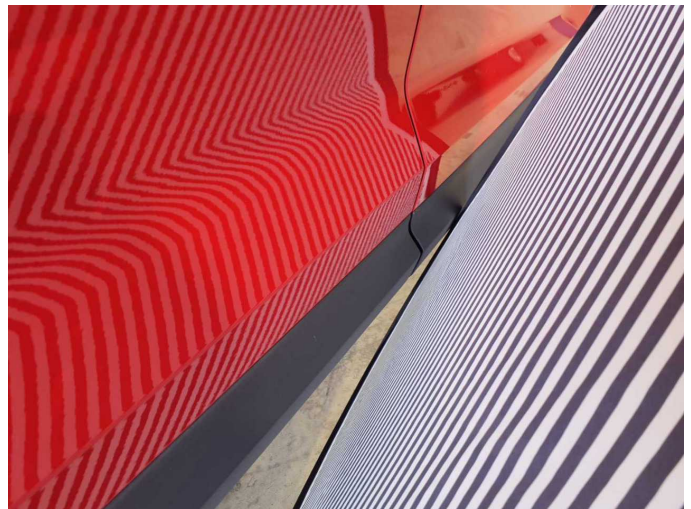

Damage 9: Door - rear right side: Door (Einschlüsse) - Unprofessionally repaired - Repair and paint

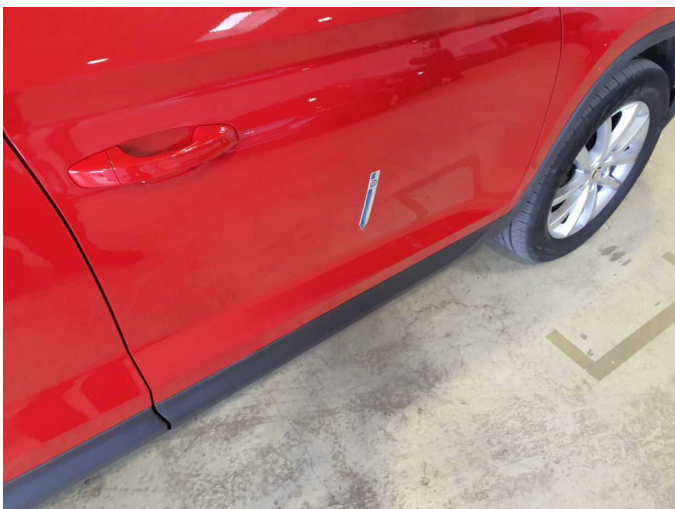

Damage 10: Door - front right side: Door (Orangenhaut, Einschlüsse) - Unprofessionally repaired - Repair and paint

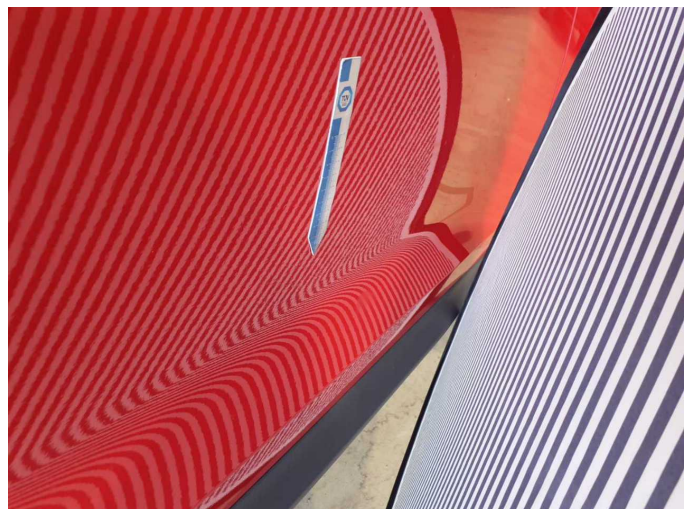


Damage 10: Door - front right side: Door (Orangenhaut, Einschlüsse) - Unprofessionally repaired - Repair and paint




Damage 10: Door - front right side: Door (Orangenhaut, Einschlüsse) - Unprofessionally repaired - Repair and paint




Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

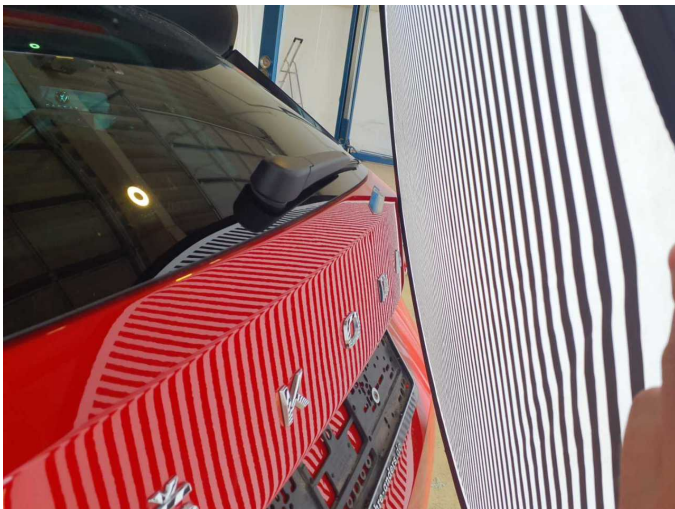


Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

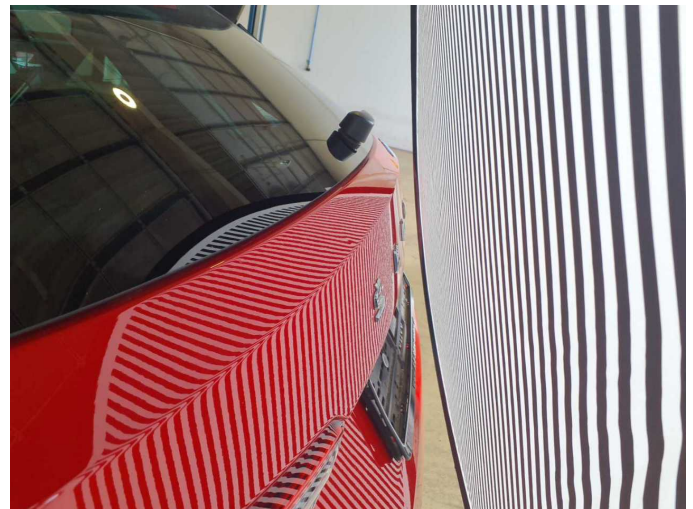


Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

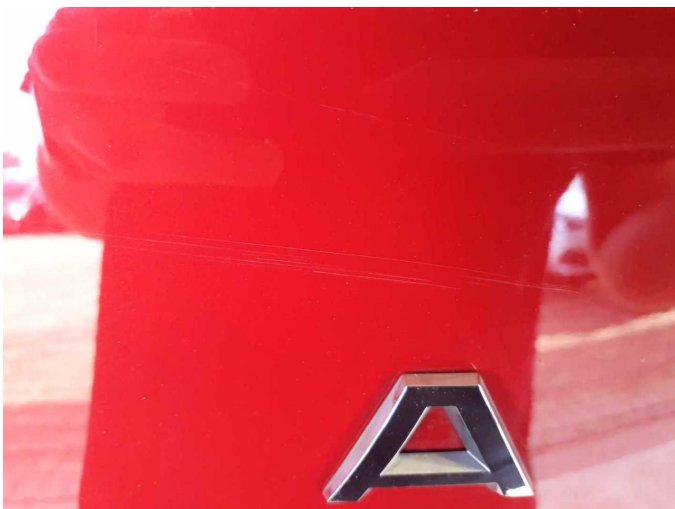


Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

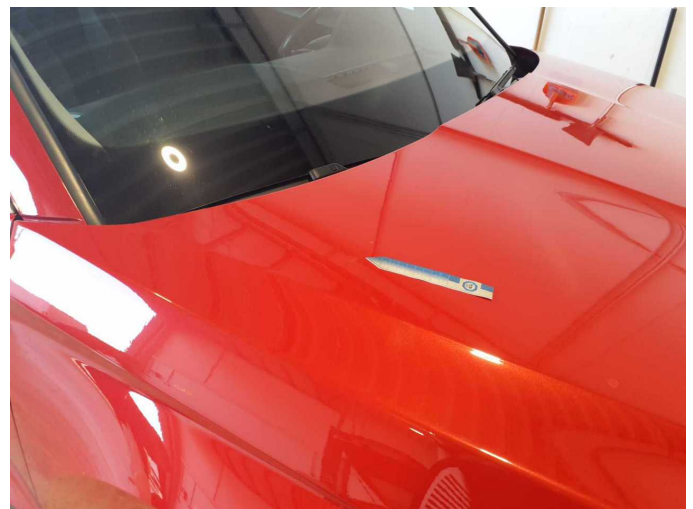

Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

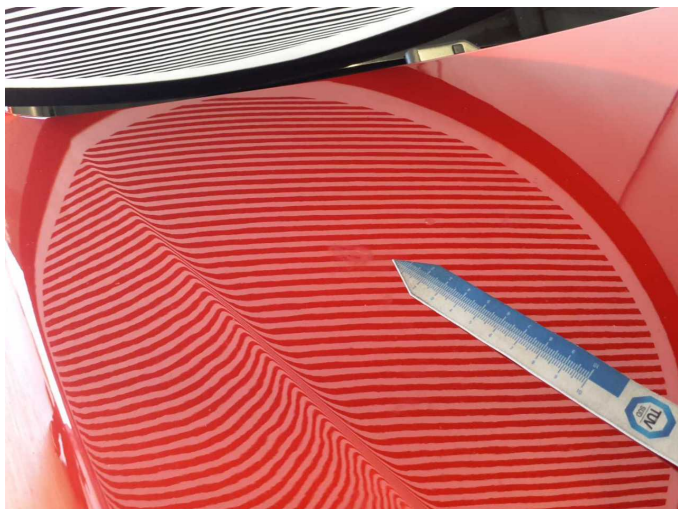

Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

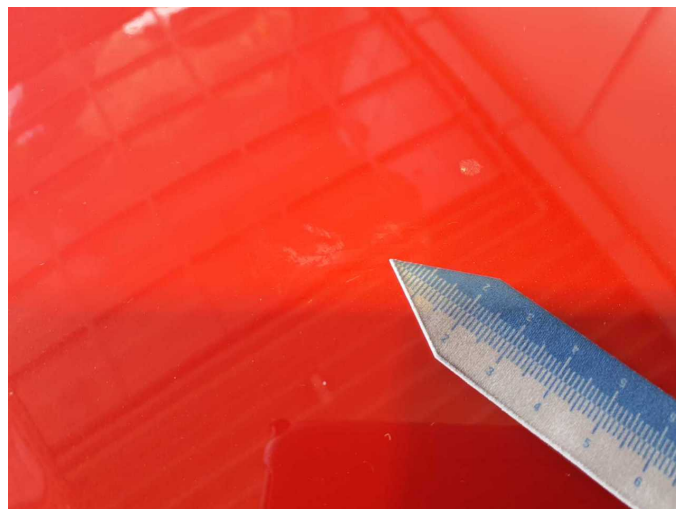


Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door

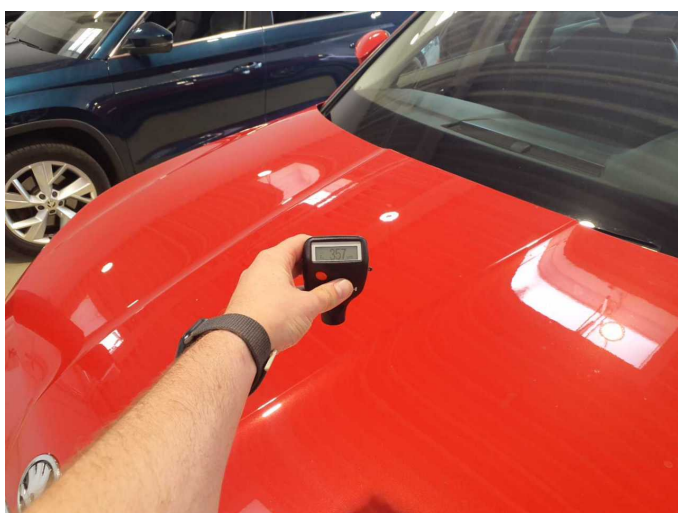

Repainting 2: Bonnet



Repainting 2: Bonnet



Repainting 3: Side panel - rear left side




Repainting 3: Side panel - rear left side



Repainting 4: Door - rear left side



Repainting 4: Door - rear left side

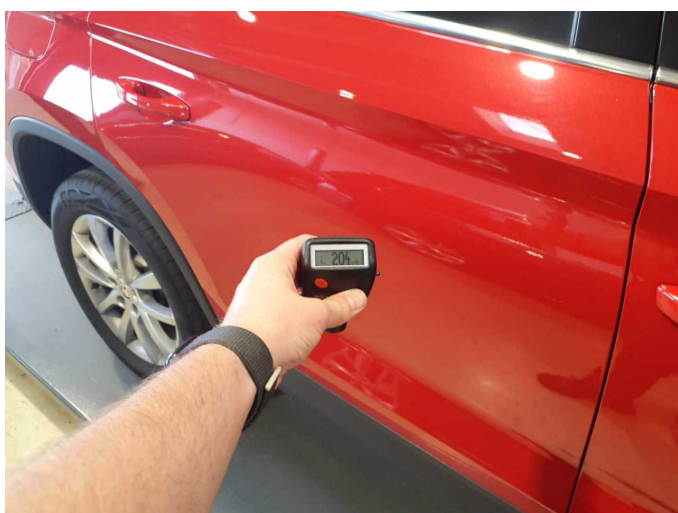

Repainting 5: Door - rear right side



Repainting 5: Door - rear right side



Repainting 6: Side panel - rear right side



Repainting 6: Side panel - rear right side



Repainting 7: Door - front right side



Repainting 7: Door - front right side