



Expertise

Protocol number: 46773816
Order No. / Reference: 26755321
Inspection date: 29 Jul 2026

Manufacturer: Ford

Model: Transit 310 L2H2 Lkw VA Trend

VIN: WF0XXXTTGXKK65410



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit 310 L2H2 Lkw VA Trend

Vehicle Identification number WF0XXXTTGXKK65410

Mileage (Read) 34,226 km

First registration 1 Aug 2019

Number of holders 1

Next periodical technical inspection 04/2028
(Report on hand)

Fuel type Diesel

Engine displacement / Cylinder 1,995 ccm / 4

Power 77 kW

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Van

Colour / colour code Polar-Silber Metallic

Doors / Seats 4 / 3

Upholstery type Cloth

Colour of upholstery Black

Re-import no

readiness to drive Roadworthy



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	0 km
Last service on / at	08/2021 at 11,770 km		
Key is / should be	2 / 4	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FH921184
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BNF 03640		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,140 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R15 104T	Summer tyres on Steel rim with wheel cover	Bridgestone	5mm / 5mm
2)	215/65 R15 104T	Summer tyres on Steel rim with wheel cover	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109R	Winter tyres on Steel	Semperit	6mm / 6mm
2)	215/65 R16 109R	Winter tyres on Steel	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R15 104T	Summer tyres on Steel	Bridgestone	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- roof, middle
- Double-leaf rear door with 180° opening angle (without window)
- Front electric windows
- Ford Easy Fuel
- Cruise control including leather steering wheel
- Grab handle on the B-pillar of the passenger side
- Front air conditioning
- Cargo area floor: Vinyl floor covering "Easy Clean" including wheel arch lining
- Fog light
- Particulate filter: diesel particulate filter
- Wheels: Tire repair kit
- Headlights with static cornering lights
- Sliding door entry light automatically illuminates when the door is opened
- Side protection strips
- Power steering
- Rear bumper with integrated step
- Partition wall to the cargo area without window
- Immobiliser
- Central locking with remote control
- Second key with remote control
- Driver's side airbag
- Exterior mirrors, electrically adjustable and heated
- On-board computer
- Headliner in driver's cab
- Tachometer
- Electronic Stability Program (ESP) with Traction Control (TSC)
- Generator, 200 A
- Transmission: 6-speed transmission
- Interior lighting with delay circuit
- Cargo area lighting
- leather steering wheel
- Steering column, adjustable in height and reach
- Front and rear parking pilot system
- Wheels: Wheel trims
- Wheels: Steel wheels 6.5 J x 15 with 215/65 R 15 tires
- Headlights with delayed shut-off
- Sliding door: Sliding door, right
- Rear mud flaps
- Low side paneling
- Seat belts
- Daytime running light
- Lashing eyes
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric

Extra equipment

- 2 batteries
- Paint finish: Metallic
- Seats: Seat Package 15 (Driver's seat, 4-way adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Integrated (fold-out) tray in the double passenger seat - Heated driver's seat - Heated passenger seat - Interior armrest for driver - Manual lumbar support (driver's seat) - Seat upholstery: fabric)
- Parking heater package 1 (parking heater (fuel-operated auxiliary heater), programmable, incl. remote control)
- Steel rear step
- 3rd and 4th master keys
- Radio: Audio system 15: Ford navigation system including Ford SYNC 3 with AppLink and touchscreen (16.5 cm screen diagonal - radio, MP3-compatible, dual tuner, DAB/DAB+, speed-dependent volume control, audio remote control on the steering wheel, 4 front speakers, USB port, AUX input - voice control - Bluetooth and USB interface - hands-free system - SMS readout/send function - Bluetooth audio streaming - emergency call assist - SD card slot - acoustic and visual route guidance - TMCpro - detailed visualization (3D display) - Michelin travel guide for Europe)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats (VL) - Holes - Replace
2	Boot lid / rear door	Seal - Malposition - Repair
3	Side panel - rear left side	Wheel arch - Scratch(es) - Loss in value
4	Side panel - rear left side	Side panel (Zierleiste) - Scratch(es) - Loss in value
5	Front bumper	Front bumper (unpainted) - Scratch(es) - Smart repair
6	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - Smart repair
7	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance (Historie) - No evidence - No deduction
2	Interior	Cargo space partition (bott Regalsystem) - Differs from the original configuration - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key (3 und 4)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Side right, Professionally repaired, Invoice of repair done	Non-existent

Repainting

No.	Repainting
1	Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side, Professionally carried out, Invoice of repair done

Paint coat thickness measurement

Boot lid / rear door	167 µm	Mudguard - left side	200 µm
Mudguard - right side	171 µm	Side panel - rear left side	203 µm
Door - rear right side	232 µm	Door - front left side	258 µm
Door - front right side	170 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

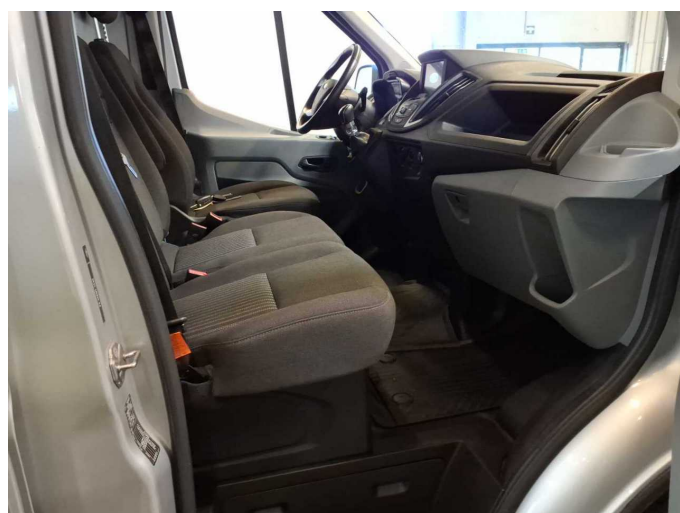


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster

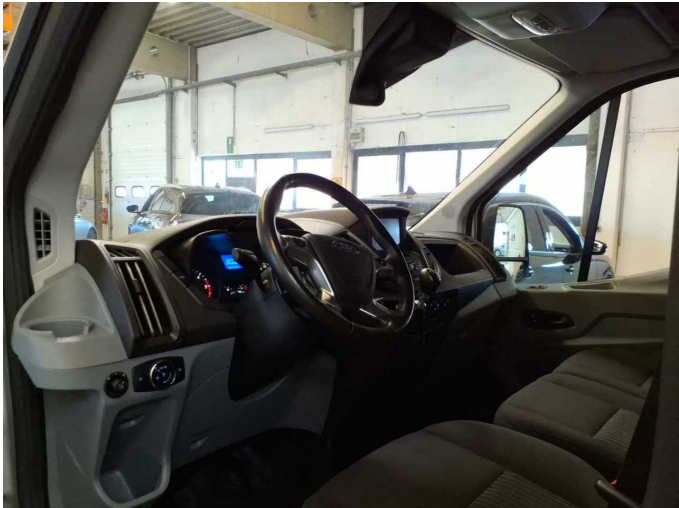


Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

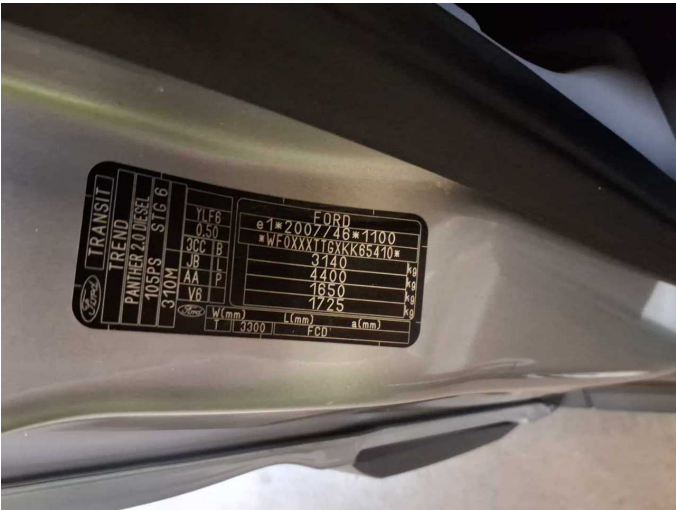


Figure 11: VIN



Figure 12: Mounted tyres

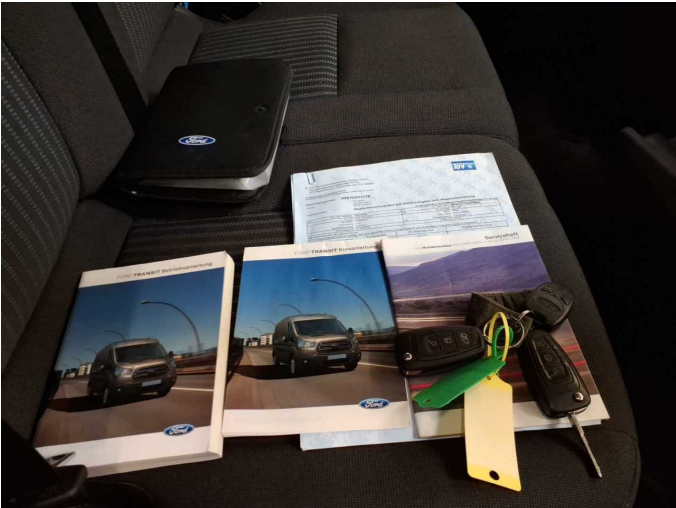


Figure 13: Documents

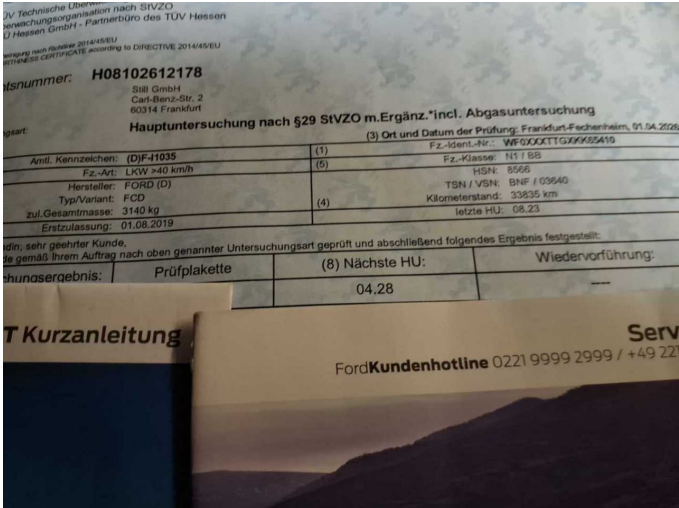


Figure 14: Documents

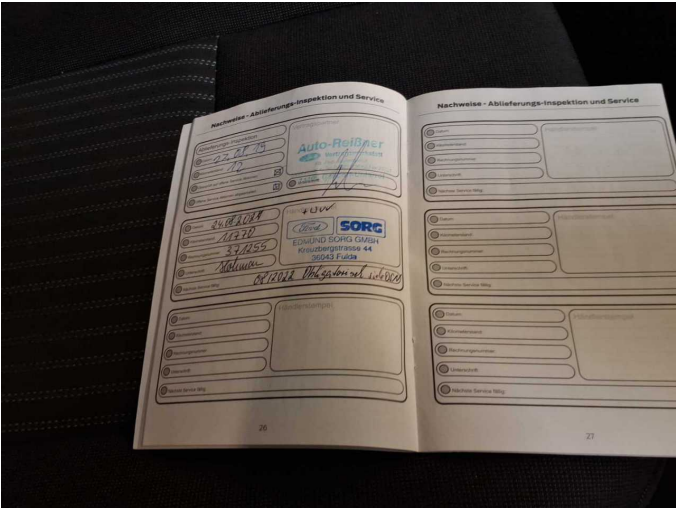


Figure 15: Documents



Figure 16: Additional tyres

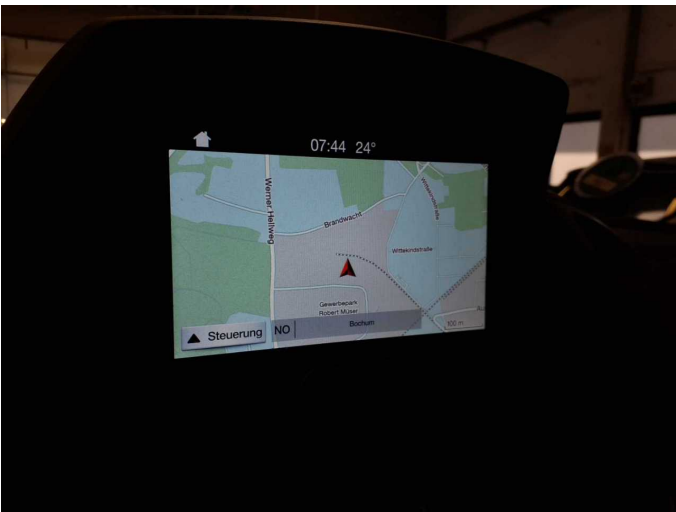


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

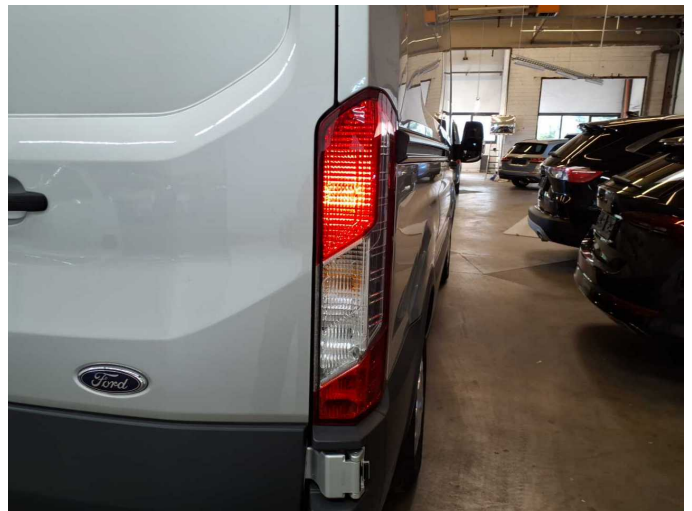


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

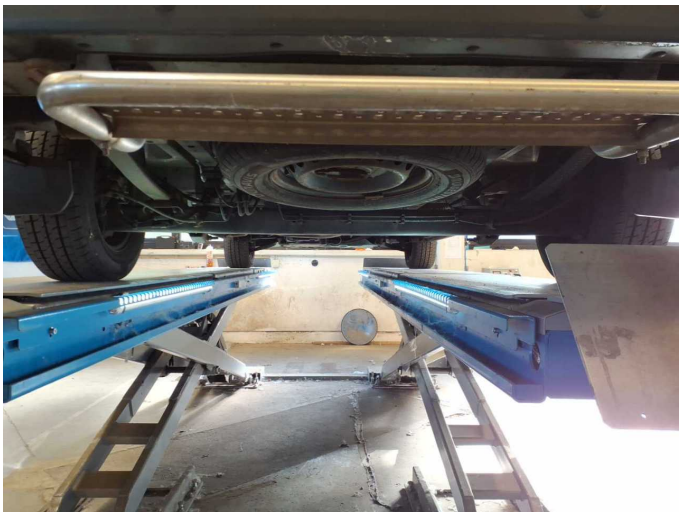



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.

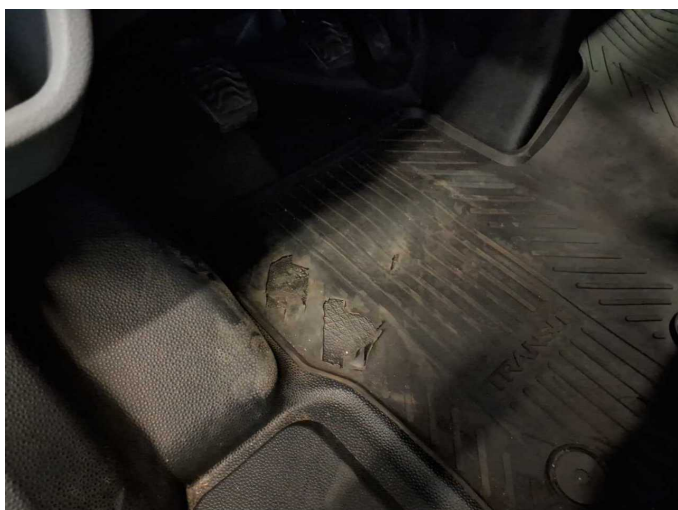

Damage 1: Trim / covers: Floor mats (VL) - Holes - Replace

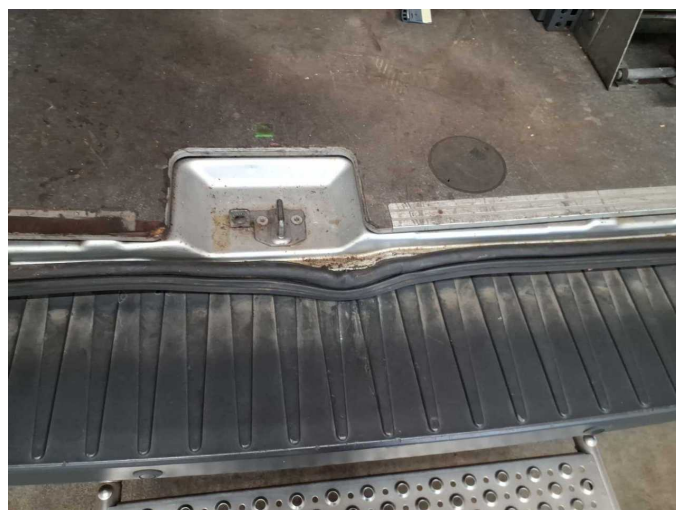

Damage 2: Boot lid / rear door: Seal - Malposition - Repair



Damage 2: Boot lid / rear door: Seal - Malposition - Repair



Damage 3: Side panel - rear left side: Wheel arch - Scratch(es) - Loss in value




Damage 3: Side panel - rear left side: Wheel arch - Scratch(es) - Loss in value



Damage 4: Side panel - rear left side: Side panel (Zierleiste) - Scratch(es) - Loss in value



Damage 4: Side panel - rear left side: Side panel (Zierleiste) - Scratch(es) - Loss in value

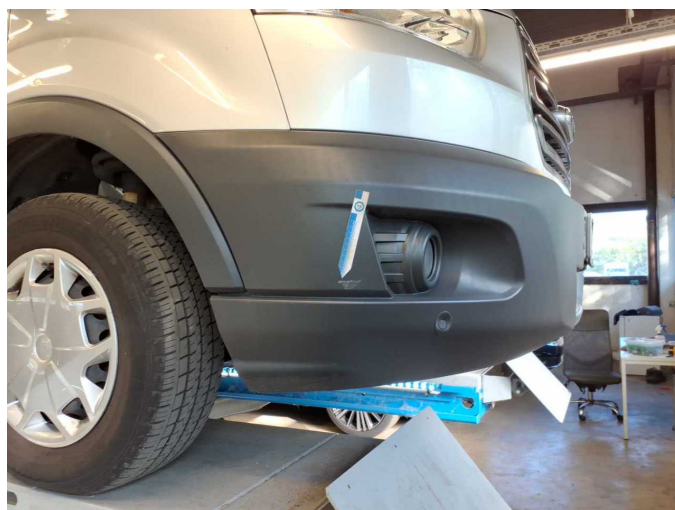


Damage 5: Front bumper: Front bumper (unpainted) - Scratch(es) - Smart repair



Damage 5: Front bumper: Front bumper (unpainted) - Scratch(es) - Smart repair



Damage 6: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Smart repair

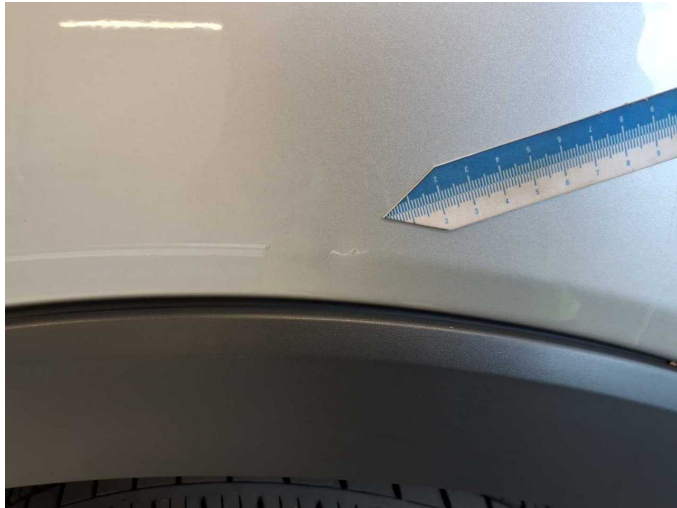


Damage 6: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Smart repair



Damage 6: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Smart repair



Damage 7: Misc.: Inspection / maintenance - Due - Perform

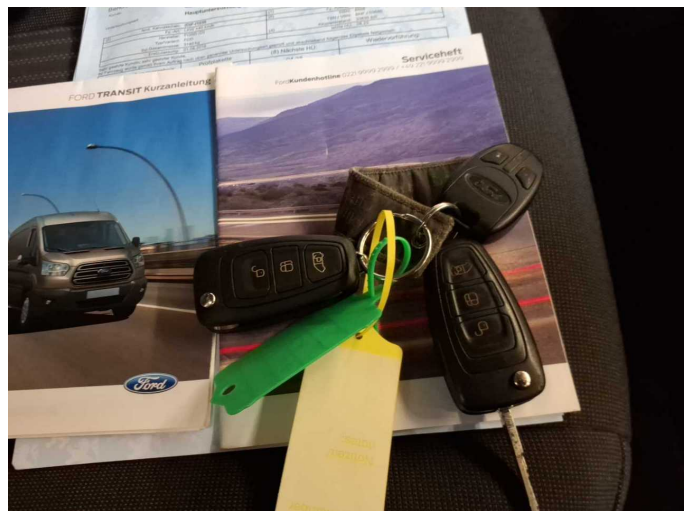

Missing part 1: Equipment: Vehicle key (3 und 4) - Missing - Replace



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side




Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side

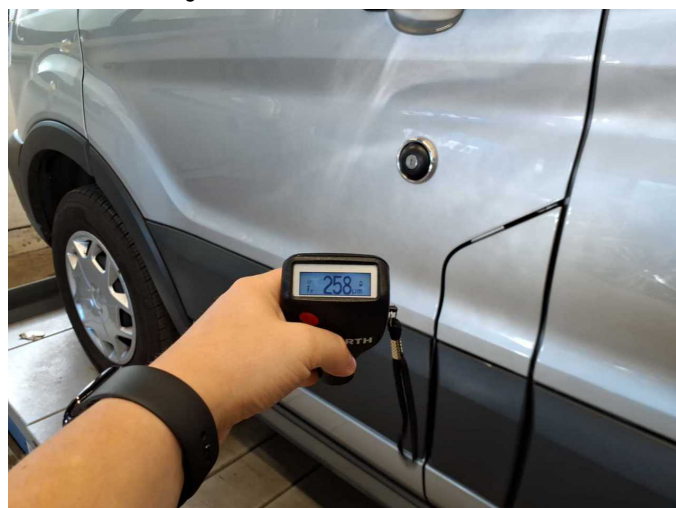

Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Door - rear right side, Door - front left side, Door - front right side