



Expertise

Protocol number: 46052026
Order No. / Reference: 26601148
Inspection date: 19 Jun 2026

Manufacturer: Skoda
VIN: TMBJJ9NS5L8521334

Model: Kodiaq 2.0 TDI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI DSG Style	
Vehicle Identification number	TMBJJ9NS5L8521334
Mileage (Read)	153,122 km
First registration	13 Jul 2020
Number of holders	2
Next periodical technical inspection	01/2028
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Blau Race Metallic (F5W)
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	700 km
Last service on / at	04/2026 at 148,836 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FU117054
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ART 00536		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,247 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	235/50 R19 99V	Summer tires (with run-flat tires) on Light alloy	Continental	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment on the left wheel arch
- Storage compartments
- front aero windshield wipers
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist
- Cargo elements in the trunk
- Decorative inlay Waves
- Tachometer
- Easy Start (start-stop button instead of the ignition lock)
- Electronic transverse differential lock (XDS+)
- ESC Electronic Stability Control
- Electric windows front and rear
- rear footwell lighting
- Front footwell lighting
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (Start/Stop automatic including brake energy recuperation)
- Aero rear window wiper including windshield washer system
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED headlights with LED daytime running lights
- Steering wheel with multifunction buttons
- Steering wheel: 3-spoke leather steering wheel
- Front center armrest, including storage compartment
- MSR (Motor drag torque control)
- Network program in the trunk
- Front and rear parking sensors
- Radio: Bolero infotainment system
- Radio accessories: 8 speakers
- Radio accessories: SmartLink+
- Tire Mobility Kit
- Wheels: 18" Elbrus alloy wheels
- Heated windshield washer nozzles
- Headlights washer / wiper system
- Kodiahq seat belts
- Seats: Electrically adjustable front seats with memory function
- Skoda Care Connect
- 12V socket - in the center console and in the trunk
- Telephone: Convenient hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with remote control
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Hill start assist
- Care Connect: Proactive services (term of 14 years)
- Roof rails, anodized
- Diesel particulate filter
- Third brake light
- Electronic parking brake including auto-hold function
- Emergency Call
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Cruise control
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- ISOFIX preparation on the outer rear seats
- Kessy - keyless entry and start-stop system
- Boot cover, roll-up and removable
- Paint finish: Solid
- LED taillights in crystal glass look & LED license plate lights
- Rear center armrest with cup holders and pass-through option
- Multifunction display with Maxi-Dot display, color (on-board computer)
- Upholstery: Cloth
- Radio: Bolero 8" music system
- Radio accessories: Digital radio reception DAB+
- Radio accessories: USB port in the center console
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Driver and passenger seats are height-adjustable
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- Bumpers painted in body color
- Front door sill trims
- Variable fastening concept in the boot (only for 5-seaters)
- Immobiliser



Extra equipment

- Adaptive Cruise Control (ACC) (up to 210 km/h) with Lane Assist, Lane Change Assist and Parking Assist (Lane Assist, Lane Change Assist (Blind Spot Detection) and Parking Assist with Adaptive Cruise Control (ACC) (control range up to 210 km/h) Replaces cruise control)
- Driving profile selection including customizable key (Normal, Eco, Sport, Individual)
- Chassis: Adaptive chassis DCC including driving profile selection (with customizable key (Normal, Eco, Sport, Individual), including off-road assistant for 4x4 drive)
- Comfort opening for electric tailgate operation
- Paint finish: Metallic
- Package: Sleeping package (Outer headrests in the 2nd row of seats with sleeping function - sleeping blanket - Lounge Step comfort floor mats - acoustic glazing)
- Proactive occupant protection including rear side airbags
- Wheels: 19" Sirius alloy wheels (7Jx19 tires 235/50 R19 99V ET43)
- Seats: 3rd row of seats (7-seater), cargo cover in the trunk
- Seats: Folding tables on the front seatbacks
- Auxiliary heater with remote control
- 360° surround view camera (Area-View) including trailer maneuvering assistant (Trailer Assist), parking assistant
- Swiveling towbar (with electric release, including trailer stabilization)
- Digital instrument cluster (Virtual Cockpit) (with, among other functions: time, outside temperature, current fuel consumption, average fuel consumption, distance traveled, driving time, average speed, fuel range, service interval indicator, door and trunk lid warning, display of information from radio, navigation system and telephone (if available))
- Climatronic air conditioning (3-zone) (fully automatic, separately adjustable for driver, front passenger and rear seats)
- Package: Business Columbus (Dynamic Radio-Nav.Columbus with MP3, Chapter 9, 2" color display, color Maxi-Dot display, traffic sign recognition, SmartLink+, 2 SD card slots, voice control, SIM card slot (LTE support), phone box with inductive charging (connection via external antenna), Wi-Fi hotspot (data connection via SIM in LTE modem or via the paired mobile phone), driver fatigue detection, 230 V socket and USB, electric tailgate operation, Sunset tinted windows, luggage net partition, Infotainment Online (3-year contract))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key (Batterie) - Non-operational - Replace
2	Equipment	Vehicle key (Batterie) - Non-operational - Replace
3	Wing mirror - right side	Cap - Scratch(es) - Smart repair
4	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
5	Headlight	Headlight - right side (- Mehrkosten möglich) - Leaking - Perform diagnosis
6	Bonnet	Bonnet - dent(s) - Smart repair
7	Roof	Roof - dent(s) - Smooth repair work
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Door - rear right side	Door - Scratch(es) - Paint
10	Door - rear left side	Door - Scratch(es) - Paint
11	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint



Wear and tear

No.	Component group	Description
1	Documents	Service book - Missing - No deduction
2	Door - front right side	Door - Scratch(es) - No deduction
3	Tail light	Tail lamp - right side - Scratch(es) - No deduction
4	Side panel - rear left side	Sill - Scratch(es) - No deduction
5	Front bumper	Front bumper - Stone chips - No deduction
The vehicle shows signs of wear and tear commensurate with its age and use.		

Missing parts

Description

Documents - Owner's manual

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 10 Apr 2026	5.985,24 €
2	Front, Side - left, Side right, Provided by user / customer, from 20 Sept 2024	12.298,28 €

Repainting

No. Repainting

- Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
- Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
- Bonnet, Professionally carried out, Invoice of repair done Non-existent
- Door - front left side, Professionally carried out, Invoice of repair done Non-existent
- Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	192 µm	Mudguard - right side	176 µm
Bonnet	329 µm	Door - front left side	227 µm
Door - front right side	216 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

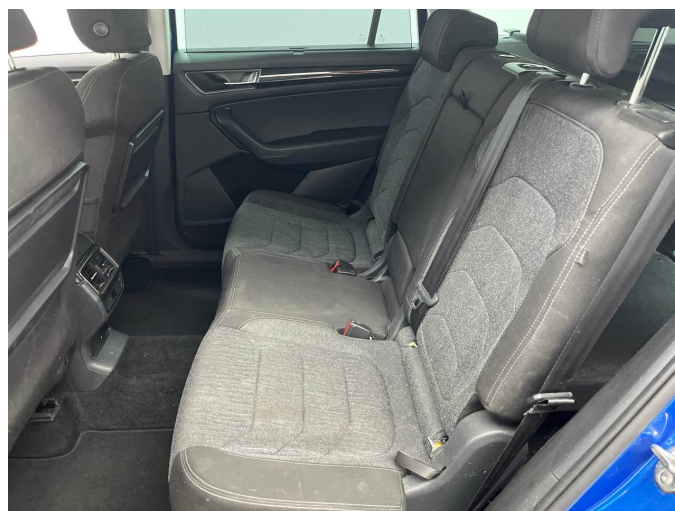


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

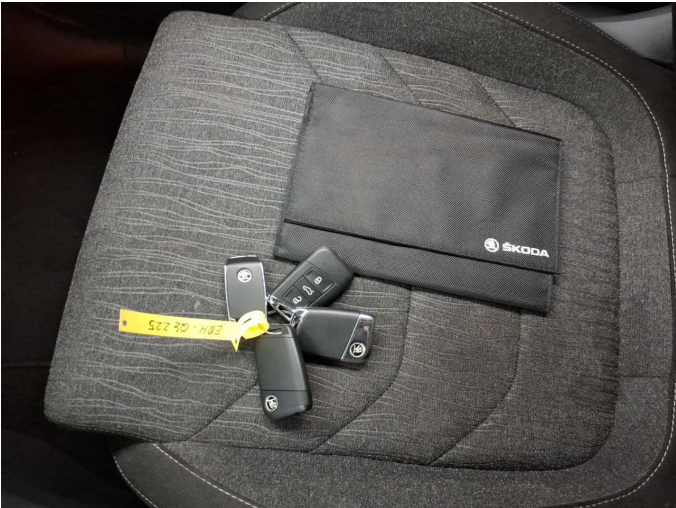


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

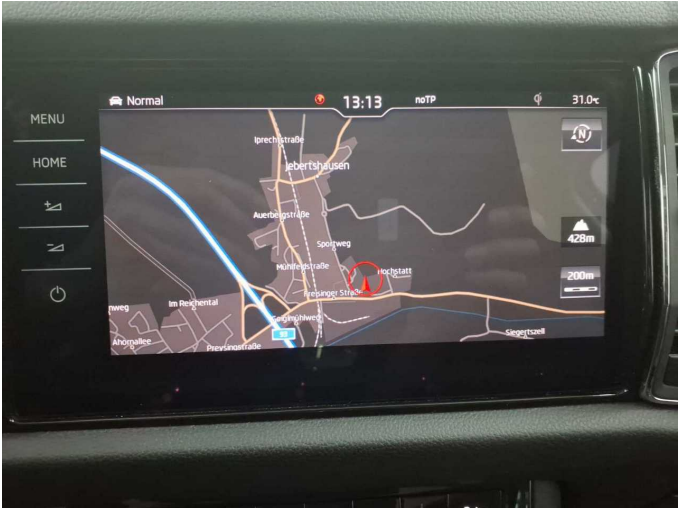


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

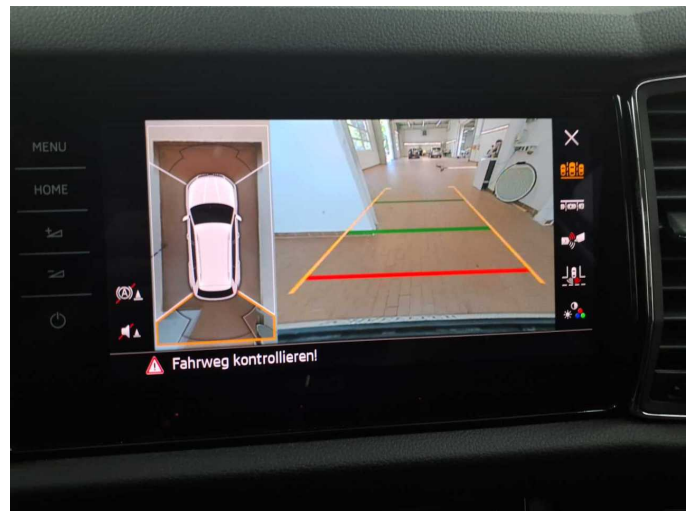


Figure 22: Misc.



Figure 23: Misc.

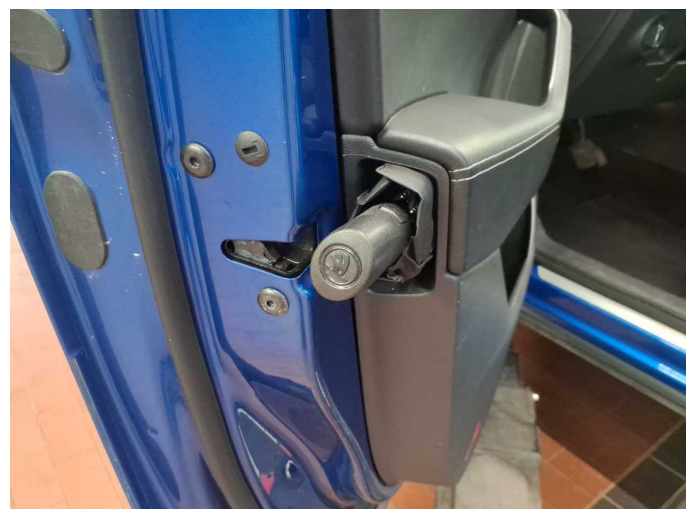


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.

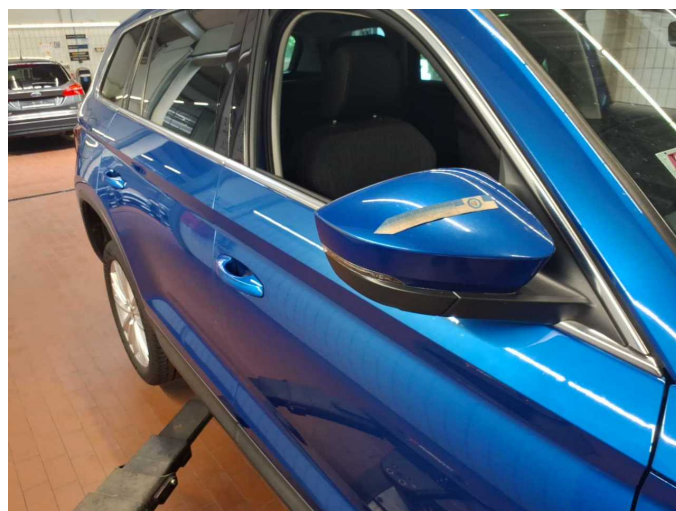

Damage 3: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 3: Wing mirror - right side: Cap - Scratch(es) - Smart repair

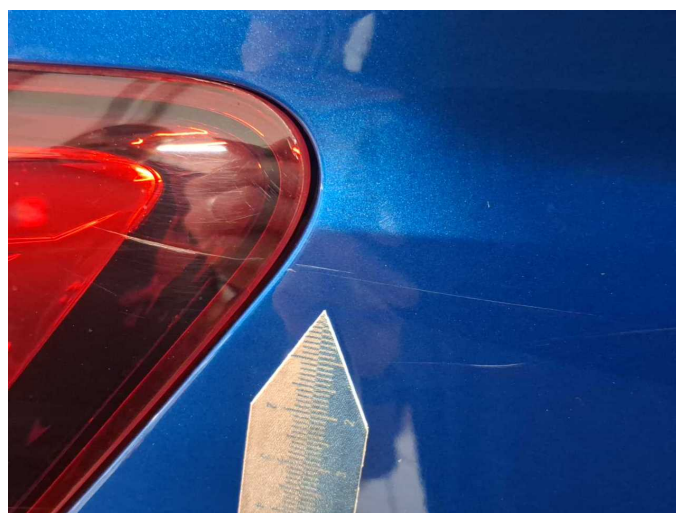

Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

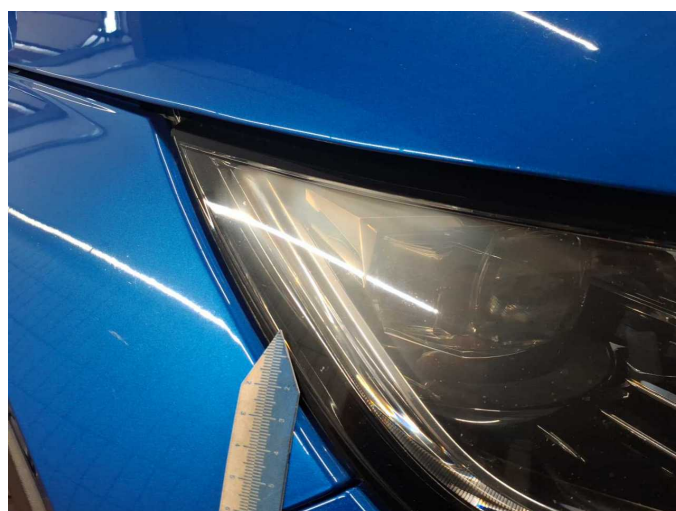


Damage 5: Headlight: Headlight - right side (- Mehrkosten möglich) - Leaking - Perform diagnosis



Damage 5: Headlight: Headlight - right side (- Mehrkosten möglich) - Leaking - Perform diagnosis



Damage 6: Bonnet: Bonnet - dent(s) - Smart repair

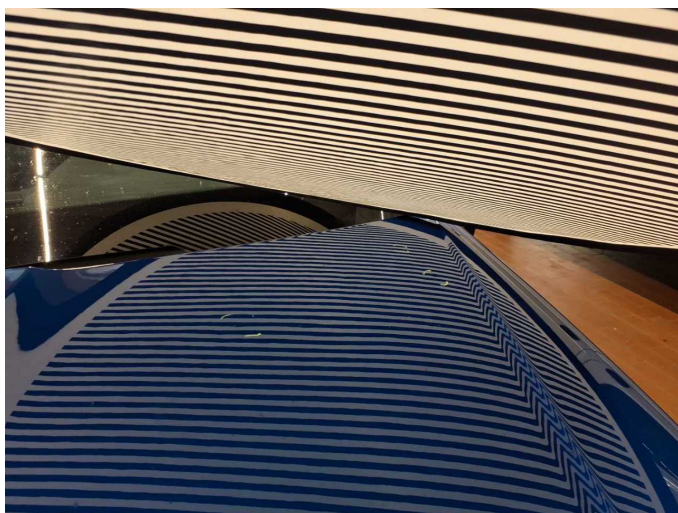

Damage 6: Bonnet: Bonnet - dent(s) - Smart repair




Damage 6: Bonnet: Bonnet - dent(s) - Smart repair




Damage 6: Bonnet: Bonnet - dent(s) - Smart repair




Damage 7: Roof: Roof - dent(s) - Smooth repair work

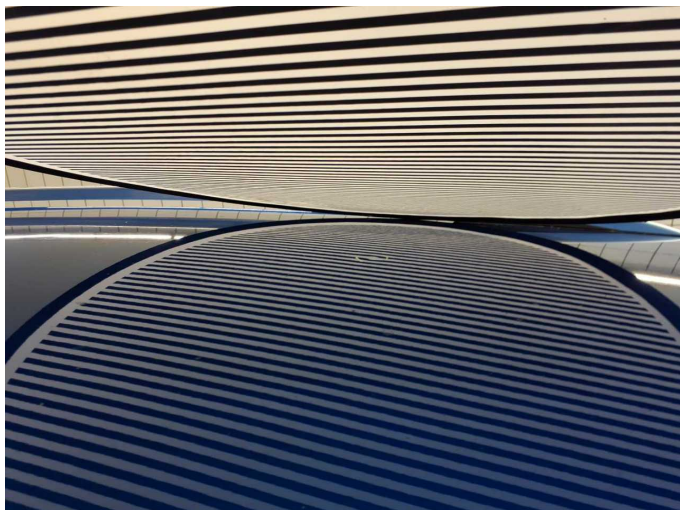

Damage 7: Roof: Roof - dent(s) - Smooth repair work

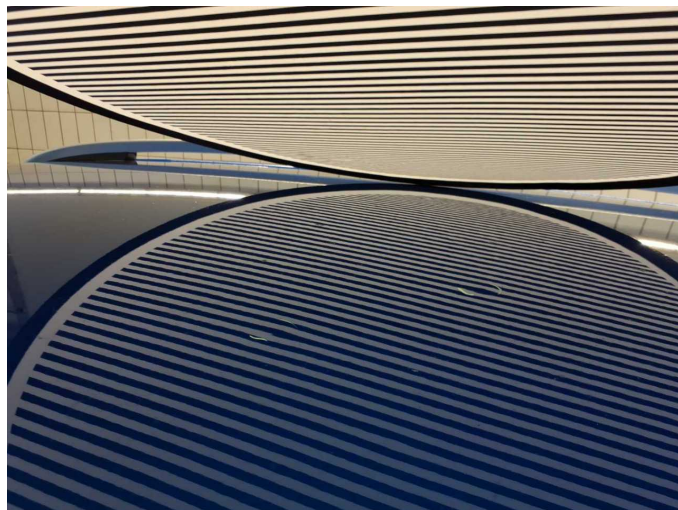

Damage 7: Roof: Roof - dent(s) - Smooth repair work

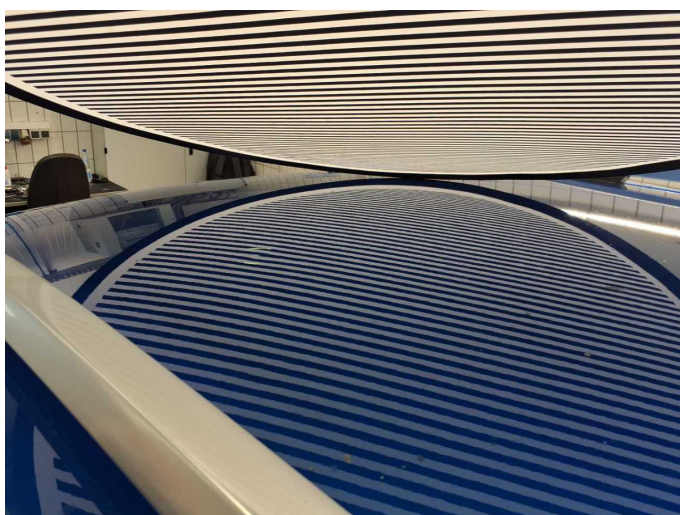

Damage 7: Roof: Roof - dent(s) - Smooth repair work



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 9: Door - rear right side: Door - Scratch(es) - Paint

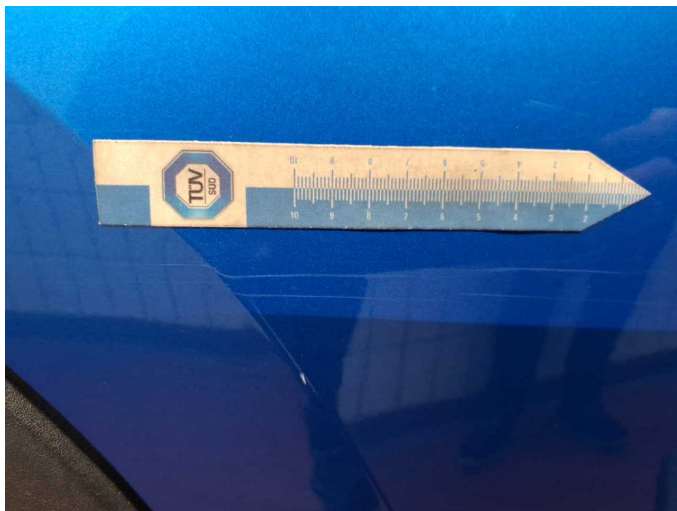

Damage 9: Door - rear right side: Door - Scratch(es) - Paint

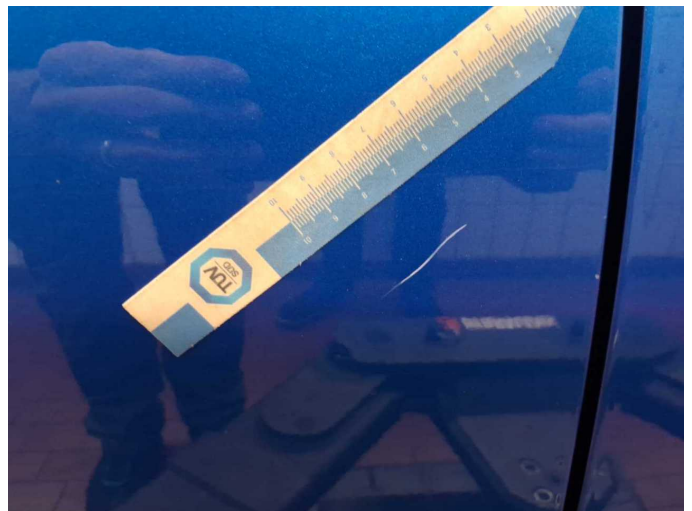

Damage 9: Door - rear right side: Door - Scratch(es) - Paint

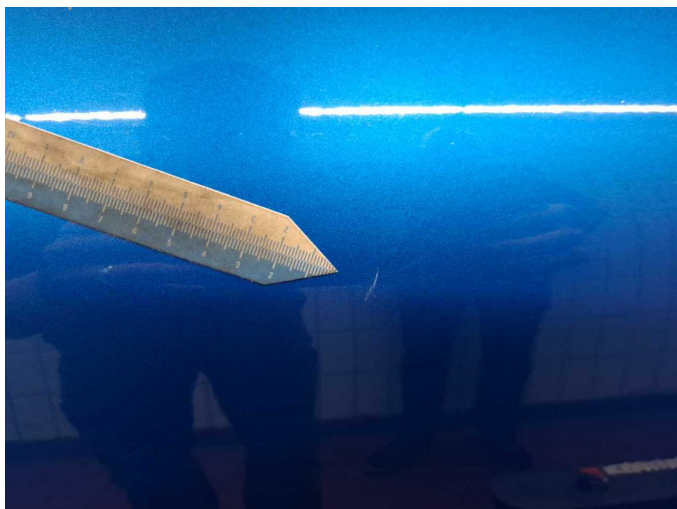

Damage 9: Door - rear right side: Door - Scratch(es) - Paint



Damage 10: Door - rear left side: Door - Scratch(es) - Paint



Damage 10: Door - rear left side: Door - Scratch(es) - Paint



Damage 10: Door - rear left side: Door - Scratch(es) - Paint




Damage 10: Door - rear left side: Door - Scratch(es) - Paint




Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

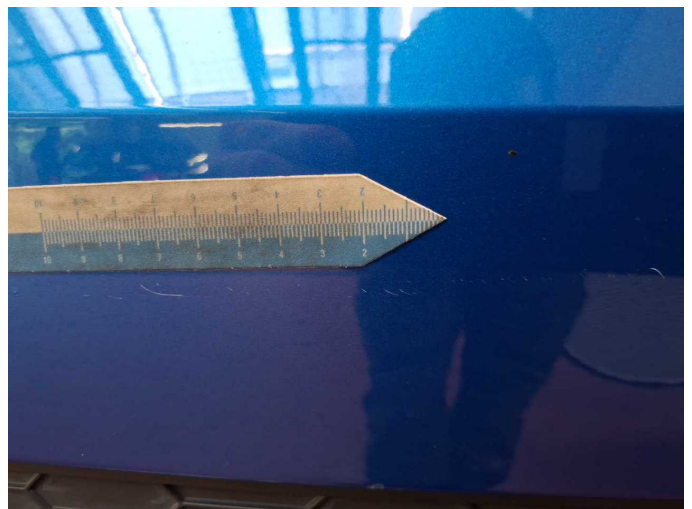

Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

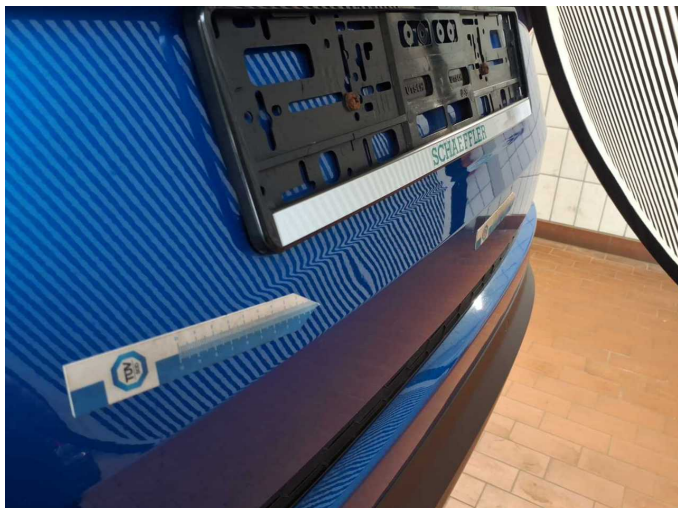


Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

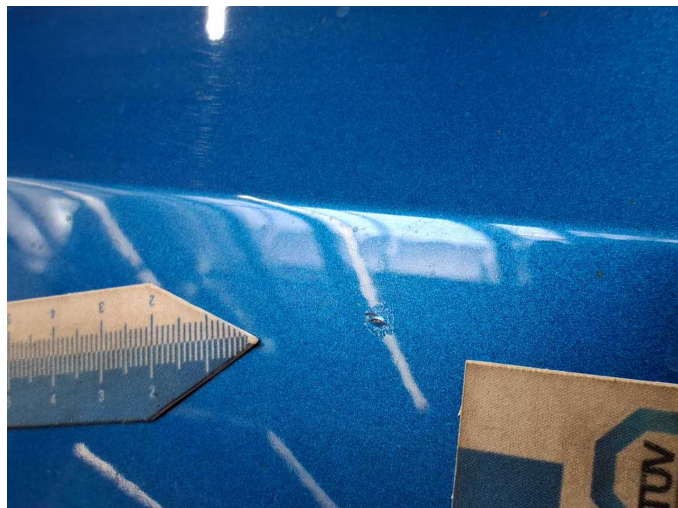

Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

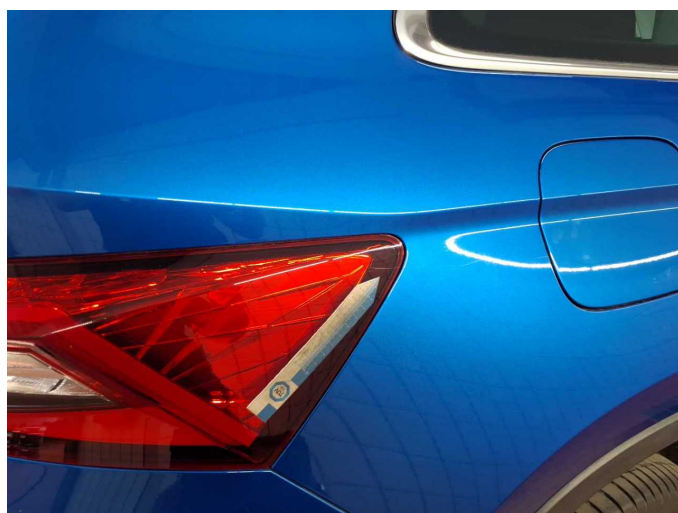


Wear and tear 3: Tail light: Tail lamp - right side - Scratch(es) - No deduction



Wear and tear 5: Front bumper: Front bumper - Stone chips - No deduction

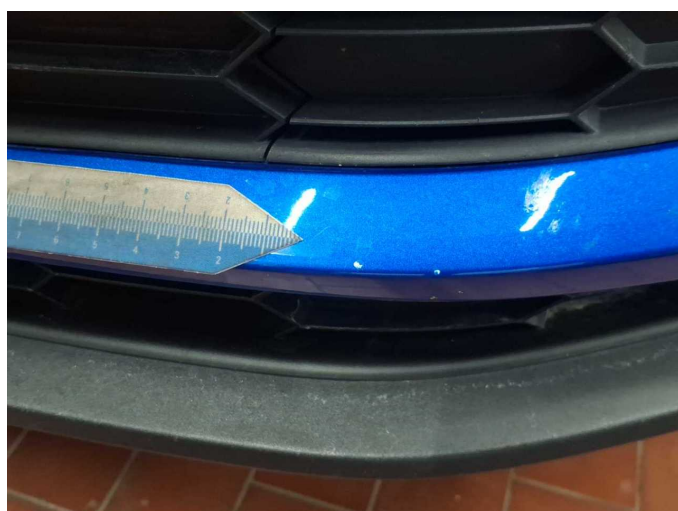

Wear and tear 5: Front bumper: Front bumper - Stone chips - No deduction

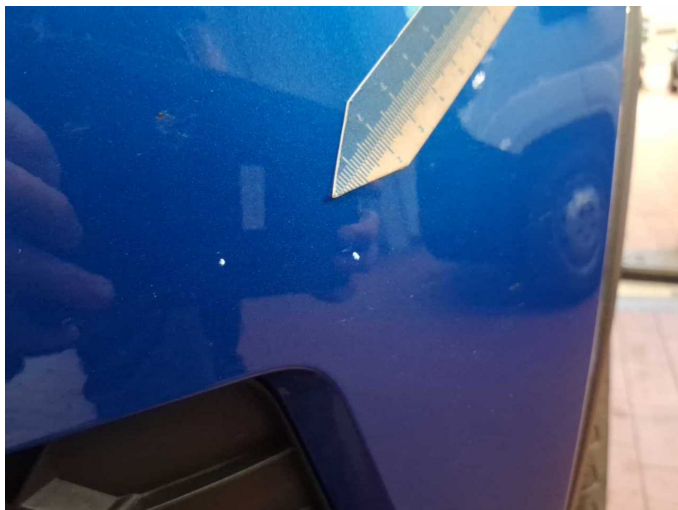

Wear and tear 5: Front bumper: Front bumper - Stone chips - No deduction




Repainting 1: Mudguard - left side



Repainting 2: Mudguard - right side



Repainting 3: Bonnet

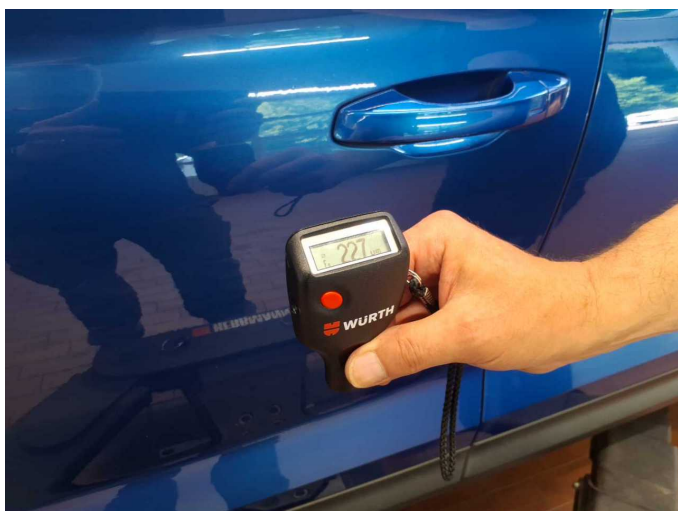

Repainting 4: Door - front left side



Repainting 5: Door - front right side