



VSSZZZKLZNR041293

Angaben zum Fahrzeug

Halter		Besichtigungszustand	bedingt: Licht/Nässe/Schmutz
Kennzeichen		Laufleistung (abgelesen)	89.166 km
Hersteller	Seat	Restlauf bis Service	11.700 km
Typ/Modell	CUPRA LEON SP	HU (Bericht lag vor)	06/2027
Fahrgestellnummer	VSSZZZKLZNR041293	Leistung / Hubraum	228 kW / 1.984 ccm
Erstzulassung	23.05.2022	Polster/Farbe	Stoff/Leder Kombination / Anthrazit-Grau
Letzte Wartung		Lackierung	Schwarz
Kraftstoffart	Benzin	Getriebe	Automatik

Zustandsbericht

Wertmindernde Faktoren

Nr.	Bauteilgruppe	Beschreibung	Kosten (netto)	Minderwert
1	Tür vorn rechts	Tür - verkratzt / verschürft - lackieren	555,00 €	310,00 €
2	Rad/Reifen	Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern	925,00 €	510,00 €

Gebrauchsspuren

Nr.	Bauteilgruppe	Beschreibung	Kosten (netto)	Minderwert
1	Tür hinten links	Tür - Delle(n) - kein Abzug	0,00 €	0,00 €

Fehlteile

Fehlteil	Kosten (netto)	Minderwert
----------	----------------	------------

Festgestellte Nachlackierungen

Nr.	Ort	Wertminderung
1	Seitenwand rechts, fachgerecht ausgeführt, Reparaturrechnung nicht vorhanden	

Hauptbereifung

Achse	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Verktgl.	Zul.
1	235/35 R19 91Y	Hankook	Sommerreifen	5mm - 5mm	i.O.	i.O.
2	235/35 R19 91Y	Hankook	Sommerreifen	5mm - 5mm	i.O.	i.O.

Ersatz

Typ	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Ablaufdatum
Notrad					

Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.



Angaben zum Fahrzeug

Hersteller	Seat	Besichtigungszustand	bedingt: Licht/Nässe/Schmutz
Typ/Modell	CUPRA LEON SP	Laufleistung (abgelesen)	89.166 km
Fahrgestellnummer	VSSZZZKLZNR041293	Erstzulassung	23.05.2022

Schadenzusammenfassung

Schadenklasse	Rep.Kosten	Minderwert
Beschädigungen	1.480,00 €	820,00 €
Gebrauchsspuren	0,00 €	0,00 €
Fehlteile	0,00 €	0,00 €
Gesamtsumme (ohne Mwst.)	1.480,00 €	820,00 €
Mwst. (19%)	281,20 €	155,80 €
Gesamtsumme (inkl. Mwst.)	1.761,20 €	975,80 €

Angaben zum Auftrag:

Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

Fahrzeug-Identifizierung:

Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

Besichtigungsbedingungen:

Eine ordnungsgemäße Sichtprüfung der Lackierung und der Karosserie war wegen unzureichender Lichtverhältnisse/ Nässe oder Verschmutzung nur eingeschränkt möglich.

Allgemeinzustand:

Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.

Unterschrift Sachverständiger (Paula Kube)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

Übersichtsfotos



Abbildung 1: FIN

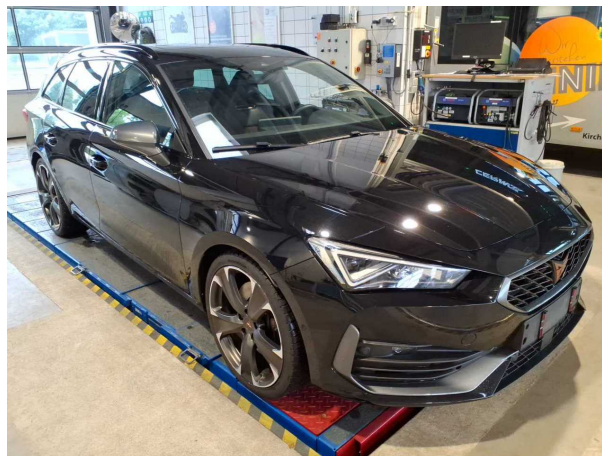


Abbildung 2: Schräg vorne

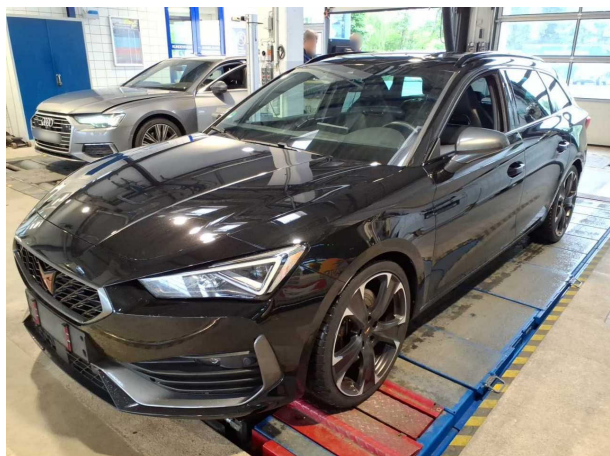


Abbildung 3: Schräg vorne



Abbildung 4: Schräg hinten

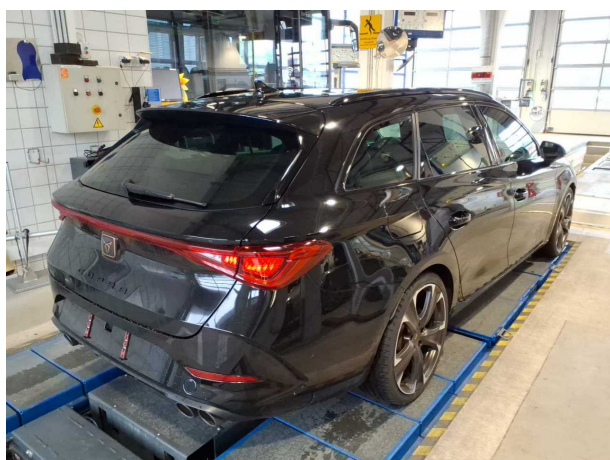


Abbildung 5: Schräg hinten

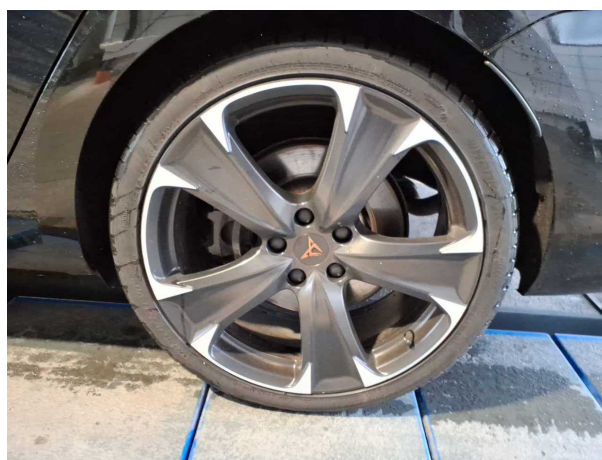


Abbildung 6: Montierte Bereifung

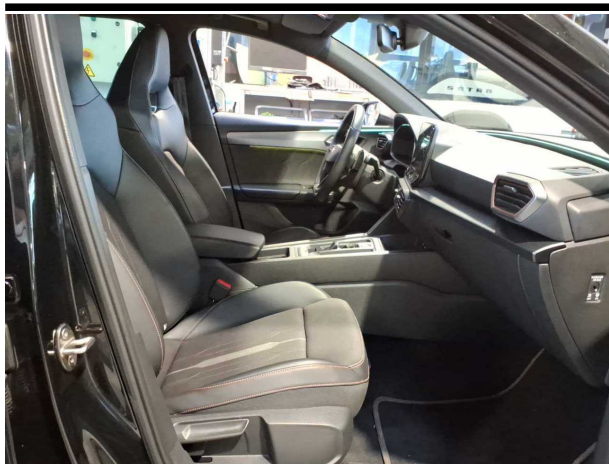


Abbildung 7: Innenraum vorne



Abbildung 8: Laderaum



Abbildung 9: Laderaum



Abbildung 10: Kombiinstrument



Abbildung 11: Kombiinstrument



Abbildung 12: Instrumententafel

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Service-Center
Weiden
Vohenstraußer Straße 3
92637 Weiden in der Oberpfalz

Besichtigungsdatum: 12.06.2026
Protokollnummer: 46415330
Erstellt durch: Paula Kube
Besichtigt durch: Nattias Mirle

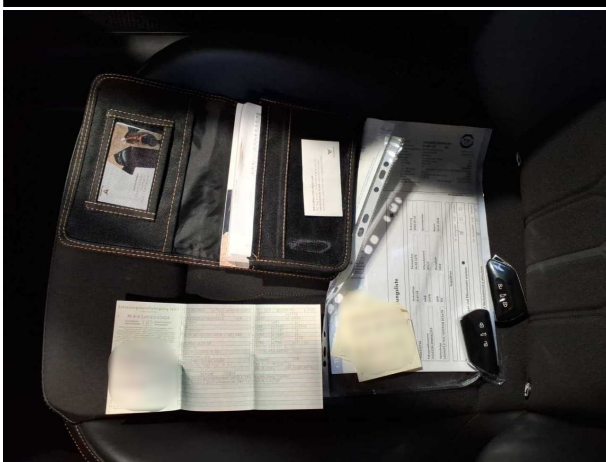


Abbildung 13: Dokumente


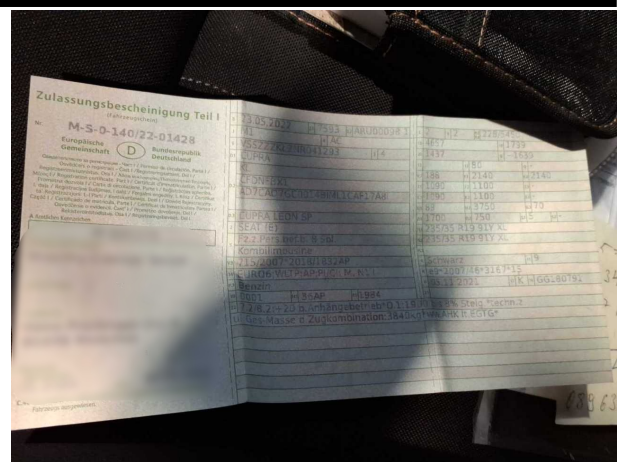


Abbildung 14: Dokumente



Abbildung 15: Sonstiges

Beschädigungsfotos

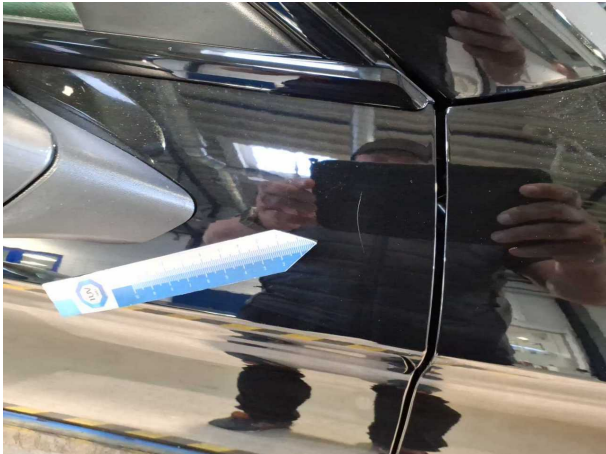

Beschädigung #1: Tür vorn rechts: Tür - verkratzt / verschürft - lackieren




Beschädigung #2: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern




Beschädigung #2: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern

EC Certificate of Conformity

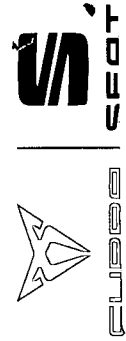

046CC0125529



CUPRA
KL
CFDNFB
AD7CAD7G0014BIML1CAF17A8I
CUPRA LEON SP

www.PS-Team.de

IP-MQB37WZ_A0_0805-VSS-1
AT-5Q0_0V_0182_000-VSS-1
09-VSS-715W_KL_DNFB_AD7_A-000
RL-DQ381_7A_19_002-WVW-1
PR-AU_00109_00_000-WVW-1
EV-A1_DGW_D_AYAAXX-WVW-1
M1
SEAT, S.A.
Autovia A-2, Km. 585
ES-08760 Martorell

Complete vehicles

The undersigned hereby certify that the vehicle:

0.1. Make (Trade name of manufacturer):
0.2. Type:

Variant:
Version:

0.2.1. Commercial name:
0.2.3.1. Interpolation family's identifier:
0.2.3.2. ATCT family's identifier:
0.2.3.3. PEMS family's identifier:
0.2.3.4. Roadload family's identifier:
0.2.3.5. Roadload matrix family's identifier (if applicable):
0.2.3.6. Periodic regeneration family's identifier:
0.2.3.7. Evaporative test family's identifier:
0.4. Vehicle category:
0.5. Company name and address of manufacturer:

0.6. Location and method of attachment of the statutory plates:

Location of the vehicle identification number:

0.10. Vehicle identification number:
0.11. Date of manufacture of the vehicle:

conforms in all respects to the type described in approval e9*2007/46*3167*15 issued on 2021-11-05 and can be permanently registered in Member States having right hand traffic and using metric units for the speedometer and metric units for the odometer.

Martorell, 2022-02-02

Martorell, 2022-02-02

Daniel Cortina Munuera
Director Quality Assurance

Robin Christoph Bräutigam
Head of Technical Conformity

Internal Manufacturer Data

VSSZZZKLZNR041293



49. CO₂ emissions/fuel consumption/electric energy consumption:

1. All power trains except pure electric vehicles (if applicable):

NEDC values	CO ₂ emissions		Fuel consumption [l/100 km]		
	Petrol/Diesel g/km	LPG / CNG g/km	Others g/km	Petrol/Diesel [L]	LPG / CNG [L]/[m³]
Urban conditions	220	----	----	9.6	----
Extra-urban conditions	147	----	----	6.5	----
Combined	174	----	----	7.6	----
Weighted, combined	----	----	----	----	----

Deviation factor (if applicable):

Verification factor (if applicable):

2. Pure electric vehicles and OVC hybrid electric vehicles (if applicable)

Electric energy consumption (weighted, combined): [Wh/km]

Electric range: [km]

3. Vehicle fitted with eco-innovation(s):

3.1. General code of the eco-innovation(s):

3.2. Total CO₂ emissions savings due to the eco-innovation(s):

3.2.1. NEDC savings (if applicable)

Diesel / Petrol

LPG / NG [g/km]

Others [g/km]

4. All power trains, except pure electric vehicles (if applicable)

WLTP values	CO ₂ emissions		Fuel consumption: [l/100 km]		
	Petrol/Diesel g/km	LPG / CNG g/km	Others g/km	Petrol/Diesel [L]	LPG / CNG [L]/[m³]
Low	286	----	----	12.6	----
Medium	189	----	----	8.4	----
High	162	----	----	7.1	----
Extra High	173	----	----	7.7	----
Combined	188	----	----	8.3	----
Weighted, combined	----	----	----	----	----

5.1. Pure electric vehicles (if applicable)

Electric energy consumption [Wh/km]:

Electric range [km]:

Electric range city [km]:

Electric range city (EAER) [km]:

Electric range city (EAER city) [km]:

Designation in accordance with Annex II, Section 5:

52. Remarks:

NO 16.2.: with trailer axle 2.+20 kg#NO

35.: alt. to pos 35 with deviating val. in pos 49:#235/35 R19 91Y XL#8,0JX19 E

T49:#225/35 R19 88H XL M+S#8,0JX19 ET49,##225/40 R18 92V XL M+S#7,5JX18 ET46,##

1. Number of axes / wheels: 2 / 4

3. Powered axes (number, position): 2 Axle 1/2
Interconnection of powered axes: cardan shaft

3.1. Specify if the vehicle is non-automated/automated/fully automated: non-automated

4. Wheelbase[mm]: 2679

4.1. Axle spacing [mm]: 2679

5. Length [mm]: 4657

6. Width [mm]: 1799

7. Height [mm]: 1437

13. Mass in running order [kg]: 1639

13.2. Actual mass of the vehicle [kg]: 1722

16. Technically permissible maximum masses:

16.1. Technically permissible maximum laden mass [kg]: 2140

16.2. Technically permissible mass on each axle (1./2.) [kg]: 1090 / 1100

16.4. Technically permissible maximum mass of the combination [kg]: 3840

18. Technically permissible maximum towable mass in case of:

18.1. Drawbar trailer [kg]: -----

18.3. Centre-axle trailer [kg]: 1700

18.4. Unbraked trailer [kg]: 750

19. Technically permissible maximum static vertical mass at the coupling point [kg]: 80

20. Manufacturer of the engine: Audi AG

21. Engine code as marked on the engine: DNF

22. Working principle: Positive ignition / 4 stroke

23. Pure electric: no

23.1. Class of Hybrid (electric) vehicle: -----

24. Number and arrangement of cylinders: 4, in Line

25. Engine capacity [cm³]: 1984

26. Fuel: petrol

26.1. Mono fuel/Bi fuel/Flex fuel/Dual fuel: mono fuel vehicle

26.2. Type of dual fuel engine: -----

27. Maximum power: -----

27.1. Maximum net power [kW at min⁻¹] (internal combustion engine): 228.00 / 5450

27.2. Maximum hourly output [kW] (electric motor): -----

27.3. Maximum net power [kW] (electric motor): -----

27.4. Maximum 30 minutes power [kW] (electric motor): -----

28. Gearbox (type): automatic

28.1. Gear	-----	-----	-----	-----	-----	-----	-----	-----	-----
28.1. Gearbox ratios:	-----	-----	-----	-----	-----	-----	-----	-----	-----
28.1.2. Final drive ratio:	-----	-----	-----	-----	-----	-----	-----	-----	-----
28.1.2. Total gear ratios:	-----	-----	-----	-----	-----	-----	-----	-----	-----

29. Maximum speed [km/h]: 250

30. Axle(s) track (1./2.) [mm]: 1554 / 1520

35. Fitted tyre/wheel combination/energy/efficiency class of RRC/type category used for CO₂ determination:

Axle 1: 235/35 R19 91Y XL / 8.0JX19 ET49 / C / C1

Axle 2: 235/35 R19 91Y XL / 8.0JX19 ET49 / C / C1

Trailer brake connections: -----

36. Code for bodywork: AC

38. Colour of vehicle: BLACK

40. Number and configuration of doors: 5 / ie. 2, ri. 2, ba. 1

41. Number of seating positions (including the driver): 5

42. Seat(s) designated for use only when the vehicle is stationary: ---

42.1. Number of wheelchair user accessible position: ---

42.3. Sound level

46. Stationary [dB(A) at min⁻¹]: 89.00 / 3750

Drive-by [dB(A)]: 70.00

47. Exhaust emission level: EURO 6 AP

47.1. Parameters for emission testing of Vind: 1801

47.1.1. Test mass [kg]: 1801

47.1.2. Frontal area [m²]: -----

47.1.3. Road load coefficients

47.1.3.0. f0 [N]	47.1.3.1. f1 [N/(km/h)]	47.1.3.2. f2 [N/(km/h)²]
188.807525	0.115000	0.035544

47.2. Driving cycle: 3b

47.2.1. Driving cycle class: -----

47.2.2. Downscaling factor (f_{dec}): -----

47.2.3. Capped speed: no

48. Exhaust emissions: 715/2007-2018/1832AP

1.2. Test procedure: Type 1 (NEDC average values, WLTP highest values) [mg/km] or WHSC (EURO VI)

Petrol /	CO	THC	NMHC	NO _x	THC + NO _x	NH ₃	Particles #	Particles #
Diesel	344.2	28.6	24.1	7.5	-----	-----	0.1900	0.23E11
LPG/CNG	-----	-----	-----	-----	-----	-----	-----	-----
Other	-----	-----	-----	-----	-----	-----	-----	-----

2.2. Test procedure: WHTC (EURO VI) [mg/kWh]

Petrol /	CO	THC	NMHC	CH ₄	NO _x	NH ₃	Particles	Particles #
Diesel	-----	-----	-----	-----	-----	-----	-----	-----
LPG/CNG	-----	-----	-----	-----	-----	-----	-----	-----
Other	-----	-----	-----	-----	-----	-----	-----	-----

48.1. Smoke corrected absorption coefficient [m⁻¹]: NO_x [mg/km] Particles (number) with exponent (#/km)

48.2. Declared maximum RDE values (if Complete RDE trip: 60.0 6.00 E11

Urban RDE trip: 60.0 6.00 E11

MOBILITY CONCEPT

LVV Nr 4340539
Hersteller Cupra
Model León
Variante DE - Kb5 2.0 TSI EU6d, VZ 4Drive OPF, 2021 - 2024
2.0 TSI VZ
Listenpreis 40.071,42
VIN VSSZZZKLZNR041293
Erstzulassungsdatum 23.5.2022
Kennzeichen M-GZ 1175

Schadensfälle der int. Belegnummer: 4340539 17.07.2026

Schadennummer	Unfalldatum	Beschädigung	Schadenhöhe in EUR
2023108061	27.06.2023	Windschutzscheibe gerissen	
2023117714	07.12.2023	Fahrerseite Seitenteil hinten	9.549,27
2025112599	29.12.2024	Marderschaden	72,62

- Seite 1 von 1 -