



Expertise

Protocol number: 46104613
Order No. / Reference: 26470120
Inspection date: 23 Jun 2026

Manufacturer: Skoda
VIN: TMBJF7NU3PC217624

Model: Karoq 2.0 TDI SCR DSG Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Karoq 2.0 TDI SCR DSG Ambition	
Vehicle Identification number	TMBJF7NU3PC217624
Mileage (Read)	46,193 km
First registration	20 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	85 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Lava-Blau Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	39 Tag(e)
Last service on / at	02/2025 at 31,640 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ559481
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AVU 01476		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,002 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Goodyear	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Exterior mirrors and door handles painted in body color
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Diesel particulate filter
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Closed storage compartment on the dashboard
- Cruise control
- Tinted windows
- Heated rear window
- Rear window wiper/washer system
- ISOFIX preparation on the outer rear seats
- Trunk cover, fixed
- LED brake light in the rear spoiler
- LED taillights in crystal glass look
- LED headlights with daytime running lights
- Reading lights at the front of the headliner
- Rear center armrest with cup holders and pass-through option
- Multi-collision brake
- Rear parking sensors
- Wheel arch cover
- Radio accessories: Digital radio reception DAB+
- Tire Mobility Kit
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Gear shift indicator
- Seat belts
- Skoda Care Connect
- Speed limiter
- 12V socket - in the trunk
- Bumpers partially painted in body color
- Lashing eyes in the trunk
- Immobiliser
- front aero windshield wipers
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Illuminated trunk
- Hydraulic brake assist (HBA)
- Grey headliner
- Ambition decorative inlay
- Digital Cockpit (8")
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (start/stop system and brake energy recuperation)
- Automatic interior mirror dimming
- Air conditioning
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- LED fog lights
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters.
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Fatigue detection
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Radio accessories: USB port in the center console (Type-C)
- Wheels: 17" Scutus alloy wheels with aerodynamic covers in matte black
- Electromechanical power steering
- Seats: Height-adjustable front seats
- Sun visor on driver and passenger side with illuminated vanity mirror
- 12V socket - in the center console
- Telephone: Comfort hands-free telephone system (without connection to the external antenna)
- Central locking with remote control



Extra equipment

- Anti-theft alarm system (with SAFE system, interior monitoring and tilt sensor)
- Steering wheel: Heated steering wheel (leather steering wheel with multifunction buttons including paddle shifters)
- Package: Comfort PLUS (Adjustable lumbar support in the front seats - Climatronic air conditioning (2-zone) - Sunset - Kessy)
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Package: Winter PLUS (Heated front and outer rear seats - Heated windshield washer nozzles - Headlight cleaning system - Heated windshield)
- Panoramic sliding sunroof, electric (incl. sunshade - no glasses compartment in the headliner)
- Upholstery: Glamour leather interior (seat surfaces made of fine nappa leather, combined with high-quality materials)
- Power outlet: 230-volt socket and USB charging port (Type-C) (on the back of the front center armrest)
- Luggage net partition
- Paint finish: Metallic
- Package: Amundsen Infotainment Package (Amundsen Dynamic Radio Navigation System - 8" Capacitive Color Display - Digital Cockpit Plus - Wireless SmartLink - Voice Control - Phonebox with inductive charging function (connection via external antenna) - Infotainment Online (3-year term) - Mapcare navigation data update)
- Package: Traveller BASIC (Predictive Adaptive Cruise Control ACC (control range up to 210 km/h) - Adaptive Lane Keeping Assist - Traffic Sign Recognition - Capacitive Steering Wheel with Hands Off Detection - USB-C Charging Port on the Interior Mirror - Emergency and Traffic Jam Assist)
- VARIOFLEX seating system in the rear (sliding and repositionable outer rear seats with adjustable backrest angle, removable, middle seat with table function)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Insulation lining - Malposition - Un- / install
2	Rear bumper	Rear bumper - Scratch(es) - Paint
3	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
4	Front bumper	Front bumper (+Radlauf, + Spoiler) - Damaged - repair according to calculation

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Side right



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung, Mehrkosten und somit Abweichung der für die Stoßstange ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

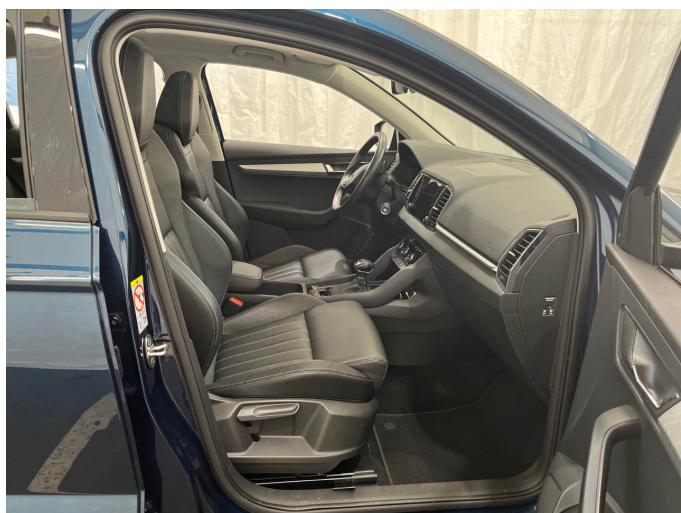


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

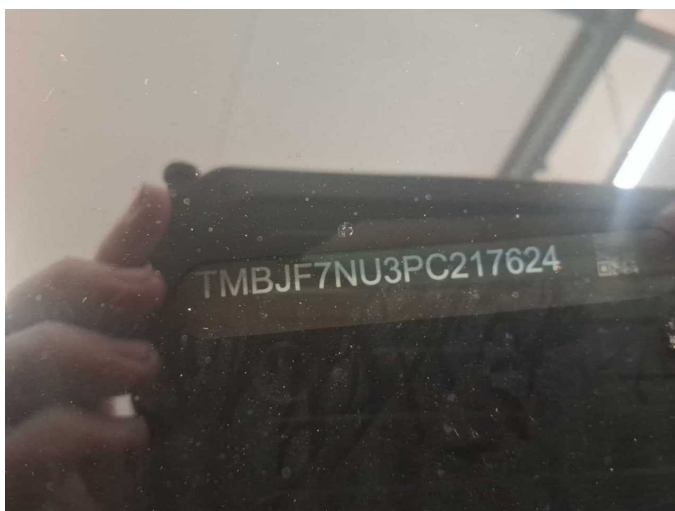


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

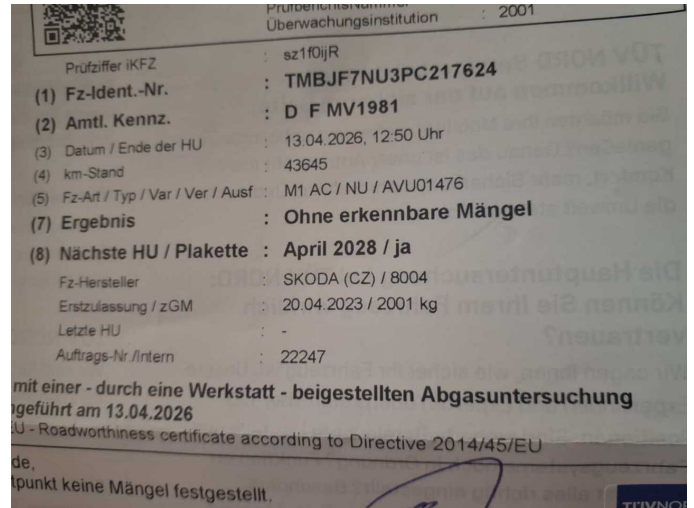


Figure 14: Documents



Figure 15: Documents

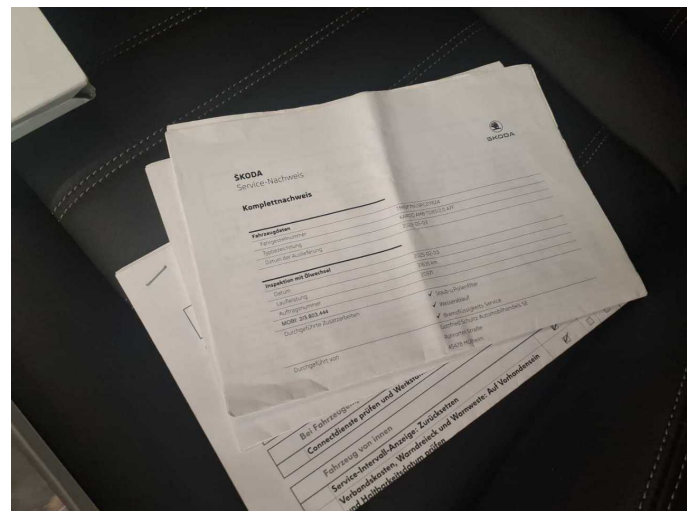


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

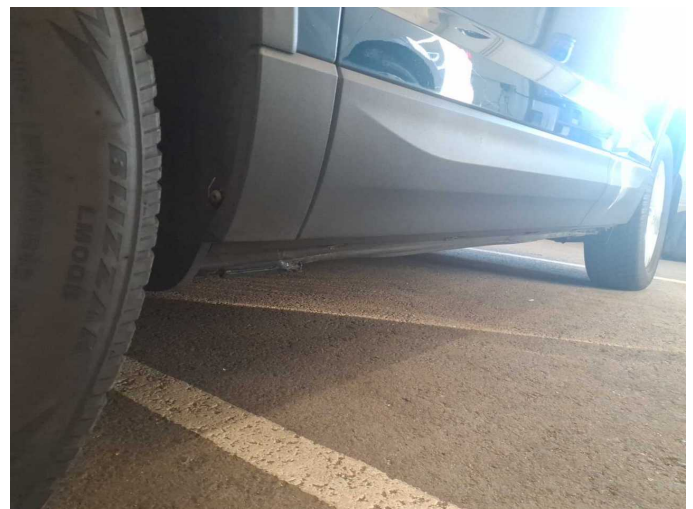


Figure 24: Misc.



Figure 25: Misc.

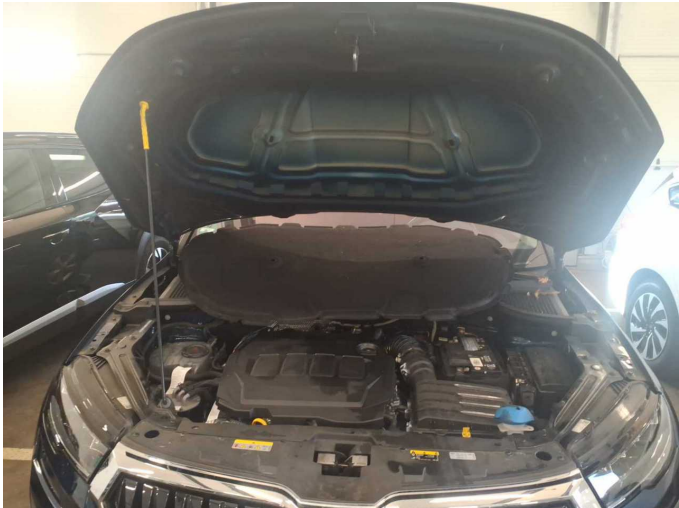


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

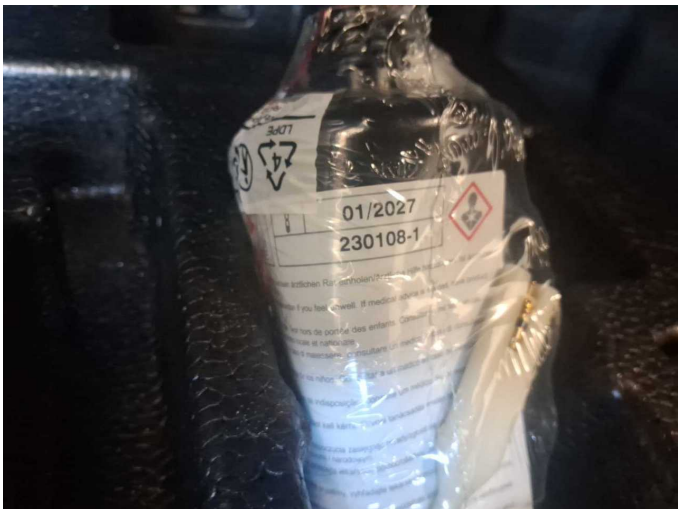


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.




Figure 33: Misc.




Damage 1: Bonnet: Insulation lining - Malposition - Un- / install

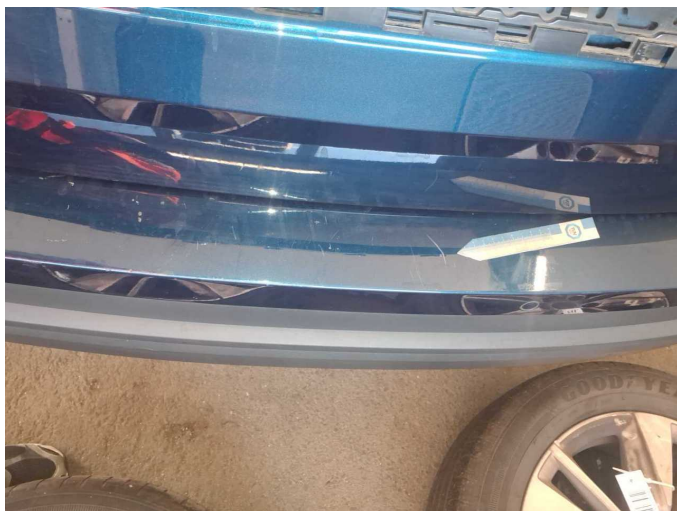


Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint

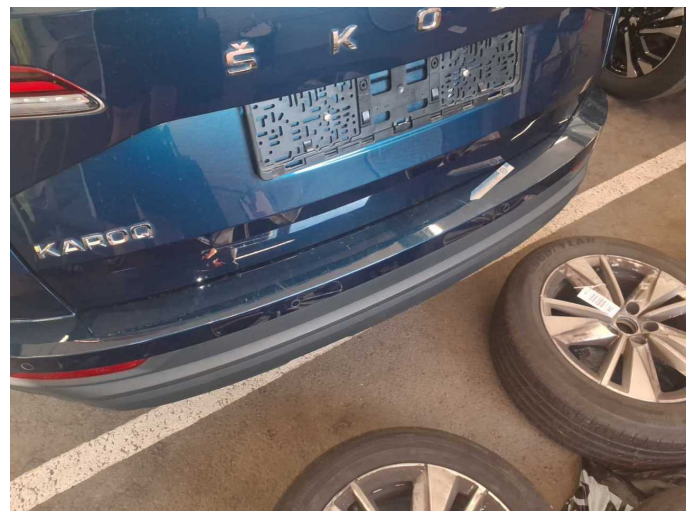


Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint

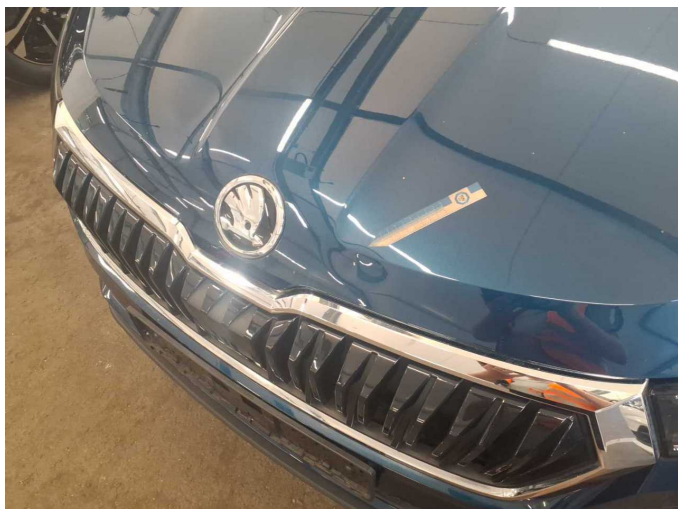


Damage 3: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

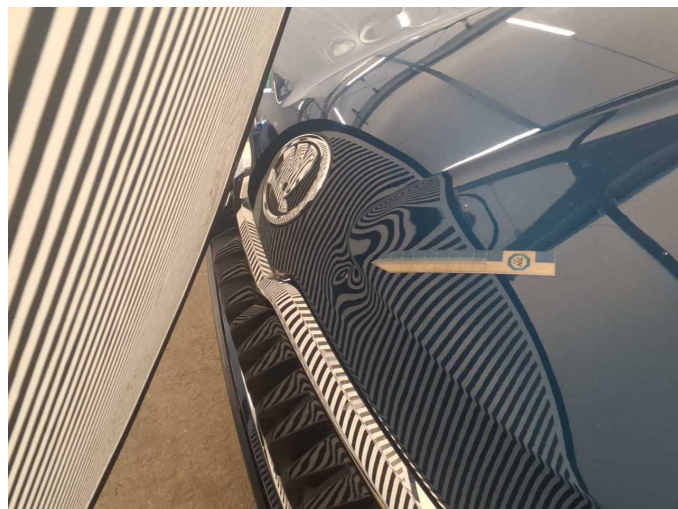


Damage 3: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

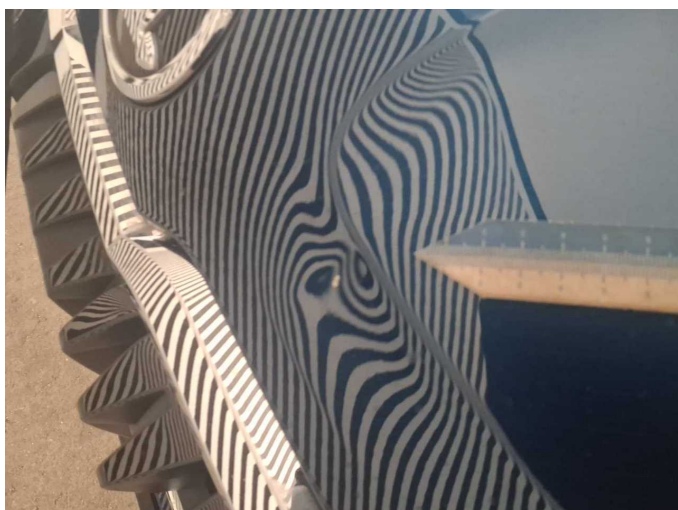

Damage 3: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

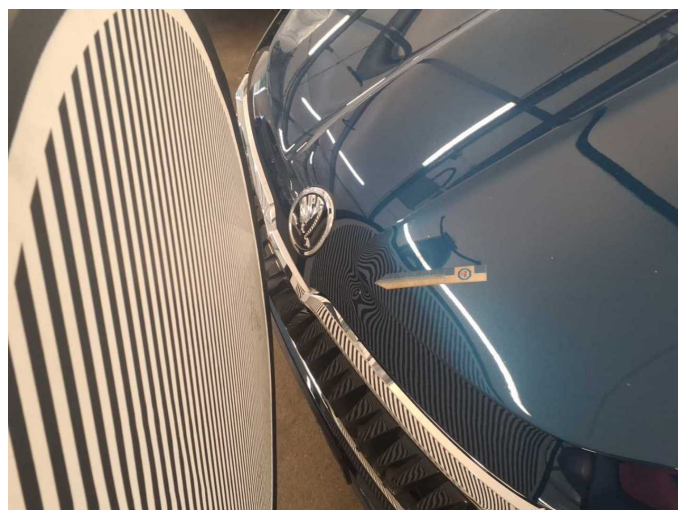


Damage 3: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

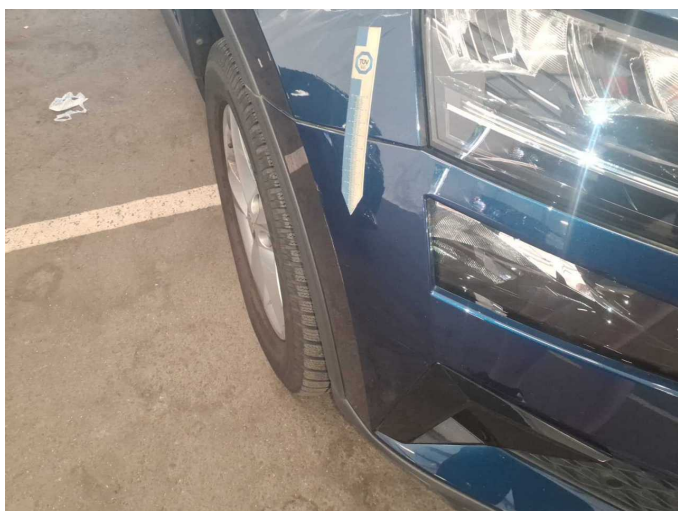

Damage 4: Front bumper: Front bumper (+Radlauf, + Spoiler) - Damaged - repair according to calculation




Damage 4: Front bumper: Front bumper (+Radlauf, + Spoiler) - Damaged - repair according to calculation

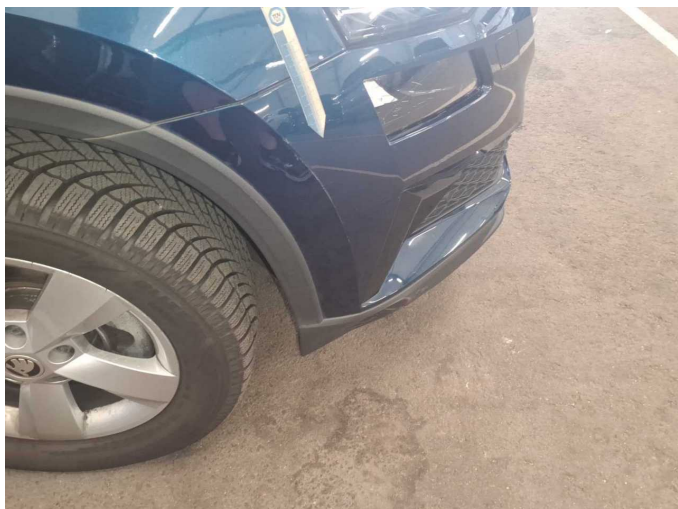


Damage 4: Front bumper: Front bumper (+Radlauf, + Spoiler) - Damaged
- repair according to calculation



Damage 4: Front bumper: Front bumper (+Radlauf, + Spoiler) - Damaged
- repair according to calculation

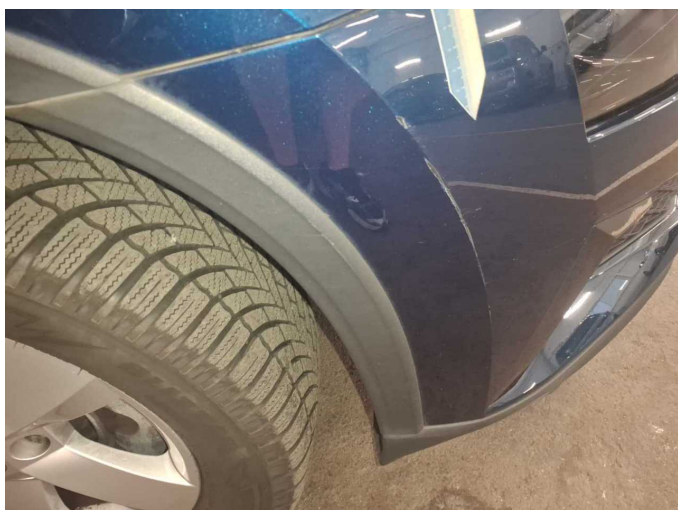

Damage 4: Front bumper: Front bumper (+Radlauf, + Spoiler) - Damaged
- repair according to calculation

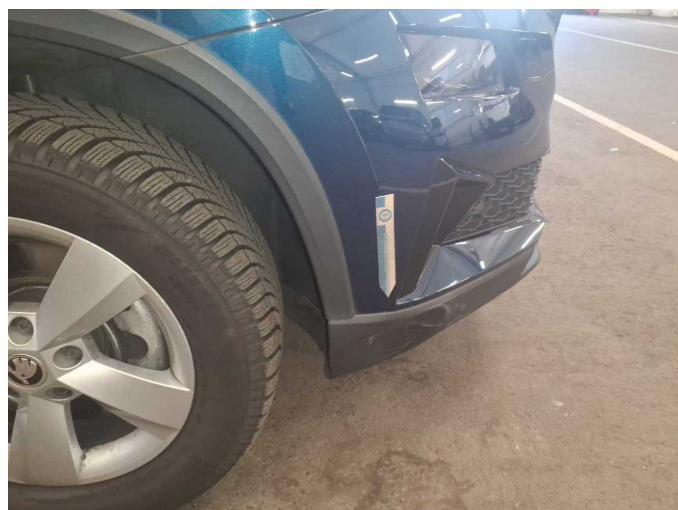

Damage 4: Front bumper: Front bumper (+Radlauf, + Spoiler) - Damaged
- repair according to calculation



Damage 4: Front bumper: Front bumper (+Radlauf, + Spoiler) - Damaged
- repair according to calculation



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right




Accident 1: Side right



Accident 1: Side right



Accident 1: Side right

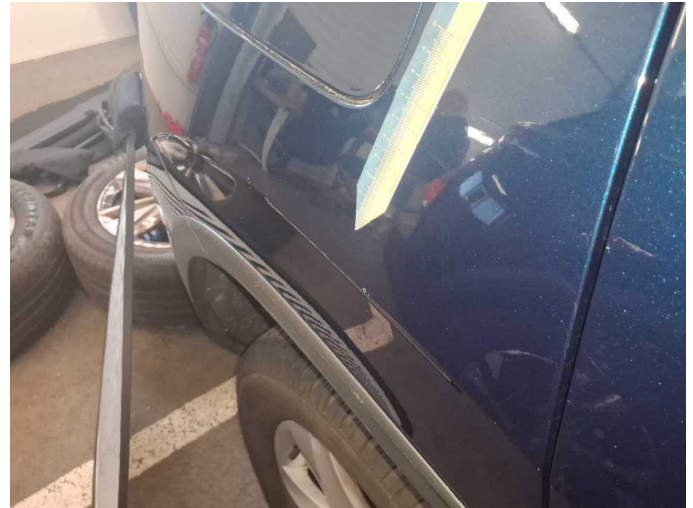

Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJF7NU3PC217624

Hersteller / Modell: SKODA SKODA Karoq 2.0 TDI SCR DSG Ambition

Datum	KM-Stand	Beschreibung
04.02.2025	31.640	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.03.2024	14.758	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges