



Expertise

Protocol number: 46605708
Order No. / Reference: 26699673
Inspection date: 16 Jul 2026

Manufacturer: Ford

Model: Transit Connect 220 L2 Trend

VIN: WF0SXXWPGSNR61459



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Connect 220 L2 Trend	
Vehicle Identification number	WF0SXXWPGSNR61459
Mileage (Read)	46,174 km
First registration	24 Jan 2023
Number of holders	1
Fuel type	Petrol
Engine displacement / Cylinder	999 ccm / 3
Power	74 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frost-Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	24 %
Last service on / at	01/2025 at 30,932 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP475094
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BHA 00583		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,175 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, electrically adjustable and heated
- Battery, reinforced
- Rubberized flooring, front
- Front overhead storage shelf (across the entire width of the interior, including side grab handles)
- Third brake light
- Front electric windows (with one-touch down function for driver's side)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Transmission: 6-speed transmission
- Glove compartment with lid
- Front air conditioning including semi-electronic recirculation system
- Cargo area lining, side, half-height
- Alternator/Generator
- Fog light
- Emergency brake light (hazard warning flashing activated during heavy braking)
- Wheels: Tire repair kit
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Side protection strips, plastic
- Emergency Brake Assist (EBA)
- Seat belts (front seat belt tensioners and force limiters - warning system for unfastened seat belts for driver and front passenger)
- Seats: Seat package 4 (driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - single passenger seat, 2-way manually adjustable (forward/backward/backrest) - headrests, height-adjustable - lumbar support, manual (driver's seat) - "Capitol/City" fabric in Ebony (black))
- Daytime running light
- Child safety lock on sliding doors
- Lashing eyes
- Heat-insulating glazing, lightly tinted
- Driver's side airbag
- Exterior mirrors, narrow mirror format
- Hill start assist
- On-board computer including outside temperature display
- Double-leaf rear doors without windows
- Tachometer
- Electronic Stability Program (ESP) (with Traction Control (TCS) including Torque Vectoring Control and Adaptive Load Control)
- FordPass Connect (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - incl. live traffic information in real time (in conjunction with Ford navigation system incl. Ford SYNC 3) - incl. Wi-Fi hotspot)
- Front interior lighting with delay function
- Paint finish: Solid
- Cargo area floor protection plastic, molded
- Steering column, adjustable in height and reach
- Center console, front (open with storage area, 2 cup holders)
- Gasoline particulate filter (GPF)
- Radio: Ford Audio System 2 (DAB/DAB+ radio - FM/AM radio - USB port - Bluetooth interface - Steering wheel audio remote control)
- Sliding door at rear, right
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Automatic security door lock (45 sec.) (Automatic relocking if no door is opened within 45 seconds of unlocking via remote control)
- Sun visor for driver and front passenger
- Start-stop system
- Dust and pollen filter
- Power outlet: 12-volt connection on the front center console
- Front bumper and rear bumper end caps painted in body color
- Partition wall to the cargo area without window
- Door handles, black
- Electronic immobilizer (EPATS)
- Central locking with remote control (door lock only on driver's door - 2 keys, one of which is a remote control key)

Extra equipment

- Cargo area lighting, LED
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, Apple CarPlay, Android Auto, live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- Front and rear parking pilot system
- Seats: Seat package 18 (fabric "Capitol/City" in Ebony (black) - Double passenger seat (with storage compartment under smaller seat section), variably foldable and collapsible - Driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - Headrests, height-adjustable - Lumbar support, manually adjustable (driver's seat))
- Partition wall to the cargo area with pass-through opening, no window



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Wheel cover - front right side - Scratched - Loss in value
2	Wheel / tyres	Wheel cover - rear right side - Scratch(es) - Loss in value
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Sill - left side	Sill - Scratch(es) - Smart repair
5	Rear bumper	Bumper - rear right side - Scratch(es) - Smart repair
6	Body	Body - Glued / labelled - De-glue / neutralise
7	Rear bumper	Rear bumper - Scratched - Replace
8	Side panel - rear left side	Side panel - dent(s) - Repair and paint
9	Front bumper	Front bumper - Scratched - Paint
10	Boot lid / rear door	Rear door - left side - Dent / paintcoat damage - Repair and paint
11	Boot lid / rear door	Rear door - right side - Dent / paintcoat damage - Repair and paint
12	Roof	Roof - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Interior	Interior (Hinten) - Dent / paintcoat damage - No deduction
2	Trim / covers	Door trim - front left side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 4 Feb 2026	2.751,57 €

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Side panel - rear right side

211 µm

Door - rear right side

199 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Fahrzeug beklebt, verborgene Schäden können nicht ausgeschlossen werden. Schadenausweitung möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

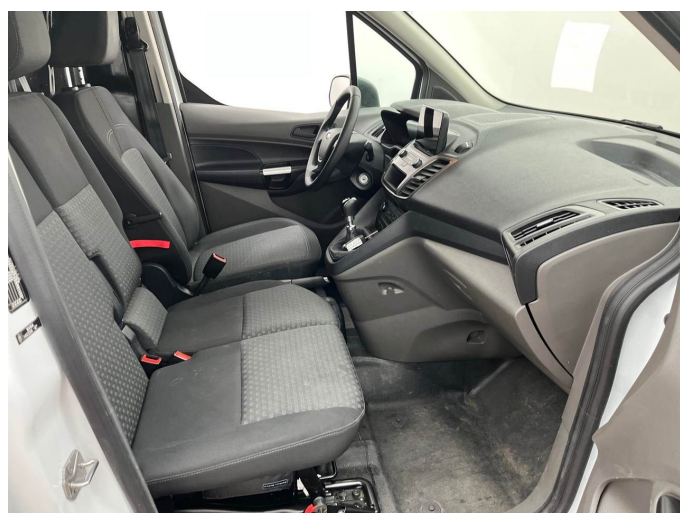


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

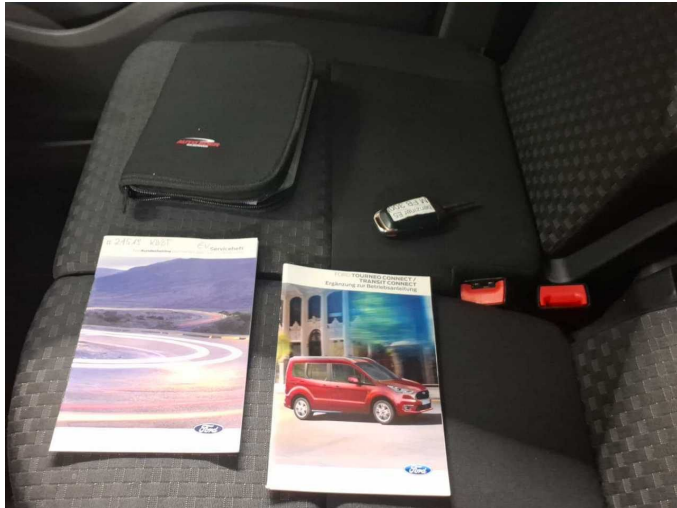


Figure 13: Documents



Figure 14: Documents

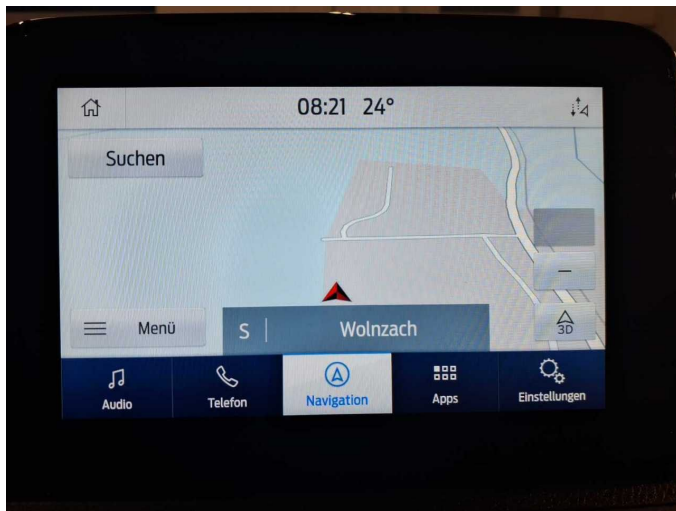


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

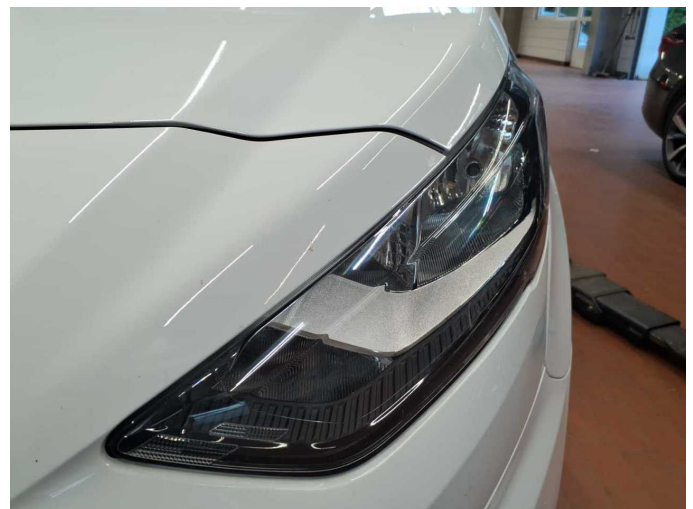


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

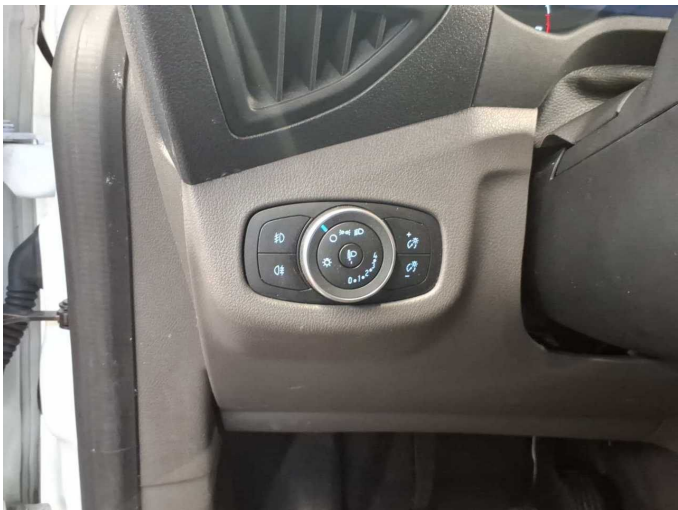


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

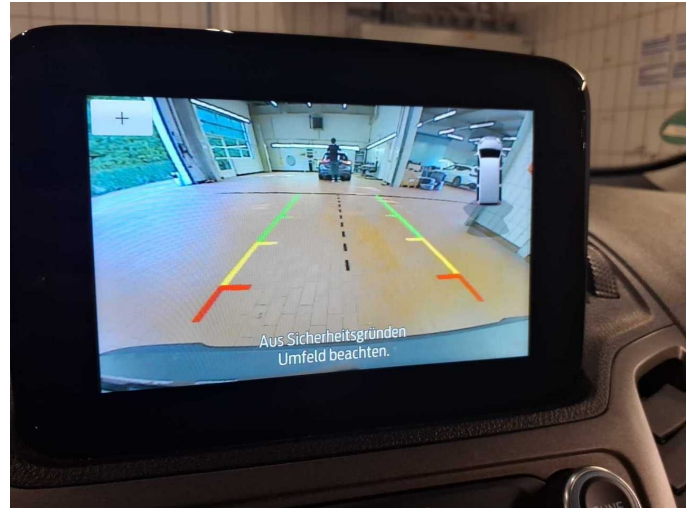


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Wheel / tyres: Wheel cover - front right side - Scratched - Loss in value



Damage 1: Wheel / tyres: Wheel cover - front right side - Scratched - Loss in value



Damage 2: Wheel / tyres: Wheel cover - rear right side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Wheel cover - rear right side - Scratch(es) - Loss in value



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 5: Rear bumper: Bumper - rear right side - Scratch(es) - Smart repair



Damage 5: Rear bumper: Bumper - rear right side - Scratch(es) - Smart repair



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise




Damage 6: Body: Body - Glued / labelled - De-glue / neutralise




Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise

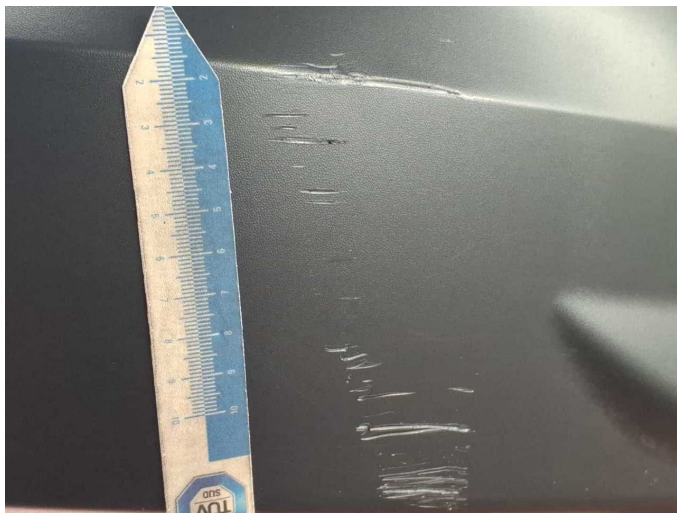


Damage 7: Rear bumper: Rear bumper - Scratched - Replace

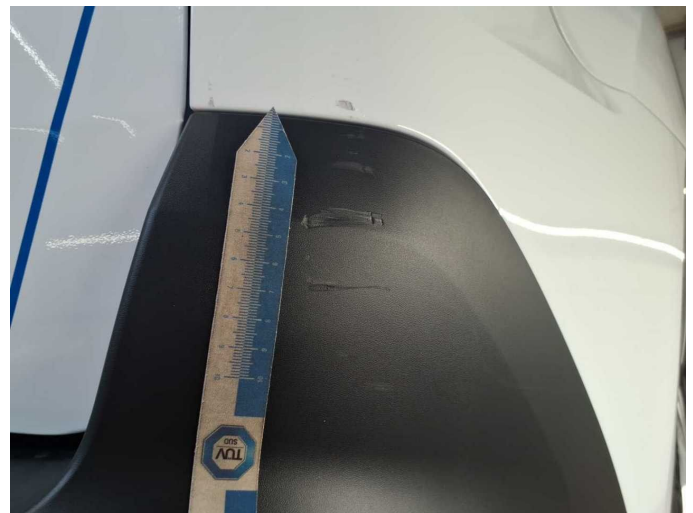

Damage 7: Rear bumper: Rear bumper - Scratched - Replace




Damage 7: Rear bumper: Rear bumper - Scratched - Replace

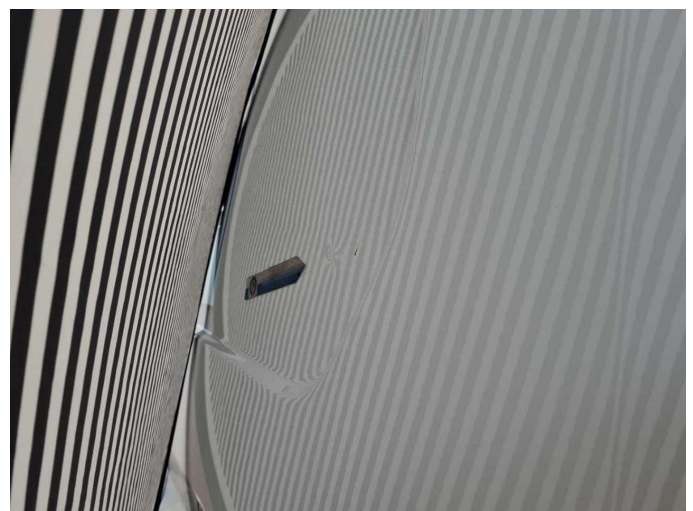

Damage 8: Side panel - rear left side: Side panel - dent(s) - Repair and paint



Damage 8: Side panel - rear left side: Side panel - dent(s) - Repair and paint

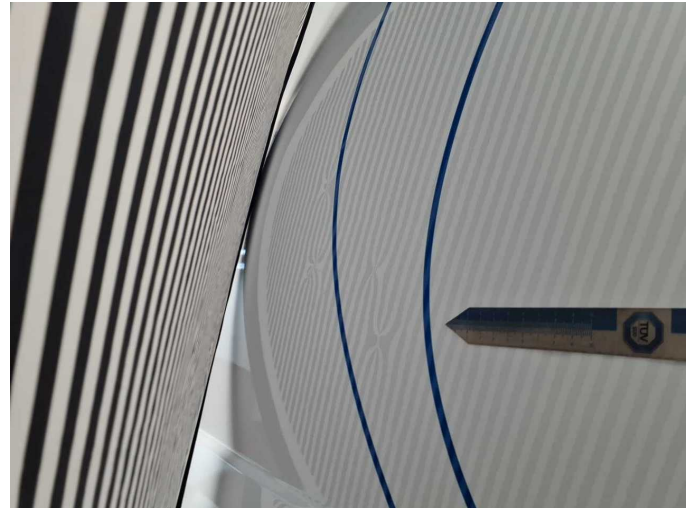

Damage 8: Side panel - rear left side: Side panel - dent(s) - Repair and paint



Damage 8: Side panel - rear left side: Side panel - dent(s) - Repair and paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint




Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint

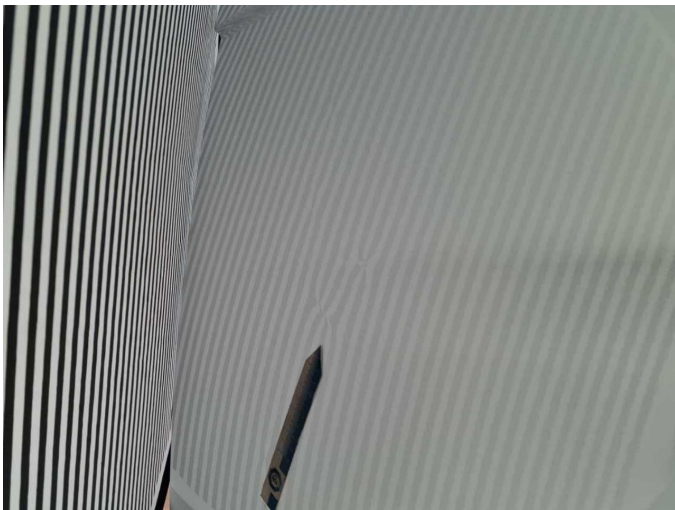

Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint




Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint

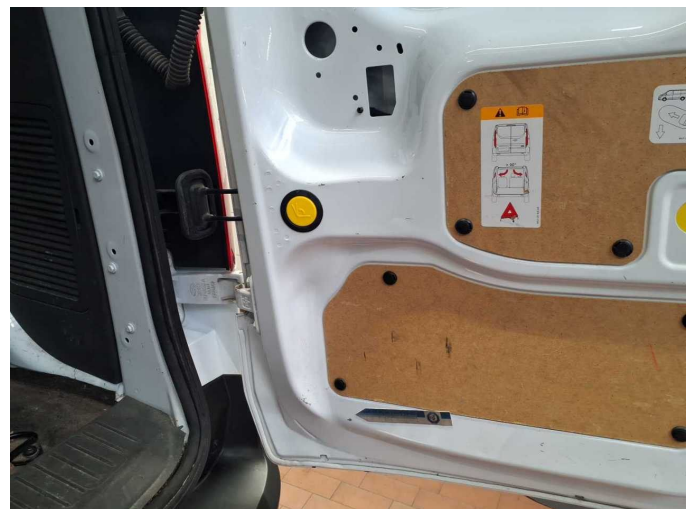

Damage 11: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint




Damage 12: Roof: Roof - Scratch(es) - Paint



Damage 12: Roof: Roof - Scratch(es) - Paint




Damage 12: Roof: Roof - Scratch(es) - Paint

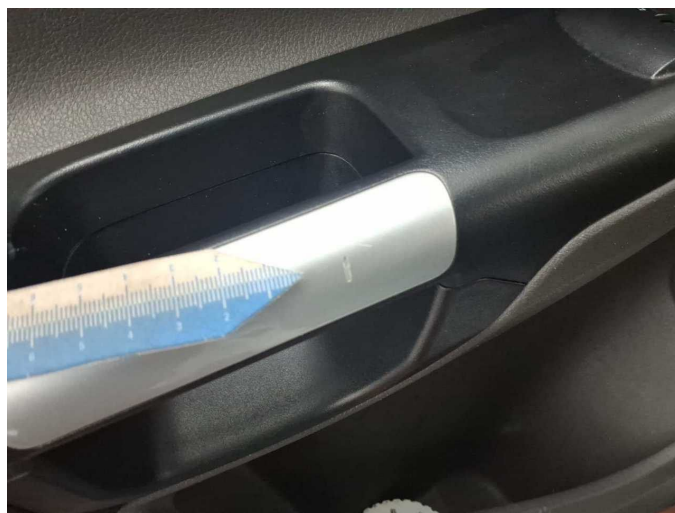

Wear and tear 2: Trim / covers: Door trim - front left side - Scratch(es) - No deduction



Wear and tear 2: Trim / covers: Door trim - front left side - Scratch(es) - No deduction

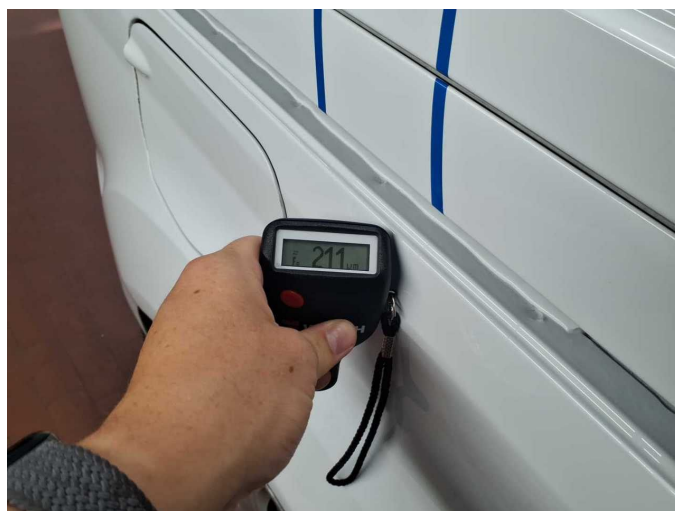

Repainting 1: Side panel - rear right side



Repainting 2: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0SXXWPGSNR61459
Hersteller / Modell: FORD FORD Transit Connect 220 L2 Trend

Datum	KM-Stand	Beschreibung
10.01.2025	30.932	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges