



Expertise

Protocol number: 46898058
Order No. / Reference: 26737203
Inspection date: 5 Aug 2026

Manufacturer: Ford

Model: S-Max 2.5 Duratec FHEV TREND

VIN: WF0JXXWPCHNG12283



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford S-Max 2.5 Duratec FHEV TREND	
Vehicle Identification number	WF0JXXWPCHNG12283
Mileage (Read)	131,570 km
First registration	23 Jun 2023
Number of holders	1
Fuel type	Hybrid Petrol / E
Engine displacement / Cylinder	2,488 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 1
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Blue Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	Yes (not ozone-treated)



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	56 %
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP507339
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BVI 00082		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,350 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/55 R17 103W	Summer tyres on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Equipment

- Klimaautomatik

Standard equipment

- Anti-lock braking system (ABS)
- Attachment points for safety partition grilles
- Hill start assist
- Overhead console with glasses storage compartment and child observation mirror
- High Beam Assist
- Ford Easy Fuel
- Ford Power Start function
- FordPass Connect including eCall and Wi-Fi hotspot
- Luggage compartment lighting
- Back window, heater
- Interior lighting with delay circuit
- Intelligent Protection System (IPS)
- Electric child safety lock
- Rear headrests (3)
- Steering wheel: Steering column, adjustable in height and reach
- Front center console with padded armrest
- Fog light
- Front and rear parking pilot system
- Radio: Ford SYNC 3
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Electromechanical power steering
- Seats: Driver and passenger seats, 4-way manually adjustable
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- Traffic sign recognition system
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats

Extra equipment

- Adaptive cruise control with pre-collision assist and pedestrian detection (distance display and distance warning, forward alert system (FA) and active emergency braking assist - intelligent speed limiter - traffic jam assist with stop&go function)
- Detachable towbar (including ESP trailer stabilization)
- Paint finish: Metallic
- Safety partition net behind the 2nd row of seats
- Seats: Front seats can be heated individually and variably.
- Side windows from the 2nd row of seats and rear window, dark tinted.

- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- third brake light
- Tachometer
- Electric windows front and rear
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- luggage compartment cover
- Transmission: CVT automatic
- rear window wiper
- Interior mirror, automatically dimming
- Isofix bracket
- Air conditioning with automatic temperature control
- Front headrests, 4-way height and tilt adjustable
- Steering wheel: Multifunction leather steering wheel
- Reading lights front and rear
- MyKey key system (individually programmable second key)
- Emergency brake light
- Upholstery: Cloth
- Tire repair kit
- LED taillights
- Headlight dipped beam with switch-off delay including "greeting function"
- Seats: 2nd row of seats with 3 individual seats (FoldFlat System)
- Seats: Front sports seats
- Daytime running light
- Premium carpet floor mats, front and rear
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control

- Package: Business Package II (Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+, acoustic and visual route guidance, live traffic in conjunction with FordPass, enhanced voice control and voice output, Michelin travel guide, quick destination search for addresses and points of interest in one input field - Adaptive LED headlights (Ford Dynamic LED) with glare-free high beam - Anti-theft alarm system including double locking (with interior monitoring) - Rearview camera)
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires (in 10x2-spoke design in Pearl Grey premium paint finish)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
3	Door - rear right side	Door - Scratch(es) - Smart repair
4	Door - front left side	Door - Scratch(es) - Smart repair
5	Door - front left side	Door edge - Scratch(es) - Smart repair
6	Interior	Interior (Raucherfahrzeug) - Odour - Ozone treatment
7	Side panel - rear right side	Elbow - Dent / paintcoat damage - Smart repair
8	Seat - front	Seat cover - left side - Damaged - Replace
9	Front bumper	Spoiler - Scratched - Paint
10	Side panel - rear left side	Elbow - Scratch(es) - Paint
11	Bonnet	Bonnet - Stone chips - Paint
12	Rear bumper	Rear bumper - Scratch(es) - Paint
13	Boot lid / rear door	Boot lid (Rostansatz) - Corrosion - Paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

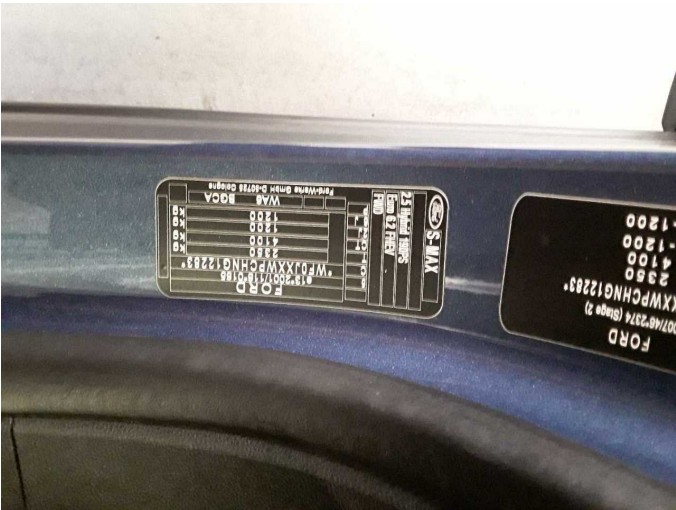


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 3: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 3: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 7: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Smart repair



Damage 7: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Smart repair



Damage 7: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Smart repair



Damage 8: Seat - front: Seat cover - left side - Damaged - Replace



Damage 8: Seat - front: Seat cover - left side - Damaged - Replace



Damage 9: Front bumper: Spoiler - Scratched - Paint




Damage 9: Front bumper: Spoiler - Scratched - Paint



Damage 10: Side panel - rear left side: Elbow - Scratch(es) - Paint




Damage 10: Side panel - rear left side: Elbow - Scratch(es) - Paint

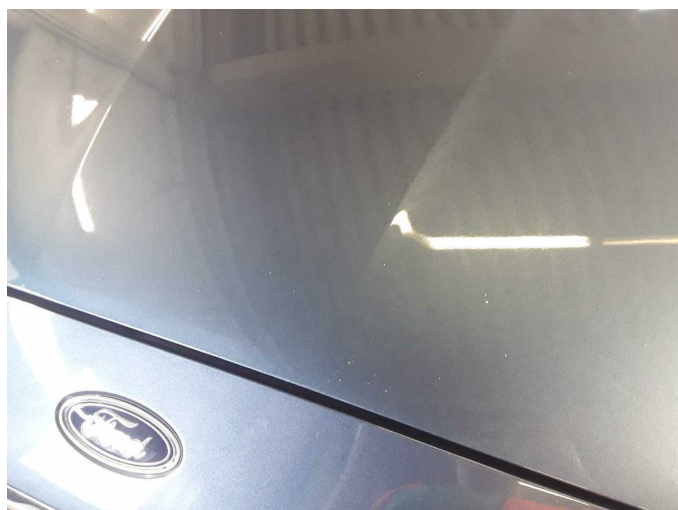

Damage 11: Bonnet: Bonnet - Stone chips - Paint



Damage 11: Bonnet: Bonnet - Stone chips - Paint

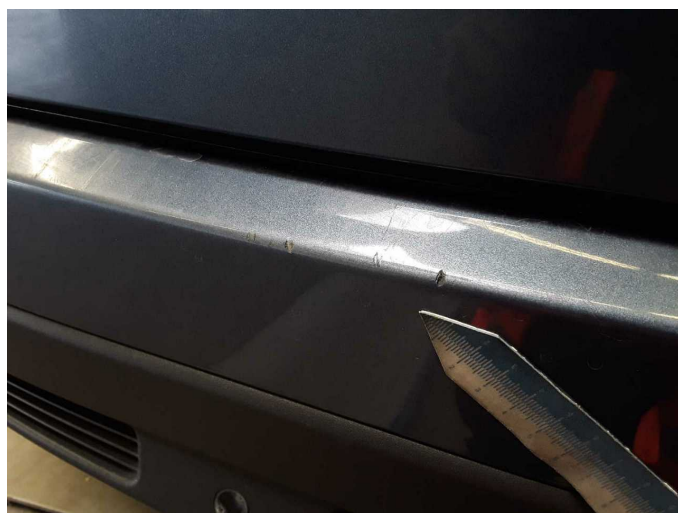


Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint

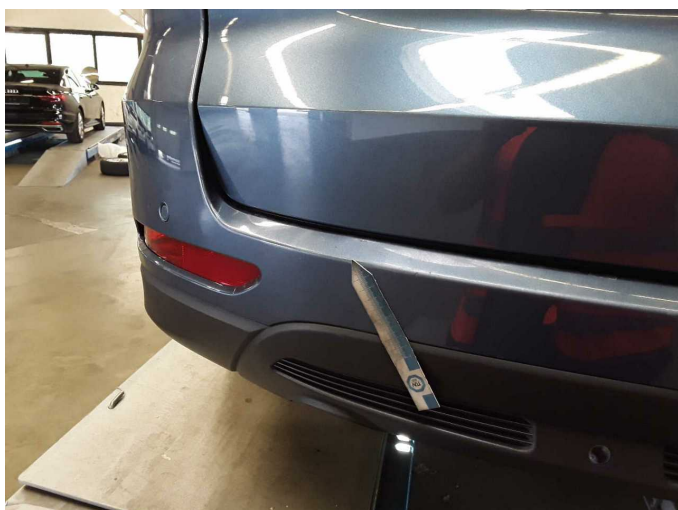

Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 13: Boot lid / rear door: Boot lid (Rostansatz) - Corrosion - Paint



Damage 13: Boot lid / rear door: Boot lid (Rostansatz) - Corrosion - Paint



Damage 13: Boot lid / rear door: Boot lid (Rostansatz) - Corrosion - Paint