



Expertise

Protocol number: 46776759
Order No. / Reference: 26841746
Inspection date: 29 Jul 2026

Manufacturer: Opel

Model: Grandland 1.5 D Automatik Enjoy

VIN: W0VZCYHZ4R6022566



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Grandland 1.5 D Automatik Enjoy

Vehicle Identification number W0VZCYHZ4R6022566

Mileage (Read) 116,887 km

First registration 11 Jun 2024

Number of holders 1

Next periodical technical inspection 06/2027
(Report not on hand)

Fuel type Diesel

Engine displacement / Cylinder 1,499 ccm / 4

Power 96 kW

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle SUV

Colour / colour code Silver Metallic

Doors / Seats 5 / 5

Upholstery type Cloth / leather
combination

Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	28,500 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB474210
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AHG 00288		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 103V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	215/65 R17 103V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 ignition keys, both foldable
- Driver and passenger side airbags
- Airbag: Front and side airbags
- Airbag: Head airbags, front and rear outer
- Ambient lighting, center console and in the front door pockets
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag and seatbelt tensioner)
- Hill Start Assist
- Roof design line in chrome
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Front collision warning (automatic emergency braking, pedestrian detection, lane keeping assist, traffic sign recognition, driver drowsiness detection, blind spot warning)
- Transmission: 8-speed automatic
- rear window wiper
- Child safety lock in the rear doors, manual
- Dual-zone automatic climate control including rear footwell heating (with separate temperature control for driver and front passenger - manual recirculation - automatic air distribution - sun sensor - particle and odor filter)
- Leather steering wheel, flat-bottomed, with steering wheel remote control
- Center armrest, sliding, front, including storage compartment and cup holder
- Quickheat heating system
- Radio accessories: Digital radio reception DAB+ (Offers a wider selection of radio programs. Digitally broadcast radio stations and traffic information can be received.)
- Rain sensor
- Tire pressure warning
- Wheels: Light alloy 7 J x 17, (5 double spokes) (with tires 215/65 R 17)
- Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack))
- Side windows heavily tinted
- Seat belts (three-point seat belts in all seats - height-adjustable seat belts, front - belt force limiters, front and rear outer seats - double belt tensioners, front - belt tensioners, rear outer seats - warning tone and light for unfastened seat belts, front and rear)
- Start/Stop System (Reinforced starter motor - High-performance battery - Switch to deactivate the start/stop function)
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer (and for ISOFIX child seat mounting system on the front passenger seat)
- Storage compartments (storage compartment in the instrument panel, driver's side - storage compartment in the center console, front - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 1.0-liter beverage bottles - illuminated glove compartment with cooling and heating function - bag hooks, on the side in the luggage compartment - lashing eyes in the luggage compartment)
- Exterior mirrors, electrically adjustable and heated, manually foldable
- On-board computer
- Decorative strips, Erino/Palladium Medium
- Third brake light
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Cruise control with intelligent speed limiter (The intelligent speed limiter, in conjunction with traffic sign recognition, allows for rapid speed adjustment)
- Heated rear window
- Interior lighting, front and rear (with reading lights front and rear - luggage compartment lighting)
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- LED headlights (LED taillights - LED front turn signals - manual headlight range control - high beam assist)
- Steering wheel, height and reach adjustable
- Illuminated makeup mirror in sun visor, for driver and front passenger
- Front and rear parking sensors
- Radio: Multimedia Radio (with 7" touchscreen and fully digital 12" driver information display - Bluetooth audio streaming - Automatic music recognition - Hands-free system - Phonebook and call list display - Smartphone integration via Apple CarPlay and Android Auto - Display and operation of selected apps and functions via the 7" touchscreen or voice control, e.g., navigation, music, telephone - Text message reading and dictation - Steering wheel controls - 6 speakers, 4 x 20 watts, FM/AM - USB - Graphic equalizer - Dual tuner)
- Speed-sensitive power steering
- Seats: Comfort seats, front (Berson Black fabric - driver's seat manually adjustable in length, height and backrest angle, and passenger seat manually adjustable in length and backrest angle)
- Seats: Rear seat backrest split 40:60 and foldable
- 12-volt power outlet (in the center console, front)
- Bumpers and side panels in high-gloss black
- Traction control TC Plus
- Immobiliser
- Central locking with remote control and interior switches



Extra equipment

- Paint finish: Metallic
- safety net
- Package: Infotainment package (Multimedia Navi Pro with 10" touchscreen color display - OpelConnect (incl. emergency call/ breakdown call, vehicle status) - Wireless Charging)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Side panel - rear left side	Sill - dent(s) - Smooth repair work
4	Roof	Roof - dent(s) - Smooth repair work
5	Instrument panel	Air nozzle - centre (Hinten) - Broken / torn - Replace
6	Trim / covers	Roof lining - Loose - Repair
7	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
8	Engine	Engine - Leaking - Perform diagnosis
9	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
10	Trim / covers	Trim / covers (Ablagefach) - Broken / torn - Replace
11	Door - front right side	Door - Dent / paintcoat damage - Smart repair
12	Instrument panel	Air nozzle - centre - Broken / torn - Replace
13	Roof	Roof - Stone chips - Loss in value
14	Engine	Engine cover - Damage caused by marten / rodent - Replace
15	Body	Underbody panelling - Broken / torn - Replace
16	Interior	Boot cover / roller cover - Broken / torn - Replace
17	Bonnet	Bonnet - Corrosion - Paint
18	Vehicle glazing	Windscreen (Randbereich) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Dent / paintcoat damage - No deduction
2	Door - rear left side	Door - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die Wartungshistorie ist nicht vorhanden und kann somit nicht auf Vollständigkeit geprüft werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

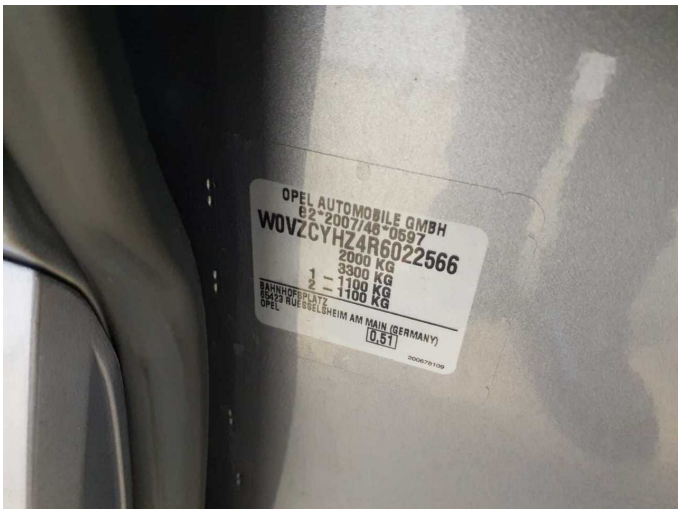


Figure 11: VIN



Figure 12: Mounted tyres

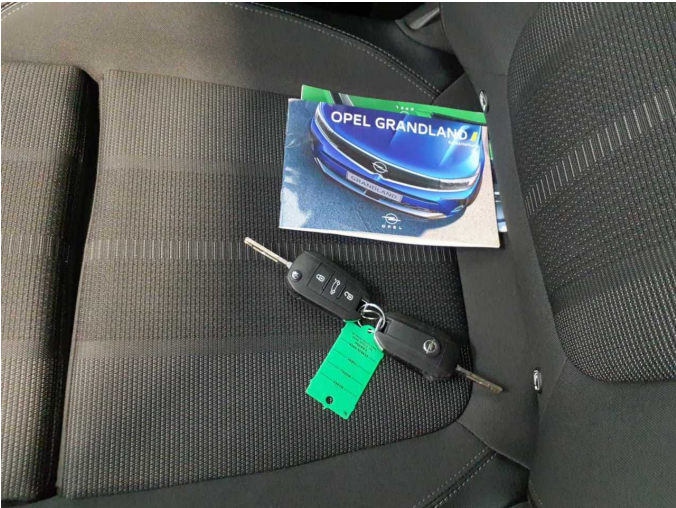


Figure 13: Documents

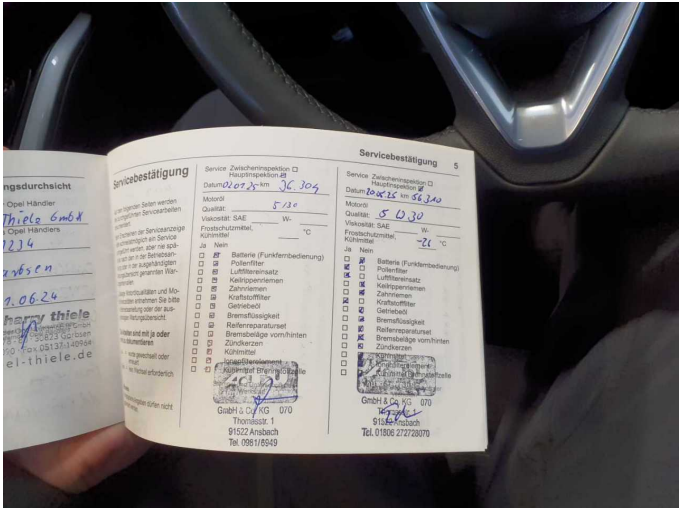


Figure 14: Documents

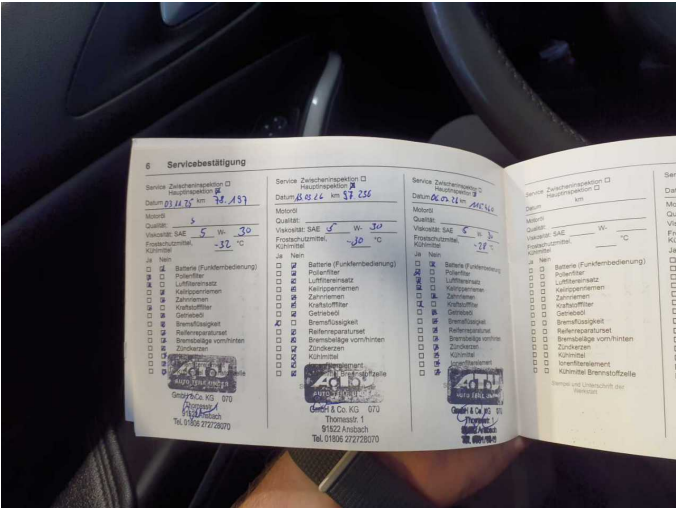


Figure 15: Documents

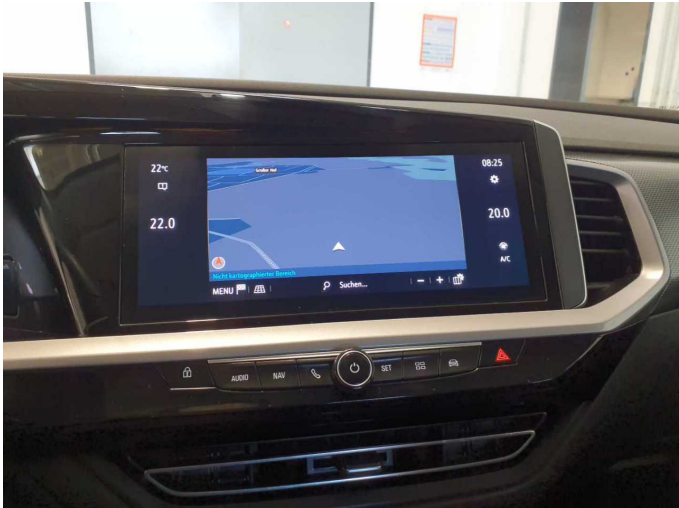


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

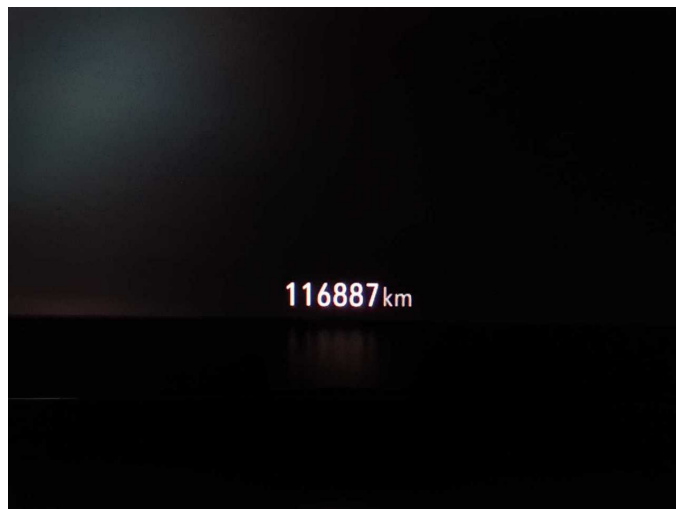


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

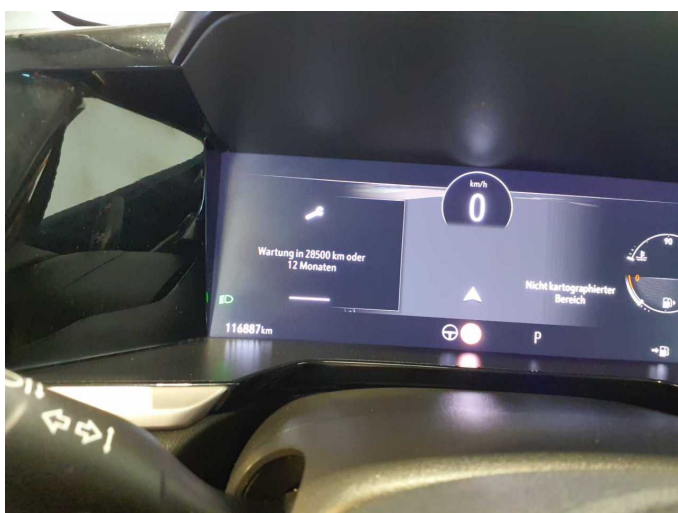


Figure 23: Misc.

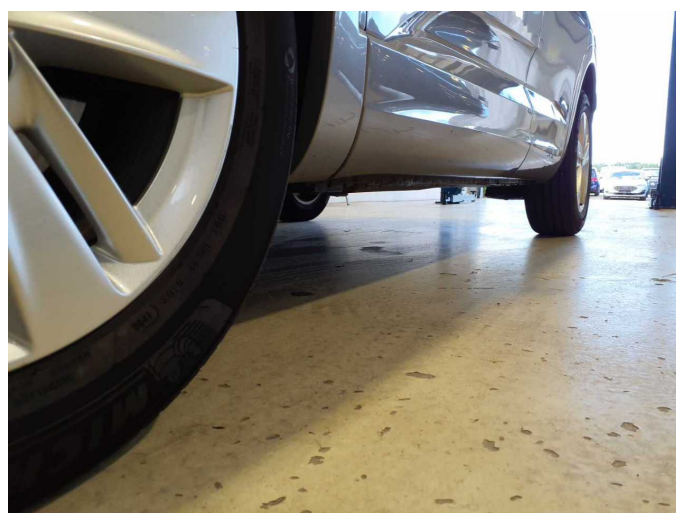


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

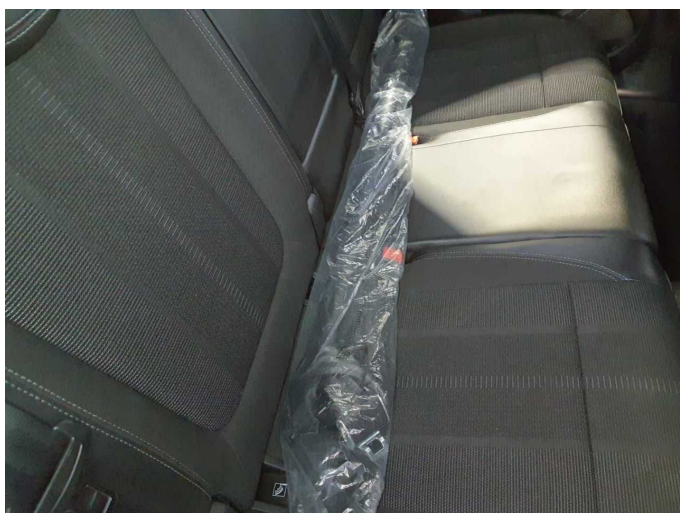


Figure 27: Misc.




Figure 28: Misc.



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair

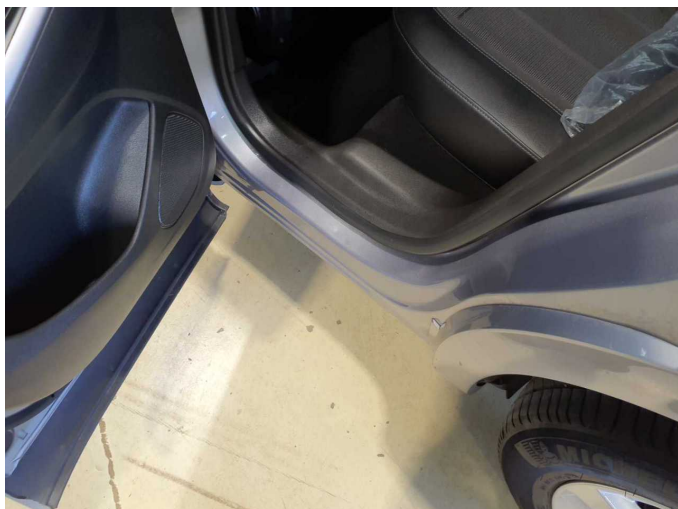


Damage 3: Side panel - rear left side: Sill - dent(s) - Smooth repair work




Damage 3: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 4: Roof: Roof - dent(s) - Smooth repair work

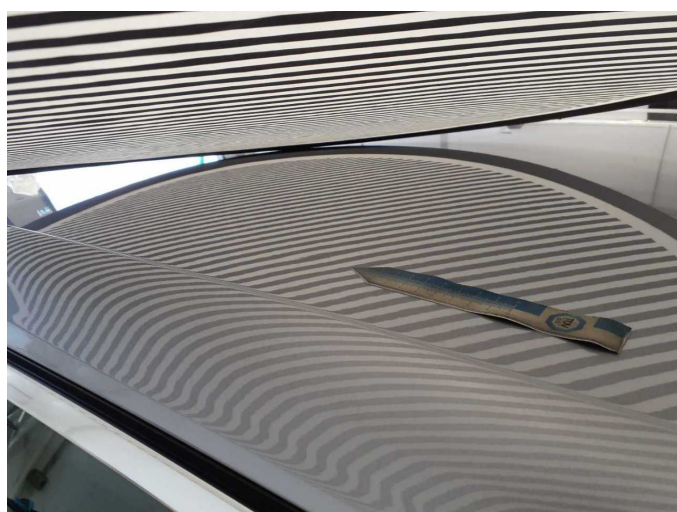

Damage 4: Roof: Roof - dent(s) - Smooth repair work

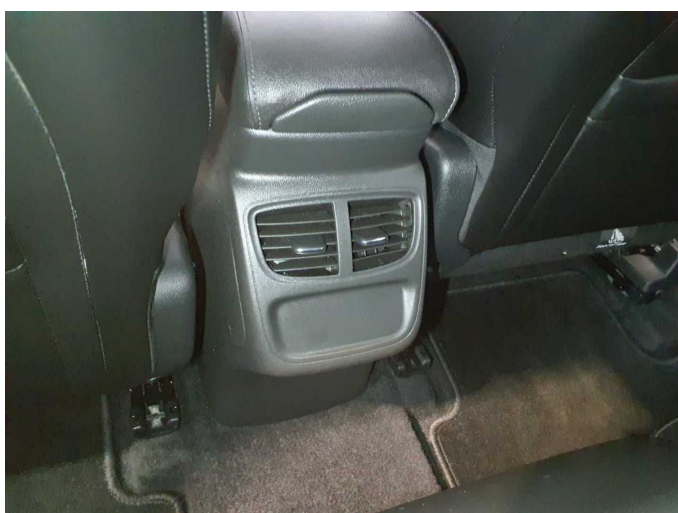

Damage 5: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 5: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace




Damage 6: Trim / covers: Roof lining - Loose - Repair



Damage 6: Trim / covers: Roof lining - Loose - Repair




Damage 7: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

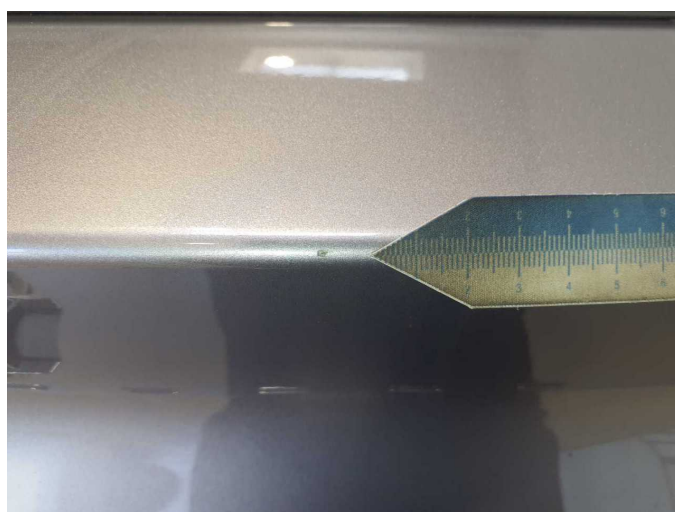

Damage 7: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 8: Engine: Engine - Leaking - Perform diagnosis

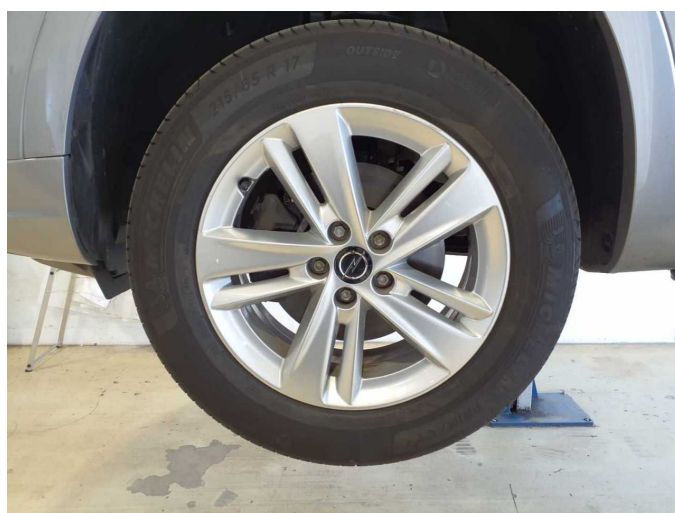

Damage 9: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value

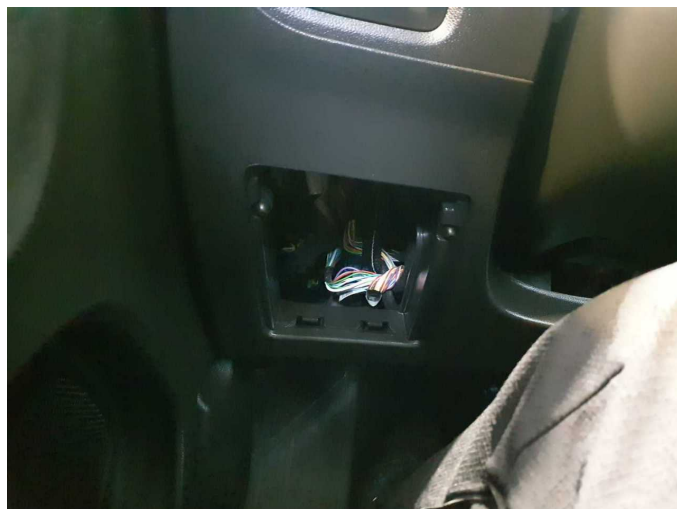


Damage 10: Trim / covers: Trim / covers (Ablagefach) - Broken / torn - Replace




Damage 10: Trim / covers: Trim / covers (Ablagefach) - Broken / torn - Replace



Damage 11: Door - front right side: Door - Dent / paintcoat damage - Smart repair

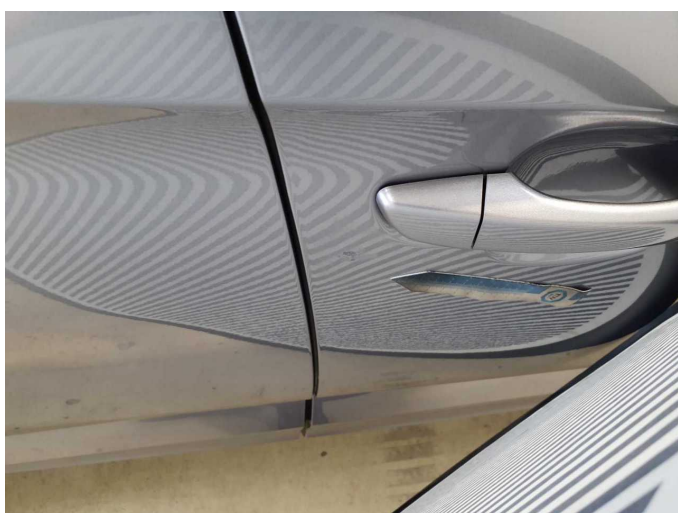

Damage 11: Door - front right side: Door - Dent / paintcoat damage - Smart repair

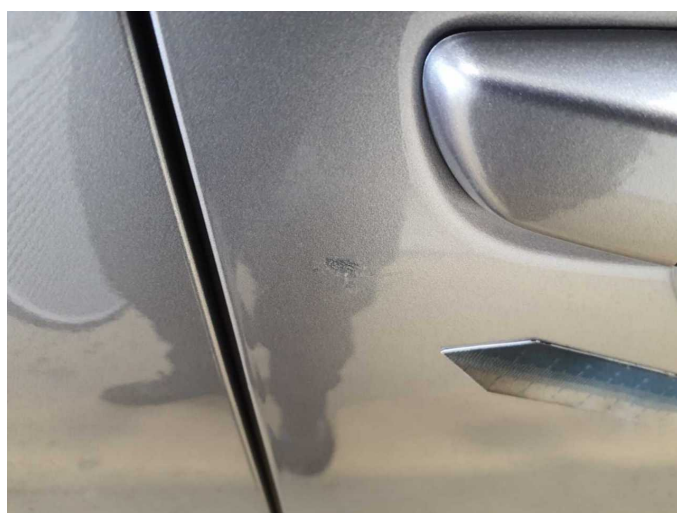

Damage 11: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 12: Instrument panel: Air nozzle - centre - Broken / torn - Replace



Damage 12: Instrument panel: Air nozzle - centre - Broken / torn - Replace




Damage 13: Roof: Roof - Stone chips - Loss in value



Damage 13: Roof: Roof - Stone chips - Loss in value



Damage 14: Engine: Engine cover - Damage caused by marten / rodent - Replace

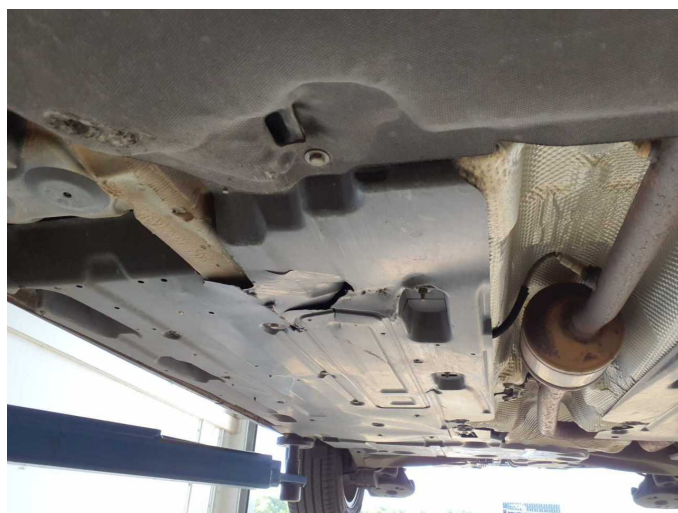

Damage 15: Body: Underbody panelling - Broken / torn - Replace



Damage 15: Body: Underbody panelling - Broken / torn - Replace




Damage 16: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 16: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 17: Bonnet: Bonnet - Corrosion - Paint

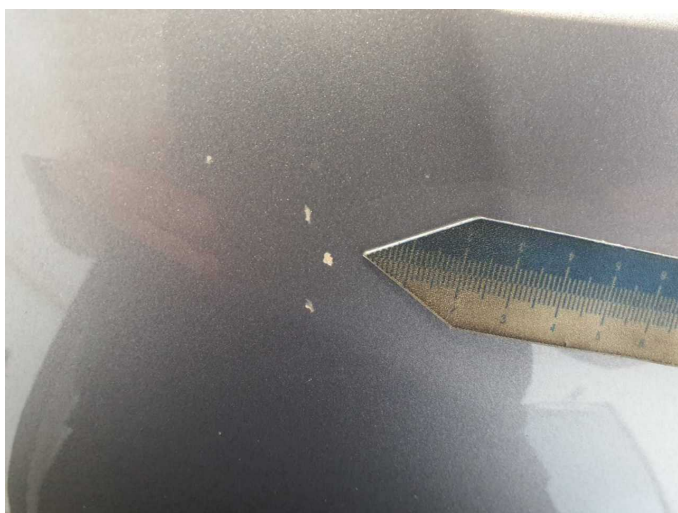

Damage 17: Bonnet: Bonnet - Corrosion - Paint



Damage 17: Bonnet: Bonnet - Corrosion - Paint



Damage 17: Bonnet: Bonnet - Corrosion - Paint



Damage 18: Vehicle glazing: Windscreen (Randbereich) - Stone chips - Replace



Damage 18: Vehicle glazing: Windscreen (Randbereich) - Stone chips - Replace



Wear and tear 2: Door - rear left side: Door - Stone chips - No deduction