



Expertise

Protocol number: 46365872
Order No. / Reference: 26641733
Inspection date: 2 Jul 2026

Manufacturer: Ford

Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System
COOL&CONNECT

VIN: WF0PXXGCHPNT52314



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System COOL&CONNECT	
Vehicle Identification number	WF0PXXGCHPNT52314
Mileage (Read)	136,717 km
First registration	22 Jun 2022
Number of holders	2
Next periodical technical inspection (Report on hand)	07/2027
Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Moondust Silver Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite
Vehicle with smoke odor	Yes (not ozone-treated)
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	23 %
Last service on / at	12/2025 at 113,490 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK825642
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	With complaint
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8566 / BPV 00642		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,955 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Hankook	4mm / 4mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- Tires: 6.5 J x 16 design wheels (4) with 205/60 R16 tires (in 5-spoke design, in black-silver)
- Fabric headliner
- Roof spoiler painted in car color
- Tachometer
- Driver information system with on-board computer, color (10.7 cm screen diagonal)
- Electronic parking brake
- Luggage compartment cover
- Speed limiter
- Transmission: 6-speed manual transmission
- Back window, heater
- Interior lighting with LED technology
- Isofix bracket
- Headrests: 2 front and 3 rear, height adjustable
- Leather gear knob
- Adjustable steering column
- Center console "Premium" front
- Front and rear parking pilot system
- Post-Collision Assist
- Radio: Ford SYNC 3 Light with AppLink, 8" touchscreen and DAB/DAB+
- Headlight assistant with day/night sensor
- Seats: Passenger seat height-adjustable, manually
- Seats: Map grid on the driver's and front passenger's seat backrests
- Start-stop system
- Carpet floor mats in the front
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Attachment points behind the second row of seats for mounting the safety partition net
- Hill start assist
- Roof rails, black
- Diesel particulate filter (DPF)
- Electronic Safety and Stability Program (ESP)
- Lane keeping assist including lane keeping assist
- Electric windows front and rear
- FordPass Connect including eCall, live traffic information (only with navigation) and Wi-Fi hotspot
- Cruise control
- Illuminated glove compartment
- Rear window wiper
- Intelligent security system
- Air conditioning, manual
- LED headlights
- Steering wheel: 3-spoke design
- Make-up mirrors in driver and passenger sun visors
- MyKey key system (individually programmable second key)
- Upholstery: Cloth
- Pre-Collision Assist
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Tire Pressure Monitoring System (TPMS)
- Electromechanical speed-dependent power steering
- Seats: Driver's seat height adjustable
- Seats: Rear seat backrest
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Central locking with remote control and remote luggage compartment release



Extra equipment

- Paint finish: Metallic
- Package: Driver Assistance Package I (Intelligent cruise control, adaptive; traffic sign recognition system; wrong-way driver warning function; evasive steering assist; distance display and distance warning; driver drowsiness detection; high beam assist (in conjunction with adaptive LED matrix headlights with glare-free high beam assist); blind spot assist with cross traffic alert including emergency braking function (when reversing out of parking spaces) and trailer detection; reversing camera with split-view technology; electrically folding exterior mirrors with surround-view function.)
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Safety partition net for luggage compartment
- Fuel-operated auxiliary heater
- Navigation: Ford SYNC 3 with AppLink, 8" touchscreen and DAB/ DAB+ (Ford navigation system with AppLink, 8" touchscreen (20.3 cm screen diagonal) - 6 speakers - Android Auto and Apple CarPlay - Bluetooth hands-free system and audio streaming - Steering wheel controls - Radio player - USB port - Voice control via audio and telephone - Acoustic and visual route guidance, dynamic navigation with enhanced traffic information system, lane guidance and road map for Europe)
- Package: Comfort (Air conditioning with automatic temperature control, separately adjustable for driver and front passenger side (2-zone automatic climate control) - Ford Key Free System (keyless locking/unlocking) including Ford Power Start function (keyless start) - Windscreen wipers with rain sensor, variable sensitivity adjustment - Interior mirror, automatically dimming - Exterior mirrors electrically folding and with ambient lighting)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Motorschaden
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Sill - left side	Sill - Scratched - Smart repair
3	Interior	Interior (Rauchgeruch) - Odour - Ozone treatment
4	Side panel - rear right side	Side panel - Dent / paintcoat damage - Smart repair
5	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
6	Trim / covers	Carpet - front left side (mehrere Brandlöcher) - Burn hole (cigarettes) - Smart repair
7	Seat - front	Seat cover - left side - Burn hole (cigarettes) - Replace
8	Braking system	Brake discs and pads - rear - Corrosion - Replace
9	Bonnet	Bonnet - Dent / paintcoat damage - Paint
10	Engine cooling	Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres - Worn - No deduction
2	2nd wheel set	1 alloy rim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description
Equipment - Tirefit complete

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 9 Oct 2025	1.154,04 €
2	Side - left, Provided by user / customer, from 9 Oct 2025	1.200,86 €
3	Side right, Provided by user / customer, from 9 Oct 2025	2.305,91 €

Repainting

No.	Repainting
1	Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - left side	201 µm	Mudguard - left side	163 µm
Mudguard - right side	272 µm	Side panel - rear left side	236 µm
Side panel - rear right side	135 µm	Door - rear left side	226 µm
Door - rear right side	137 µm	Door - front left side	253 µm
Door - front right side	142 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

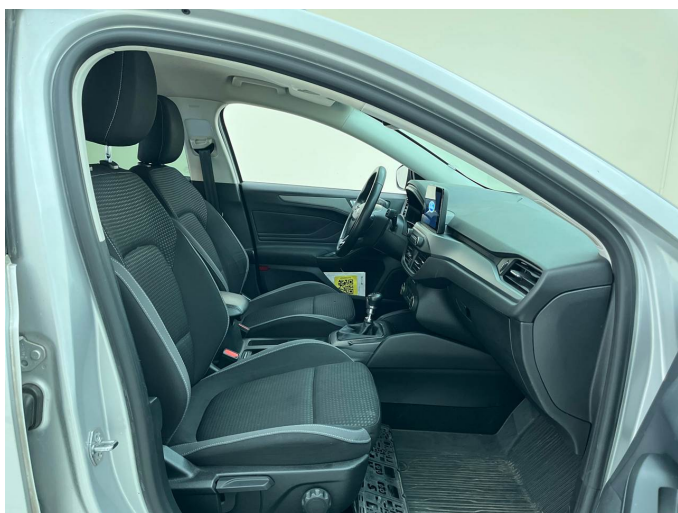


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

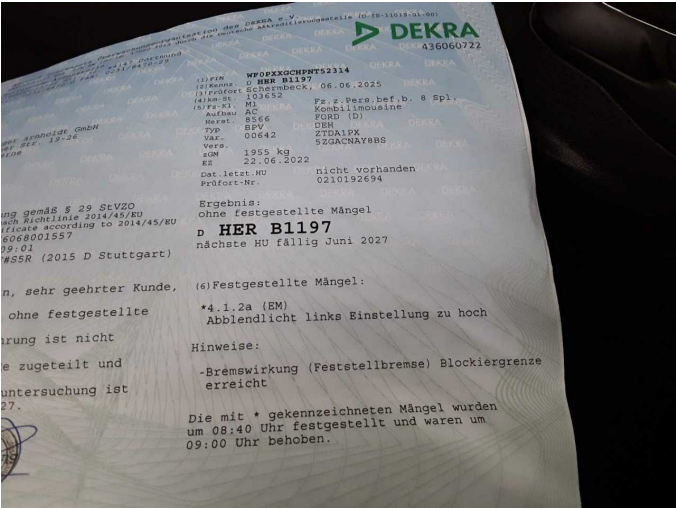


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

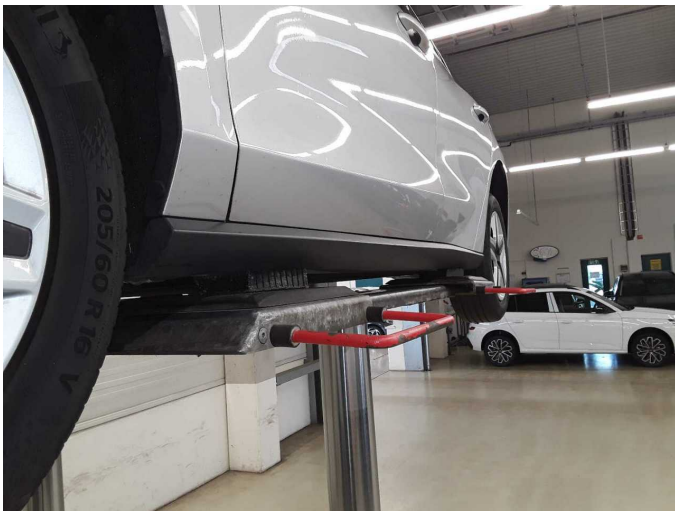


Figure 21: Misc.



Figure 22: Misc.

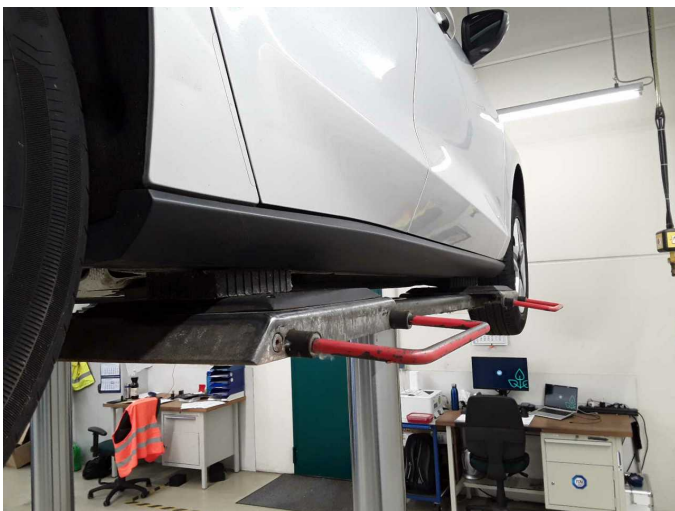


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




Damage 2: Sill - left side: Sill - Scratched - Smart repair



Damage 2: Sill - left side: Sill - Scratched - Smart repair




Damage 3: Interior: Interior (Rauchgeruch) - Odour - Ozone treatment

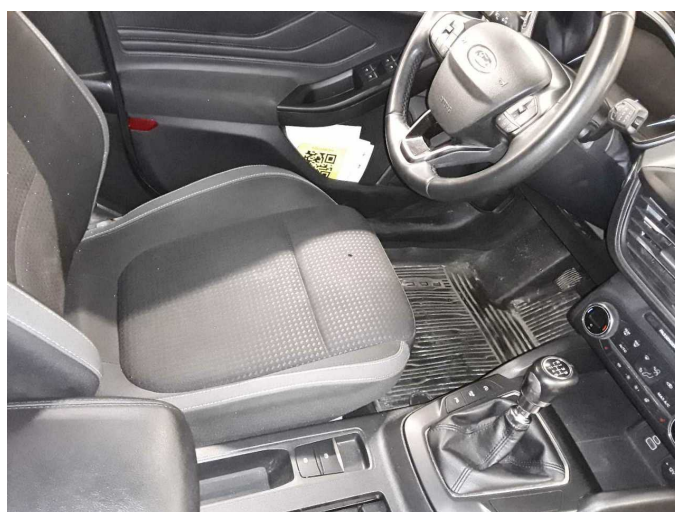

Damage 3: Interior: Interior (Rauchgeruch) - Odour - Ozone treatment



Damage 4: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair

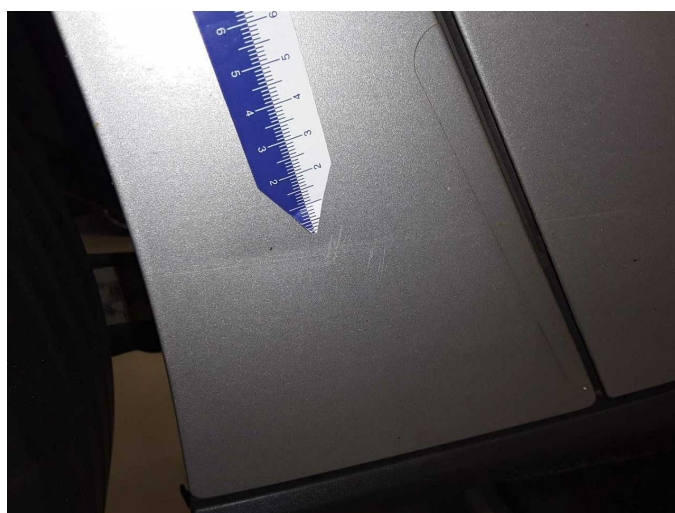

Damage 4: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair




Damage 4: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair



Damage 4: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair



Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

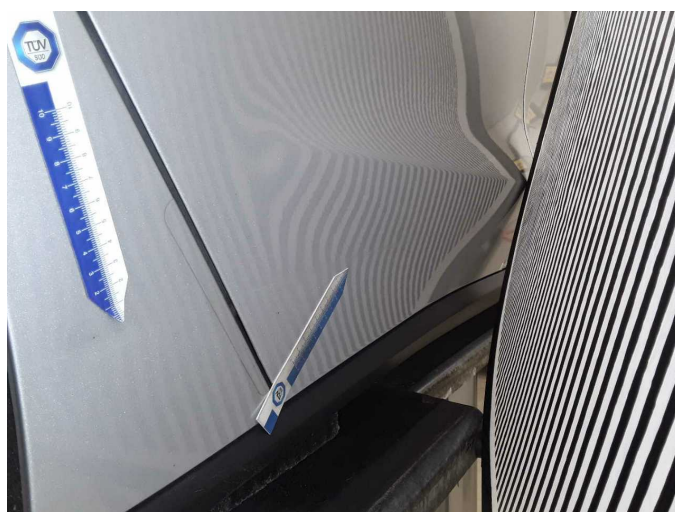

Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 6: Trim / covers: Carpet - front left side (mehrere Brandlöcher) - Burn hole (cigarettes) - Smart repair




Damage 6: Trim / covers: Carpet - front left side (mehrere Brandlöcher) - Burn hole (cigarettes) - Smart repair




Damage 6: Trim / covers: Carpet - front left side (mehrere Brandlöcher) - Burn hole (cigarettes) - Smart repair

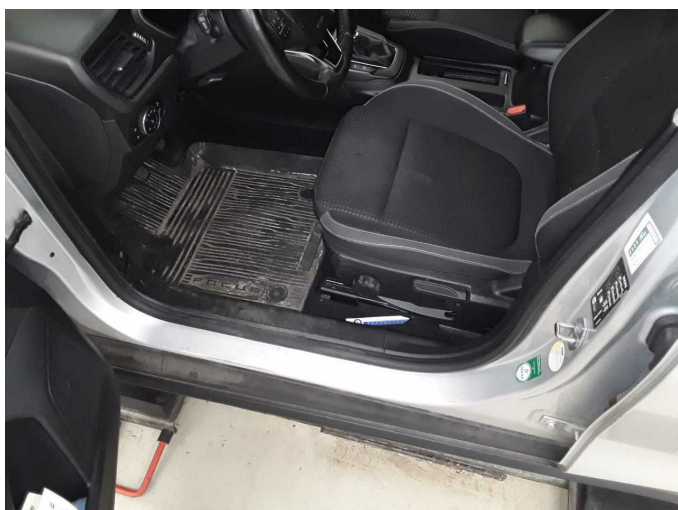


Damage 6: Trim / covers: Carpet - front left side (mehrere Brandlöcher) - Burn hole (cigarettes) - Smart repair

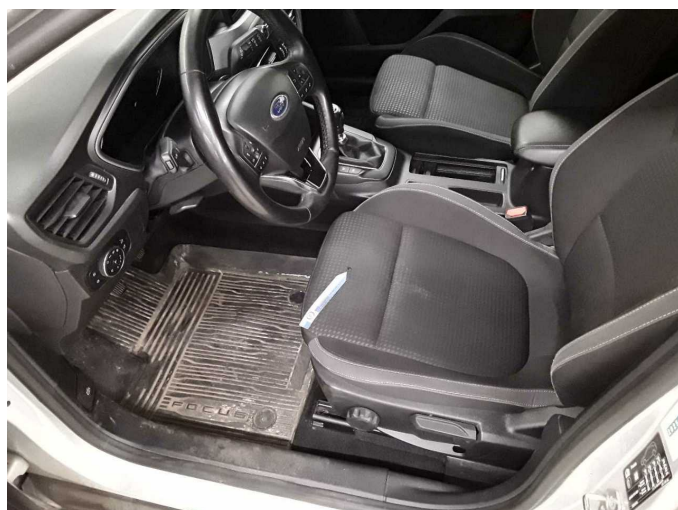

Damage 7: Seat - front: Seat cover - left side - Burn hole (cigarettes) - Replace

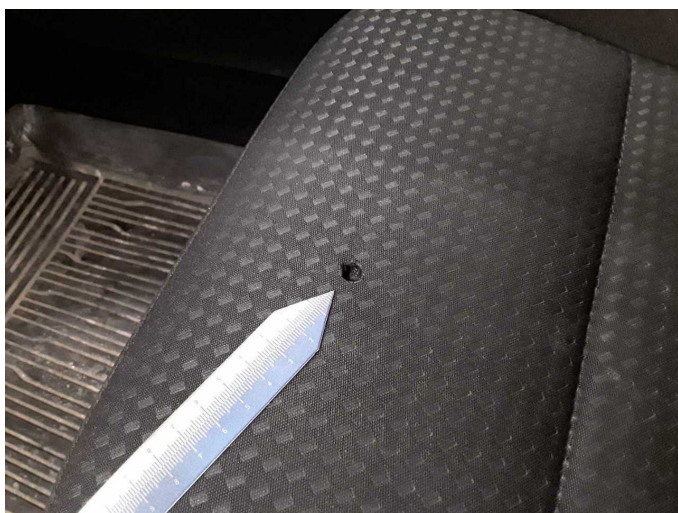


Damage 7: Seat - front: Seat cover - left side - Burn hole (cigarettes) - Replace

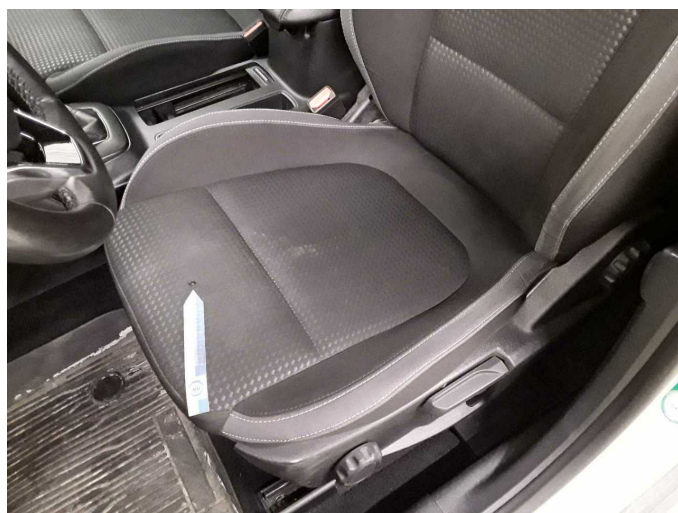


Damage 7: Seat - front: Seat cover - left side - Burn hole (cigarettes) - Replace



Damage 8: Braking system: Brake discs and pads - rear - Corrosion - Replace

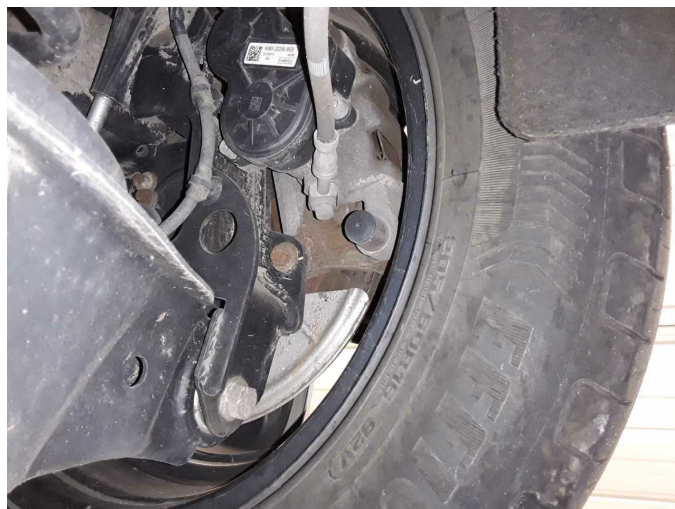

Damage 8: Braking system: Brake discs and pads - rear - Corrosion - Replace

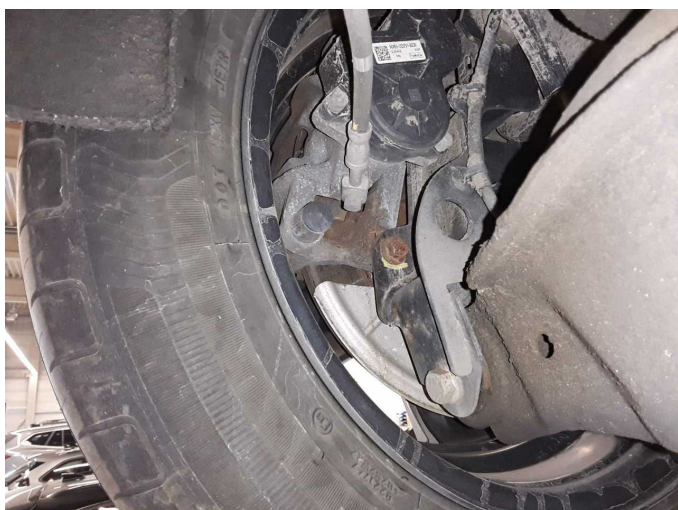


Damage 8: Braking system: Brake discs and pads - rear - Corrosion - Replace



Damage 8: Braking system: Brake discs and pads - rear - Corrosion - Replace




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint

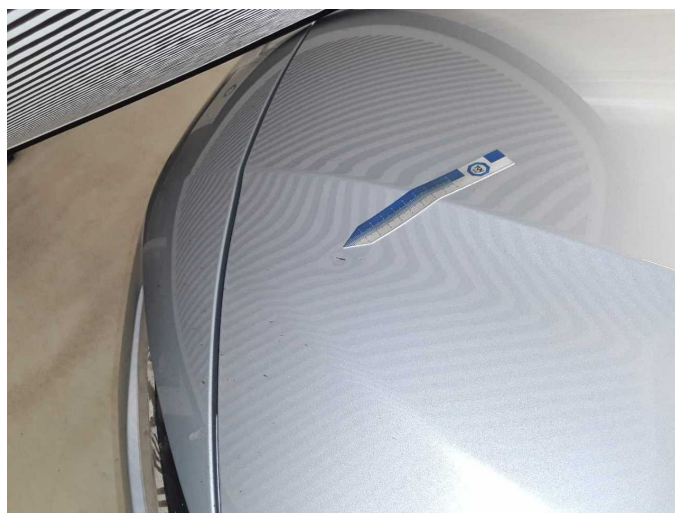


Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint

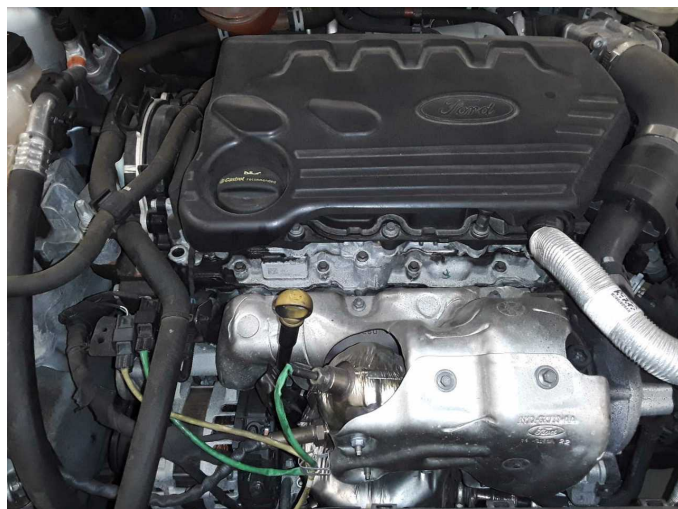

Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace

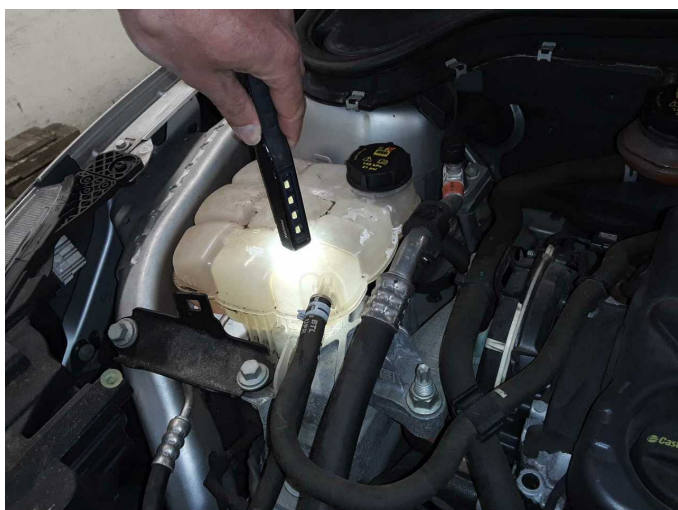


Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace

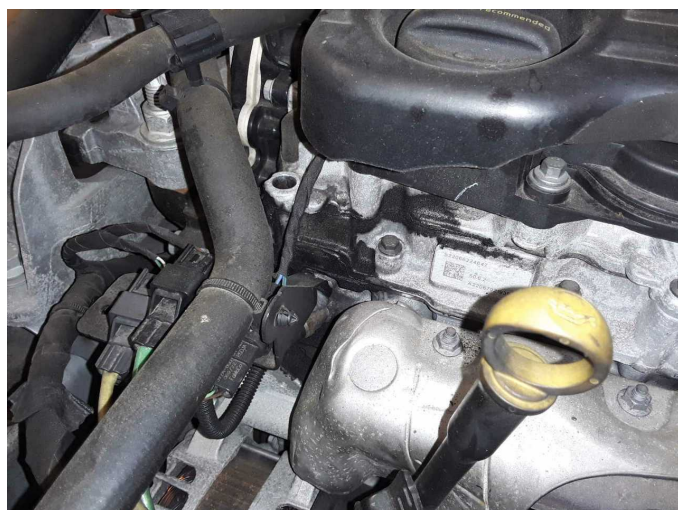

Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace

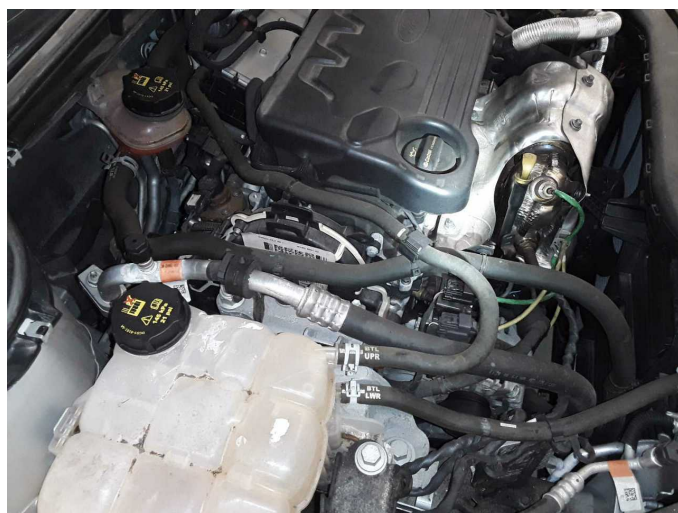

Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace




Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace

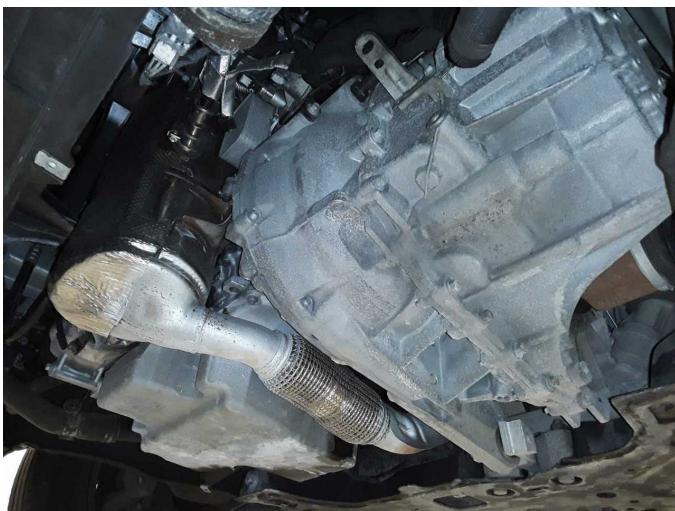

Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Damage 10: Engine cooling: Coolant (Siehe Kostenvoranschlag) - Leaking - Replace



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Missing part 1: Equipment: Tirefit complete - Missing - Replace



Repainting 1: Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof rail - left side, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Roof rail - left side: 201 µm



Mudguard - left side: 163 µm



Mudguard - right side: 272 µm



Side panel - rear left side: 236 µm



Side panel - rear left side: 236 µm



Door - rear left side: 226 µm



Door - front left side: 253 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0PXXGCHPNT52314

Hersteller / Modell: FORD Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System
COOL&CONNECT

Datum	KM-Stand	Beschreibung
19.12.2025	113.490	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
20.05.2025	103.652	AU; Dieselpartikelfilter ern; Systemtest/Eigendiagnose
30.12.2024	95.187	Batterie ern
15.11.2024	92.666	Systemtest/Eigendiagnose
23.10.2024	92.666	Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.08.2024	88.506	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten
27.09.2023	63.217	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
08.03.2023	32.688	Motoröl b. Wartung; Regelwartungsdienst