



Expertise

Protocol number: 46303645
Order No. / Reference: 26508860
Inspection date: 29 Jun 2026

Manufacturer: Volkswagen

Model: Caddy Cargo 2.0 TDI BMT DSG

VIN: WV1ZZZSK6NX061387



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Caddy Cargo 2.0 TDI BMT DSG

Vehicle Identification number WV1ZZZSK6NX061387

Mileage (Read) 96,954 km

First registration 27 Jul 2022

Number of holders 1

Power / Engine displacement 90 kw / 1,968 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 7

Type of drive Front drive

Type of vehicle Van

Colour / colour code Reflexsilber Metallic

Doors / Seats 4 / 2

Upholstery type Cloth

Colour of upholstery Grey-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,700 km
Last service on / at	03/2026 at 92,366 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM621415
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CME 00521		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,250 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Goodyear	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel	Hankook	3mm / 3mm
2)	205/60 R16 96H	Summer tyres on Steel	Hankook	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments (Various shelves and storage compartments)
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- Cockpit panel, matte
- Three-phase generator 140 A
- Electronic parking brake including auto-hold function
- ESP Electronic Stability Program with Brake Assist (incl. Anti-lock Braking System (ABS), Traction Control (ASR), (EDS and MSR))
- Electric windows, front
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Heating and ventilation system in the driver's cab
- Interior lighting in the cargo area (1 light)
- Fuel fill quantity, standard fuel initial fill
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Center console with 2 universal cup holders
- Multi-collision brake
- Fatigue detection
- Non-smoking version
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- Wheels/Tires: 205/60 R 16 96 H XL, optimized for low rolling resistance
- Gearshift DSG (with shift-by-wire technology)
- Sliding door, on the right in the passenger/cargo area
- Standard side panels in the cargo area
- Speed-sensitive power steering (Servotronic)
- Seats: Height adjustment for left seat, manual
- Seats: Left and right seats in the 1st row (including headrests)
- Start-stop system (with brake energy recuperation)
- Tire Mobility Set (12-volt compressor and tire sealant)
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Additional dust protection seal on the outside
- Storage compartments: Glove compartment open
- Towing eye front and rear, screw-in
- Exterior mirrors: electrically adjustable
- Exterior mirror housings and door handles in black, sliding door track in silver
- Floor coverings: Carpet in the driver's cab
- third brake light
- Roof rail/roof rack preparation
- Three-point automatic seat belts (with front belt height adjustment and electric belt tensioners)
- Automatic headlight control with daytime running lights
- Windows: Laminated glass front pane in heat-insulating glazing
- Cruise control system including speed limiter
- Halogen dual headlights-H7
- Rear wing door (asymmetrically divided) without window cutout
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Steering column adjustable in height and tilt
- Headlight range control
- Multifunction display: 16.51 cm (6.5 inch) color touchscreen for convenient operation (with USB charging port (Type C), no radio function)
- eCall emergency call system
- Upholstery: Fabric, "Double Grid" design
- Wheels, tires: Wheel covers
- Wheels/Tires: Steel wheels 6.5J x 16, in black
- taillights
- Windscreen wiper intermittent control with light sensor
- Keys for locking system: 2 remote control flip keys
- Side indicator lights
- Seat belt indicator (warning tone and light for unfastened front seat belts)
- Sun visors without mirrors, with ticket pocket on the driver's side, plus airbag label on the sun visor
- Bumper in grey
- Partition wall (tall) without window
- Lashing points: 6 lashing points for securing cargo
- Electronic immobilizer
- Central locking with remote control and interior operation



Extra equipment

- Exterior mirrors, electrically adjustable, heated and folding
- Floor coverings: Loading area covering made of wood (anthracite): multi-layered glued plywood (10 mm thick, non-slip)
- Interior lighting in the cargo area (2 LED spotlights and LED tailgate lighting)
- Package: Special Offers - Assistance Package (DSG) (Multifunction camera - Multifunction display "Plus" - Auto-dimming rearview mirror - Three-point automatic front seat belts with height adjustment and electric pretensioners - Side and head airbags for driver and front passenger - Lane Assist - Tire pressure monitoring system - Rear parking sensors - Front Assist - Cruise control including speed limiter)
- Package: Window package (Caddy Cargo with rear wing doors) (Rear wing doors with asymmetrically divided window cutouts - Fixed side window in the load/passenger compartment, front left - Fixed side window in the load/passenger compartment, front right - Fixed side window in the load/passenger compartment, rear left - Heated rear window - Fixed side window in the load/passenger compartment, rear right - Rear window wiper/washer system with intermittent function)
- Smoker's version
- Smartphone
- Exterior mirror housings in black, door handles in body color and sliding door rail in silver
- Vehicle lettering
- Interior design
- Paint finish: Metallic
- Navigation system "Discover Media" (25.4 cm (10 inch) touch color display - streaming & internet - 2 USB interfaces (Type C) in the center console, front - glove compartment with lockable, illuminated flap - 4 speakers - mobile phone interface)
- Package: Cool & Sound (Refrigerant R1234yf - Safety interior mirror, automatically dimming - Air Care Climatronic air conditioning with 2-zone temperature control and air purification function)
- Package: Light and Sight (Safety interior mirror, automatically dimming - Windscreen wiper interval control with light and rain sensor - Automatic headlight control, with daytime running lights and welcome and farewell lights)
- Package: Winter package (Seat heating for seats in the driver's cab, left and right, separately adjustable - Washer fluid level indicator with enlarged washer fluid reservoir - Heated windshield washer nozzles at the front)
- Seats: Manually adjustable lumbar support, left
- Partition wall (high) with windows and grilles

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Rear bumper	Rear bumper (unpainted) - Scratch(es) - Loss in value
3	Body	Body - Glued / labelled - De-glue / neutralise
4	Headlight	Headlight - right side - Scratch(es) - Replace
5	Boot lid / rear door	Rear door - right side - Scratch(es) - Paint
6	Door - front right side	Door - Scratch(es) - Paint
7	Vehicle glazing	Windscreen - Stone chips - Replace
8	Roof	Roof - Deformed - Repair and paint



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper (unpainted) - Scratch(es) - No deduction
2	Wheel / tyres	Wheel cover - front left side - Scratch(es) - No deduction
3	Wheel / tyres	Wheel cover - front right side - Scratch(es) - No deduction
4	Sill - right side	Sill - Scratch(es) - No deduction
5	Wheel / tyres	Wheel cover - rear right side - Scratch(es) - No deduction
6	Sill - right side	Sill - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

1	Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent
---	--

Paint coat thickness measurement

Roof	187 µm	Mudguard - left side	171 µm
Mudguard - right side	167 µm	Side panel - rear left side	176 µm
Side panel - rear right side	178 µm	Door - front left side	193 µm
Door - front right side	183 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

-Der montierte Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

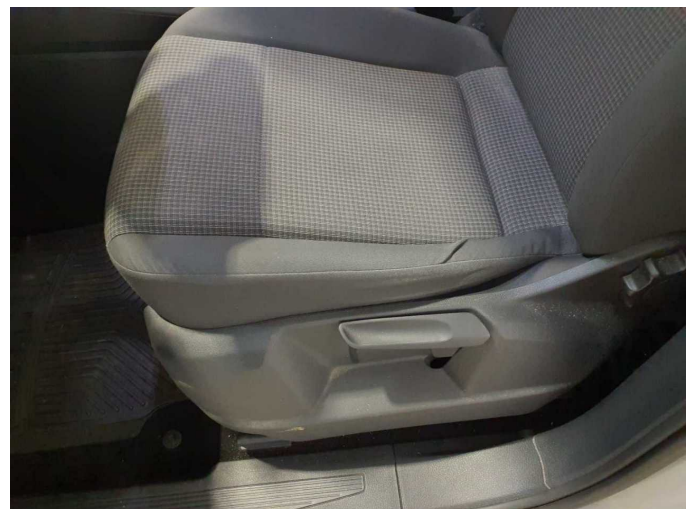


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

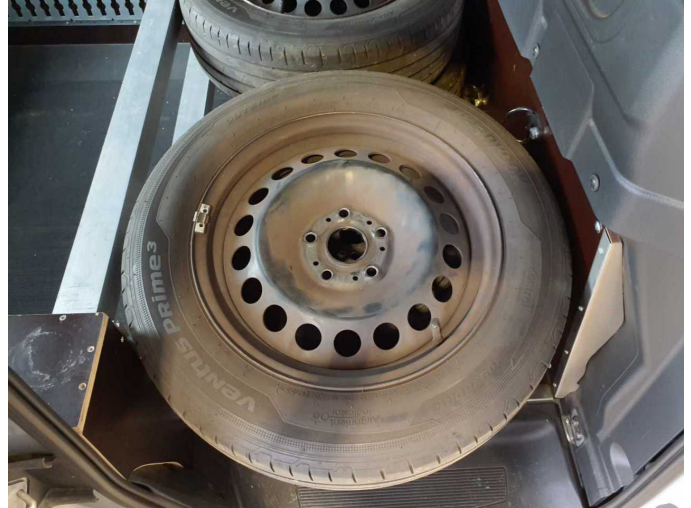


Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair

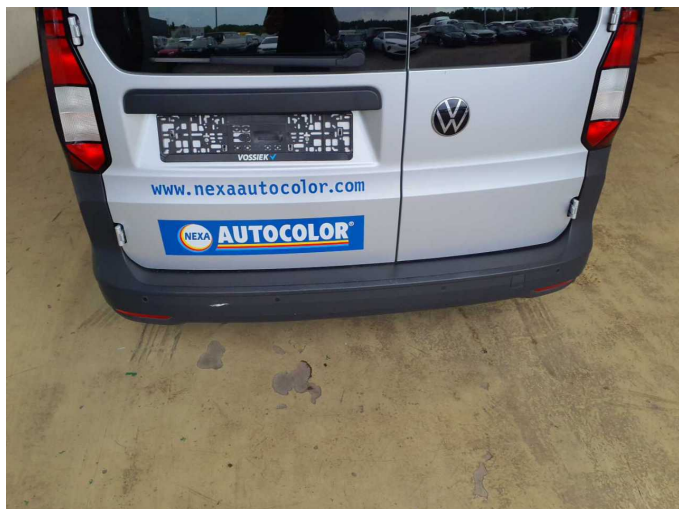

Damage 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Headlight: Headlight - right side - Scratch(es) - Replace




Damage 4: Headlight: Headlight - right side - Scratch(es) - Replace



Damage 4: Headlight: Headlight - right side - Scratch(es) - Replace



Damage 4: Headlight: Headlight - right side - Scratch(es) - Replace

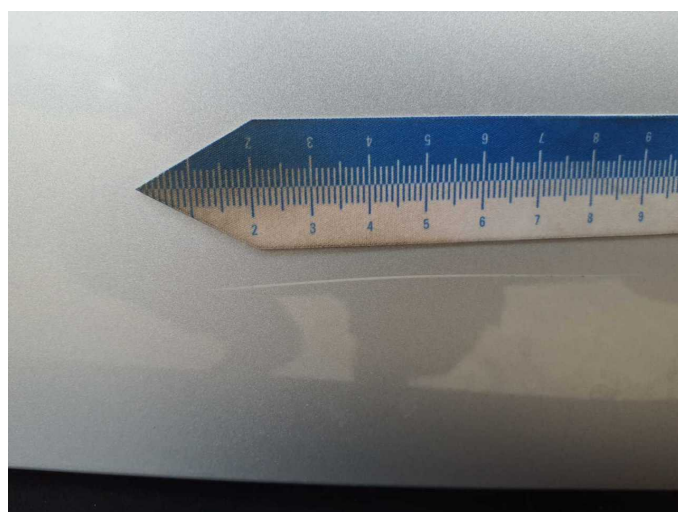

Damage 5: Boot lid / rear door: Rear door - right side - Scratch(es) - Paint



Damage 5: Boot lid / rear door: Rear door - right side - Scratch(es) - Paint




Damage 6: Door - front right side: Door - Scratch(es) - Paint




Damage 6: Door - front right side: Door - Scratch(es) - Paint



Damage 6: Door - front right side: Door - Scratch(es) - Paint

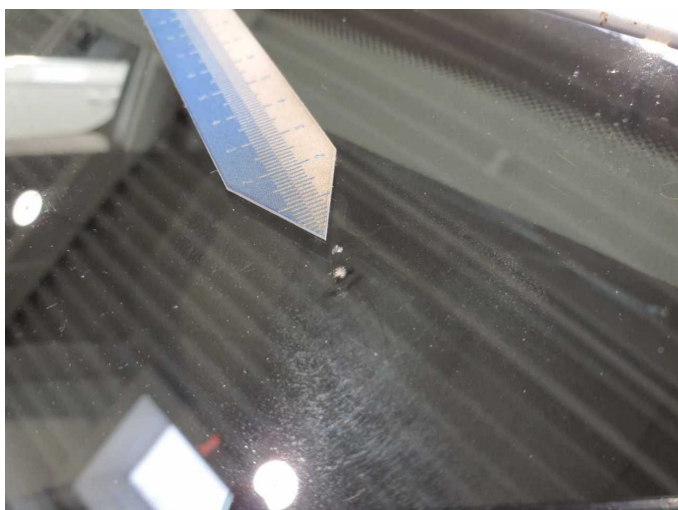

Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace

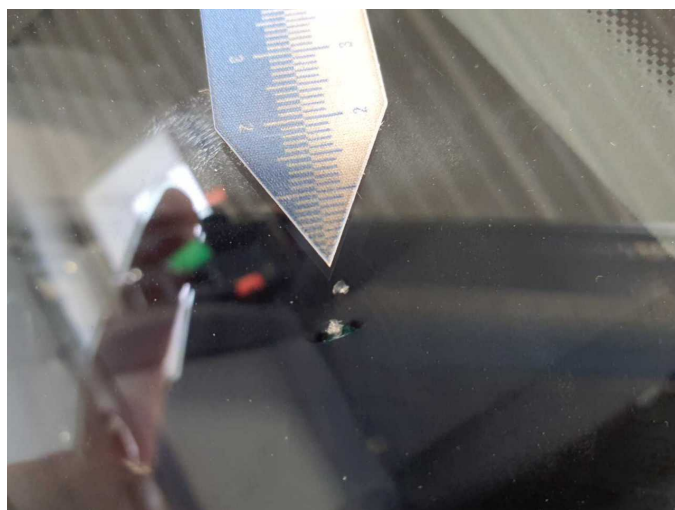

Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 8: Roof: Roof - Deformed - Repair and paint



Damage 8: Roof: Roof - Deformed - Repair and paint



Damage 8: Roof: Roof - Deformed - Repair and paint



Damage 8: Roof: Roof - Deformed - Repair and paint



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Mudguard - left side, Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - front left side, Door - front right side