



Expertise

Protocol number: 46857112
Order No. / Reference: 26776872
Inspection date: 4 Aug 2026

Manufacturer: Skoda
VIN: TMBJB9NS1P8018659

Model: Kodiahq 1.5 TSI ACT DSG Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiahq 1.5 TSI ACT DSG Ambition	
Vehicle Identification number	TMBJB9NS1P8018659
Mileage (Read)	66,572 km
First registration	6 Feb 2023
Number of holders	2
Next periodical technical inspection	02/2028
(Report on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	1,498 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Graphit-Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	24,000 km
Last service on / at	02/2026 at 60,476 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ530633
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ATM 04059		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	235/55 R18 100V	Summer tyres on Light alloy	4mm / 4mm
2)	235/55 R18 100V	Summer tyres on Light alloy	5mm / 5mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 08/2026	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Equipment

- Klimaautomatik

Standard equipment

- Storage compartment on the left wheel arch
- Storage compartments
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist
- Cargo elements in the trunk
- Decorative inlay Anthracite Brushed
- Third brake light
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- Rear spoiler
- ISOFIX preparation on the outer rear seats
- Boot cover, roll-up and removable
- LED taillights
- Rear center armrest with cup holders and pass-through option
- MSR (Motor drag torque control)
- Fog lights with integrated LED daytime running lights
- Otto particulate filter
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire Mobility Kit
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Driver and passenger seats are height-adjustable
- Speed limiter
- Bumpers painted in body color
- Variable fastening concept in the boot (only for 5-seaters)
- Lashing eyes in the trunk
- Central locking with remote control
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Tachometer
- Easy Start (start-stop button instead of the ignition lock)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Cruise control
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (Start/Stop automatic including brake energy recuperation)
- Aero rear window wiper including windshield washer system
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- Steering wheel: Leather steering wheel with multifunction buttons
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster
- Network program in the trunk
- Rear parking sensors
- Radio: Swing 6.5" music system
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring
- Heated windshield washer nozzles
- Headlights washer / wiper system
- Kodiahq seat belts
- Skoda Care Connect
- 12V socket - in the center console and in the trunk
- Telephone: Comfort hands-free telephone system (without connection to the external antenna)
- Immobiliser



Extra equipment

- Traveller assistance system (DSG) (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist - Adaptive Lane Guidance - Traffic Jam and Emergency Assist - Traffic Sign Recognition)
- Package: Family (Removable waste bin for the door panel - Sunshades for the rear side windows - Door edge protectors - Electric child safety lock adjustment)
- Proactive occupant protection including rear side airbags
- Wheels: 18" Elbrus alloy wheels (7Jx18 tires 235/55 R18 100V ET43)
- Rear view camera
- Seats: Heated front seats
- Seats: Folding tables on the front seatbacks
- Tablet holder in the rear
- Windscreen, wirelessly heated
- ISOFIX preparation on the front passenger seat
- Paint finish: Metallic
- LED matrix headlights PN5
- Package: Business Columbus (Dynamic radio navigation system Columbus - 9.2" capacitive color display - Color multifunction display in the instrument cluster - SmartLink (standard from Style trim level) - Wireless SmartLink for Apple CarPlay - Voice control - Phonebox with inductive charging function (connection via external antenna, standard from Style trim level) - Driver fatigue detection - 230V socket and USB port - Electric tailgate operation - Sunset lighting - Luggage net partition - Infotainment Online (3-year subscription))
- Variable loading floor in the trunk

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front right side	Door - dent(s) - Smooth repair work
3	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair
5	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
6	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
7	Side panel - rear left side	Sill - Scratch(es) - Smart repair
8	Door - rear right side	Door - dent(s) - Repair and paint
9	Bonnet	Bonnet - dent(s) - Repair and paint

Repainting

No. Repainting

- 1 Side panel - rear left side, Door - rear left side, Professionally carried out

Paint coat thickness measurement

Side panel - rear left side	530 µm	Door - rear left side	398 µm
-----------------------------	--------	-----------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument cluster



Figure 9: Instrument panel



Figure 10: Interior 360° view



Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres



Figure 14: Documents

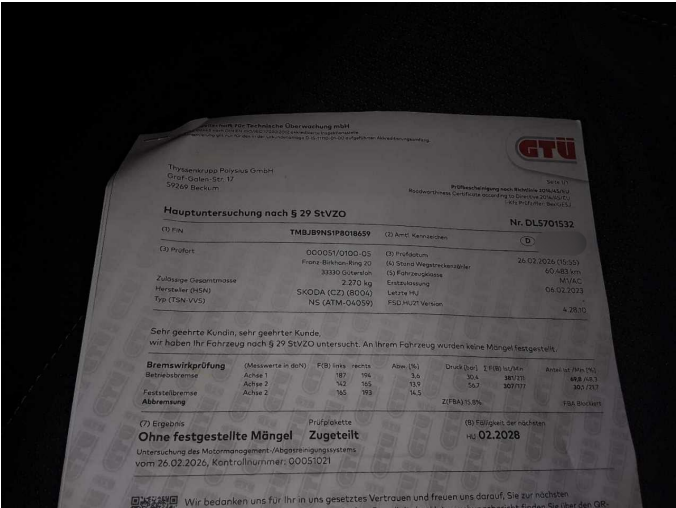


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.

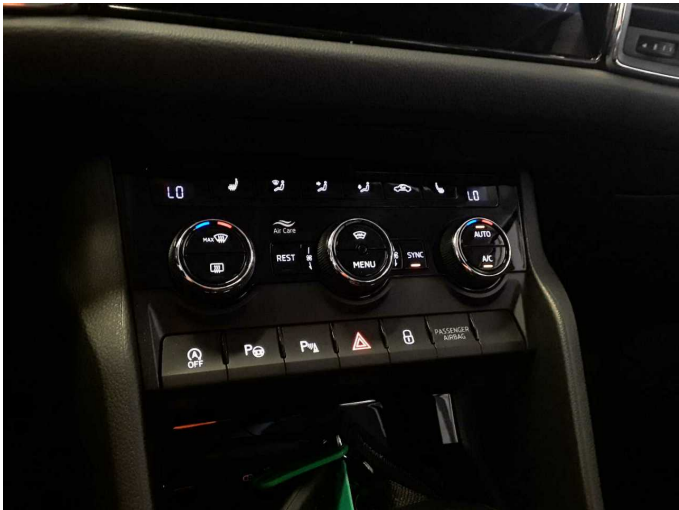


Figure 18: Misc.

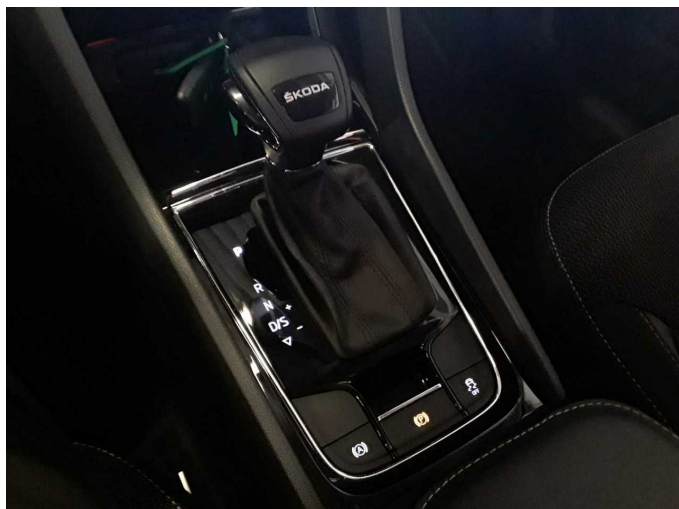


Figure 19: Misc.



Figure 20: Misc.

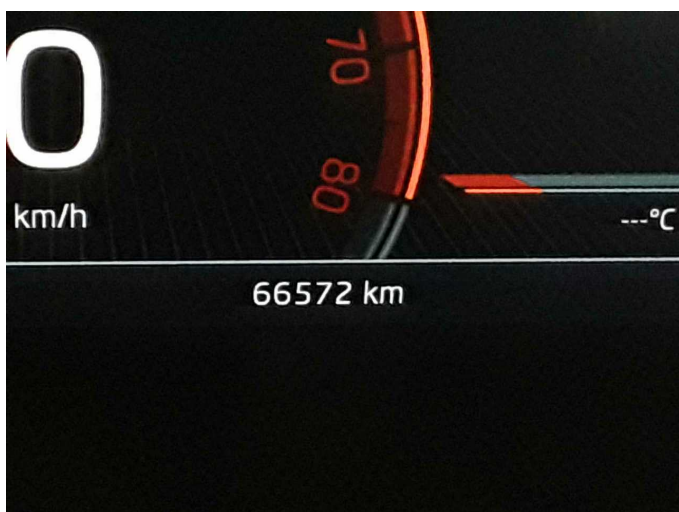


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

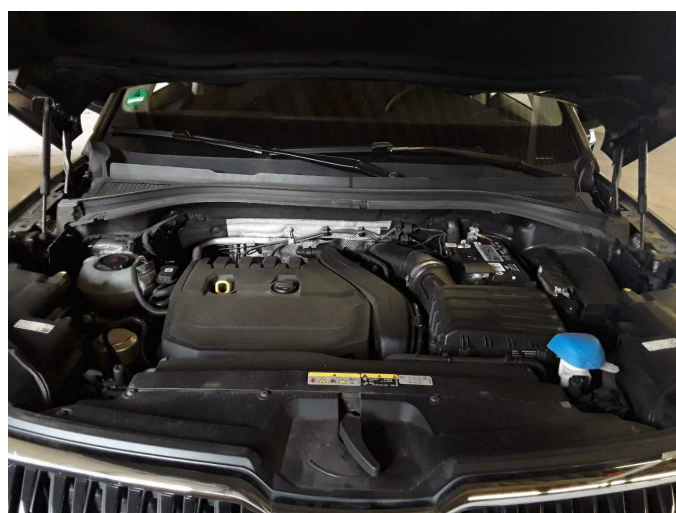


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

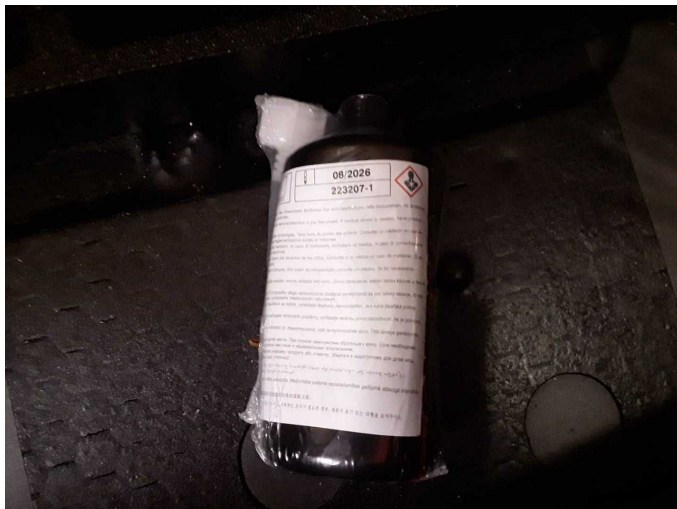

Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - front right side: Door - dent(s) - Smooth repair work



Damage 2: Door - front right side: Door - dent(s) - Smooth repair work



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair




Damage 6: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 7: Side panel - rear left side: Sill - Scratch(es) - Smart repair

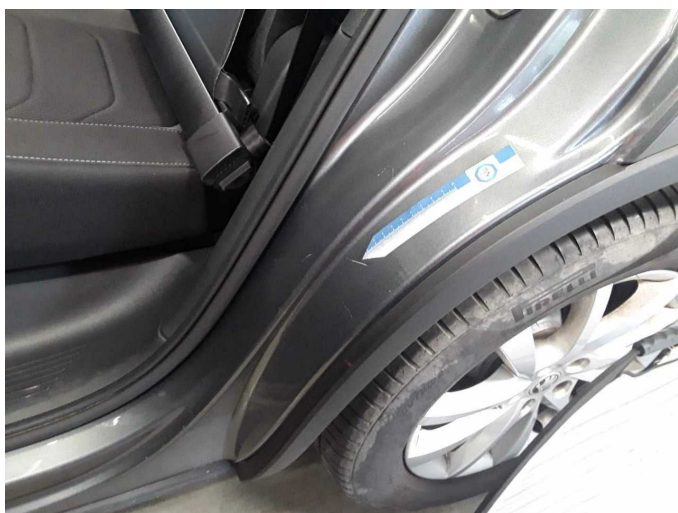

Damage 7: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 8: Door - rear right side: Door - dent(s) - Repair and paint



Damage 8: Door - rear right side: Door - dent(s) - Repair and paint



Damage 9: Bonnet: Bonnet - dent(s) - Repair and paint



Damage 9: Bonnet: Bonnet - dent(s) - Repair and paint



Side panel - rear left side: 530 µm



Door - rear left side: 398 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJB9NS1P8018659

Hersteller / Modell: SKODA SKODA Kodiaq 1.5 TSI ACT DSG Ambition

Datum	KM-Stand	Beschreibung
26.02.2026	60.476	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
12.02.2025	30.132	Bremsflüssigkeit ern; Motoröl b. Wartung; Regelwartungsdienst