



Expertise

Protocol number: 46605201
Order No. / Reference: 26754606
Inspection date: 16 Jul 2026

Manufacturer: Opel

Model: Astra 1.5 D Start/Stop Sports Tourer Business Edition

VIN: W0VBD8EU9N8035514



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Astra 1.5 D Start/Stop Sports Tourer Business Edition

Vehicle Identification number W0VBD8EU9N8035514
Mileage (Read) 108,997 km
First registration 9 Feb 2022
Number of holders 1

Fuel type Diesel
Engine displacement / Cylinder 1,496 ccm / 3
Power 77 kW
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle Station wagon

Colour / colour code Schneeweiß
Doors / Seats 5 / 5
Upholstery type Cloth
Colour of upholstery Black-Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	29 %
Last service on / at	12/2025 at 93,547 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF971647
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / ALJ 00130		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,945 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 94V	All-season tyres on Steel rim with wheel cover	Pirelli	3mm / 4mm
2)	205/55 R16 94V	All-season tyres on Steel rim with wheel cover	Continental	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	115/70 R16 92M	Summer tyres on Steel	Continental	3 mm
Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.				



Equipment

Equipment

- Rubber mats
- Wheels: Steel 6.5Jx16 with tires 205/55R16 CWDN
- cargo area liner
- Formula fabric, black



Standard equipment

- 2 ignition keys (one of which is foldable)
- Airbag for driver and front passenger side (passenger airbag can be deactivated)
- Airbag: Chest-pelvis side airbag for driver and front passenger side
- Airbag: Head airbags, 1st and 2nd row (outer seats)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable - exterior mirror housing in black)
- third brake light
- black roof rails
- Diesel particulate filter (DPF) (maintenance-free)
- Electronic Stability Program Plus (ESP Plus)
- Speed controller with limiter
- Transmission: 6-speed manual transmission
- rear window wiper
- Instruments, black, with high-gloss chrome rings, 3.5" driver information display
- Rear headrests (3) (height adjustable)
- Cargo area cover
- LED daytime running lights (including LED turn signals, front, manual headlight range adjustment)
- Steering column, height and reach adjustable
- Fog light
- Parkpilot, rear parking aid (with acoustic warning signal when reversing)
- Upholstery: Cloth
- Quickheat rapid heating system (electric auxiliary heater)
- Radio: Multimedia radio with 7" touchscreen color display (automatic music recognition (title, album, artist, cover) for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, display of phonebook and call lists, smartphone integration via Apple CarPlay and Android Auto, voice control, navigation (Google Maps, Apple Maps), music, phone, text message reading and dictation, speed-dependent volume and bass control, USB interface and Aux-In, 6 speakers)
- Safety net for luggage compartment (incl. mounting hardware behind 1st or 2nd row of seats)
- Visibility features (rain sensor, front interior rearview mirror automatically dimming, automatic dimming headlights with tunnel detection)
- Start/Stop system (driving assistant - reinforced starter - high-performance battery - eco switch to deactivate the start/stop function - brake energy recuperation)
- Pre-installation for child seat restraint system "ISOFIX" (incl. top tether attachment points, rear outer)
- Central locking with remote control and interior switches (ignition key matching exterior color)
- Storage compartments (storage compartment in the center console and instrument panel, driver's side - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 0.5-liter beverage bottles - 4 lashing eyes in the luggage compartment)
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag or seatbelt pretensioner)
- Hill Start Assist
- On-board computer (with check control system)
- Roof design line, above in black
- Decorative trim strips Antelao Sand/Polar Silver
- Tachometer
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Back window, heater
- Interior lighting, front and rear
- Air conditioning (with particle and activated carbon filter)
- trunk light
- Front headrests (height adjustable)
- LED headlights
- Steering wheel: Comfort steering wheel with steering wheel remote control
- Lighting equipment (illuminated make-up mirrors in sun visors - reading lights, rear - ambient lighting in the roof console)
- Pedal system: Disengaging safety pedals (PRS (Pedal Release System))
- Radio: Digital radio reception DAB/DAB+/DMB-R (Digital Audio Broadcasting)
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Tire pressure monitoring system (tire pressure display for each wheel)
- Wheels: Design wheels, 6.5 J x 16 with tires 205/55 R16
- Rear seat backrest folds forward in a 60:40 split
- Power steering (speed-dependent)
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Seats: Comfort seats, front (driver's seat adjustable in 6 ways (length, height) - passenger seat adjustable in 4 ways (length))
- 12V power outlet in the center console
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Immobiliser
- Heat-insulating glazing, green tinted, and windshield



Extra equipment

- Detachable trailer hitch (including trailer stability program TSP)
- Parkpilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards)
- Wheels: Emergency spare wheel, steel 4Jx16
- Seats: Ergonomic active seat (certified by the Campaign for Healthy Backs (AGR) Driver's seat: - Length, height and tilt adjustable - Electropneumatic lumbar support adjustable in height and length - Extendable thigh support - Pocket on the back of the front seats, driver and front passenger)
- Paintwork: Solid special color Snow White
- Sliding center armrest, front (with storage compartments and cup holders)
- Radio: Multimedia Navi (Multimedia Radio, 7" touchscreen color display with USB port, hands-free system, voice control, Bluetooth audio streaming, smartphone integration via Apple CarPlay and Android Auto - Navigation system with integrated memory - Road map for over 30 European countries - Map display in 2D and 3D - Dynamic route guidance via map and/or arrow display and voice prompts - Dynamic destination guidance via enhanced Traffic Message Channel (TMCpro))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Wheel / tyres	Tyres - complete set (Reifendruck) - Specify findings - Perform diagnosis
4	Trim / covers	Boot lid - interior trim - Scratch(es) - Smart repair
5	Door - front right side	Door edge - Scratch(es) - Smart repair
6	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
7	Trim / covers	Carpet - front left side - Burn hole (cigarettes) - Smart repair
8	Wheel / tyres	Wheel cover - front right side - Does not meet the leasing specifications - Replace
9	Headlight	Headlight - left side (Klarlack löst sich, Randbereich) - Paint defect - Replace
10	Headlight	Headlight - right side (Klarlack löst sich, Randbereich) - Paint defect - Replace
11	Front bumper	Front bumper - Dent / paintcoat damage - Paint
12	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
13	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
14	Roof	Roof - Dent / paintcoat damage - Paint



Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Door - rear left side	Door handle - outside - Scratch(es) - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Wing mirror - right side	Cap - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle jack

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

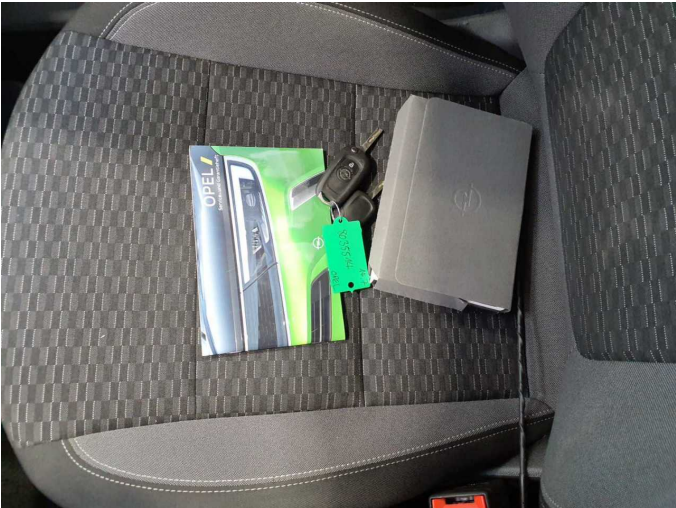


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

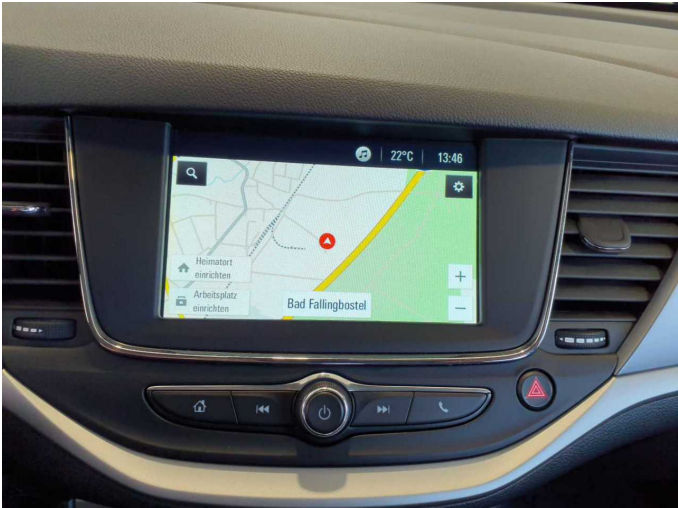


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

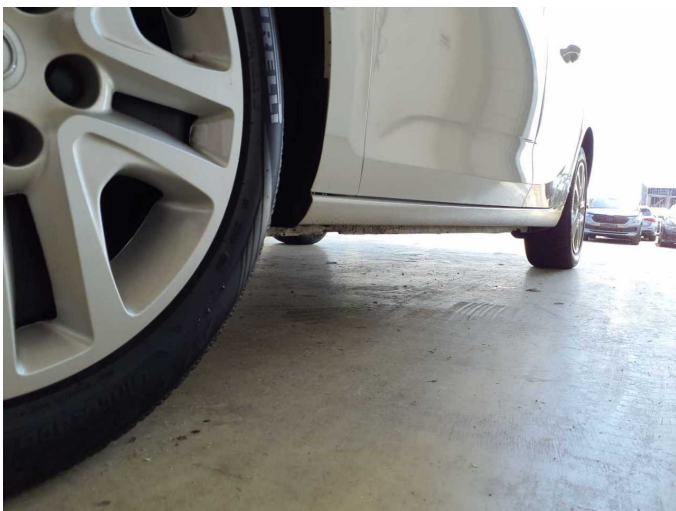


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Tyres - complete set (Reifendruck) - Specify findings - Perform diagnosis



Damage 4: Trim / covers: Boot lid - interior trim - Scratch(es) - Smart repair



Damage 4: Trim / covers: Boot lid - interior trim - Scratch(es) - Smart repair




Damage 5: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 5: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 6: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

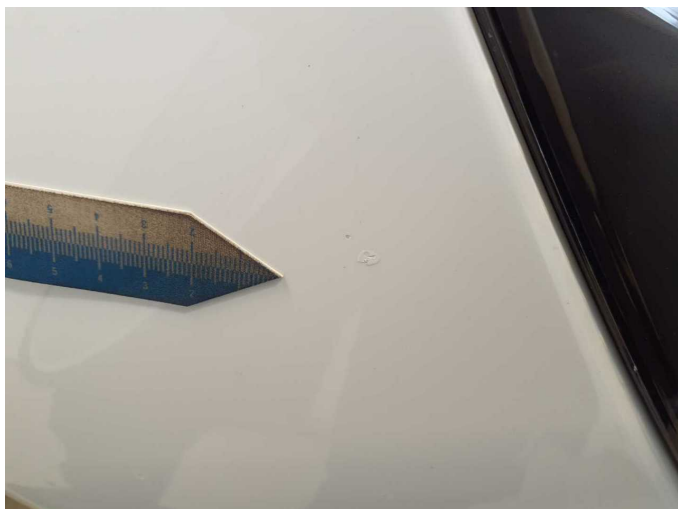


Damage 6: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 7: Trim / covers: Carpet - front left side - Burn hole (cigarettes) - Smart repair



Damage 7: Trim / covers: Carpet - front left side - Burn hole (cigarettes) - Smart repair

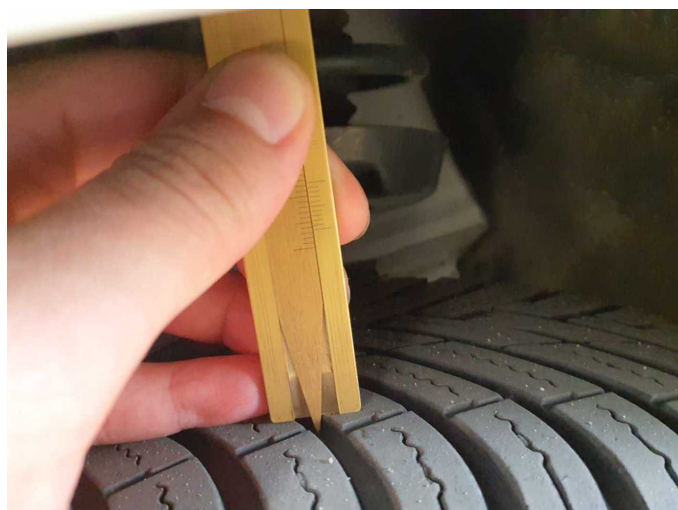


Damage 8: Wheel / tyres: Wheel cover - front right side - Does not meet the leasing specifications - Replace




Damage 9: Headlight: Headlight - left side (Klarlack lack löst sich, Randbereich) - Paint defect - Replace



Damage 9: Headlight: Headlight - left side (Klarlack lack löst sich, Randbereich) - Paint defect - Replace

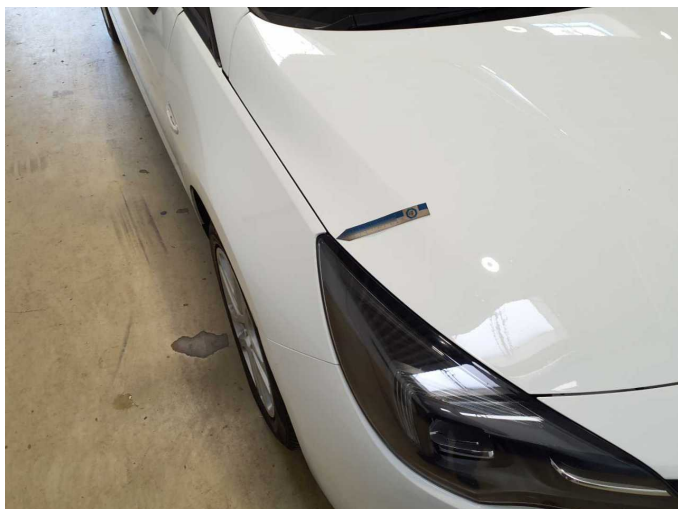

Damage 10: Headlight: Headlight - right side (Klarlack löst sich, Randbereich) - Paint defect - Replace

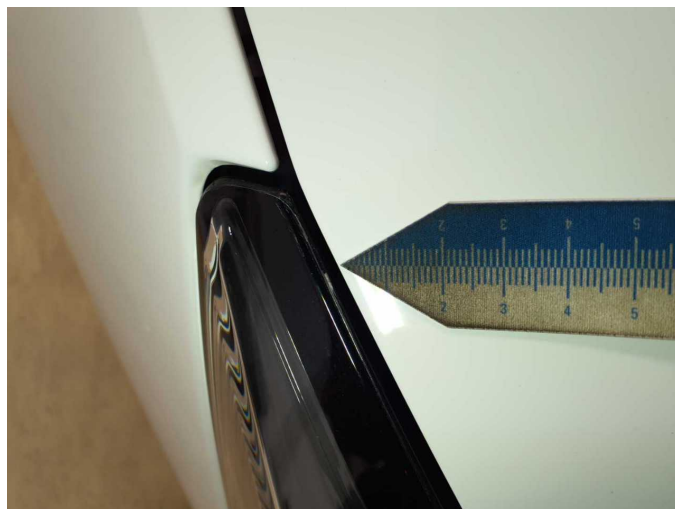

Damage 10: Headlight: Headlight - right side (Klarlack löst sich, Randbereich) - Paint defect - Replace



Damage 11: Front bumper: Front bumper - Dent / paintcoat damage - Paint




Damage 11: Front bumper: Front bumper - Dent / paintcoat damage - Paint




Damage 11: Front bumper: Front bumper - Dent / paintcoat damage - Paint



Damage 11: Front bumper: Front bumper - Dent / paintcoat damage - Paint

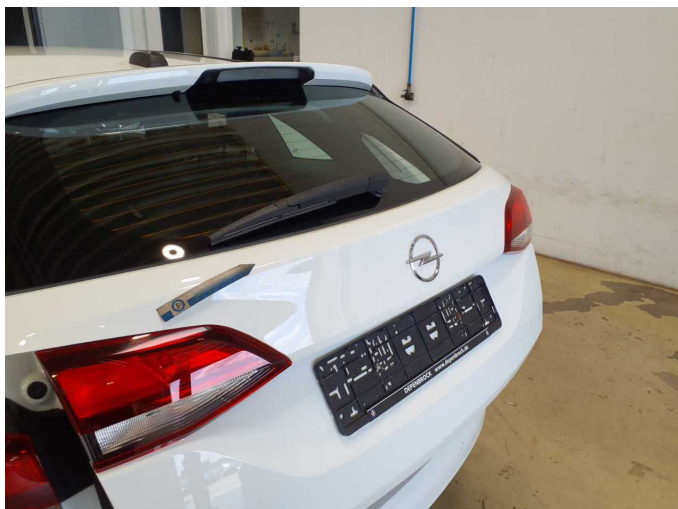

Damage 12: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

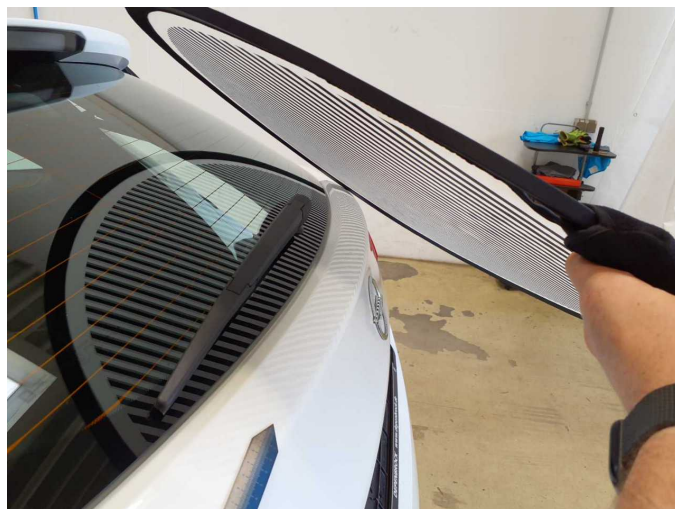

Damage 12: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 12: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 12: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

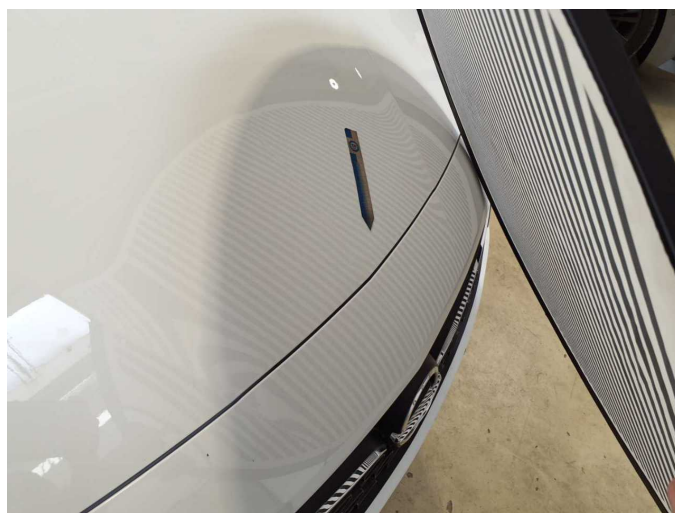

Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 14: Roof: Roof - Dent / paintcoat damage - Paint

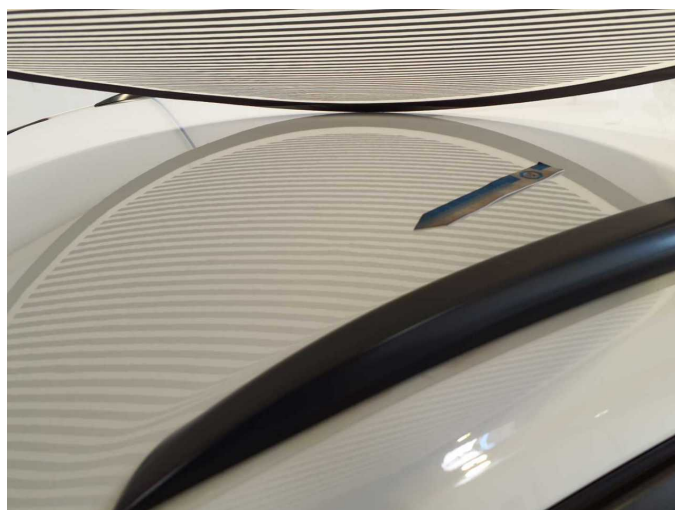

Damage 14: Roof: Roof - Dent / paintcoat damage - Paint



Damage 14: Roof: Roof - Dent / paintcoat damage - Paint



Damage 14: Roof: Roof - Dent / paintcoat damage - Paint



Damage 14: Roof: Roof - Dent / paintcoat damage - Paint



Damage 14: Roof: Roof - Dent / paintcoat damage - Paint



Damage 14: Roof: Roof - Dent / paintcoat damage - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBD8EU9N8035514

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Business Edition

Datum	KM-Stand	Beschreibung
16.12.2025	93.547	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.01.2025	148.180	Bremsinspektion vo + hi; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
27.11.2024	69.575	Reparatur Sonstiges; Systemtest/Eigendiagnose
16.09.2024	64.673	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.01.2024	45.411	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.01.2023	21.129	Motoröl b. Wartung; Regelwartungsdienst