



Expertise

Protocol number: 46381034
Order No. / Reference: 26503772
Inspection date: 7 Jul 2026

Manufacturer: Skoda
VIN: TMBJH9NPXL7058247

Model: Superb Combi 2.0 TDI DSG L&K



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG L&K	
Vehicle Identification number	TMBJH9NPXL7058247
Mileage (Read)	167,621 km
First registration	27 May 2020
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	0 km
Last service on / at	09/2025 at 148,347 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FU081015
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / APL 00762		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,196 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 94W	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	235/45 R18 94W	Summer tires (with run-flat tires) on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Traction control (ASR)
- Exterior mirrors and door handles in body color
- Illuminated glove compartment
- Hydraulic brake assist (HBA)
- Roof rails, anodized
- Diesel particulate filter and SCR catalyst
- Third brake light
- Electric tailgate opening
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Chassis: Adaptive chassis DCC (10 mm lowering, adjustable damper setting)
- Front radar assistant including city emergency braking function
- Cruise control system (cruise control) including speed limiter
- Green tec: Start/stop system including brake energy recuperation
- ISOFIX preparation on the outer rear seats, including top tether
- Front and rear headrests are height-adjustable.
- LED ambient lighting
- Steering wheel: height and reach adjustable
- Reading lights at the front and rear of the headliner
- Matrix LED headlights
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Front and rear parking sensors
- Radio: CANTON sound system
- Radio accessories: Digital radio reception DAB+
- Radio accessories: SmartLink+
- Tire mobility kit
- Heated windshield washer nozzles
- Superb seat belts
- Seats: Adjustable lumbar support in the front seats
- Seats: Height-adjustable front seats
- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- Sunset (rear window and rear side windows tinted dark)
- Textile floor mats
- Lashing eyes in the trunk
- Central locking with remote control
- Storage compartments
- Airbag, driver and switchable passenger airbag
- Airbag, head airbags
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Hill start assist
- Grey headliner
- Decorative inlay Piano Black
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Driving profile selection including customizable key (Normal, Eco, Sport, Individual)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front and rear footwell lighting
- Transmission: 7-speed dual-clutch transmission (DSG)
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- Kessy, keyless entry and start-stop system
- Boot cover, roll-up and removable, semi-automatic
- Metal loading sill protector
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel with multifunction buttons
- Rear center armrest with cup holders and pass-through option
- Color multifunction display in the instrument cluster
- LED fog lights with integrated cornering lights
- Upholstery: Executive leather interior
- Radio accessories: 2 USB-A ports in the center console
- Radio accessories: In-car communication
- Tire pressure monitoring
- Wheels: 18" Propus Aero alloy wheels
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Electrically adjustable front seats with memory function
- SKODA Care Connect
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Telephone: Comfort hands-free telephone system
- Chrome-plated elements
- Immobiliser



Extra equipment

- Adaptive Cruise Control (ACC) (control range up to 210 km/h) (replaces cruise control)
- Lane Assist, Blind Spot Detection, Parking Assist, Emergency Assist and Traffic Jam Assist (The Parking Assist provides visual and audible warnings when obstacles such as pedestrians or other vehicles are detected. In acute emergencies, automatic braking prevents an impending collision.)
- Package: Storage (waste bin - net system in the trunk)
- Paint finish: Pearl effect
- Park Assist 3.0 including front parking sensors
- Progressive steering (adjustment of the steering angle depending on the speed)
- Reversing camera with washer nozzle
- Seats: Electric operation of the front passenger seat from the rear
- Seats: Ventilated front seats for leather interior (perforated leather)
- Sunshade roller blind for the rear side windows
- Airbag, proactive occupant protection including rear side airbags
- Climatronic air conditioning (3-zone) (fully automatic, separately adjustable for driver, front passenger and rear seats)
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Headrests: Sleeping headrests on the outer rear seats
- Package: Business Columbus (Combi) (Columbus dynamic radio navigation system, capacitive 9.2" touchscreen, color multifunction display in the instrument cluster, traffic sign recognition, Wi-Fi hotspot, 2 SD card slots, phone box with inductive charging function (connection via external antenna), voice control, driver fatigue detection, 230 V socket, USB ports, tablet holder in the rear, Sunset Infotainment Online (3 years), heated steering wheel, heated outer rear seats, luggage net partition)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Wing mirror - right side	Cap - Scratched - Smart repair
3	Interior	Interior - Soiled - Clean
4	Side panel - rear left side	Side panel (Inkl. Einstieg) - Scratched - Smart repair
5	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
6	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
7	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
8	Misc.	Inspection / maintenance - Due - Perform
9	Front bumper	Front bumper (+ Blende) - Scratched - Paint



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Interior	Interior - Scratch(es) - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 26 Aug 2022	3.178,46 €
2	Side - left, Provided by user / customer, from 2 Dec 2021	3.260,53 €
3	Front, Side right, Provided by user / customer, from 27 Oct 2021	3.841,74 €

Accident damages

No.	Accident
1	Rear, Side right

Repainting

No.	Repainting
1	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
4	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
5	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	648 µm	Side panel - rear right side	205 µm
Door - rear left side	201 µm	Door - rear right side	190 µm
Door - front right side	192 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

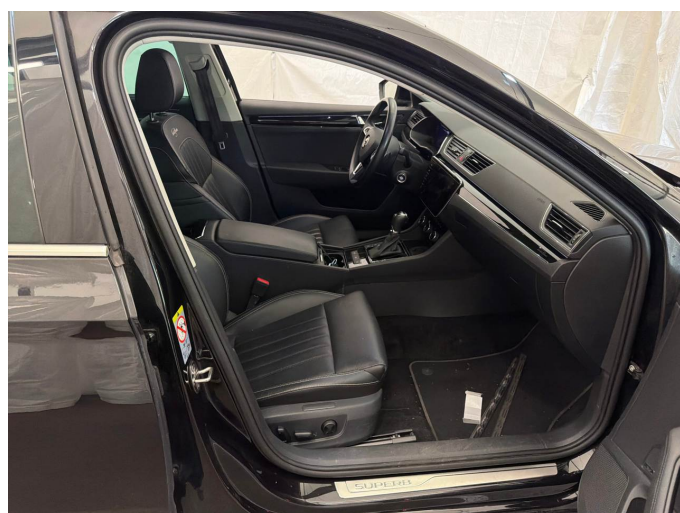


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

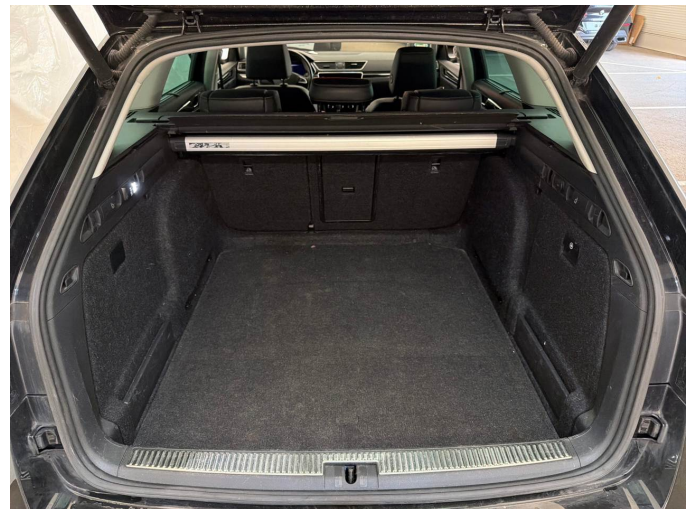


Figure 10: Cargo area

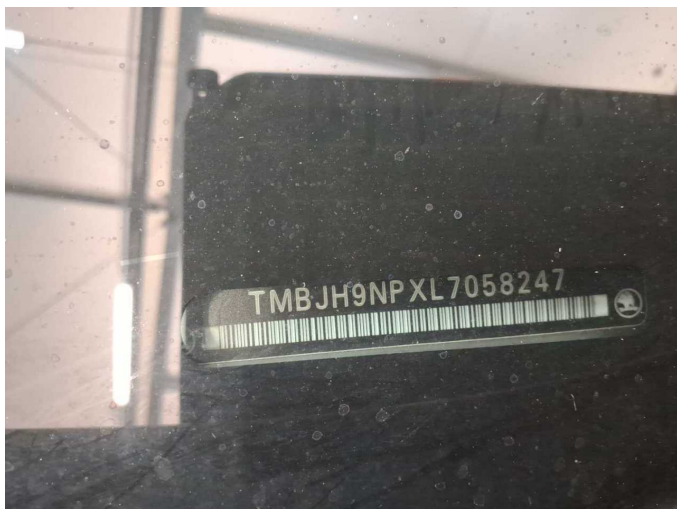


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

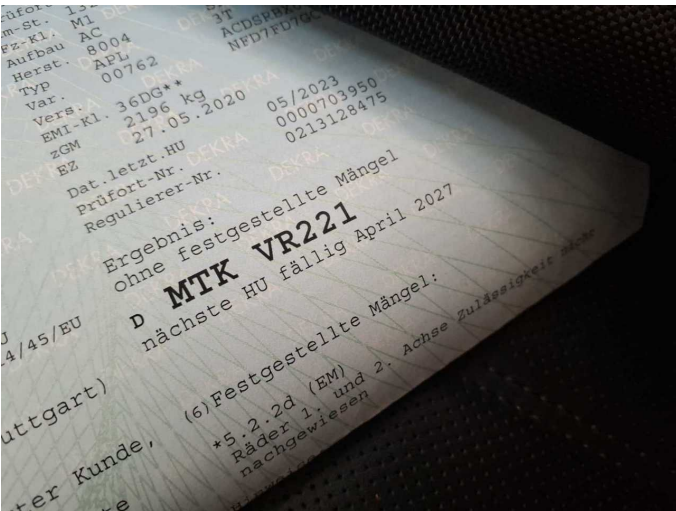


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

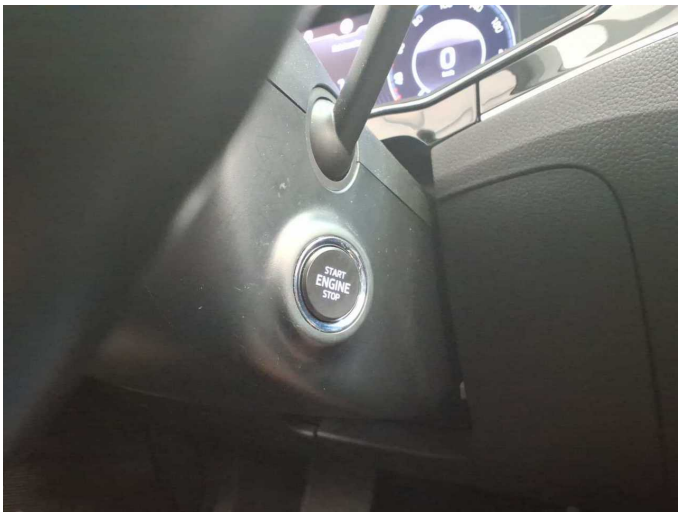


Figure 23: Misc.

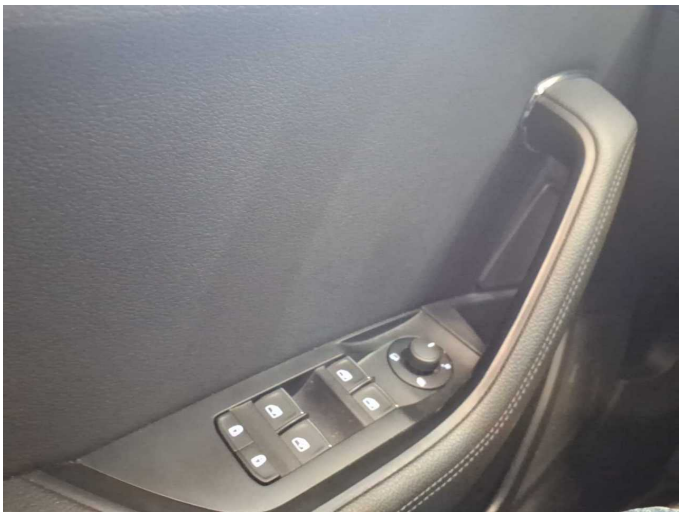


Figure 24: Misc.



Figure 25: Misc.

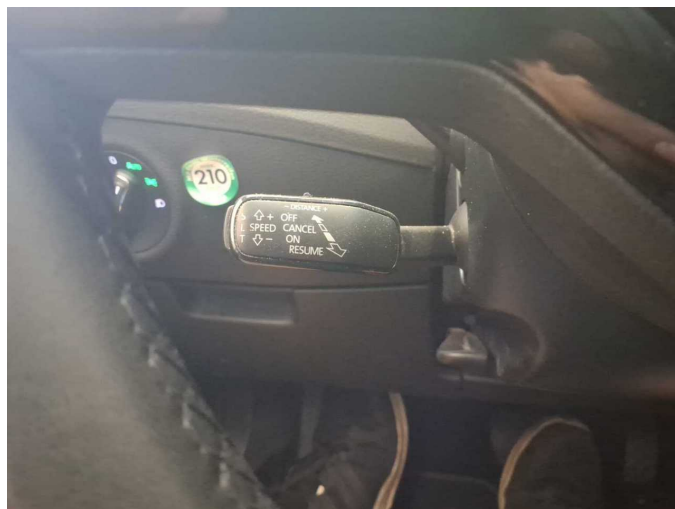


Figure 26: Misc.



Figure 27: Misc.

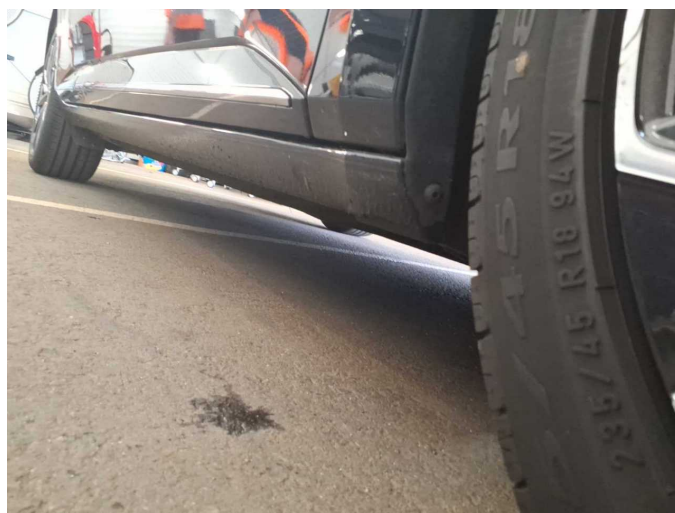


Figure 28: Misc.

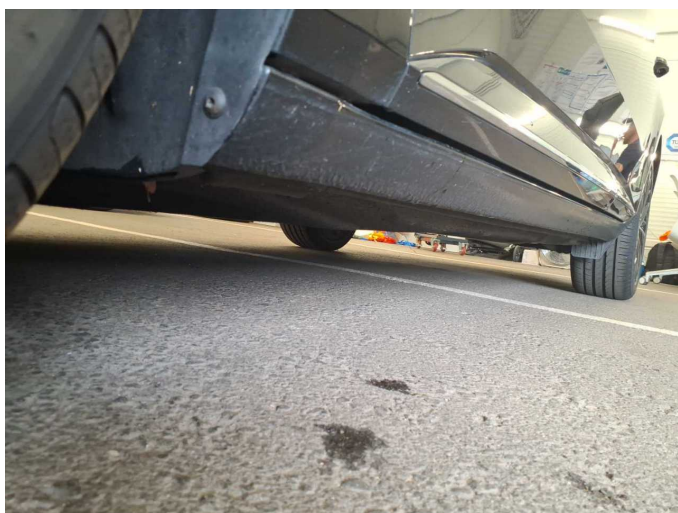


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

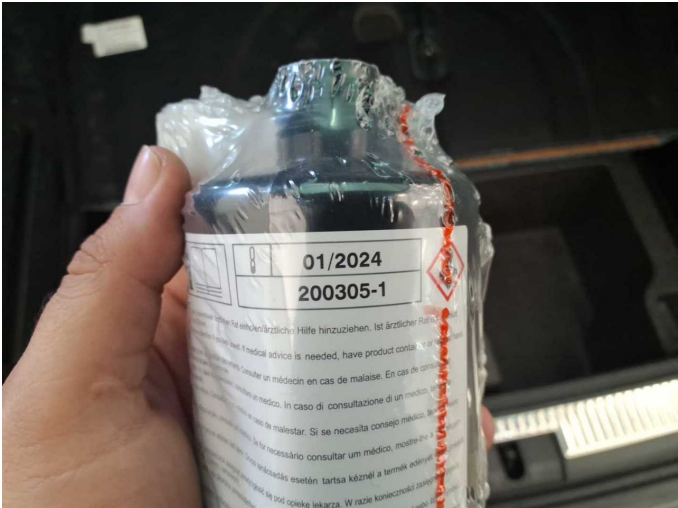


Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Wing mirror - right side: Cap - Scratched - Smart repair




Damage 2: Wing mirror - right side: Cap - Scratched - Smart repair

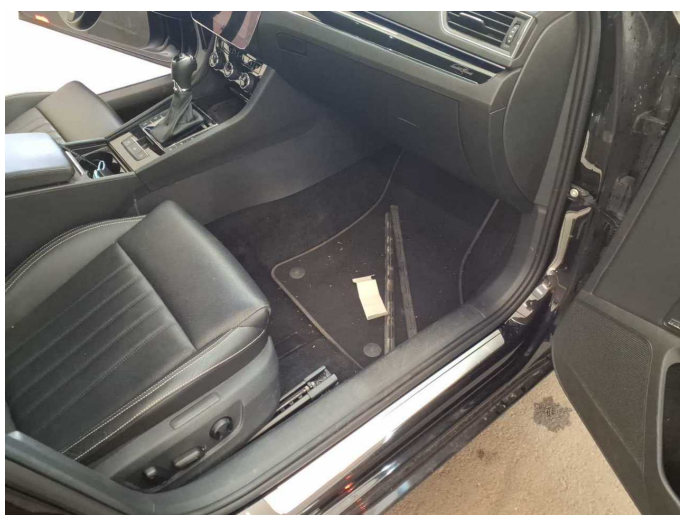


Damage 3: Interior: Interior - Soiled - Clean



Damage 3: Interior: Interior - Soiled - Clean

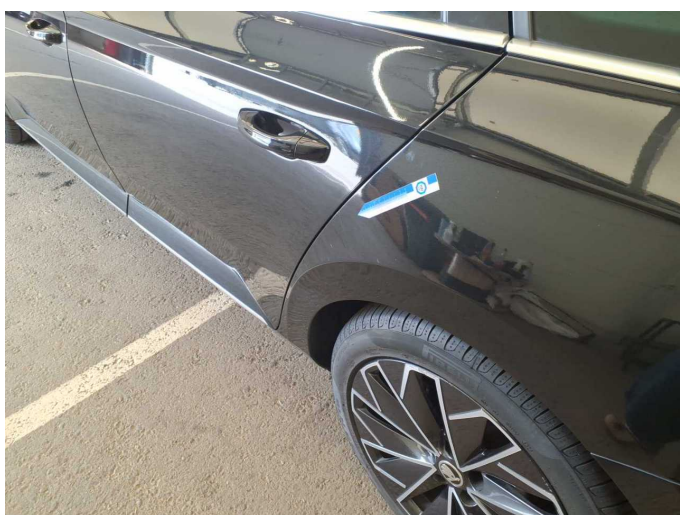


Damage 4: Side panel - rear left side: Side panel (Inkl. Einstieg) - Scratched - Smart repair

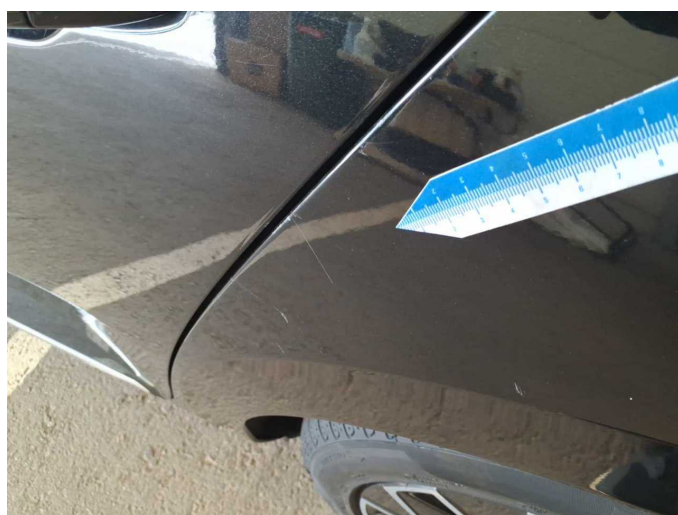


Damage 4: Side panel - rear left side: Side panel (Inkl. Einstieg) - Scratched - Smart repair



Damage 4: Side panel - rear left side: Side panel (Inkl. Einstieg) - Scratched - Smart repair

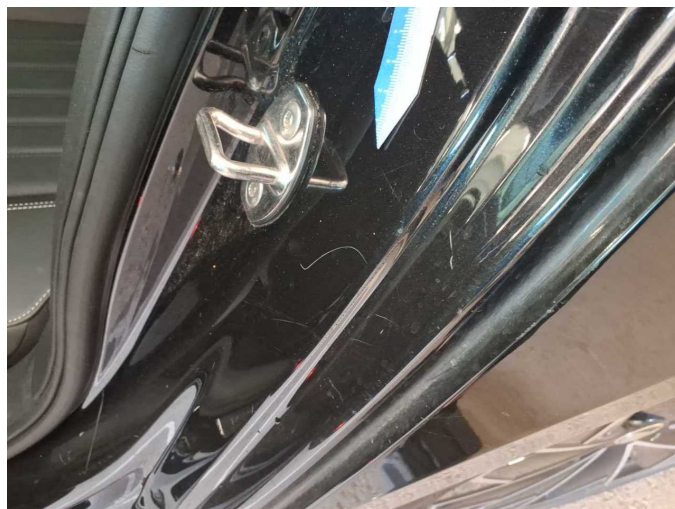


Damage 4: Side panel - rear left side: Side panel (Inkl. Einstieg) - Scratched - Smart repair

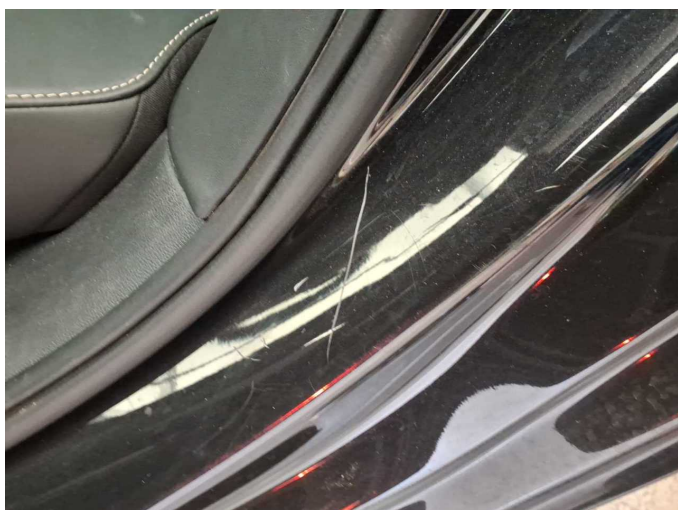

Damage 4: Side panel - rear left side: Side panel (Inkl. Einstieg) - Scratched - Smart repair



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

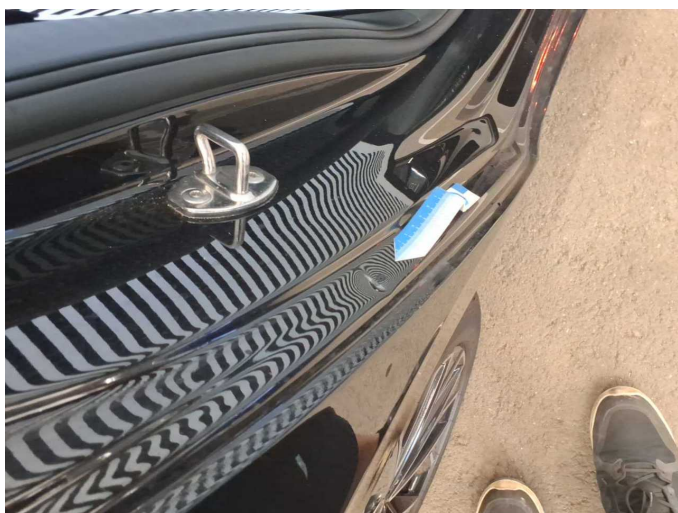


Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair




Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value

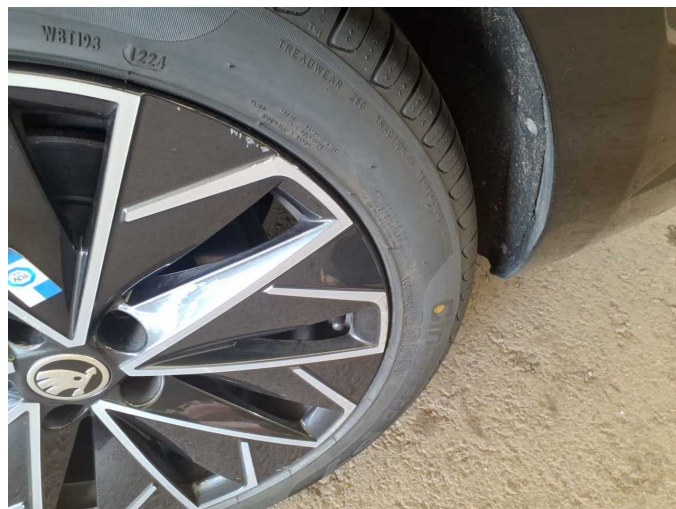

Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value

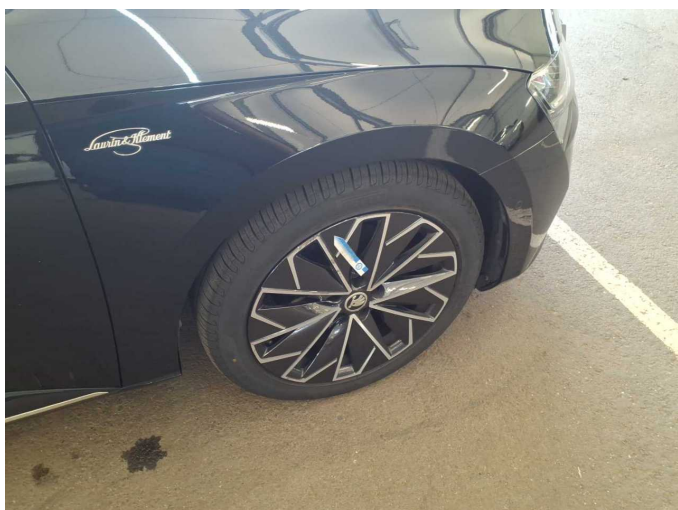


Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value




Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 8: Misc.: Inspection / maintenance - Due - Perform

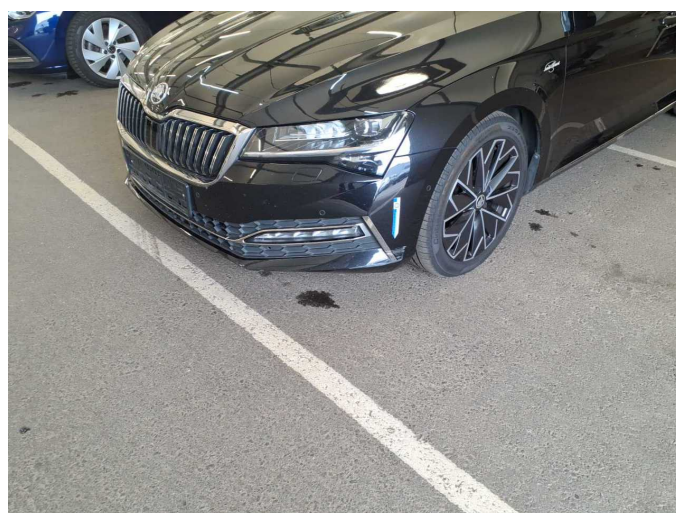


Damage 9: Front bumper: Front bumper (+ Blende) - Scratched - Paint

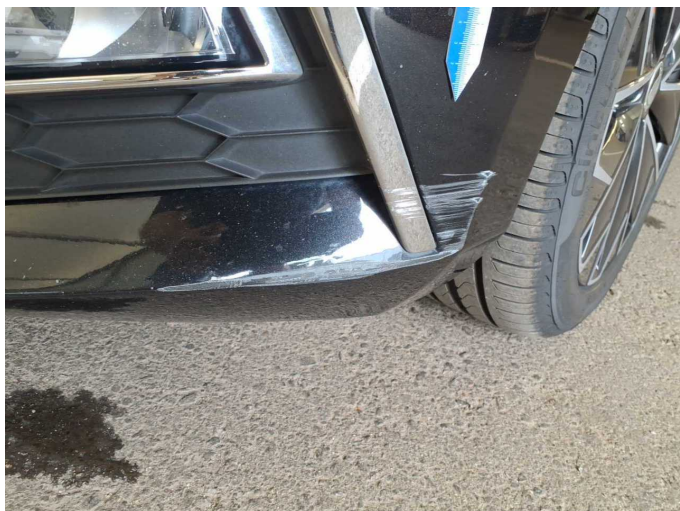

Damage 9: Front bumper: Front bumper (+ Blende) - Scratched - Paint



Damage 9: Front bumper: Front bumper (+ Blende) - Scratched - Paint

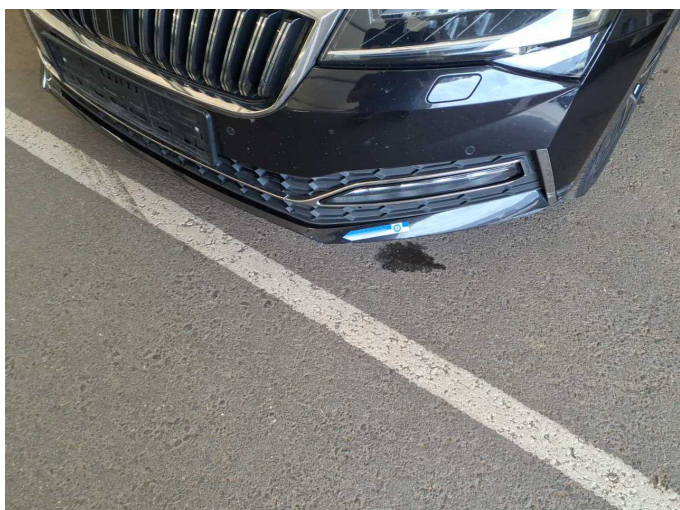

Damage 9: Front bumper: Front bumper (+ Blende) - Scratched - Paint



Damage 9: Front bumper: Front bumper (+ Blende) - Scratched - Paint



Accident 1: Rear, Side right




Accident 1: Rear, Side right



Accident 1: Rear, Side right




Accident 1: Rear, Side right

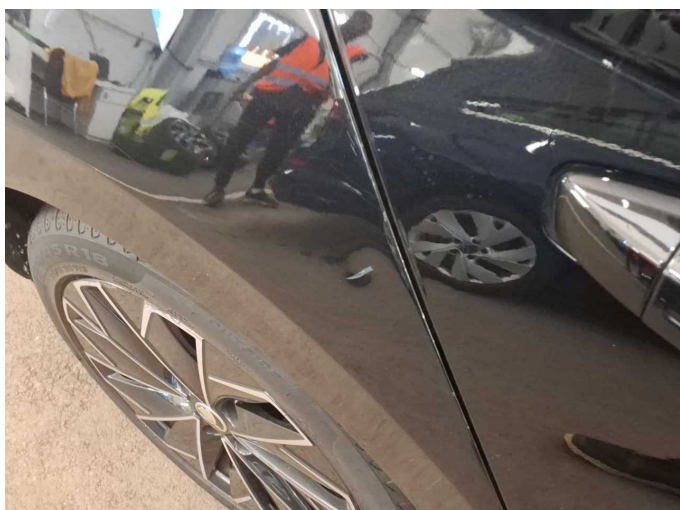


Accident 1: Rear, Side right



Accident 1: Rear, Side right

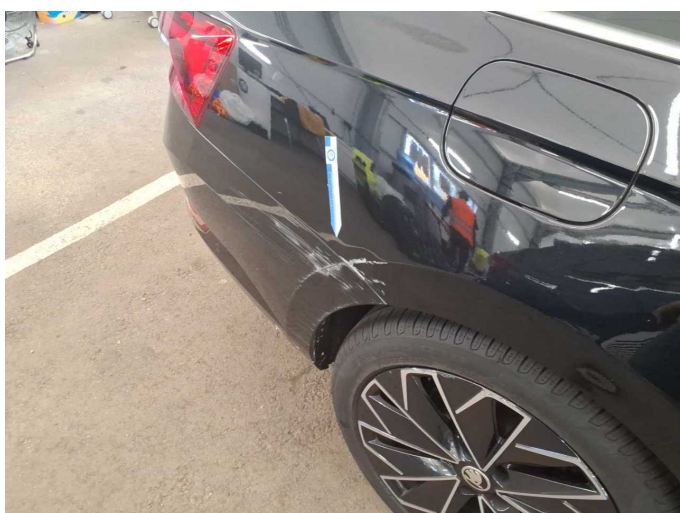

Accident 1: Rear, Side right

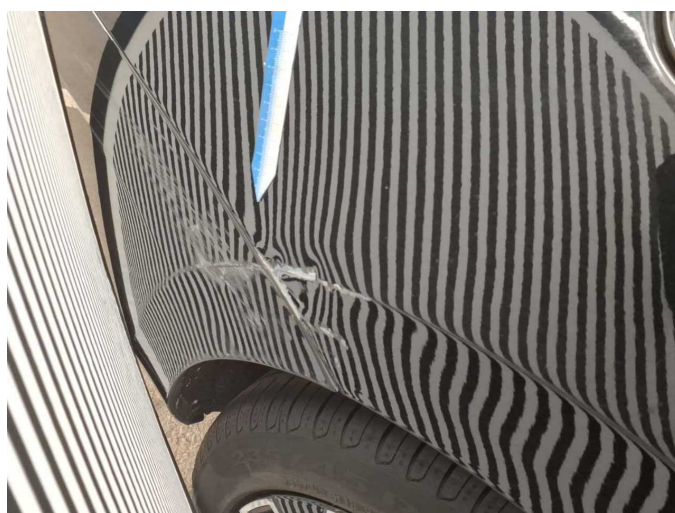

Accident 1: Rear, Side right



Accident 1: Rear, Side right




Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right

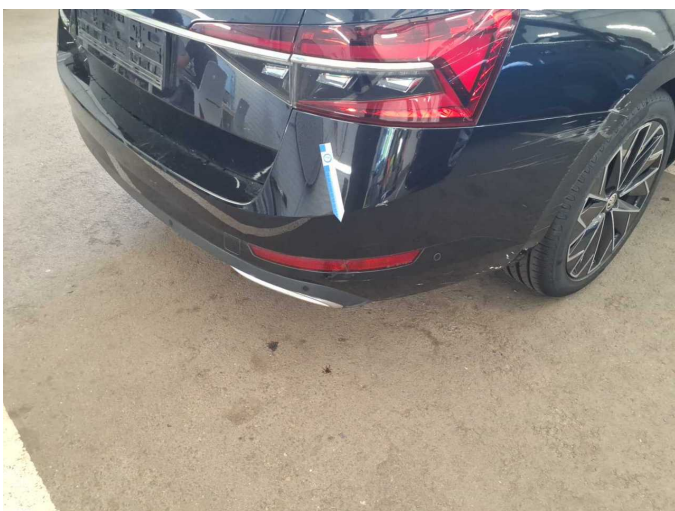

Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right




Accident 1: Rear, Side right



Accident 1: Rear, Side right




Accident 1: Rear, Side right

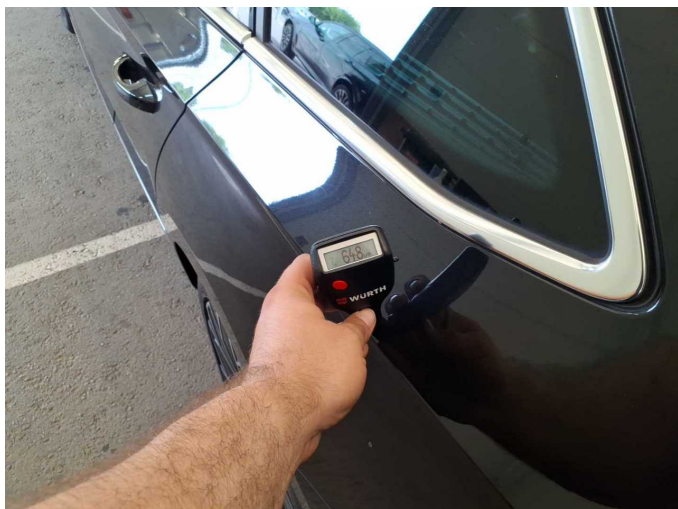

Repainting 1: Side panel - rear left side




Repainting 1: Side panel - rear left side

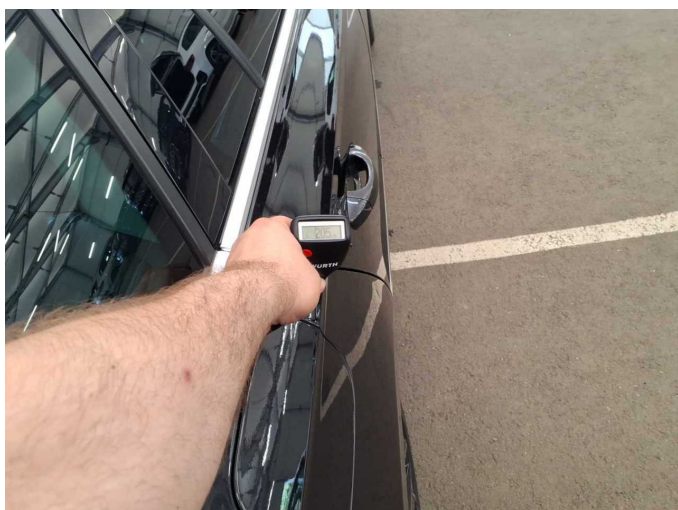

Repainting 2: Side panel - rear right side




Repainting 2: Side panel - rear right side

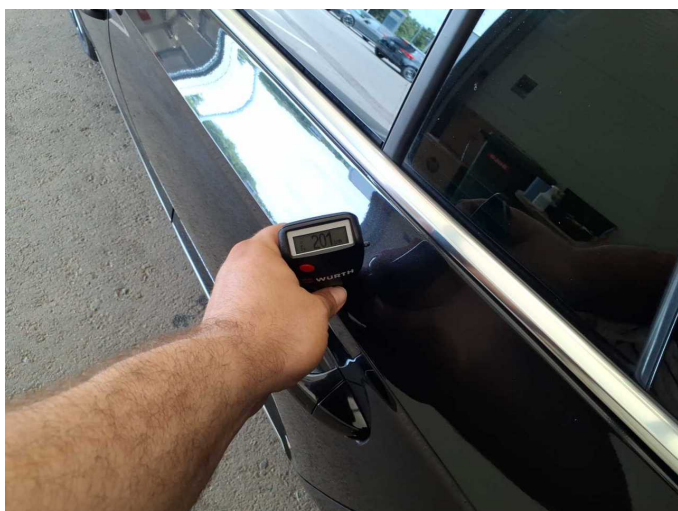

Repainting 3: Door - rear left side




Repainting 3: Door - rear left side

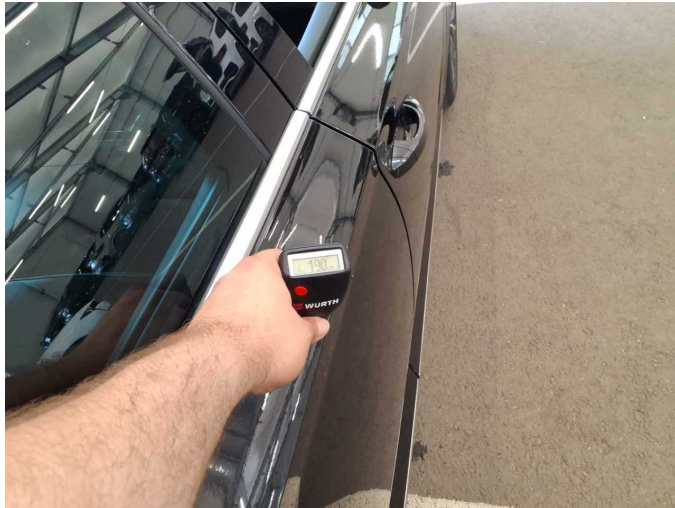

Repainting 4: Door - rear right side



Repainting 4: Door - rear right side

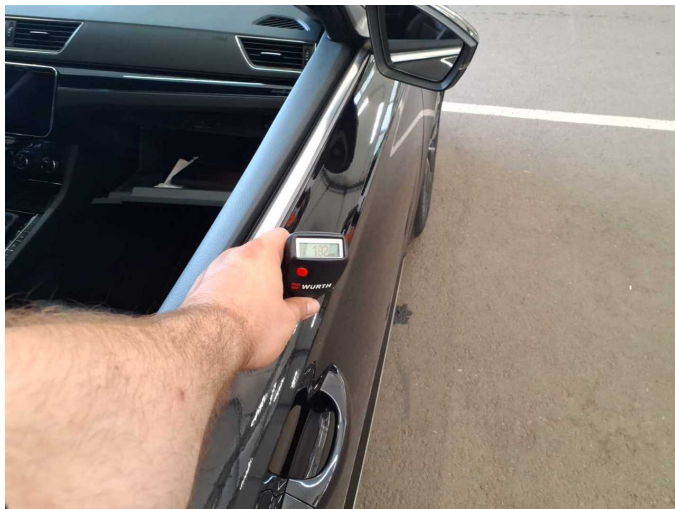

Repainting 5: Door - front right side



Repainting 5: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJH9NPXL7058247

Hersteller / Modell: SKODA SKODA Superb Combi 2.0 TDI DSG L&K

Datum	KM-Stand	Beschreibung
05.09.2025	148.347	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
02.06.2025	136.965	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Regelwartungsdienst
08.04.2025	0	HU + AU
05.09.2024	115.291	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.06.2024	107.166	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst
21.02.2024	96.655	Batterie ern; Systemtest/Eigendiagnose
05.07.2023	82.357	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.05.2023	0	HU + AU
27.01.2023	71.010	Bremsscheiben + Klötze h; Bremsscheiben + Klötze v
15.06.2022	53.440	Motoröl b. Wartung; Regelwartungsdienst
16.08.2021	31.424	Kleine Inspektion
18.03.2021	22.320	Motoröl b. Wartung; Ölwechsel