



Expertise

Protocol number: 46323022
Order No. / Reference: 26547211
Inspection date: 3 Jul 2026

Manufacturer: Opel

Model: Zafira Life 2.0 D M Edition

VIN: VXEEVHTMNZ072625



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Zafira Life 2.0 D M Edition

Vehicle Identification number VXEEVHTMNZ072625

Mileage (Read) 151,898 km

First registration 3 Jan 2023

Number of holders 1

Next periodical technical inspection 04/2028
(Report on hand)

Power / Engine displacement 106 kw / 1,997 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Van

Colour / colour code Mondstein Grau Metallic

Doors / Seats 5 / 8

Upholstery type Cloth

Colour of upholstery Grey-Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	45,240 km
Last service on / at	04/2026 at 147,140		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ347580
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / BBV 00353		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,760 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 101Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Low beam automatically
- Airbag for driver and passenger side
- Airbag: Curtain airbags, in the 2nd and 3rd rows of seats
- Automatic activation of the hazard warning lights
- Exterior mirror housings in black
- On-board computer
- Diesel particulate filter
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Luggage compartment cover
- Manual handbrake
- Child safety lock, mechanical
- Air conditioning: Auxiliary air conditioning, rear
- Headlight range adjustment, manual
- Rear fog lights with reversing lights
- Package: Driver Assistance Package 2
- Radio: Digital radio reception DAB+
- Rain sensor
- Tire pressure warning
- Sliding door trim with cover, in vehicle color
- Side protection strips in vehicle color
- Seat belts: Three-point seat belts in all seats
- Seats: 8 seats in fabric, Harlequin Black
- Solar Protect thermal insulation glazing
- 12V socket
- Door: Sliding door, driver and passenger side
- Immobiliser
- Ignition keys (2), both foldable

- Storage compartments
- Airbag: Head airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Exterior mirrors, electrically adjustable, heated and folding
- Hill Start Assist
- Third brake light
- Tachometer
- Window: Window, driver's side in the 2nd row of seats, fixed
- Transmission: 6-speed manual transmission
- Glazed tailgate, with rear window wiper and heater
- Air conditioning
- LED daytime running lights
- Fog light
- Package: Driver Assistance Package 1
- Rear parking pilot
- Radio: Multimedia radio with 7" touchscreen color display
- Tire repair kit
- Wheels: Alloy wheels in bicolor, 7J x 17
- Side impact protection
- Power steering
- Safety steering column, height and length adjustable
- Heated seats for driver and front passenger
- Sun visors driver and passenger side
- Traction Control (TC) Plus
- Exterior door handles, in car color
- Central locking with remote control

Extra equipment

- Detachable trailer hitch
- Steering wheel: Multifunction leather steering wheel, flattened at the bottom

- Paint finish: Metallic

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Gearbox	Gearbox (Tröpfchenbildung, Umweltbelastung) - Leaking - Perform diagnosis
2	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
3	Door - front left side	Door edge - Scratch(es) - Smart repair
4	Sill - left side	Sill - Scratch(es) - Smart repair
5	Sliding door - left side	Sliding door with glass panel (Bis an Grund) - Scratch(es) - Smart repair
6	Roof	Roof (vorne) - dent(s) - Smooth repair work
7	Misc.	Misc. (Stirnwand Dämmung) - Broken / torn - Replace
8	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
9	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
10	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
11	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
12	Side panel - rear right side	Side panel - Dent / paintcoat damage - Smart repair
13	Vehicle glazing	Rear window - Scratched - Replace
14	Front bumper	Front bumper - Scratched - Repair and paint
15	Door - front right side	Door - Scratched - Repair and paint
16	Sliding door, right	Sliding door (Delle) - Scratched - Repair and paint
17	Bonnet	Bonnet - Scratch(es) - Repair and paint
18	Roof	Roof (Mitte) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - No deduction
2	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
3	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Rear shelf

Repainting

No. Repainting

- 1 Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side 156 µm |



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Der beiliegende Radsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.

Die im Gutachten errechneten und angegebenen Minderwerte beziehen sich nur auf festgestellte Schäden oder Mängel, die über die normale Abnutzung entsprechend Fahrzeug-Alter und Laufleistung bzw. über das übliche Verschleißmaß hinausgehen.

Beschädigungen, die durch normalen Gebrauch während der Dauer der Nutzung entstanden sind, wurden nicht berücksichtigt (Gebrauchsspuren).



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

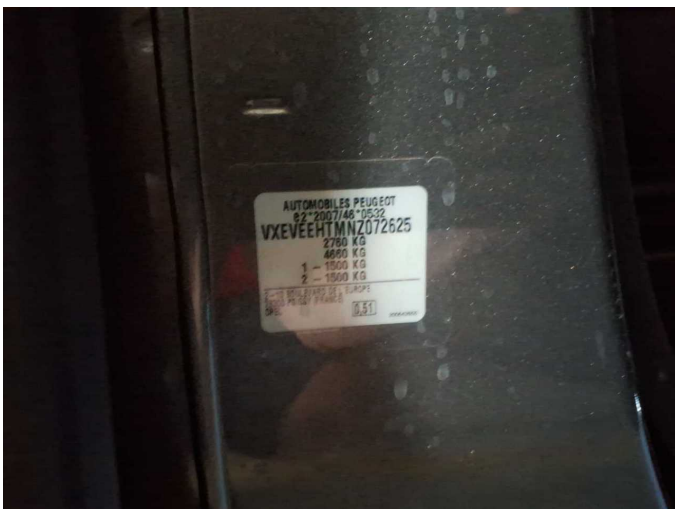


Figure 11: VIN



Figure 12: Mounted tyres

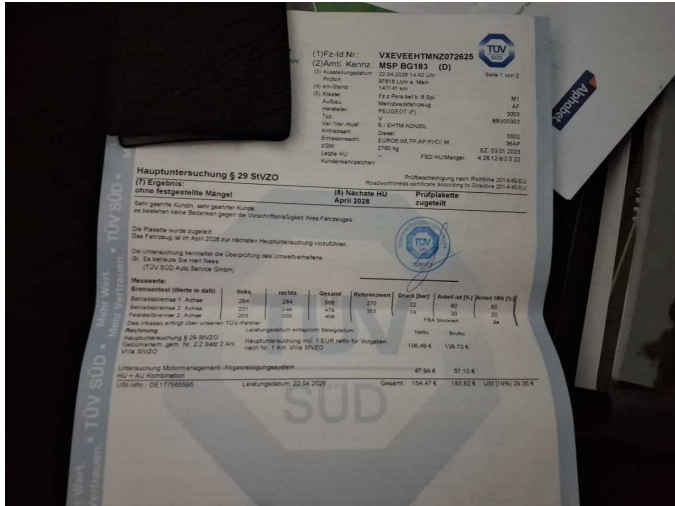


Figure 13: Documents



Figure 14: Documents

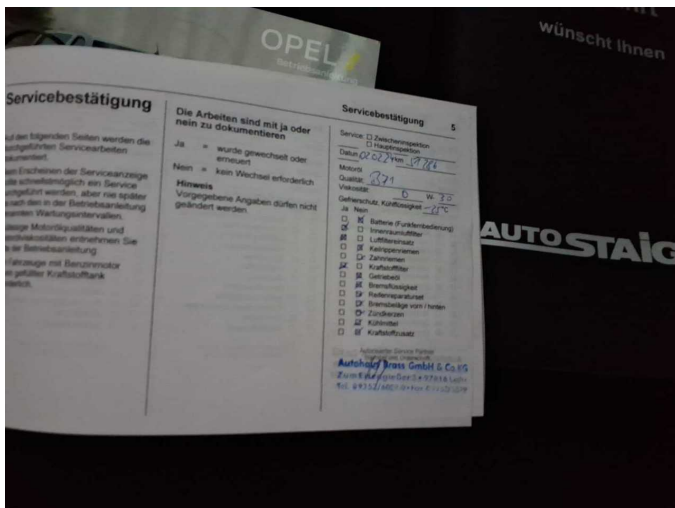


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

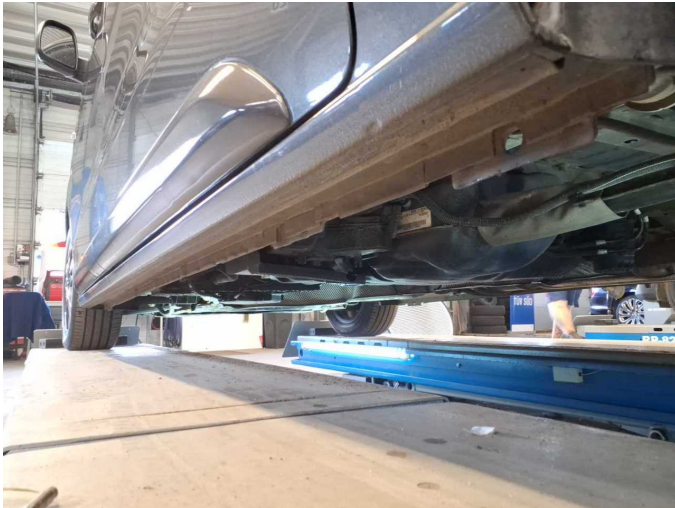


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

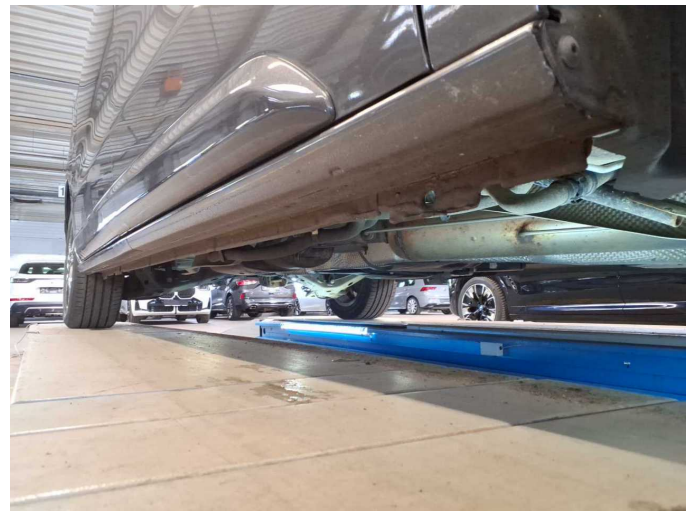


Figure 28: Misc.

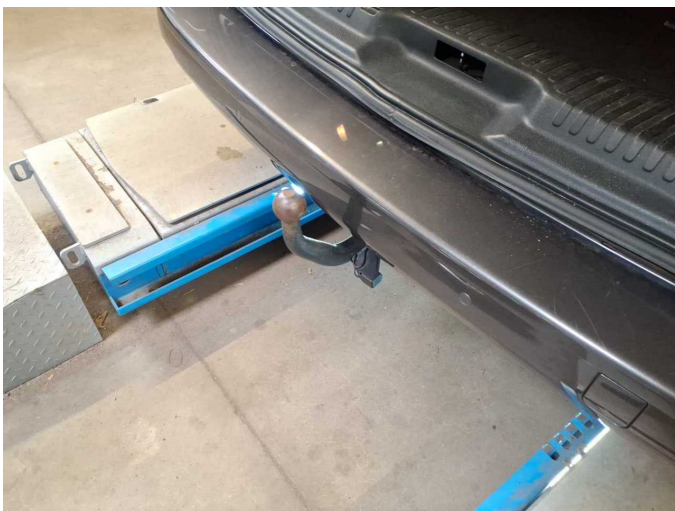


Figure 29: Misc.

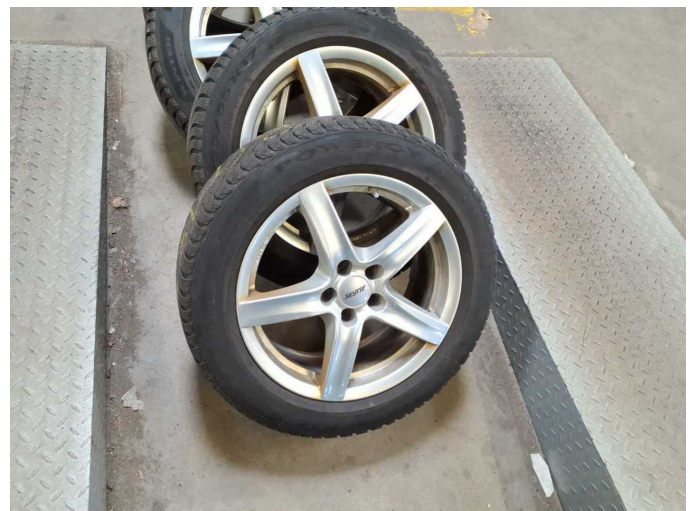


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

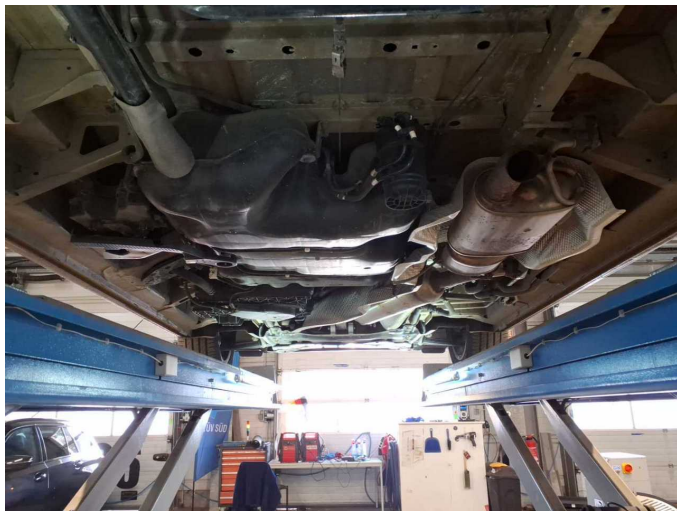


Figure 33: Misc.



Figure 34: Misc.



Damage 1: Gearbox: Gearbox (Tröpfchenbildung, Umweltbelastung) - Leaking - Perform diagnosis



Damage 1: Gearbox: Gearbox (Tröpfchenbildung, Umweltbelastung) - Leaking - Perform diagnosis



Damage 1: Gearbox: Gearbox (Tröpfchenbildung, Umweltbelastung) - Leaking - Perform diagnosis




Damage 1: Gearbox: Gearbox (Tröpfchenbildung, Umweltbelastung) - Leaking - Perform diagnosis




Damage 1: Gearbox: Gearbox (Tröpfchenbildung, Umweltbelastung) - Leaking - Perform diagnosis




Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

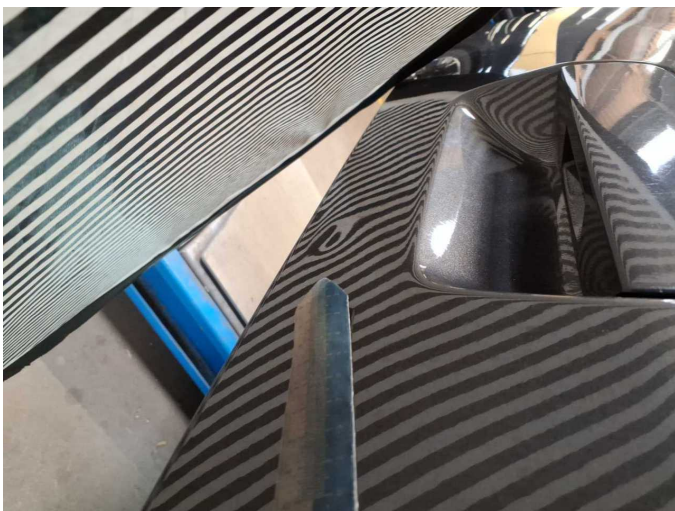

Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

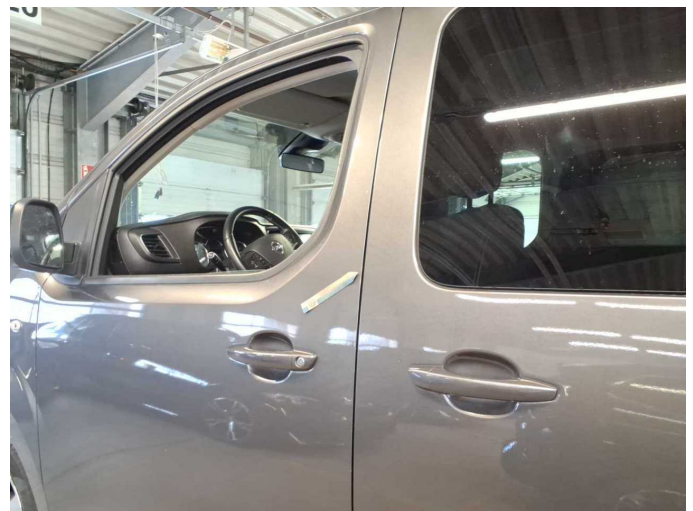

Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair

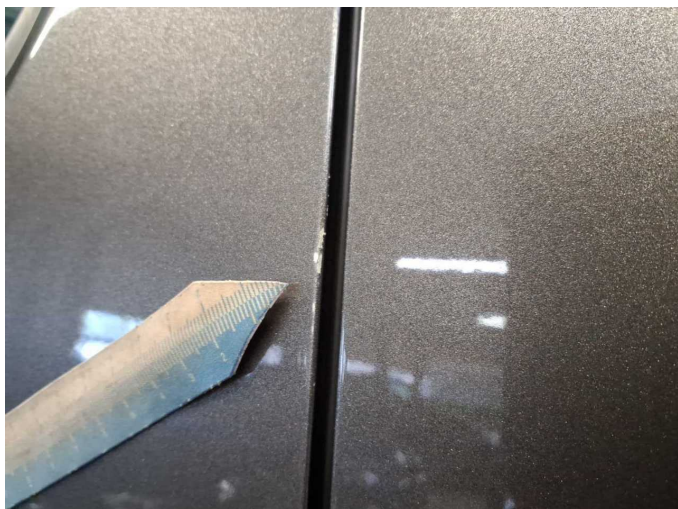

Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 5: Sliding door - left side: Sliding door with glass panel (Bis an Grund) - Scratch(es) - Smart repair

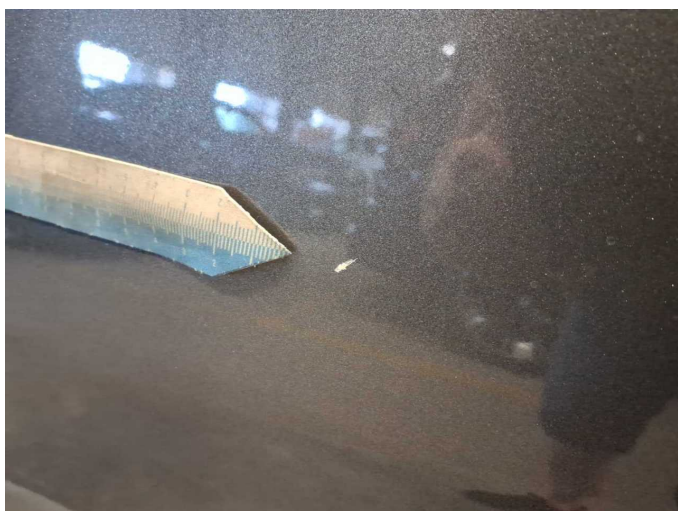

Damage 5: Sliding door - left side: Sliding door with glass panel (Bis an Grund) - Scratch(es) - Smart repair




Damage 6: Roof: Roof (vorne) - dent(s) - Smooth repair work



Damage 6: Roof: Roof (vorne) - dent(s) - Smooth repair work



Damage 6: Roof: Roof (vorne) - dent(s) - Smooth repair work

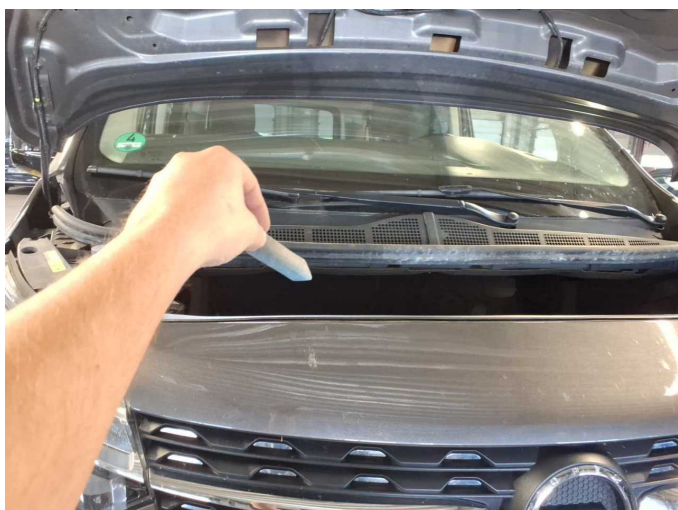

Damage 7: Misc.: Misc. (Stirnwand Dämmung) - Broken / torn - Replace



Damage 7: Misc.: Misc. (Stirnwand Dämmung) - Broken / torn - Replace



Damage 8: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 8: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 8: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 8: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

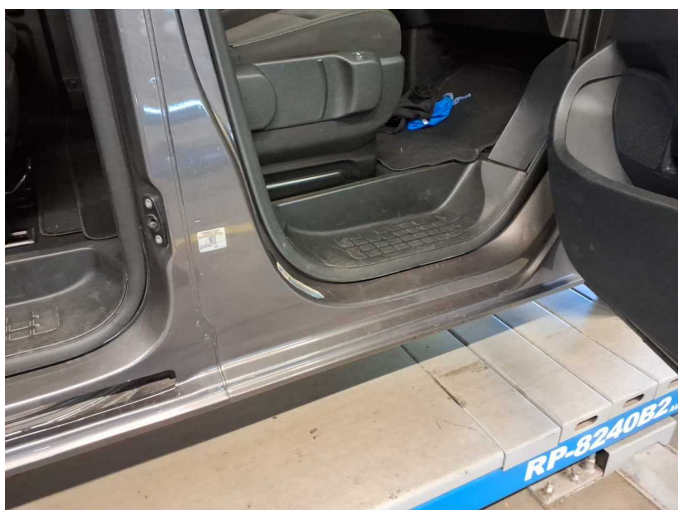

Damage 9: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

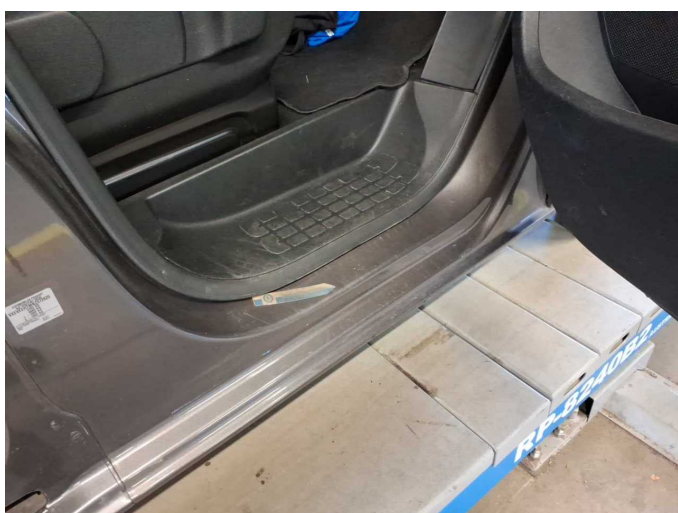

Damage 9: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair




Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 10: Sill - right side: Sill - Dent / paintcoat damage - Smart repair




Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

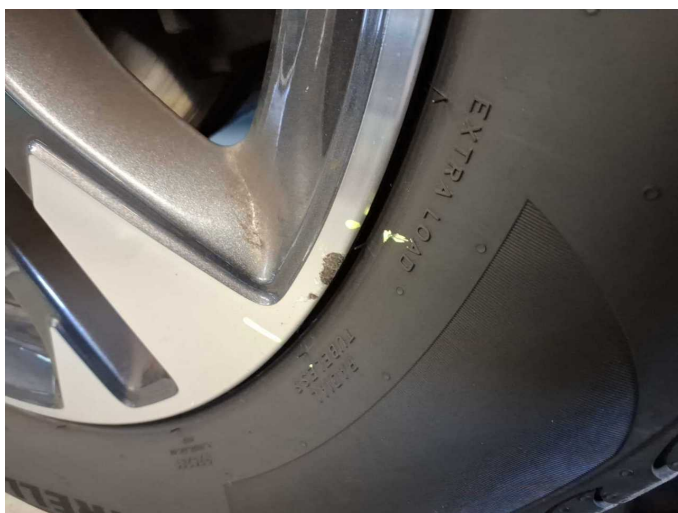


Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair

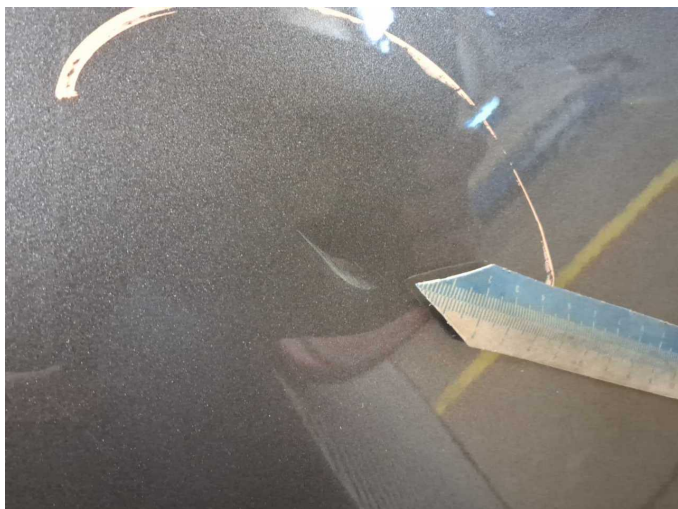

Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair

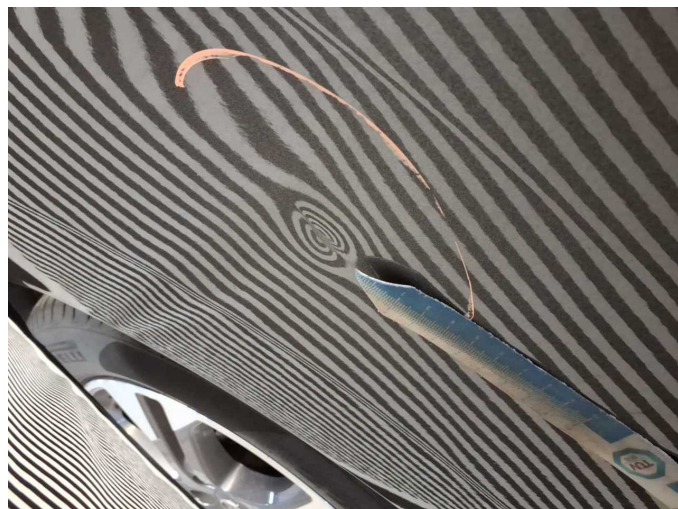

Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair



Damage 13: Vehicle glazing: Rear window - Scratched - Replace




Damage 13: Vehicle glazing: Rear window - Scratched - Replace



Damage 13: Vehicle glazing: Rear window - Scratched - Replace



Damage 13: Vehicle glazing: Rear window - Scratched - Replace

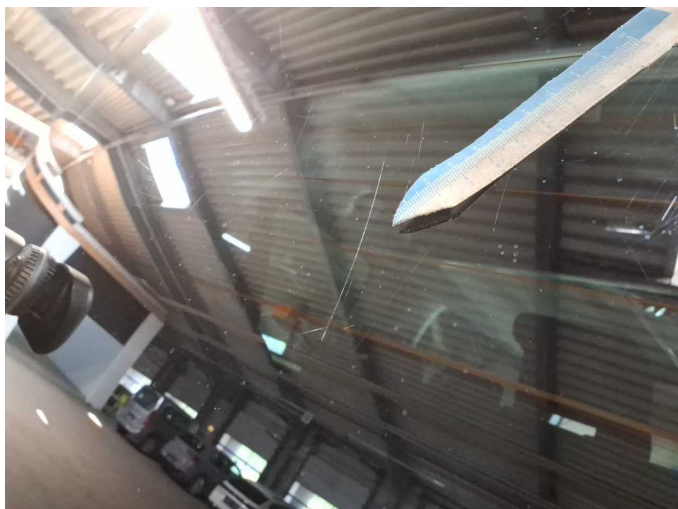


Damage 13: Vehicle glazing: Rear window - Scratched - Replace



Damage 13: Vehicle glazing: Rear window - Scratched - Replace




Damage 13: Vehicle glazing: Rear window - Scratched - Replace

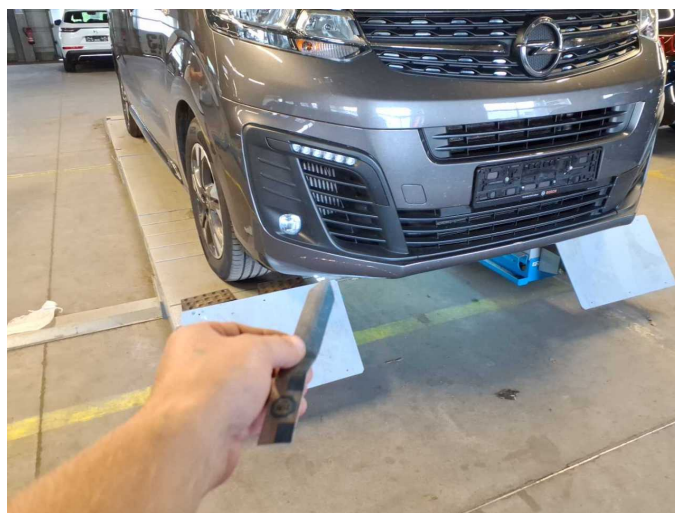


Damage 14: Front bumper: Front bumper - Scratched - Repair and paint



Damage 14: Front bumper: Front bumper - Scratched - Repair and paint

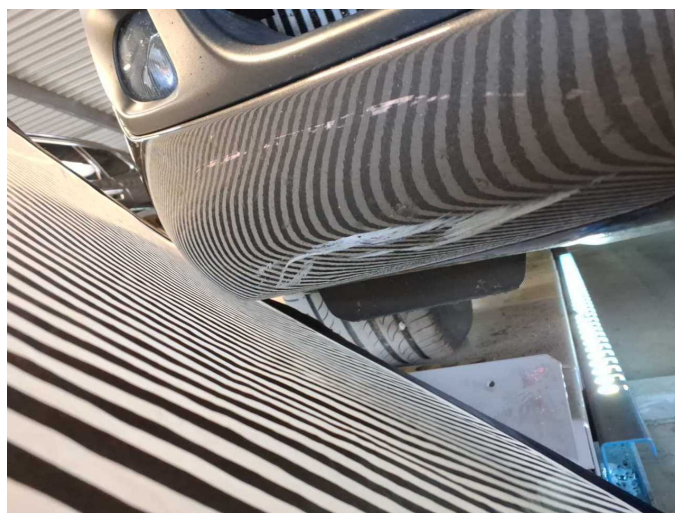

Damage 14: Front bumper: Front bumper - Scratched - Repair and paint

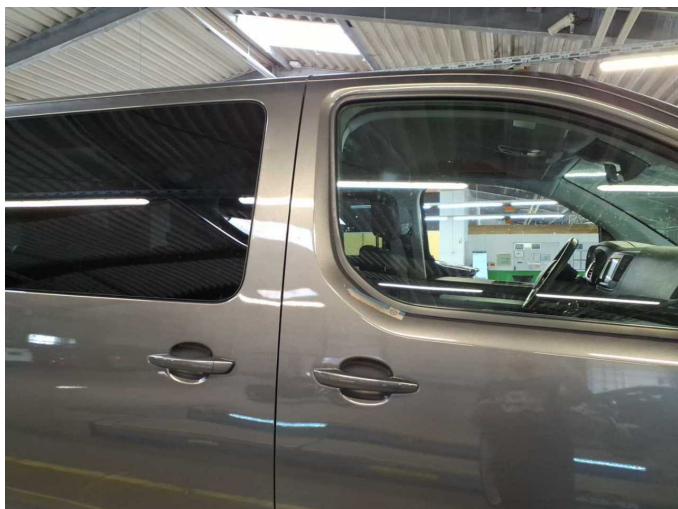

Damage 15: Door - front right side: Door - Scratched - Repair and paint



Damage 15: Door - front right side: Door - Scratched - Repair and paint



Damage 15: Door - front right side: Door - Scratched - Repair and paint



Damage 15: Door - front right side: Door - Scratched - Repair and paint




Damage 15: Door - front right side: Door - Scratched - Repair and paint



Damage 15: Door - front right side: Door - Scratched - Repair and paint




Damage 15: Door - front right side: Door - Scratched - Repair and paint

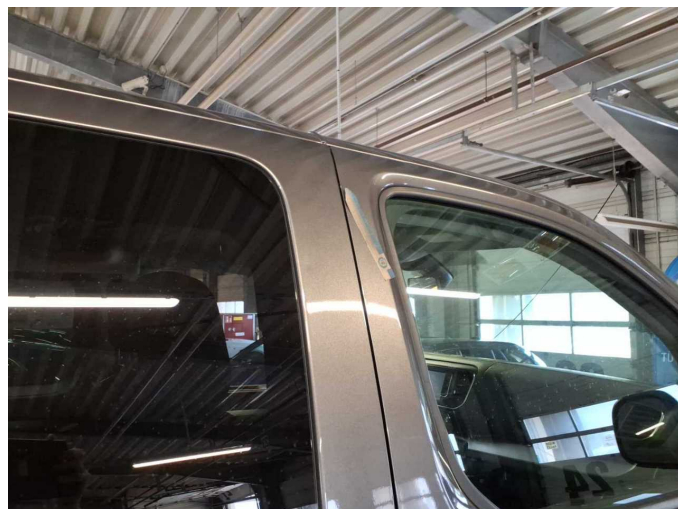

Damage 15: Door - front right side: Door - Scratched - Repair and paint



Damage 15: Door - front right side: Door - Scratched - Repair and paint

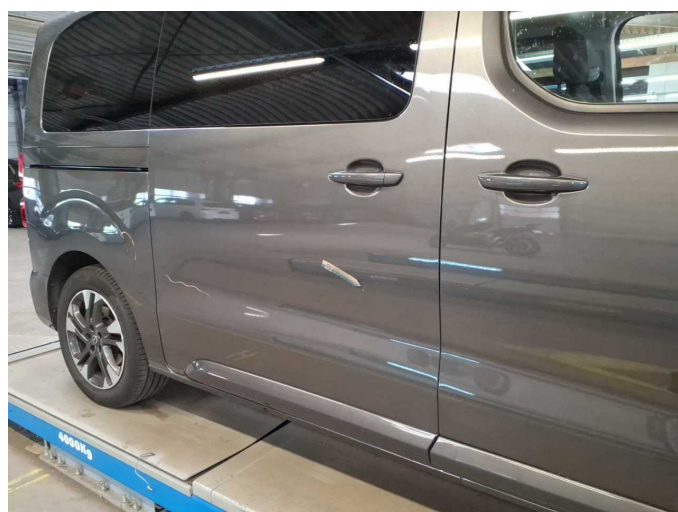

Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint



Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint



Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint




Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint




Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint



Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint

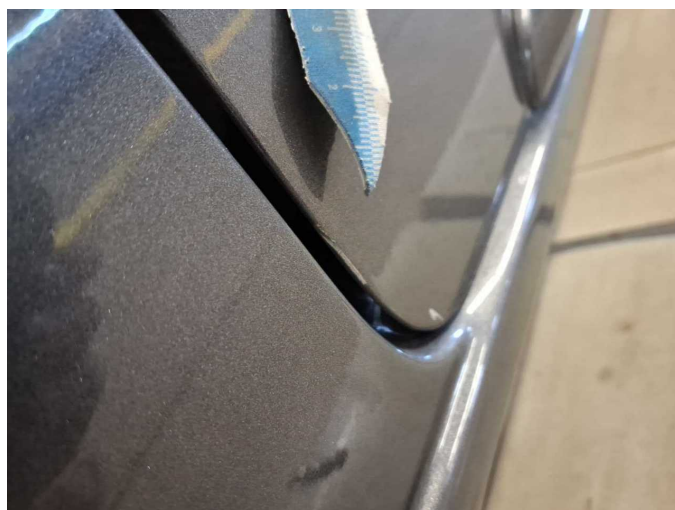

Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint

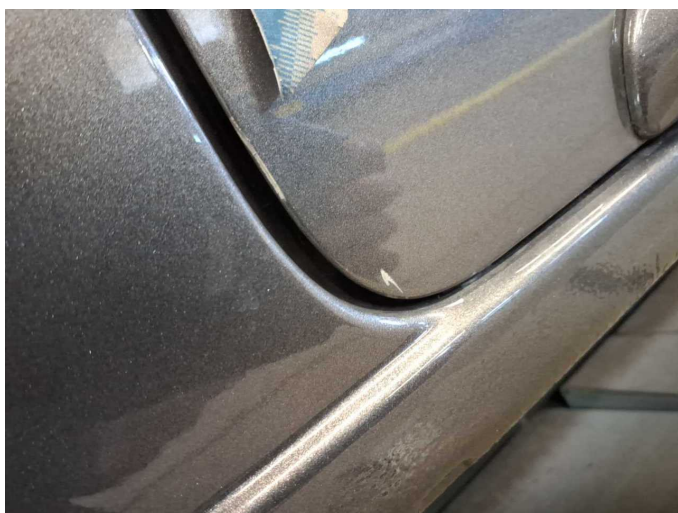


Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint



Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint



Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint

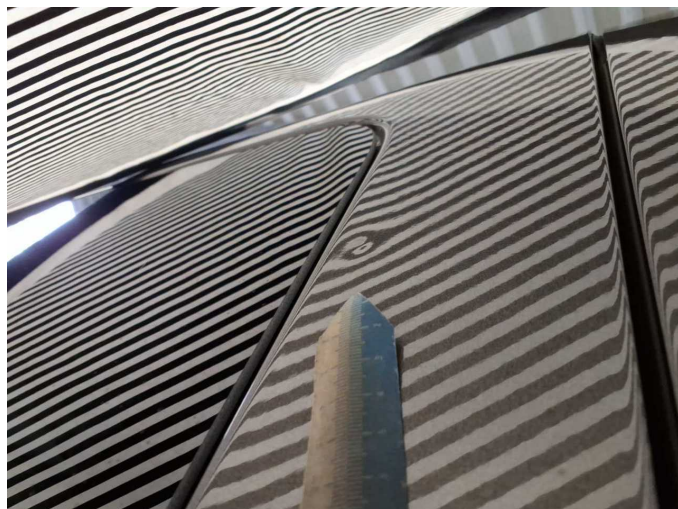

Damage 16: Sliding door, right: Sliding door (Delle) - Scratched - Repair and paint




Damage 17: Bonnet: Bonnet - Scratch(es) - Repair and paint



Damage 17: Bonnet: Bonnet - Scratch(es) - Repair and paint



Damage 17: Bonnet: Bonnet - Scratch(es) - Repair and paint

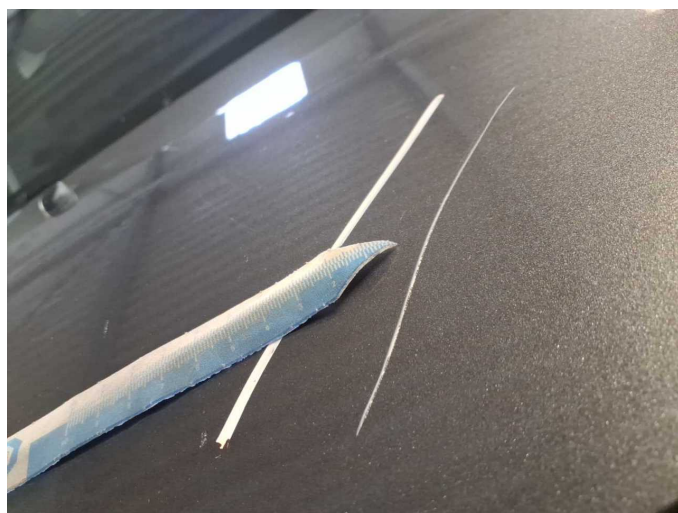

Damage 17: Bonnet: Bonnet - Scratch(es) - Repair and paint



Damage 18: Roof: Roof (Mitte) - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Mitte) - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Mitte) - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Mitte) - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Mitte) - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Mitte) - Dent / paintcoat damage - Repair and paint



Missing part 1: Interior: Rear shelf - Missing - Replace



Missing part 1: Interior: Rear shelf - Missing - Replace



Repainting 1: Mudguard - left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VXEVEEHTMNZ072625
Hersteller / Modell: OPEL OPEL Zafira Life 2.0 D M Edition

Datum	KM-Stand	Beschreibung
20.04.2026	147.140	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges; Zahnriemen/Steuerkett ern
24.02.2025	99.953	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
01.02.2024	51.286	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges