



Expertise

Protocol number: 46627076
Order No. / Reference: 26761051
Inspection date: 15 Jul 2026

Manufacturer: Ford

Model: Focus Turnier 1.0 EcoBoost Start-Stopp-System
COOL&CONNECT

VIN: WF0PXXGCHPMD03618



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.0 EcoBoost Start-Stopp-System COOL&CONNECT	
Vehicle Identification number	WF0PXXGCHPMD03618
Mileage (Read)	148,247 km
First registration	10 Jan 2022
Number of holders	1
Fuel type	Petrol
Engine displacement / Cylinder	999 ccm / 3
Power	92 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details			
Maintenance booklet / proof	Available / incomplete	Next maintenance in	7 %
Last service on / at	10/2024 at 88,716 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH386914
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BPP 00621		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,925 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	3mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Light alloy	Goodyear	3mm / 1mm
2)	205/60 R16 92V	Summer tyres on Light alloy	Goodyear	1mm / 1mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated turn signals)
- Tires: 6.5 J x 16 design wheels (4) with 205/60 R16 tires (in 5-spoke design, in black-silver)
- Roof rails, black
- Tachometer
- Driver information system with on-board computer, color (10.7 cm screen diagonal)
- Electric front and rear windows (with all-around closing function)
- Luggage compartment cover
- Speed limiter (Intelligent speed limiter with speed limit display)
- Cruise control
- Transmission: 6-speed manual transmission
- Illuminated glove compartment
- Back window, heater
- Rear window wiper
- Interior lighting with LED technology (front and rear and map reading lights at the front)
- Isofix mounting (including top tether anchor points on the outer seats of the 2nd row)
- Air conditioning, manual
- Headrests: 2 front and 3 rear, height adjustable
- Paint finish: Solid
- Leather gear knob
- Steering wheel: 3-spoke design steering wheel (in Sensico leather look)
- Steering column, adjustable (adjustable in height and reach)
- MyKey key system (individually programmable second key)
- Otto particulate filter
- Front and rear parking pilot system
- Post-Collision Assist (In the event of a severe collision, which would also deploy the airbag and in which the driver might be incapacitated, this system initiates the braking process. This reduces the risk of colliding with further obstacles and road users after the initial collision. The driver can intervene and operate the accelerator or brake pedal manually throughout the entire process.)
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Headlight assistant with day/night sensor
- Seats: Passenger seat height-adjustable, manually (with adjustable lumbar support)
- Seats: Map grid on the driver's and front passenger's seat backrests
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Central locking with remote control and remote luggage compartment release
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Attachment points behind the second row of seats for mounting the safety partition net
- Hill start assist
- Fabric headliner
- Roof spoiler painted in car color
- Electronic Stability Program (ESP) (with Emergency Brake Assist (EBA) and Traction Control System (TCS))
- Lane keeping assist including lane keeping assist
- Electronic parking brake
- FordPass Connect including eCall, live traffic information (only with navigation) and Wi-Fi hotspot (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - eCall emergency call system to send an emergency call in the event of an accident or when manually activated - Real-time traffic information (only in conjunction with navigation system) - Wi-Fi hotspot (up to 4G/LTE7, for up to 10 mobile devices))
- Intelligent safety system (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - safety pedal assembly)
- LED headlights (LED low beam - LED high beam - LED daytime running lights incl. integrated LED turn signals at the front - LED cornering lights, static, incl. integrated LED fog light function and maneuvering light)
- Make-up mirrors in driver and passenger sun visors
- Front center console "Premium" (sliding armrest - cup holder incl. cover - storage compartments - 12-volt and USB connection)
- Upholstery: Cloth
- Pre-Collision Assist (Forward Alert system with pedestrian and bicycle detection)
- Radio: Ford SYNC 3 Light with AppLink, 8" touchscreen and DAB/DAB+ (6 speakers - Android Auto and Apple CarPlay - Bluetooth hands-free system and audio streaming - steering wheel controls - voice control via phone - USB port)
- Tire Pressure Monitoring System (TPMS)
- Electro-mechanical speed-dependent power steering (EPAS - Electric Power Assisted Steering)
- Seats: Driver's seat height adjustable (with manually adjustable lumbar support)
- Seats: Rear seat backrest (foldable, 60:40 split)
- Start-stop system
- Carpet floor mats in the front
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats



Extra equipment

- Paint finish: Frozen White
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - Replace
2	Equipment	Tirefit filler - Expired - Replace
3	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
4	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
5	Sill - left side	Sill - Dent / paintcoat damage - Smart repair
6	2nd wheel set	3 tyres - Worn - Replace
7	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
8	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
9	Bonnet	Bonnet - Corrosion - Repair and paint
10	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Trim / covers	Door trim - rear left side - Scratch(es) - No deduction
2	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
3	Trim / covers	Boot lining - Scratch(es) - No deduction
4	Wheel / tyres	Tyre - rear left side - does not meet manufacturer specifications - No deduction
5	Door - rear right side	Door - Scratch(es) - No deduction
6	Roof	Roof rail - left side - dent(s) - No deduction
7	Door - front right side	Door - Dent / paintcoat damage - No deduction
8	Steering system	Steering wheel - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Owner's manual



Repainting

No. Repainting

- 1 Roof rail - right side, Professionally carried out, Invoice of repair done Non-existent
- 2 Bonnet, Professionally carried out, Invoice of repair done Non-existent
- 3 Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
- 4 Door - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - right side	186 µm	Bonnet	279 µm
Side panel - rear right side	604 µm	Door - rear right side	324 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

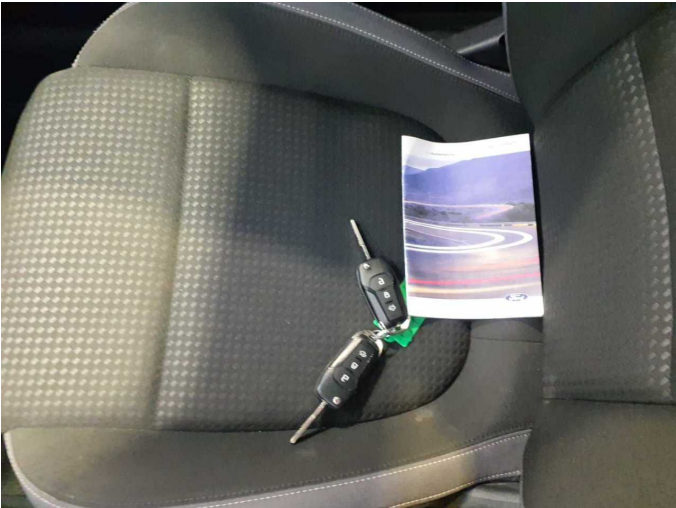


Figure 13: Documents

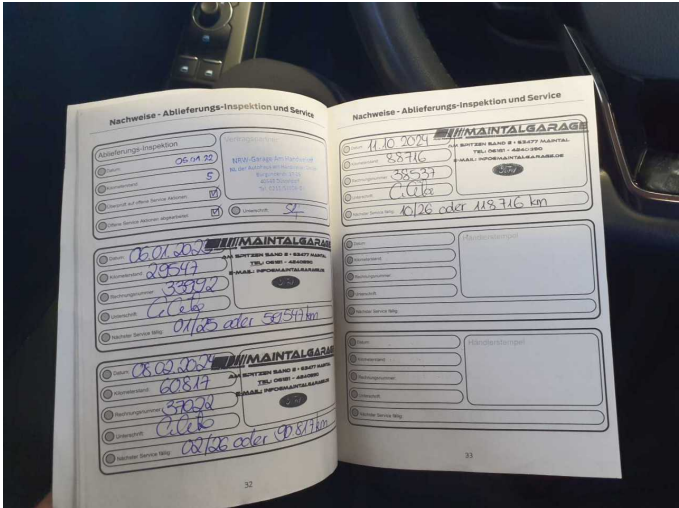


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

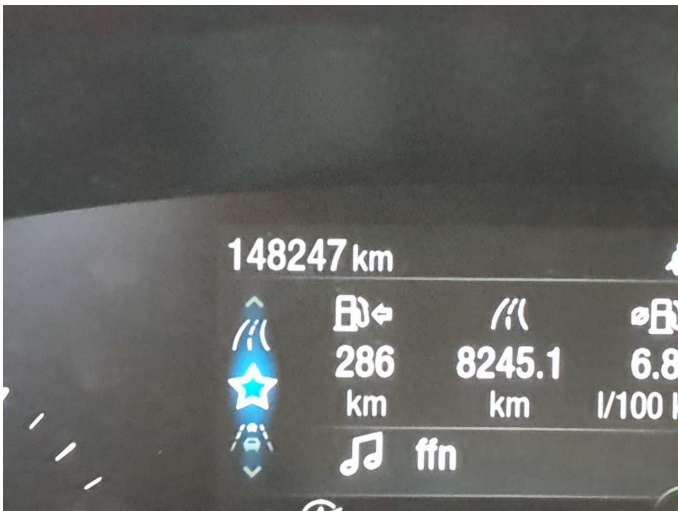


Figure 21: Misc.



Figure 22: Misc.

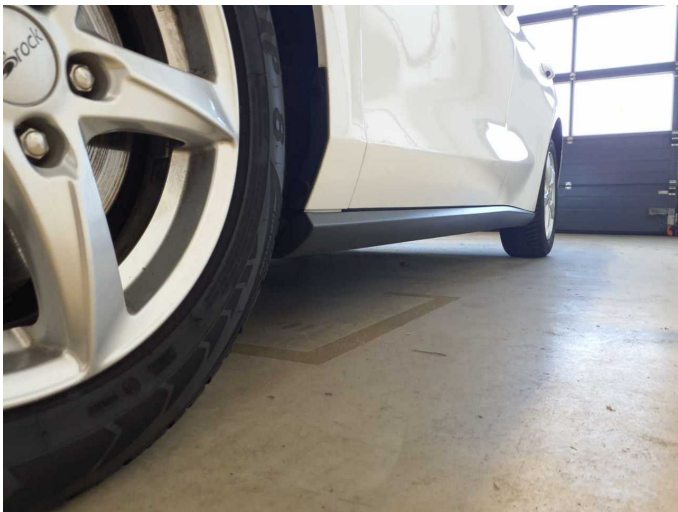


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

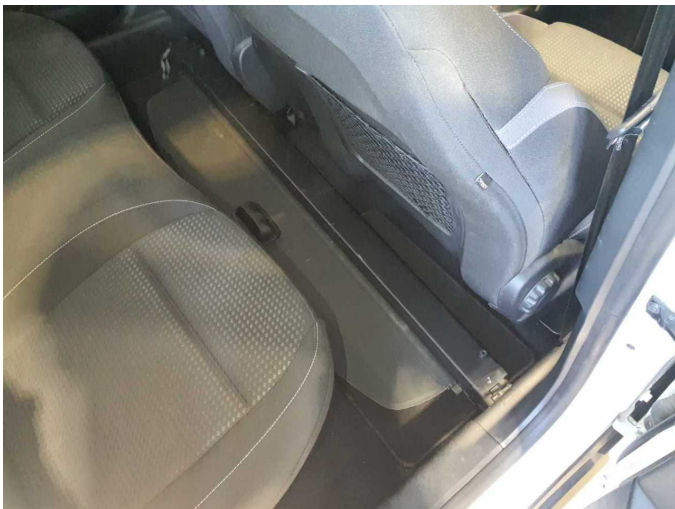


Figure 27: Misc.

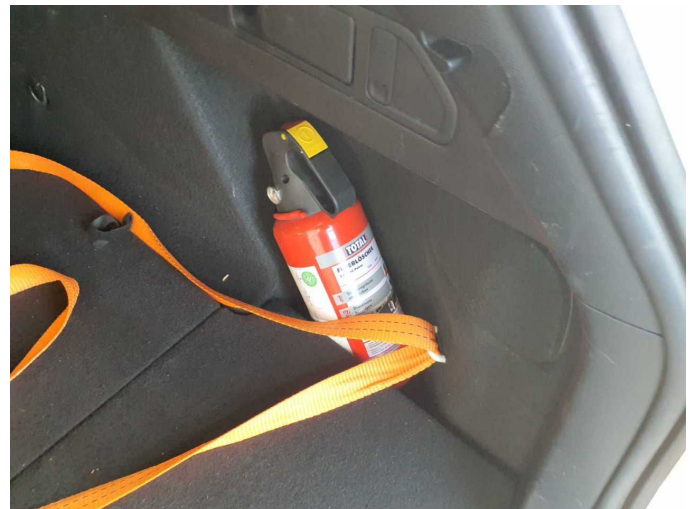


Figure 28: Misc.


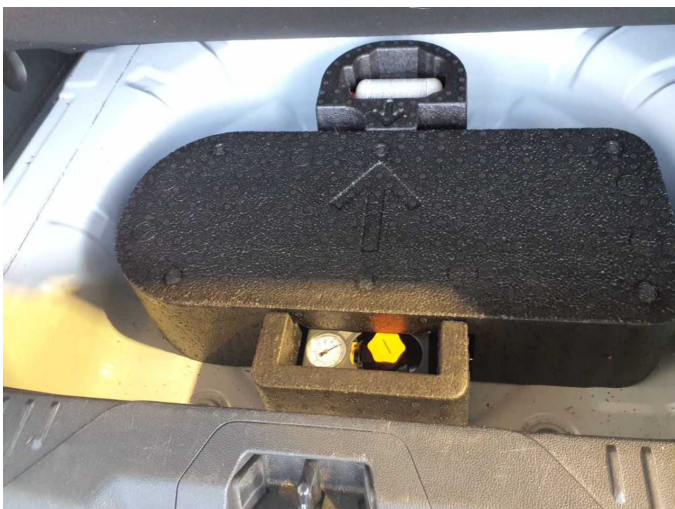


Figure 29: Misc.



Damage 1: Trim / covers: Floor mats - Broken / torn - Replace

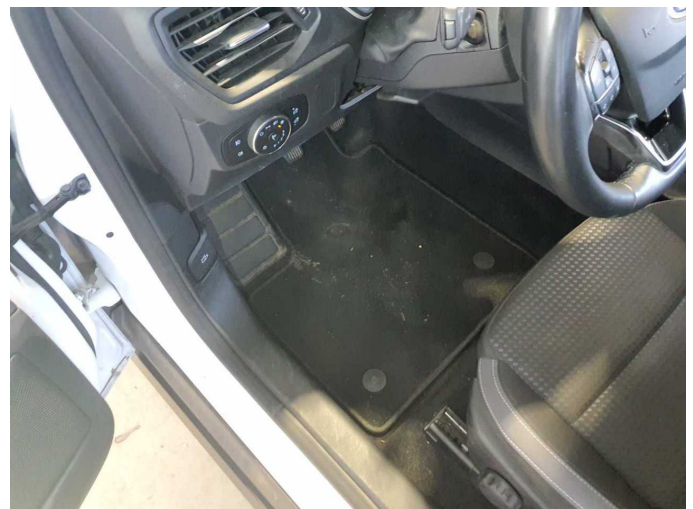


Damage 1: Trim / covers: Floor mats - Broken / torn - Replace




Damage 2: Equipment: Tirefit filler - Expired - Replace




Damage 3: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

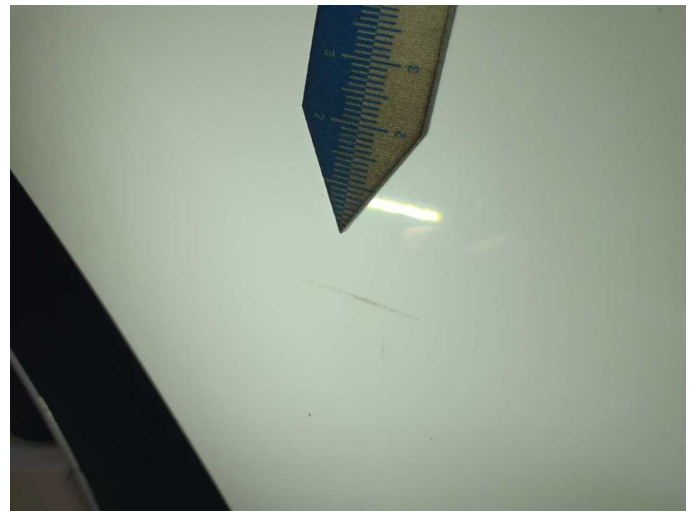


Damage 3: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

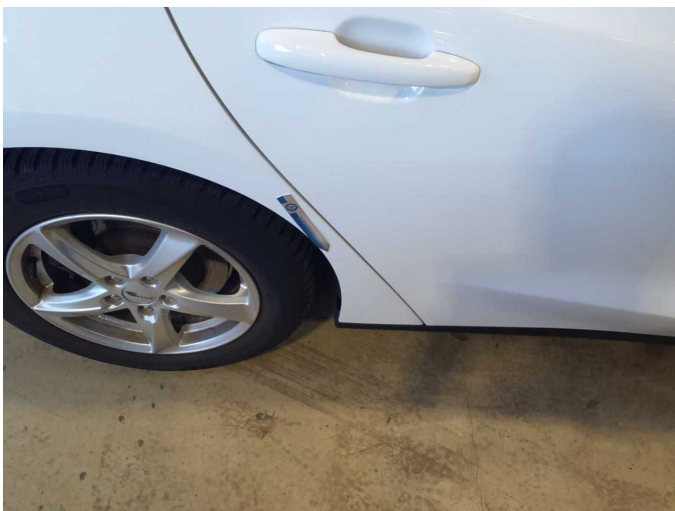

Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

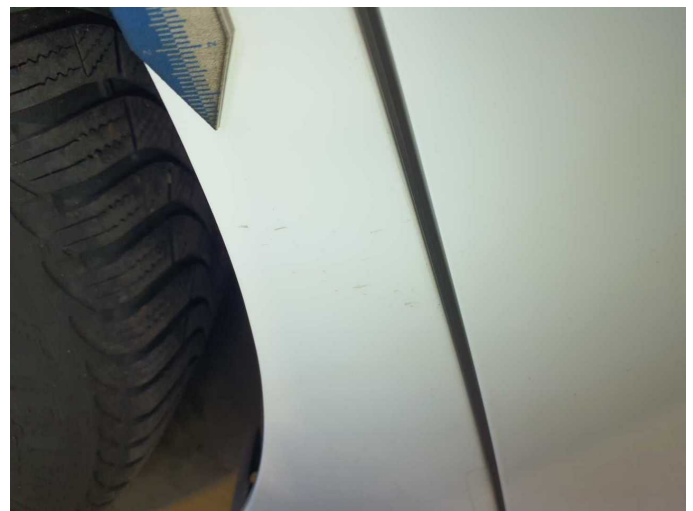

Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

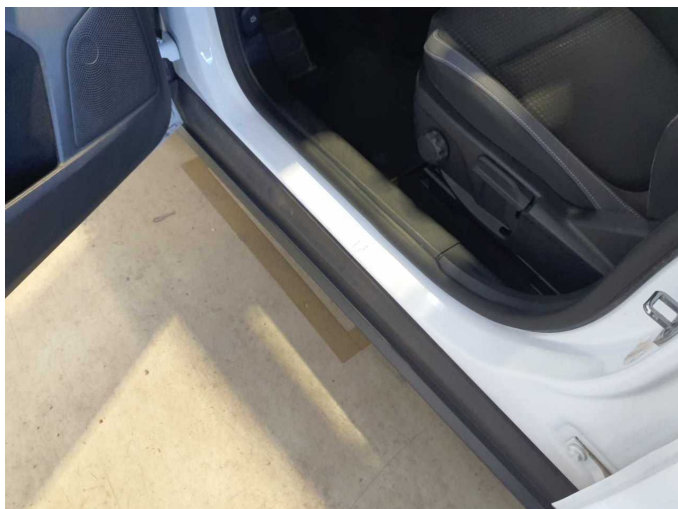

Damage 5: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Sill - left side: Sill - Dent / paintcoat damage - Smart repair




Damage 6: 2nd wheel set: 3 tyres - Worn - Replace



Damage 6: 2nd wheel set: 3 tyres - Worn - Replace



Damage 6: 2nd wheel set: 3 tyres - Worn - Replace

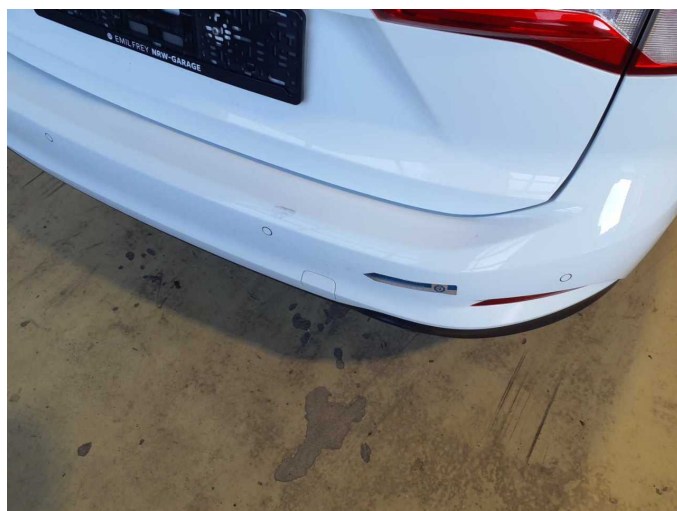

Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

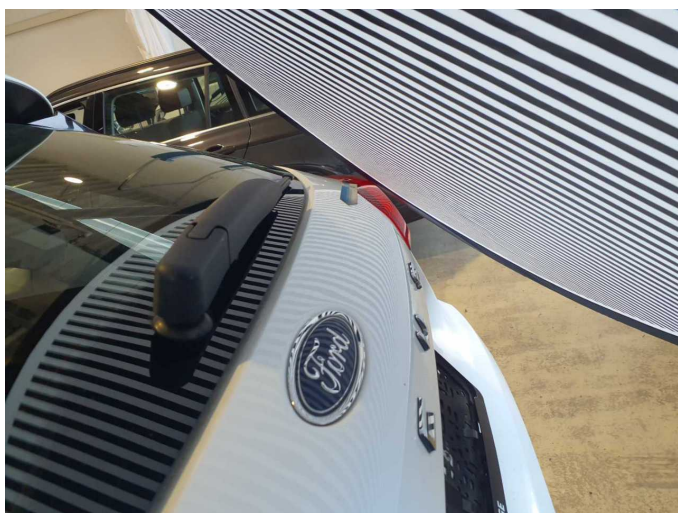

Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 9: Bonnet: Bonnet - Corrosion - Repair and paint



Damage 9: Bonnet: Bonnet - Corrosion - Repair and paint



Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace

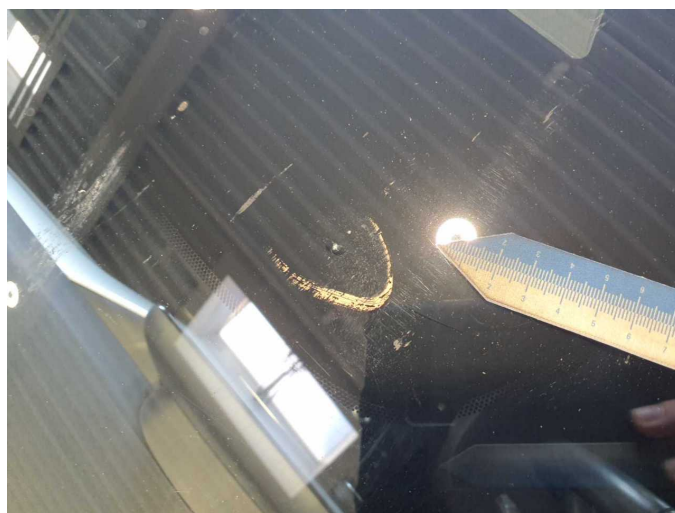


Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace




Wear and tear 6: Roof: Roof rail - left side - dent(s) - No deduction



Wear and tear 6: Roof: Roof rail - left side - dent(s) - No deduction

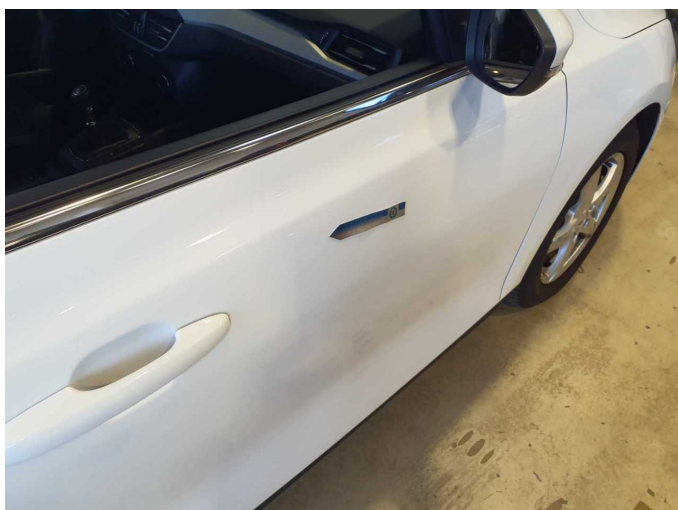


Wear and tear 7: Door - front right side: Door - Dent / paintcoat damage - No deduction

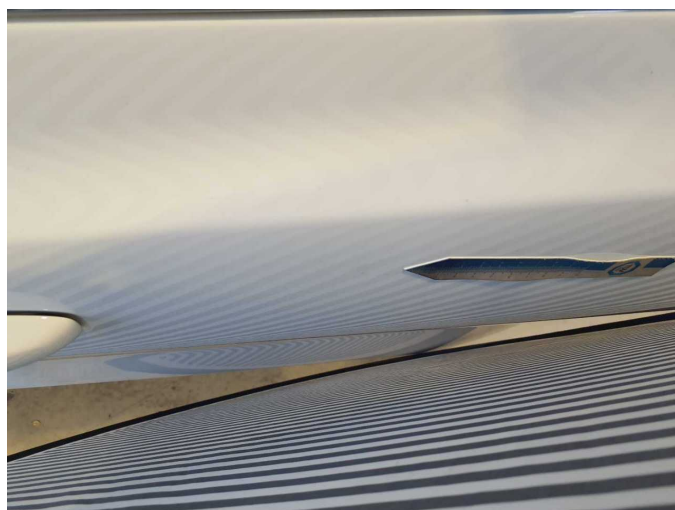

Wear and tear 7: Door - front right side: Door - Dent / paintcoat damage - No deduction




Wear and tear 8: Steering system: Steering wheel - Scratch(es) - No deduction

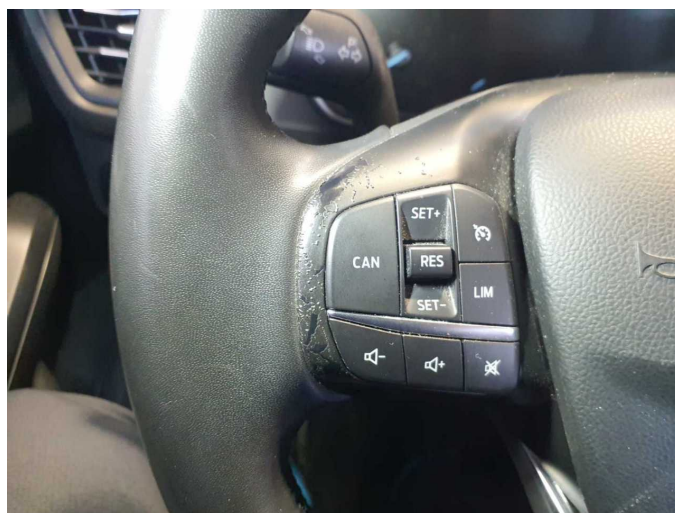

Wear and tear 8: Steering system: Steering wheel - Scratch(es) - No deduction



Wear and tear 8: Steering system: Steering wheel - Scratch(es) - No deduction

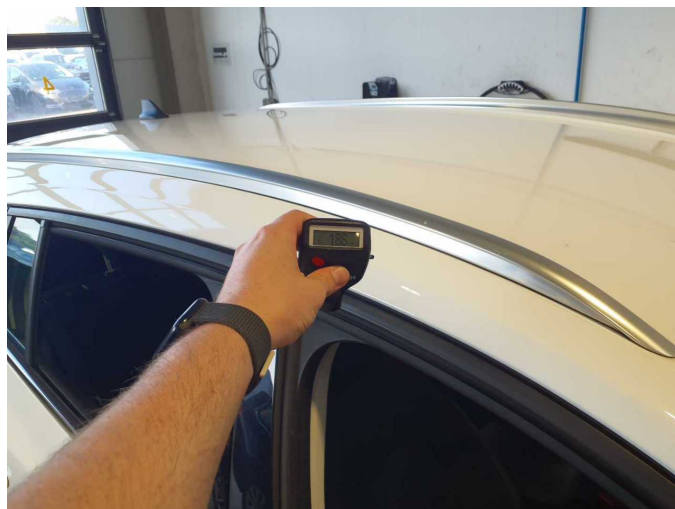

Repainting 1: Roof rail - right side




Repainting 1: Roof rail - right side



Repainting 2: Bonnet




Repainting 2: Bonnet

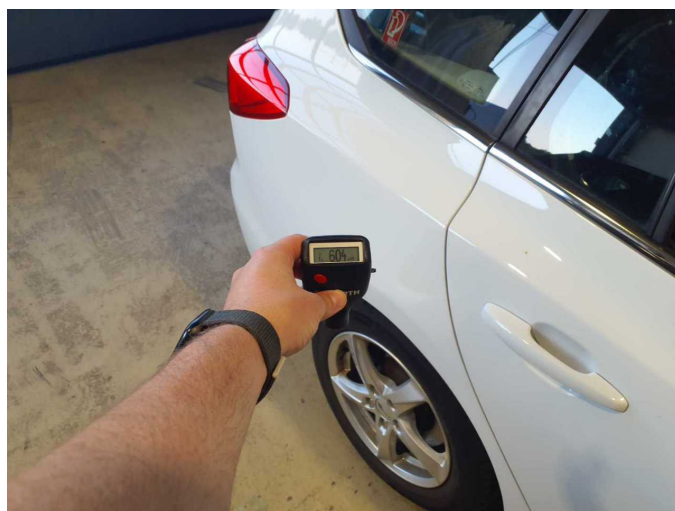

Repainting 3: Side panel - rear right side



Repainting 3: Side panel - rear right side

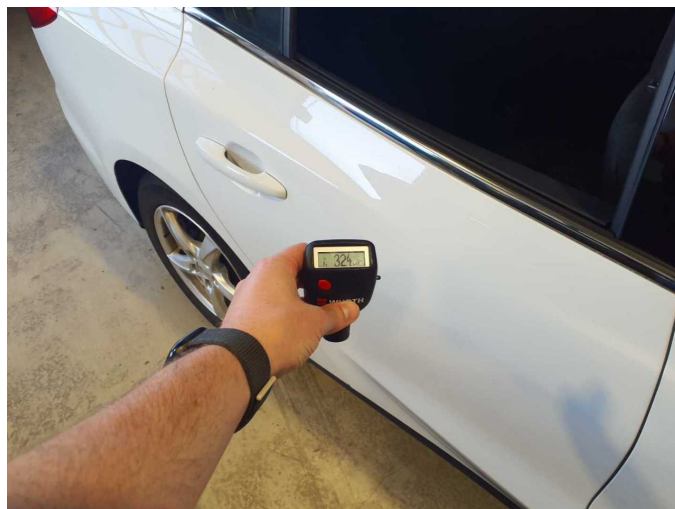

Repainting 4: Door - rear right side



Repainting 4: Door - rear right side