



Expertise

Protocol number: 46765144
Order No. / Reference: 26812652
Inspection date: 28 Jul 2026

Manufacturer: Volkswagen

Model: Caddy Cargo 2.0 TDI BMT

VIN: WV1ZZZSK4PX081558



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Caddy Cargo 2.0 TDI BMT	
Vehicle Identification number	WV1ZZZSK4PX081558
Mileage (Read)	171,451 km
First registration	22 Jun 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	75 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Candy White (B9A)
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Grey-Black
Vehicle with smoke odor	Yes (ozone-treated)



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	22,500 km
Last service on / at	05/2026 at 168,765 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS590748
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CMF 00371		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,220 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/65 R15 99H	Summer tyres on Steel rim with wheel cover	Falken	4mm / 4mm
2)	205/65 R15 99H	Summer tyres on Steel rim with wheel cover	Falken	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/65 R15 99T	Winter tyres on Steel	Hankook	3mm / 3mm
2)	205/65 R15 99T	Winter tyres on Steel	Hankook	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/65 R15 99H	Summer tyres on Steel	Hankook	6 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments: Glove compartment open
- Airbag, side and head airbags for driver and front passenger
- Exterior mirror housings and door handles in black, sliding door track in silver
- Floor coverings: Carpet in the driver's cab
- third brake light
- Roof rail/roof rack preparation
- Three-point automatic seat belts (with front belt height adjustment and electric belt tensioners)
- Deletion: Without rear window (sheet metal)
- ESP Electronic Stability Program with Brake Assist (incl. Anti-lock Braking System (ABS), Traction Control (ASR), (EDS and MSR))
- Electric windows, front
- Transmission: 6-speed transmission
- Rear wing door (asymmetrically divided) without window cutout
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Paint finish: Solid
- Headlight range control
- Center console with 2 universal cup holders
- Multifunctional camera
- Multimedia systems: 2 USB ports (Type C) in the center console, front
- Emergency braking assistant "Front Assist" (with pedestrian and cyclist detection)
- Upholstery: Fabric, "Double Grid" design
- "Composition Audio" radio with 20.96 cm (8.25 inch) color touchscreen
- Radio accessories: 4 speakers
- Radio accessories: Digital radio reception DAB+
- Wheels/Tires: 205/65 R 15 99 H XL, optimized for low rolling resistance
- taillights
- Windscreen wiper intermittent control with light sensor
- Keys for locking system: 2 remote control flip keys
- Side indicator lights
- dimmable interior safety mirror
- Seats: Left and right seats in the 1st row (including headrests)
- Lane keeping assistant "Lane Assist"
- Bumper in grey
- Tire Mobility Set (12-volt compressor and tire sealant)
- Door trim and armrest in plastic
- Lashing points: 6 lashing points for securing cargo
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Additional dust protection seal on the outside
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Exterior mirrors: electrically adjustable
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- Cockpit panel, matte
- Three-phase generator 140 A
- Rear parking assist
- Electronic parking brake including auto-hold function
- Omission: Without additional child seat anchorage
- Automatic headlight control with daytime running lights
- Windows: Laminated glass front pane in heat-insulating glazing
- Cruise control system including speed limiter
- Halogen dual headlights-H7
- Heating and ventilation system in the driver's cab
- Interior lighting in the cargo area (1 light)
- Fuel fill quantity, standard fuel initial fill
- Diesel fuel system
- Steering wheel: Multifunction steering wheel
- Air vents, front, in matte black
- Multifunction display "Plus"
- Multi-collision brake
- Fatigue detection
- Non-smoking version
- eCall emergency call system
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- Radio "Composition Audio" with 20.96 cm (8.25 inch) touch color display (2 USB interfaces (Type C) in the center console, front - 4 speakers - mobile phone interface)
- Wheels, tires: Wheel covers
- Wheels/Tires: Tire pressure monitoring system
- Wheels/Tires: Steel wheels 6J x 15, in black
- Gearshift lever in plastic
- Sliding door, on the right in the passenger/cargo area
- Standard side panels in the cargo area
- Speed-sensitive power steering (Servotronic)
- Seats: Height adjustment for left seat, manual
- Sun visors without mirrors, with ticket pocket on the driver's side, plus airbag label on the sun visor
- Start-stop system (with brake energy recuperation)
- Telephone: Mobile phone interface
- Partition wall (tall) without window
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Central locking with remote control and interior operation



Extra equipment

- Storage compartments: Glove compartment with lockable, illuminated flap
- Deletion: Lettering on the rear
- Rear wing door (asymmetrically divided) with window cutout
- Navigation system "Discover Media" (25.4 cm (10 inch) touch color display - streaming & internet - 2 USB interfaces (Type C) in the center console, front - glove compartment with lockable, illuminated flap - 4 speakers - mobile phone interface)
- Package: Window package (Caddy Cargo with rear wing doors) (Rear wing doors with asymmetrically divided window cutouts - Fixed side window in the load/passenger compartment, front left - Fixed side window in the load/passenger compartment, front right - Fixed side window in the load/passenger compartment, rear left - Heated rear window - Fixed side window in the load/passenger compartment, rear right - Rear window wiper/washer system with intermittent function)
- Electrically adjustable and heated exterior mirrors
- Floor coverings, rubber floor covering in the cargo area
- Window: Fixed side window in the cargo/passenger compartment, front right
- Rear window heating and rear window wiper (heated rear window - rear window wiper/washer system with interval function)
- Fog lights including cornering lights
- Package: Cool & Sound (Refrigerant R1234yf - Safety interior mirror, automatically dimming - Air Care Climatronic air conditioning with 2-zone temperature control and air purification function)
- Package: Winter package "Basic" (Seat heating for seats in the driver's cab, left and right, separately adjustable - Washer fluid level indicator with enlarged washer fluid reservoir - Heated windshield washer nozzles at the front)
- Wheels/Tires: Spare wheel in driving tire size, steel (spare wheel in driving tire size, steel - on-board tools and jack)
- Partition wall (high) with grilles

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	2nd wheel set	2 tyres (nicht Teil der Ausstattung) - Worn - No deduction
2	Bonnet	Bonnet (Dichtung) - Loose - Un- / install
3	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
4	Interior	Interior (Rauch) - Odour - Ozone treatment
5	Front bumper	Front bumper - Damaged - Replace
6	Bonnet	Bonnet - Corrosion - Paint
7	Sliding door, right	Sliding door - Deformed - Repair and paint



Wear and tear

No.	Component group	Description
1	Instrument panel	Instrument panel - Scratch(es) - No deduction
2	Wheel / tyres	Wheel cover - front right side - Scratch(es) - No deduction
3	Wheel / tyres	Wheel cover - rear right side - Scratch(es) - No deduction
4	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction
5	Side panel - rear right side	Side panel - dent(s) - No deduction
6	Roof	Roof - dent(s) - No deduction
7	Door - front left side	Door - dent(s) - No deduction
8	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

- Side panel - rear right side, Professionally carried out
- Door - front left side, Professionally carried out

Paint coat thickness measurement

Side panel - rear right side	224 µm	Door - front left side	226 µm
------------------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

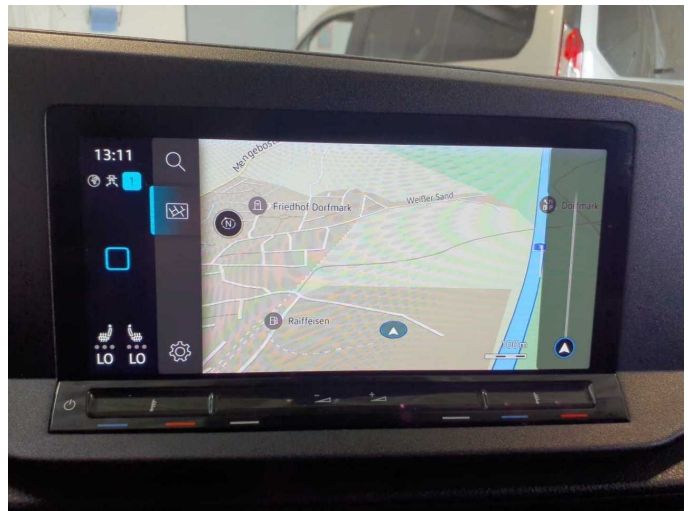


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

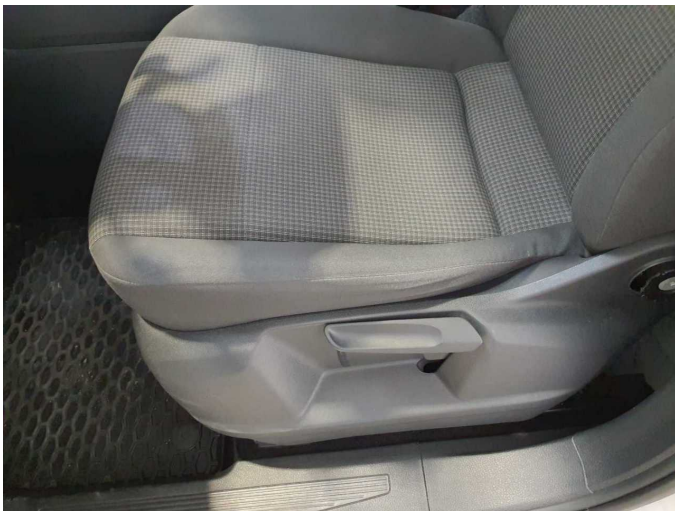


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: 2nd wheel set: 2 tyres (nicht Teil der Ausstattung) - Worn - No deduction



Damage 1: 2nd wheel set: 2 tyres (nicht Teil der Ausstattung) - Worn - No deduction




Damage 1: 2nd wheel set: 2 tyres (nicht Teil der Ausstattung) - Worn - No deduction



Damage 1: 2nd wheel set: 2 tyres (nicht Teil der Ausstattung) - Worn - No deduction



Damage 2: Bonnet: Bonnet (Dichtung) - Loose - Un- / install

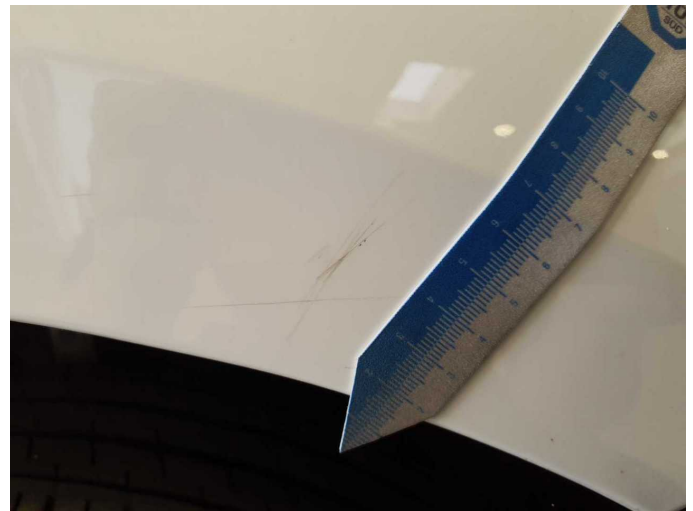

Damage 3: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 3: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 3: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 5: Front bumper: Front bumper - Damaged - Replace



Damage 5: Front bumper: Front bumper - Damaged - Replace



Damage 5: Front bumper: Front bumper - Damaged - Replace



Damage 5: Front bumper: Front bumper - Damaged - Replace



Damage 5: Front bumper: Front bumper - Damaged - Replace




Damage 5: Front bumper: Front bumper - Damaged - Replace



Damage 5: Front bumper: Front bumper - Damaged - Replace



Damage 6: Bonnet: Bonnet - Corrosion - Paint

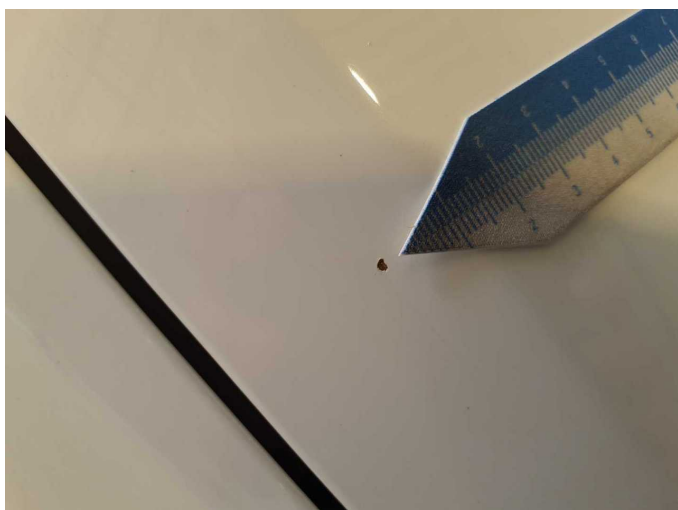

Damage 6: Bonnet: Bonnet - Corrosion - Paint



Damage 6: Bonnet: Bonnet - Corrosion - Paint



Damage 6: Bonnet: Bonnet - Corrosion - Paint



Damage 7: Sliding door, right: Sliding door - Deformed - Repair and paint



Damage 7: Sliding door, right: Sliding door - Deformed - Repair and paint



Damage 7: Sliding door, right: Sliding door - Deformed - Repair and paint



Damage 7: Sliding door, right: Sliding door - Deformed - Repair and paint



Damage 7: Sliding door, right: Sliding door - Deformed - Repair and paint



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side



Repainting 2: Door - front left side



Repainting 2: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV1ZZZSK4PX081558

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Caddy Cargo 2.0 TDI BMT

Datum	KM-Stand	Beschreibung
26.05.2026	168.765	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Regelwartungsdienst; Wartung Sonstiges
28.01.2026	153.545	Systemtest/Eigendiagnose
15.10.2025	140.233	Bremsflüssigkeit ern; Bremsscheiben + Klötze v; HU + AU; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
16.01.2025	97.217	Bremse Sonstiges; Bremsklötze hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
25.06.2024	63.847	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.12.2023	30.409	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges