



Expertise

Protocol number: 46392935  
Order No. / Reference: 26616932  
Inspection date: 7 Jul 2026

Manufacturer: Ford

Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. TITANIUM

VIN: WF0PXXGCHPPL84053



| Vehicle details                                                 |                      |
|-----------------------------------------------------------------|----------------------|
| Manufacturer / Type / Model / Equipment                         |                      |
| Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. TITANIUM |                      |
| Vehicle Identification number                                   | WF0PXXGCHPPL84053    |
| Mileage (Read)                                                  | 47,320 km            |
| First registration                                              | 10 May 2023          |
| Number of holders                                               | 1                    |
| Power / Engine displacement                                     | 85 kw / 1,499 ccm    |
| Fuel type / Cylinder                                            | Diesel / 4           |
| Gearbox / Number of gears                                       | Automatic / 8        |
| Type of drive                                                   | Front drive          |
| Type of vehicle                                                 | Station wagon        |
| Colour / colour code                                            | Chrome Blue Metallic |
| Doors / Seats                                                   | 5 / 5                |
| Upholstery type                                                 | Cloth                |
| Colour of upholstery                                            | Anthracite-Black     |
| Vehicle with smoke odor                                         | no                   |



## Vehicle details

|                                                      |                              |                                |                                                            |
|------------------------------------------------------|------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | digital proof / complete     | <b>Next maintenance in</b>     | 30 %                                                       |
| <b>Last service on / at</b>                          | 02/2025 at 29,929 km         |                                |                                                            |
| <b>Key is / should be</b>                            | 2 / 2                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                      |                              | <b>Letter No.</b>              | GT914489                                                   |
| <b>Previous damage / Accident</b>                    | Detectable                   | <b>Repainting</b>              | Detectable                                                 |
| <b>Inspection conditions</b>                         | sufficient                   | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                    | Not performed                | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/<br/>type code number</b> | 8566 / BYE 00002             |                                |                                                            |
| <b>Emission standard</b>                             | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                        | 2,035 kg                     | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                               | Manufacturer | Tread depth |
|----|----------------|--------------------------------------------|--------------|-------------|
| 1) | 205/60 R16 92V | Summer tyres on Steel rim with wheel cover | Goodyear     | 5mm / 5mm   |
| 2) | 205/60 R16 92V | Summer tyres on Steel rim with wheel cover | Goodyear     | 5mm / 5mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 205/60 R16 92H | Winter tyres on Light alloy | Bridgestone  | 5mm / 5mm   |
| 2) | 205/60 R16 92H | Winter tyres on Light alloy | Bridgestone  | 8mm / 8mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 05/2027 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors painted in body color, electrically adjustable, heated and foldable
- Tires: 6.5 J x 16 design wheels (4) with 205/60 R16 tires
- Hill start assist
- Roof rails, aluminum
- Diesel particulate filter (DPF)
- Electronic Shifter
- Driver information system with on-board computer, color (10.7 cm screen diagonal)
- Electric parking brake with auto-hold function
- FordPass Connect including live traffic information
- Luggage compartment lighting
- Cruise control
- Illuminated glove compartment
- rear window wiper
- Interior mirror, automatically dimming
- Isofix bracket
- Headrests: 2 front and 3 rear, height adjustable
- LED taillights
- Steering wheel: 3-spoke design
- Make-up mirrors in driver and passenger sun visors
- MyKey key system (individually programmable second key)
- Emergency call assistant
- Front and rear parking pilot system
- Post-Collision Assist
- Tire repair kit
- Windscreen wipers with rain sensor (sensitivity adjustable)
- Headlight assistant with day/night sensor
- Electromechanical speed-dependent power steering
- Seats: Driver's seat height adjustable
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment
- Variable radiator air intake
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Attachment points behind the second row of seats for mounting the safety partition net
- Fabric headliner
- Roof spoiler painted in car color
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Lane keeping assist including lane keeping assist
- Electric windows front and rear
- Ford Power Start function
- Luggage compartment cover
- Speed limiter
- Transmission: 8-speed automatic transmission
- Back window, heater
- Interior lighting with LED technology
- Intelligent security system
- Air conditioning with automatic temperature control
- Paint finish: Solid
- LED headlights
- Adjustable steering column
- Center console "Premium" front
- Navigation: Ford SYNC 4 including Ford navigation system with AppLink, 13.2" touchscreen and DAB/DAB+
- Upholstery: Cloth
- Pre-Collision Assist
- Tire Pressure Monitoring System (TPMS)
- Headlight low beam
- Selective driving mode switch
- Seats: Passenger seat height-adjustable, manually
- Seats: Rear seat backrest
- Start-stop system
- Carpet floor mats in the front
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Central locking with remote control and remote luggage compartment release

### Extra equipment

- Paint finish: Metallic
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)
- Safety partition net for luggage compartment



## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group              | Description                                                    |
|-----|------------------------------|----------------------------------------------------------------|
| 1   | Misc.                        | Main inspection - No evidence - No deduction                   |
| 2   | Engine                       | Engine cover - Damage caused by marten / rodent - Replace      |
| 3   | Side panel - rear right side | Side panel - Scratch(es) - Smart repair                        |
| 4   | Door - front left side       | Door edge - Scratch(es) - Smart repair                         |
| 5   | Bonnet                       | Insulation lining - Damage caused by marten / rodent - Replace |
| 6   | Rear bumper                  | Rear bumper - Scratch(es) - Paint                              |
| 7   | Front bumper                 | Front bumper - Scratch(es) - Paint                             |

## Wear and tear

| No. | Component group        | Description                                   |
|-----|------------------------|-----------------------------------------------|
| 1   | Door - rear right side | Door - Dent / paintcoat damage - No deduction |
| 2   | Door - rear left side  | Door - Scratch(es) - No deduction             |
| 3   | Bonnet                 | Bonnet - Stone chips - No deduction           |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Previous damages

| No. | Previous damage                                                                     | Extent of damage (Net) |
|-----|-------------------------------------------------------------------------------------|------------------------|
| 1   | Front, Rear, Side - left, Side right, Provided by user / customer, from 18 Apr 2024 | 13.371,59 €            |

## Repainting

| No. | Repainting                                                                                    |
|-----|-----------------------------------------------------------------------------------------------|
| 1   | Roof rail - right side, Professionally carried out, Invoice of repair done Non-existent       |
| 2   | Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent |

## Paint coat thickness measurement

|                        |        |                              |          |
|------------------------|--------|------------------------------|----------|
| Roof rail - right side | 215 µm | Side panel - rear right side | 1,007 µm |
|------------------------|--------|------------------------------|----------|



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

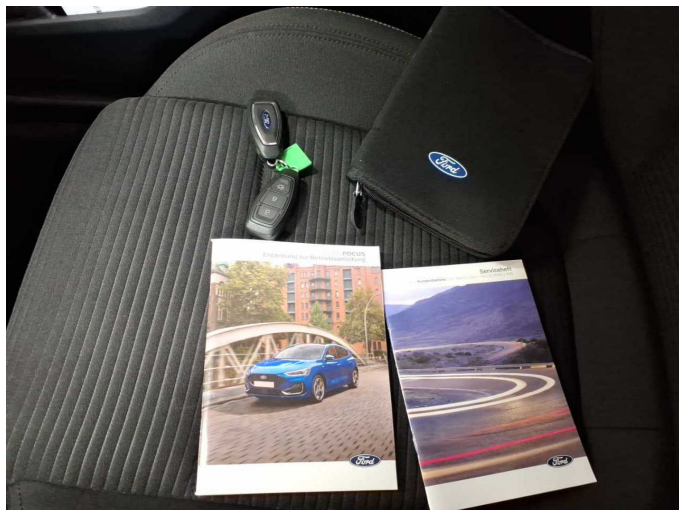


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

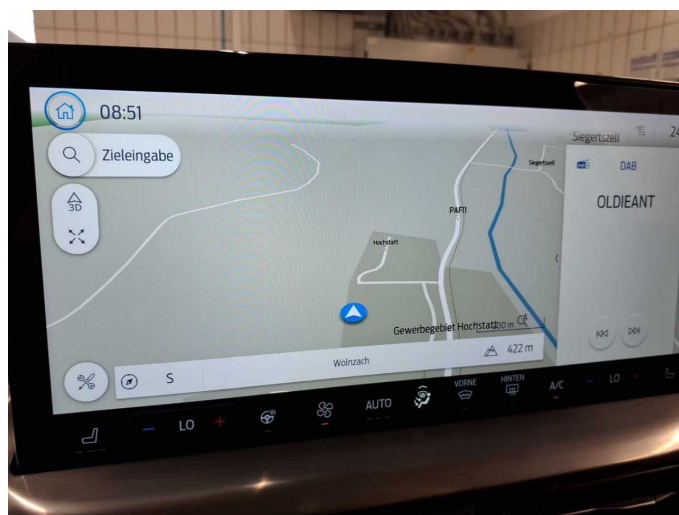


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

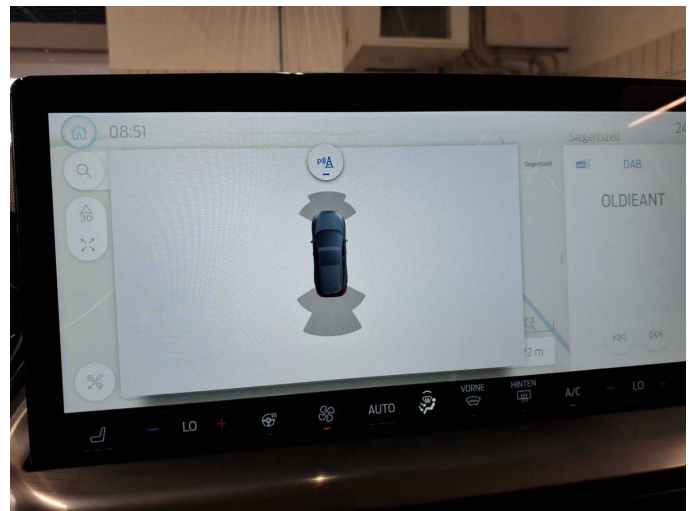


Figure 28: Misc.




Figure 29: Misc.



Figure 30: Misc.



**Figure 31:** Misc.

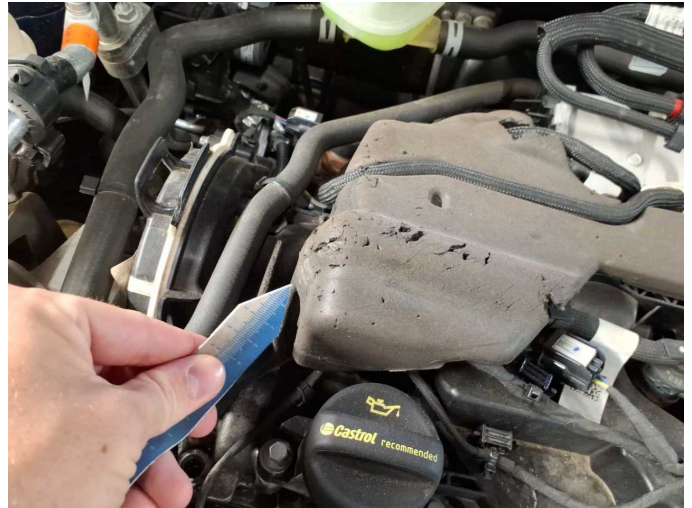

**Damage 2:** Engine: Engine cover - Damage caused by marten / rodent - Replace



**Damage 2:** Engine: Engine cover - Damage caused by marten / rodent - Replace




**Damage 3:** Side panel - rear right side: Side panel - Scratch(es) - Smart repair



**Damage 3:** Side panel - rear right side: Side panel - Scratch(es) - Smart repair



**Damage 4:** Door - front left side: Door edge - Scratch(es) - Smart repair

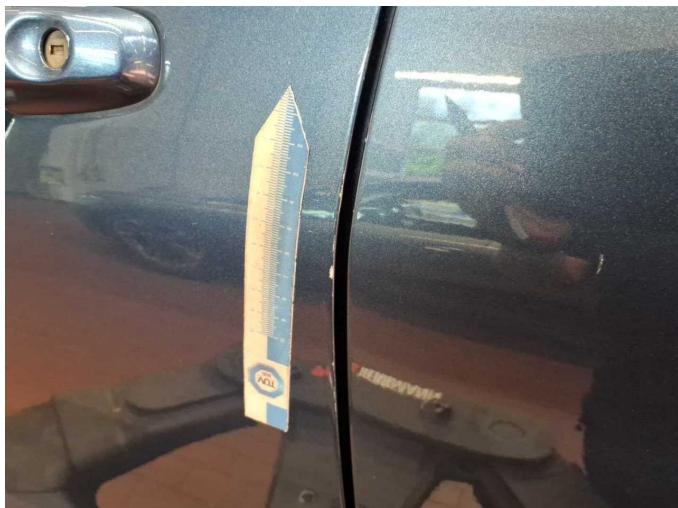

**Damage 4:** Door - front left side: Door edge - Scratch(es) - Smart repair




**Damage 5:** Bonnet: Insulation lining - Damage caused by marten / rodent  
- Replace



**Damage 5:** Bonnet: Insulation lining - Damage caused by marten / rodent  
- Replace



**Damage 6:** Rear bumper: Rear bumper - Scratch(es) - Paint

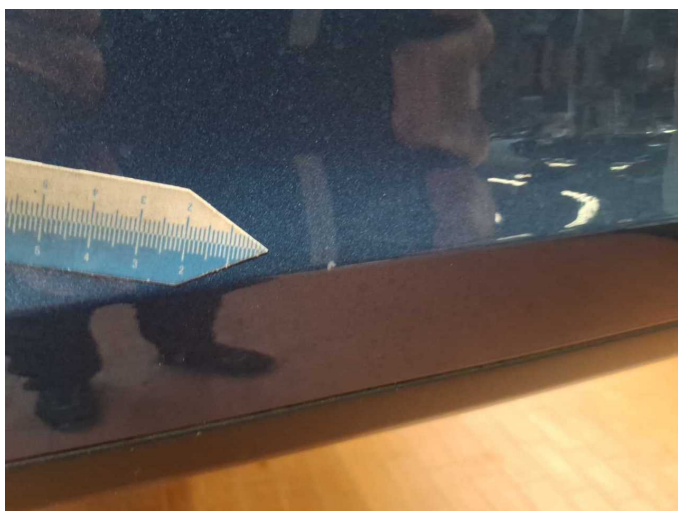

**Damage 6:** Rear bumper: Rear bumper - Scratch(es) - Paint



**Damage 6:** Rear bumper: Rear bumper - Scratch(es) - Paint



**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint



**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint



**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint



**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint



**Repainting 1:** Roof rail - right side



**Repainting 2:** Side panel - rear right side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0PXXGCHPPL84053

Hersteller / Modell: FORD FORD Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System  
Aut. TITANIUM

| Datum      | KM-Stand | Beschreibung                                                                                                        |
|------------|----------|---------------------------------------------------------------------------------------------------------------------|
| 28.04.2025 | 34.057   | Reparatur Sonstiges                                                                                                 |
| 14.02.2025 | 29.929   | Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern;<br>Regelwartungsdienst; Wartung Sonstiges |