



Expertise

Protocol number: 46405434
Order No. / Reference: 26623096
Inspection date: 8 Jul 2026

Manufacturer: Opel

Model: Corsa-e Ultimate

VIN: VVKUHZKXZM4321043



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Corsa-e Ultimate

Vehicle Identification number VVKUHZKXZM4321043

Mileage (Read) 55,061 km

First registration 20 Jan 2022

Number of holders 1

Power / Engine displacement 57 kw / 0 ccm

Fuel type / Cylinder Electric / 0

Gearbox / Number of gears Direct drive / 1

Type of drive Front drive

Type of vehicle Saloon car

Colour / colour code Diamant Schwarz Metallic

Doors / Seats 5 / 5

Upholstery type Alcantara / Leather

Colour of upholstery Anthracite-Black

Re-import no

Vehicle with smoke odor no

readiness to drive Not roadworthy /
moveable



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	16,400 km
Last service on / at	11/2025 at 46,478 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC792536
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	1889 / ABX 00009		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	1,897 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/45 R17 88H	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	205/45 R17 88H	Summer tyres on Light alloy	Michelin	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, front and rear - cup holder in the center console - glove compartment - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 0.5-liter beverage bottles)
- Aluminum sports pedals
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable - exterior mirror housing in black)
- third brake light
- Headliner, Black
- Electronic Stability Program Plus (ESP Plus)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection
- Intelligent speed control and limiter
- Transmission: Automatic electric drive with fixed gear ratio
- Back window, heater
- Rear window wiper (with intermittent function)
- IntelliLux LED Matrix Light (LED matrix headlights with individual light distribution and the following functions: - City light - Highway light - Country road light - Static cornering light - Turning light - Parking light - High beam: traffic-dependent dimming taking into account preceding and oncoming traffic - Automatic headlight range control - LED daytime running lights - LED taillights - LED turn signals in exterior mirrors)
- Steering wheel: Leather steering wheel, flattened at the bottom
- Make-up mirrors (driver and passenger side)
- Driver fatigue detection (Based on steering behavior and driving time, it detects signs of possible driver fatigue and issues a visual and audible warning (3-stage warning).)
- Onboard charger (vehicle-integrated charging unit, single-phase (7.4 kW))
- Opel Connect with telematics services (emergency call/breakdown call - vehicle status and information - route and journey information)
- Electric parking brake
- Parkpilot, rear parking aid (with acoustic warning signal when reversing)
- Pollen filter
- Quickheat rapid heating system
- Wheels: 7 J x 17 alloy wheels in 5-spoke design in black/silver (205/45 R 17 - low rolling resistance tires)
- Keyless Start system
- Power steering (speed-dependent)
- Seat belts: Three-point seat belts in all seats (belt force limiter, front and rear outer seats - Double belt tensioners, front seats - Belt tensioners, rear outer seats - Warning tone and light for unfastened seat belts, front and rear seats)
- Seats: Rear seat backrest split 60:40, foldable
- Heated seats, multi-stage, for driver and front passenger, including heated leather steering wheel
- Adaptive brake light
- Airbag: Front airbags, driver and front passenger (front passenger airbag can be manually deactivated)
- Airbag: Front and rear head airbags
- Airbag: Side airbag for driver and front passenger side (side airbag, front passenger, deactivatable)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- On-board computer
- Braking system: Regenerative
- Electronic brake force distribution (EBD)
- Driver information display 7", color (fully digital)
- Front collision warning with automatic emergency braking and pedestrian detection (Active between 5 and 85 km/h. Monitors the distance to the vehicle ahead; if the vehicle approaches a vehicle or pedestrian too quickly, the driver is alerted by a warning tone and a display in the driver information screen. In case of a collision risk, the braking system is prepared and, if necessary, emergency braking is initiated to minimize the consequences of a potential collision.)
- Child safety lock in the rear doors, manual
- Automatic climate control (recirculation mode, manual - automatic air distribution - sun position sensor - activated carbon filter - rear footwell heating)
- Headrests (5) (Height adjustable)
- LED fog lights
- Steering column, height and reach adjustable
- Lithium-ion battery (50 kWh storage capacity)
- Center armrest with storage compartment in front
- Navigation system: Multimedia Navi Pro with 10" color touchscreen display (Multimedia radio, automatic music recognition, Bluetooth hands-free system, Apple CarPlay, Android Auto, voice control, 1 USB port, DAB+, steering wheel remote control, navigation system, road map of Europe (including Russia and Turkey), 3D map display, dynamic route guidance, display of points of interest, tour planning, GPS module, charging station display, OpelConnect, including live navigation services, real-time traffic information, online POI search, map updates (via USB))
- Upholstery: Alcantara trim (seat contact surfaces and inner side bolsters in Alcantara - headrests, door panels and outer side bolsters in premium leather look - comfort driver's seat with massage function: 6-way electrically adjustable (length, height, backrest angle), lumbar support, electro-pneumatically adjustable in height and length - comfort passenger seat, 6-way manually adjustable (length, height, backrest angle) - pocket on front seat back)
- Visibility equipment (rain sensor, front - automatic dimming headlights with tunnel detection - interior rearview mirror, automatically dimming)
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)
- 12V power outlet in the center console, front



- Lane Keeping Assist (warning in case of unintentional lane departure (between 65 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Pre-installation for ISOFIX child seat mounting system (on the front passenger seat)
- Pre-wiring for child seat mounting system "ISOFIX" (rear outer)
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Ambient lighting
- Traffic sign recognition (recognition of speed limits and their cancellation, as well as display of the recognized sign in the driver information display (depending on visibility and weather conditions))
- Heat-insulating glazing, tinted
- Central locking with remote control

Extra equipment

- Paint finish: Metallic
- Onboard charger (vehicle-integrated charging unit, 3-phase (11 kW))
- Charging cable: Mode 3 charging cable, single-phase (for public charging (7.4 kW))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Engine cooling	Coolant (Unter Minimum. Werkstattprüfung erf.) - Specify findings - Diagnosed and repair if necessary
3	Wheel / tyres	Tyre - front right side - Damaged - Replace
4	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
5	Wheel / tyres	Alloy rim - rear right side - Scratched - Replace
6	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
7	Wheel / tyres	Alloy rim - front left side - Scratched - Replace
8	Braking system	Brake discs and pads - rear (Tragbild mangelhaft. Riefen.) - Corrosion - Replace
9	Side panel - rear left side	Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint
10	Front bumper	Front bumper - Scratch(es) - Repair and paint

Wear and tear

No.	Component group	Description
1	Door - rear left side	Door edge - Scratch(es) - No deduction
2	Roof	Roof - dent(s) - No deduction
3	Boot lid / rear door	Boot lid - dent(s) - No deduction
4	Vehicle glazing	Windscreen - Scratch(es) - No deduction
5	Interior	Interior - Scratch(es) - No deduction
6	Rear bumper	Rear bumper (Ladekante) - Scratch(es) - No deduction
7	Trim / covers	Floor mats - Abrasion - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

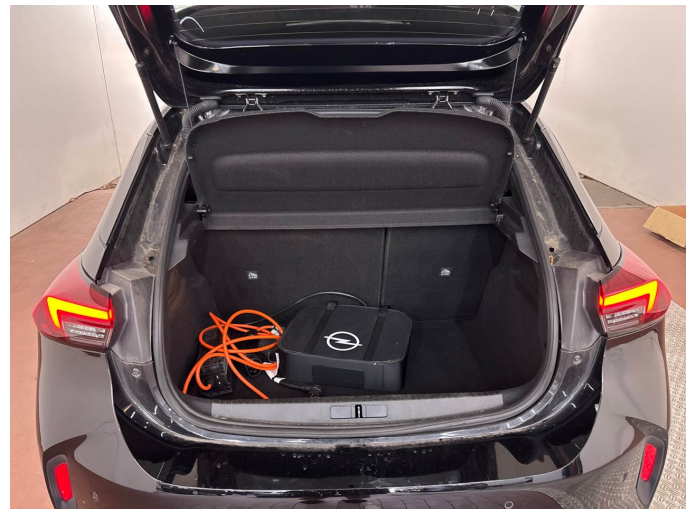


Figure 10: Cargo area

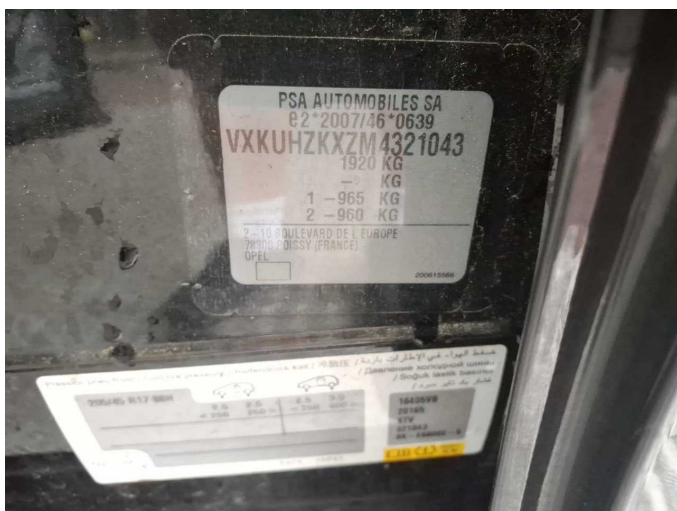


Figure 11: VIN

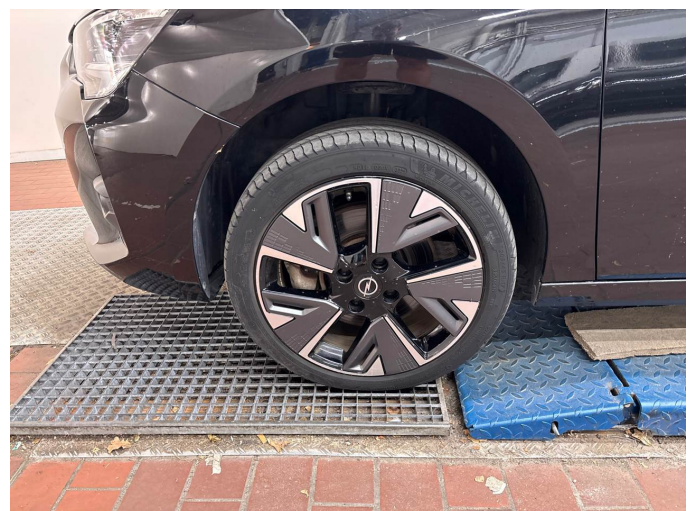


Figure 12: Mounted tyres



Figure 13: Documents

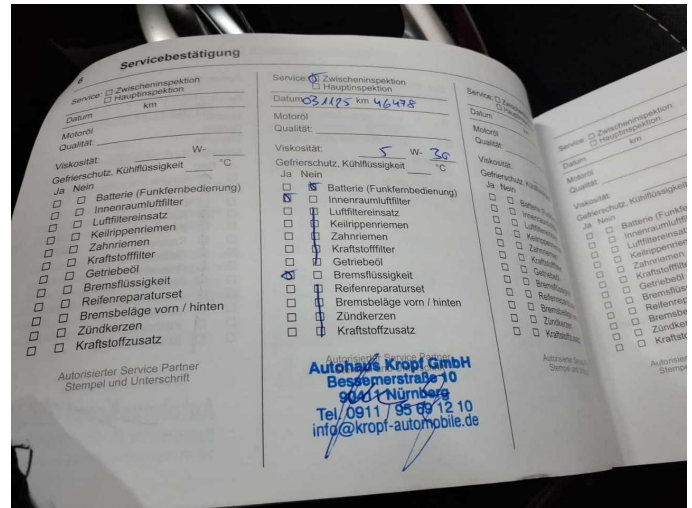


Figure 14: Documents

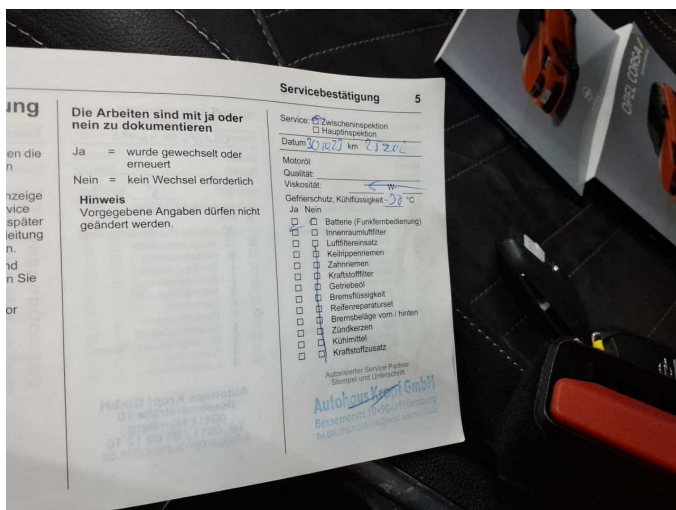


Figure 15: Documents

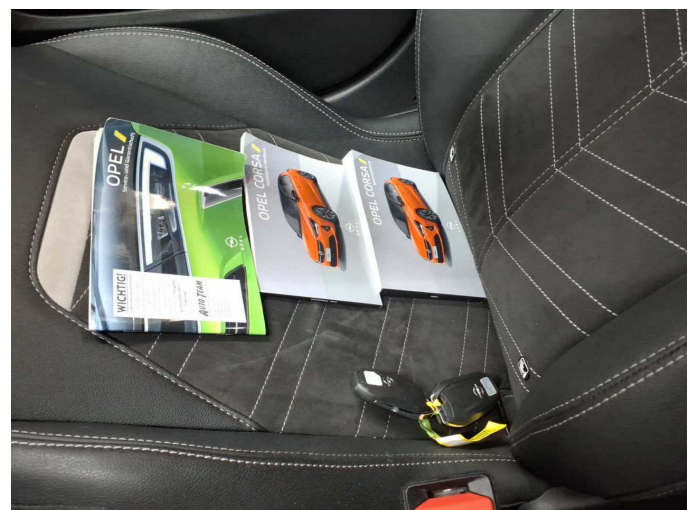


Figure 16: Documents

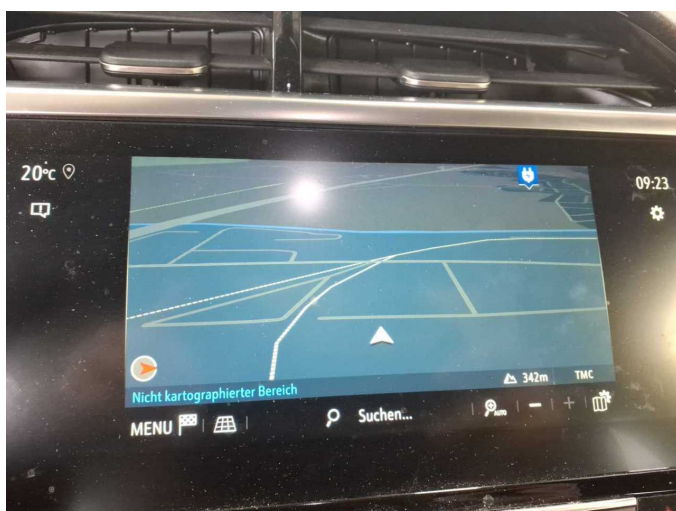


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

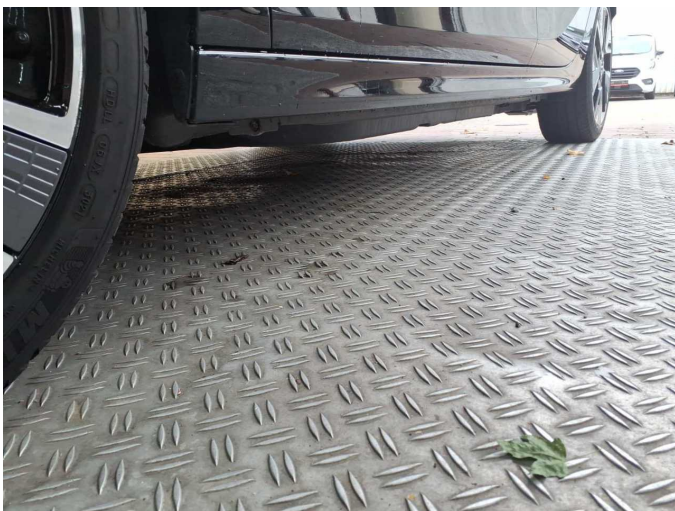


Figure 23: Misc.

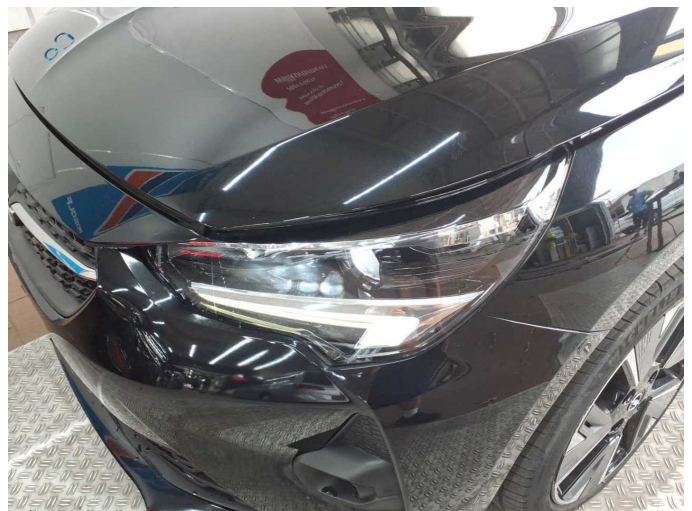


Figure 24: Misc.

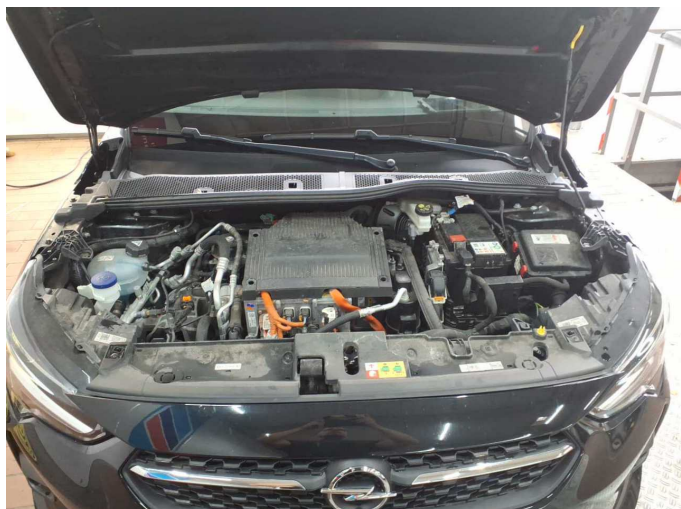


Figure 25: Misc.

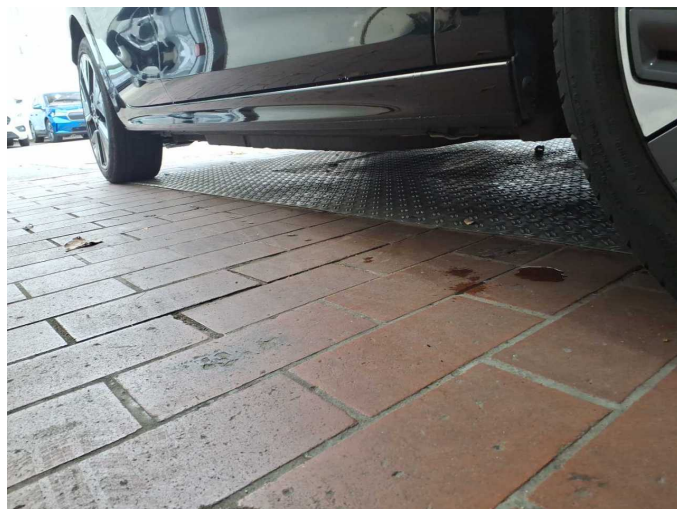


Figure 26: Misc.

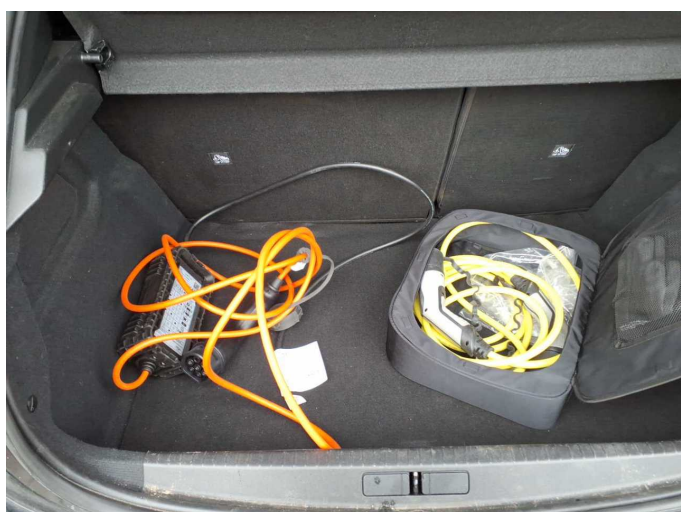


Figure 27: Misc.



Figure 28: Misc.

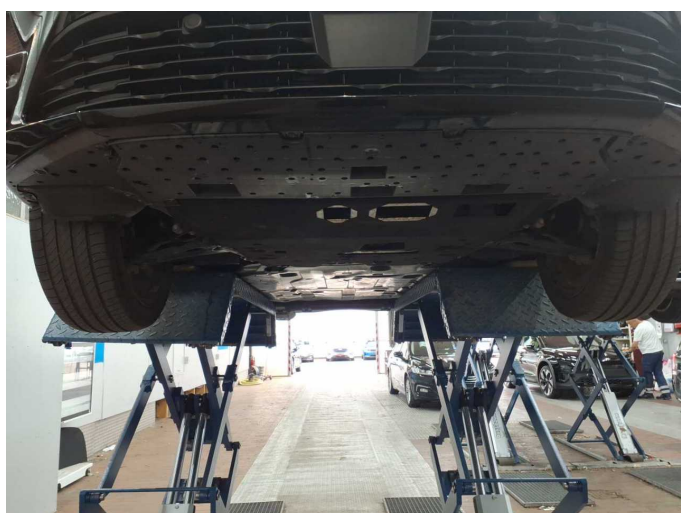


Figure 29: Misc.



Damage 2: Engine cooling: Coolant (Unter Minimum. Werkstattprüfung erf.) - Specify findings - Diagnosed and repair if necessary



Damage 2: Engine cooling: Coolant (Unter Minimum. Werkstattprüfung erf.) - Specify findings - Diagnosed and repair if necessary




Damage 3: Wheel / tyres: Tyre - front right side - Damaged - Replace




Damage 3: Wheel / tyres: Tyre - front right side - Damaged - Replace



Damage 3: Wheel / tyres: Tyre - front right side - Damaged - Replace

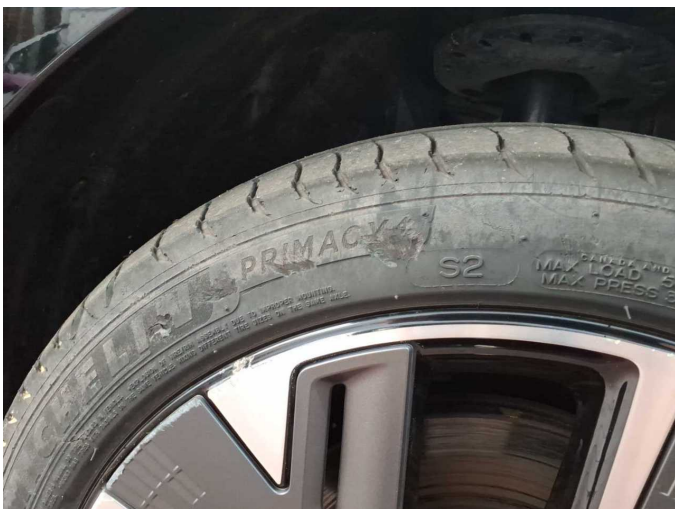

Damage 3: Wheel / tyres: Tyre - front right side - Damaged - Replace

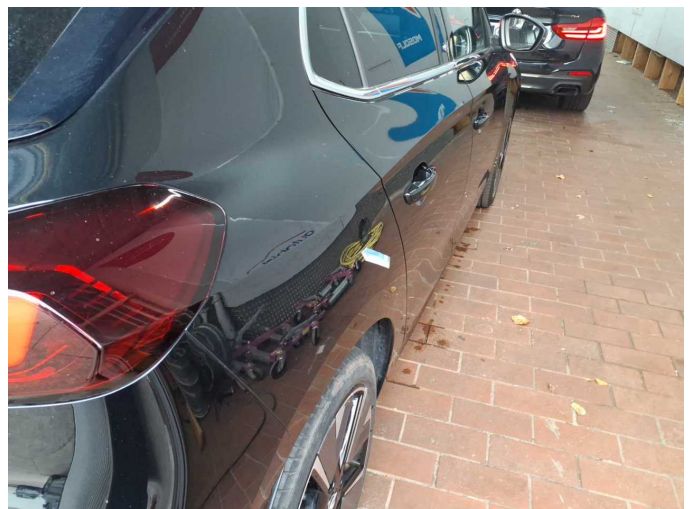


Damage 4: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 4: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 4: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

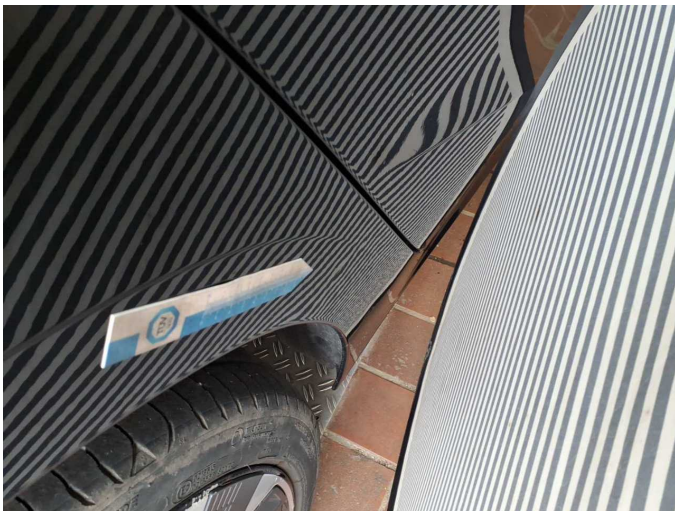

Damage 4: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

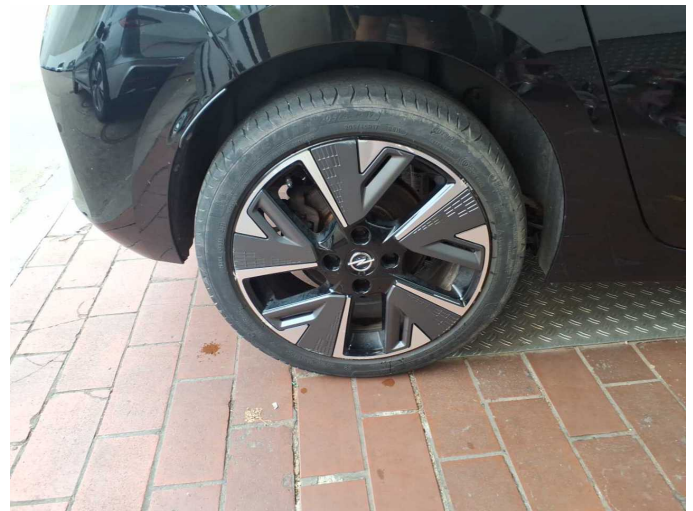

Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace




Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace




Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

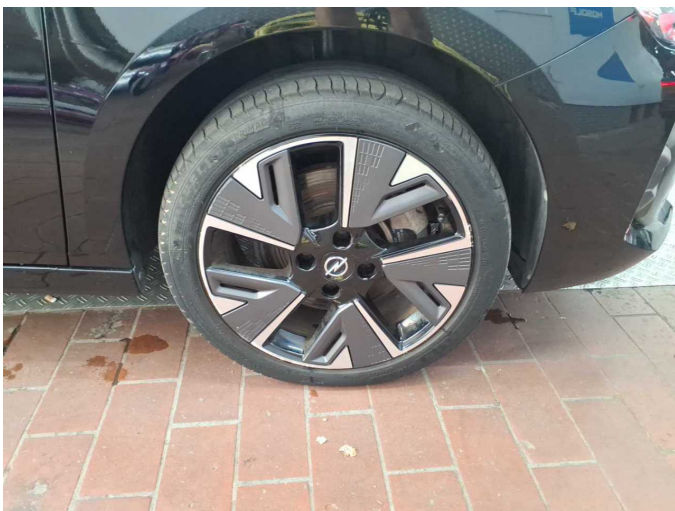

Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

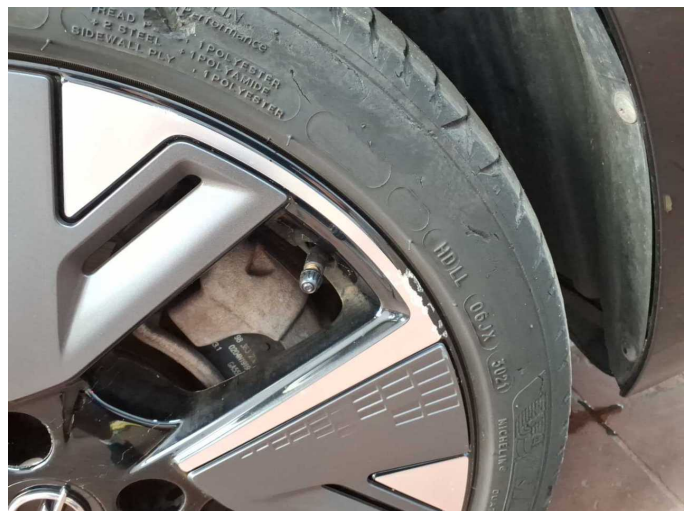


Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

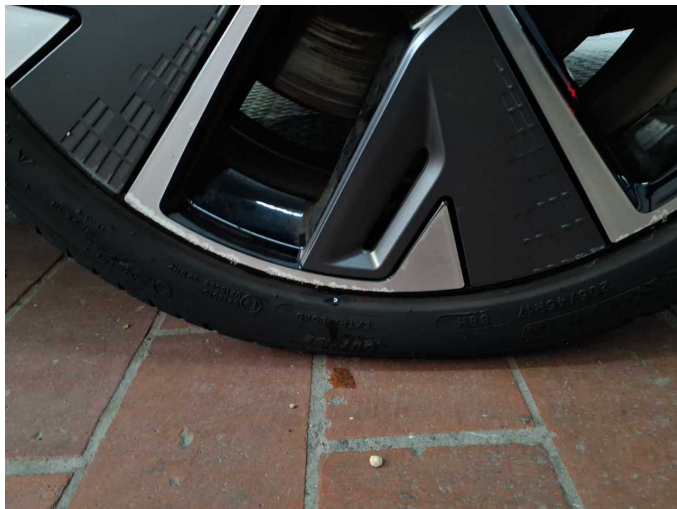

Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

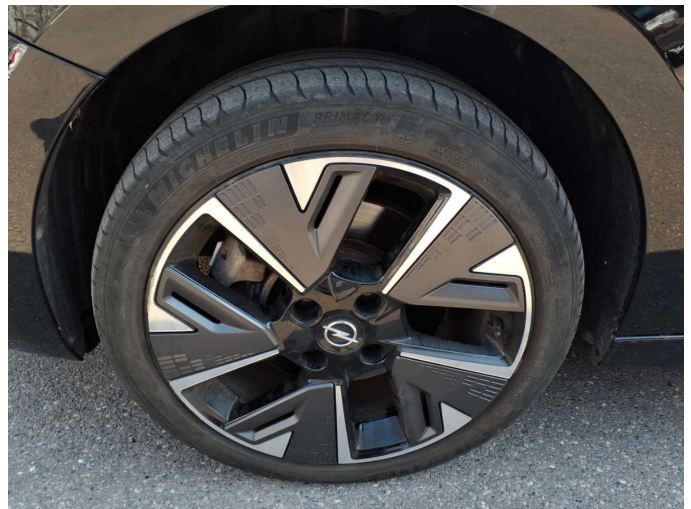

Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Replace

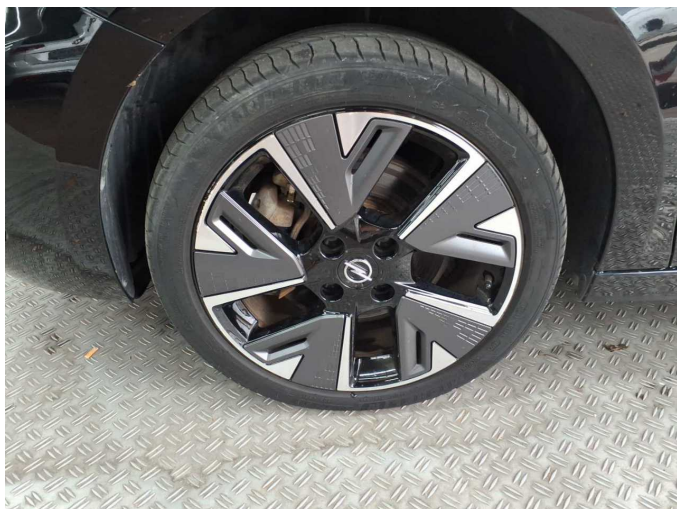

Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Replace




Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Replace




Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Replace

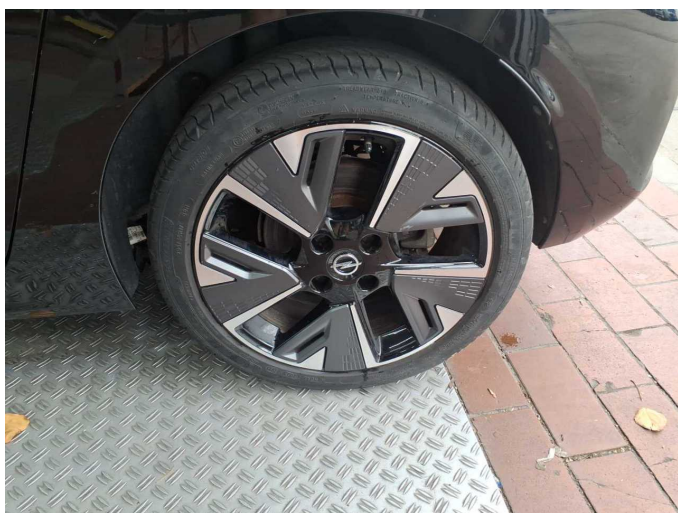


Damage 8: Braking system: Brake discs and pads - rear (Tragbild mangelhaft. Riefen.) - Corrosion - Replace

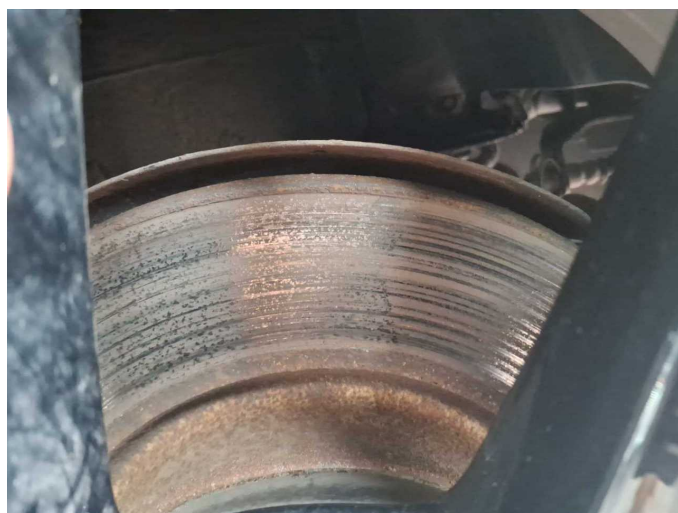

Damage 8: Braking system: Brake discs and pads - rear (Tragbild mangelhaft. Riefen.) - Corrosion - Replace



Damage 8: Braking system: Brake discs and pads - rear (Tragbild mangelhaft. Riefen.) - Corrosion - Replace

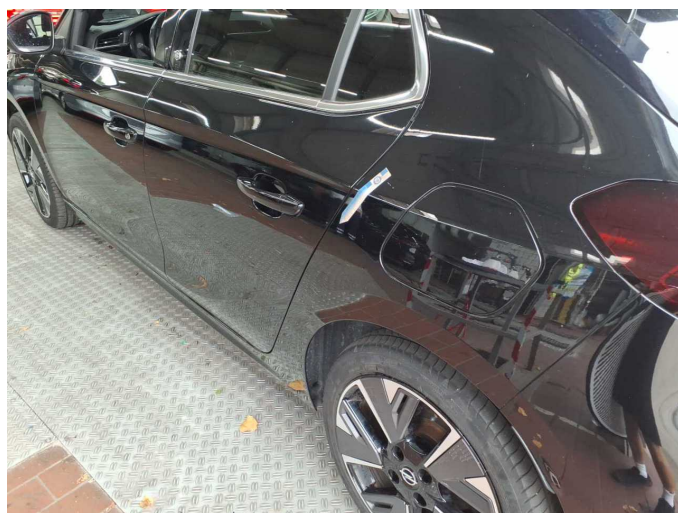


Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint




Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint



Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint

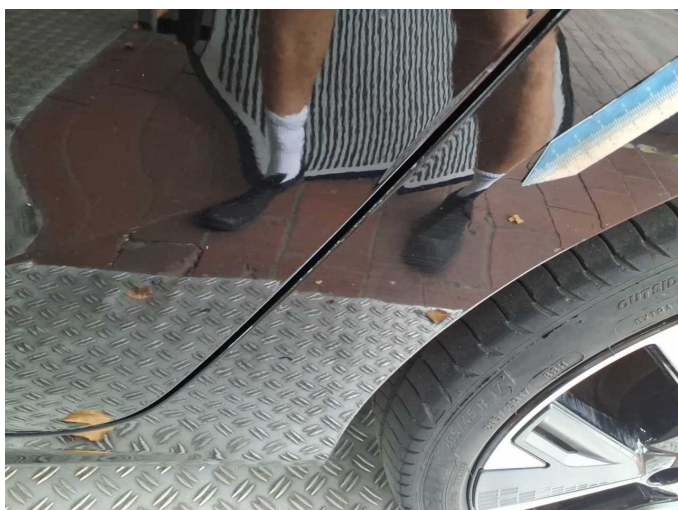


Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint

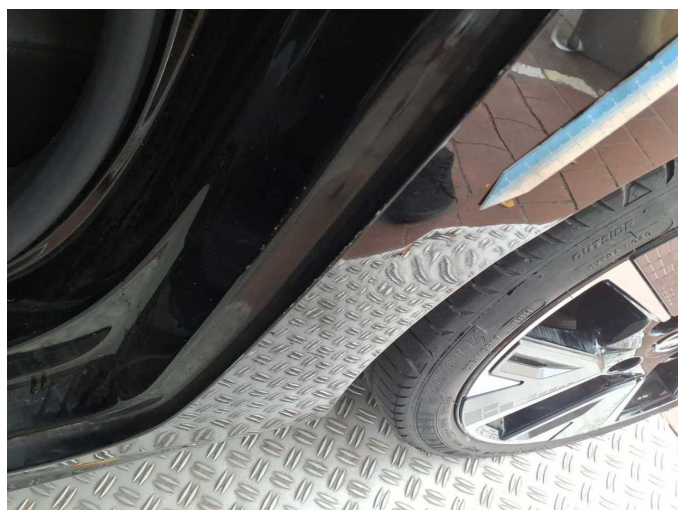

Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint



Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint

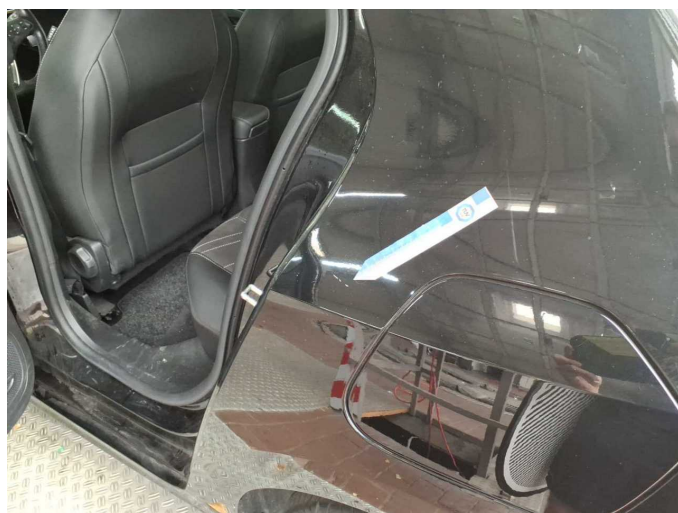

Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint



Damage 9: Side panel - rear left side: Side panel (Unterhalb Kante.) - Dent / paintcoat damage - Repair and paint



Damage 10: Front bumper: Front bumper - Scratch(es) - Repair and paint



Damage 10: Front bumper: Front bumper - Scratch(es) - Repair and paint



Damage 10: Front bumper: Front bumper - Scratch(es) - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VVKUHZKXZM4321043
Hersteller / Modell: OPEL OPEL Corsa-e Ultimate

Datum	KM-Stand	Beschreibung
03.11.2025	46.478	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
30.10.2023	25.202	Regelwartungsdienst
11.07.2022	8.835	Systemtest/Eigendiagnose