



Expertise

Protocol number: 46626124
Order No. / Reference: 26692272
Inspection date: 21 Jul 2026

Manufacturer: Peugeot

Model: 5008 BlueHDi 130 EAT8 Allure

VIN: VF3MCYHZUPS016081



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 5008 BlueHDi 130 EAT8 Allure	
Vehicle Identification number	VF3MCYHZUPS016081
Mileage (Read)	86,200 km
First registration	24 May 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Perla Nera Schwarz Metallic
Doors / Seats	5 / 7
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	11 Monat(e)
Last service on / at	06/2026 at 82,532 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG054628
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	3003 / AZJ 00276		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	225/55 R18 102Y	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS (Anti-lock Braking System)
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Active Blind Spot Assist
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- On-board computer (outside temperature and maintenance display - average and current fuel consumption - remaining range - distance traveled - average speed)
- Decorative inlays "Spray" with carbon look for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- Driving mode selector (Normal, ECO and Sport) ((Sport from GT level); (in conjunction with EAT8) or ECO button (in conjunction with manual transmission))
- High beam assist
- electric parking brake
- Front collision warning
- Cruise control system with speed limiter
- Cup holder in the center console
- Heated rear window
- rear window wiper
- Interior mirror automatically dimming
- Child safety locks on the rear doors
- Automatic climate control (2-zone), with activated carbon filter (separately adjustable for driver and front passenger)
- Front headrests (2) (Safety optimized)
- Rear headrests (3) (height adjustable and lowerable)
- Paint finish: Copper Brown
- LED taillights with 3D effect
- LED daytime running lights and LED turn signals at the front
- light sensor
- Makeup mirror (illuminated for driver and front passenger)
- Fatigue warning
- Navigation system: 3D navigation system NAC (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone and media - map transfer to the digital instrument cluster - multifunctional touchscreen - capacitive screen - piano key toggle switches)
- Radio: Mirror Screen (Mirror Screen (Transfer of multimedia content and apps from a smartphone to the touchscreen in the vehicle, via which the compatible functions and apps can be operated directly - Mirror Link: Mirroring of the smartphone screen on the touchscreen (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple) - Android Auto and Mirror Link (for compatible smartphone models with Android operating system))
- Reversing camera with 180° surround view
- Keyless start system
- Active Safety Brake and Front Collision Warning
- Airbag: Front and rear side airbags
- Airbag: Curtain airbags front and rear
- Electrically folding exterior mirrors
- Exterior mirrors in Perla Nera Black
- Hill start assist
- Chrome trim strips on the lower part of the doors
- Chrome trim strips above the side windows
- Ceiling light - LED at the front, in row 2 and in row 3, 2 LED reading lights at the front, in row 2 and in row 3
- Decorative trim on the dashboard and door panels in satin chrome
- EBV (Electronic Brakeforce Distribution)
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Misfueling protection
- Electric front and rear windows (with comfort operation and anti-pinch protection)
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Transmission: 8-speed automatic transmission EAT8
- Seat belts: 3-point seat belts (Front seats: - Height-adjustable three-point seat belts with belt locks - Pyrotechnic belt tensioners and electronically controlled belt force limiters - Warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger Rear seats: - 3 three-point seat belts - 3 three-point Isofix child seat anchors in the 2nd row - Belt force limiters on the side seats - Warning light and warning signal when the seat belt is released)
- Chrome-plated loading sill protector
- LED headlights (Eco)
- Steering wheel: Multifunction leather steering wheel
- Steering wheel: small multifunction steering wheel, flattened at the top and bottom
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- Fog light
- Emergency brake assist (with automatic activation of the hazard warning lights)
- Particulate filter: FAP diesel particulate filter
- Upholstery: Fabric/faux leather
- Radio: RCC audio system (Bi-tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire pressure monitoring system
- Wheels: 18" "Detroit" alloy wheels, two-tone with grey (with 225/55 R 18 tires)
- Wheels: Tire repair kit (compressor + tire sealant spray)
- paddle shifters on the steering wheel



- Electric power steering
- Seats: 2 additional seats for the 3rd row (removable and fully retractable)
- Seats: Passenger seat height adjustable
- Seats: Manual lumbar support for driver's seat (2-way)
- 12 Volt power outlet (3) (in the trunk, rows 1 and 2)
- Traffic sign recognition (with display of the speed recommendation in the instrument cluster)
- Central locking system, activatable from inside via remote control (doors lock automatically when driving off)

- Side windows in the second row and rear window are more heavily tinted.
- Seats: 3 separate individual seats in row 2 (foldable, with longitudinal adjustment and backrest tilt adjustment)
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Stop&Start system (automatic)
- Tie-down points in the trunk (4 pieces)
- Immobiliser

Extra equipment

- Detachable towbar (with removable ball head without tools)
- Seats: Heated front seats
- Luggage compartment partition net
- Paint finish: Special metallic paint
- Pre-installation for luggage compartment partition net

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - dent(s) - Smart repair
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
5	Roof	Roof - dent(s) - Smooth repair work
6	Wheel / tyres	Tyre - front right side - Broken / torn - Replace
7	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
8	Seat - front	Seat cover - left side - Porous / cracked - Replace
9	Bonnet	Bonnet - Paint defect - Paint
10	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Door - rear right side	Door edge - Scratch(es) - No deduction
3	Mudguard - left side	Mudguard - left side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

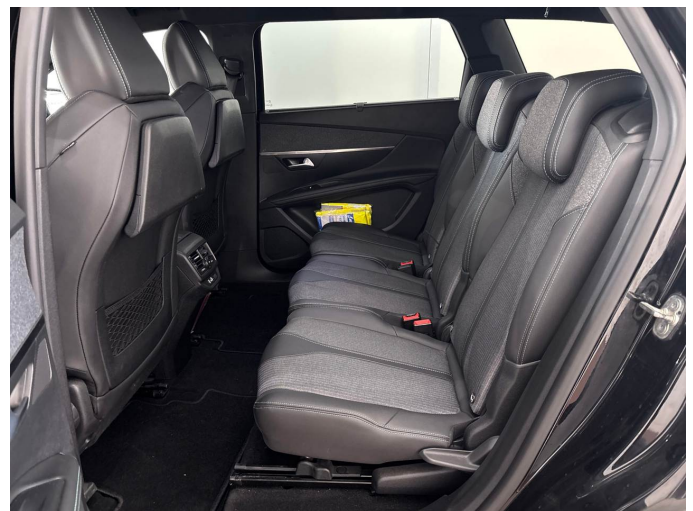


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

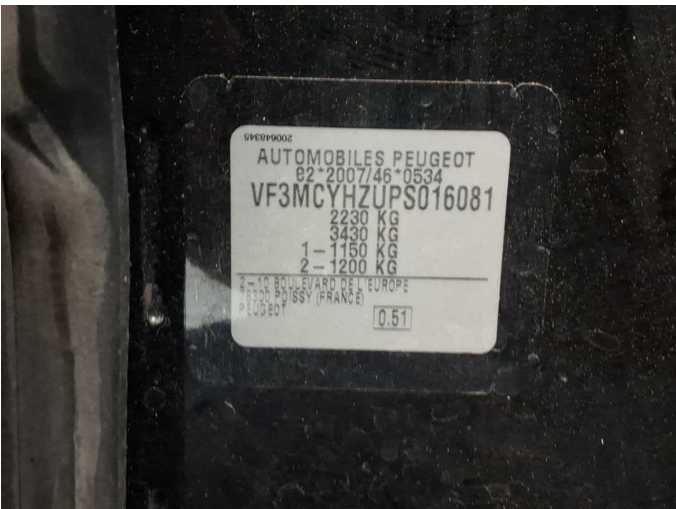


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

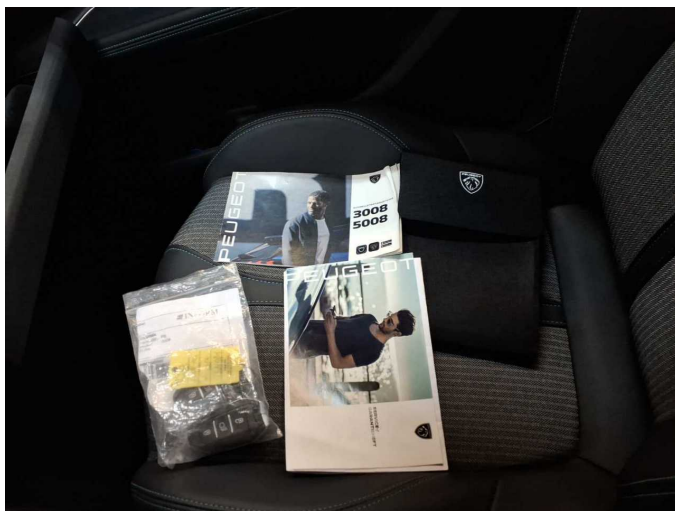


Figure 15: Documents

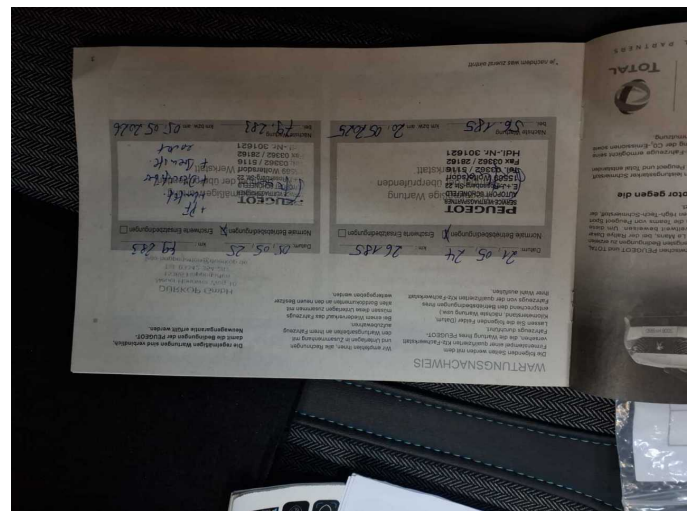


Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

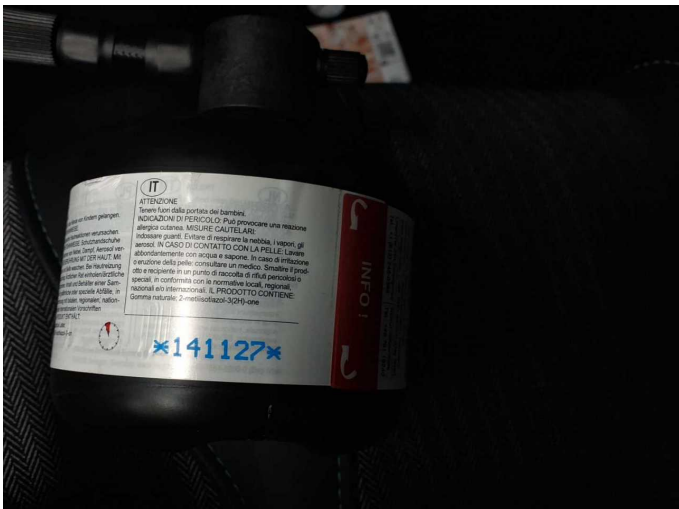


Figure 30: Misc.



Figure 31: Misc.

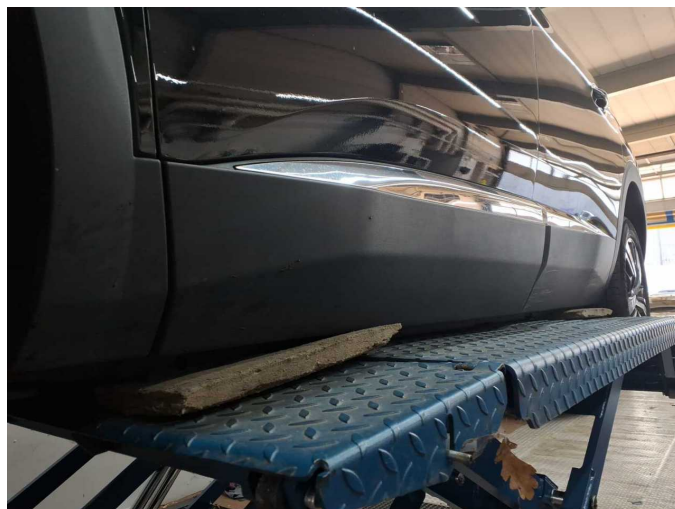


Figure 32: Misc.



Figure 33: Misc.



Damage 1: Door - front right side: Door - dent(s) - Smart repair



Damage 1: Door - front right side: Door - dent(s) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair

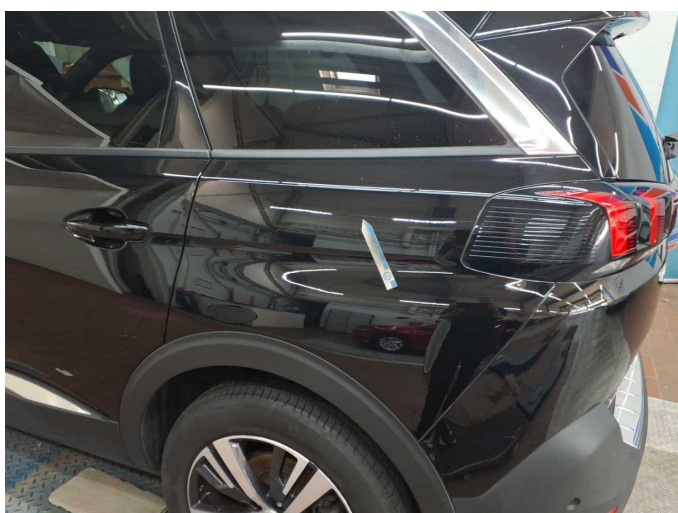

Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

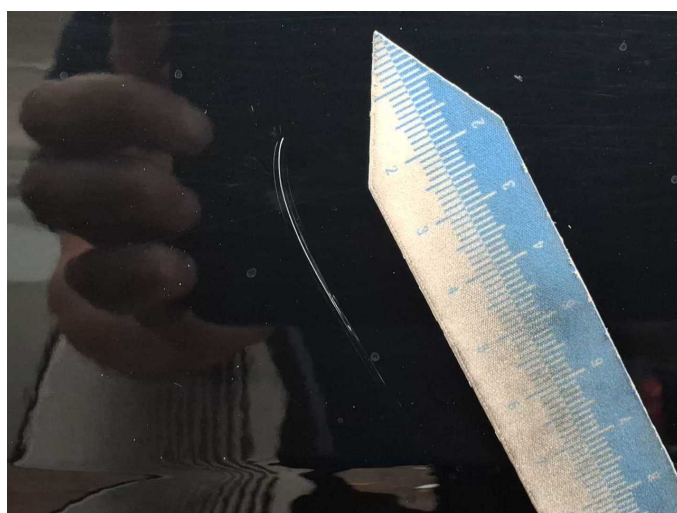

Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 5: Roof: Roof - dent(s) - Smooth repair work



Damage 5: Roof: Roof - dent(s) - Smooth repair work



Damage 5: Roof: Roof - dent(s) - Smooth repair work



Damage 5: Roof: Roof - dent(s) - Smooth repair work



Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

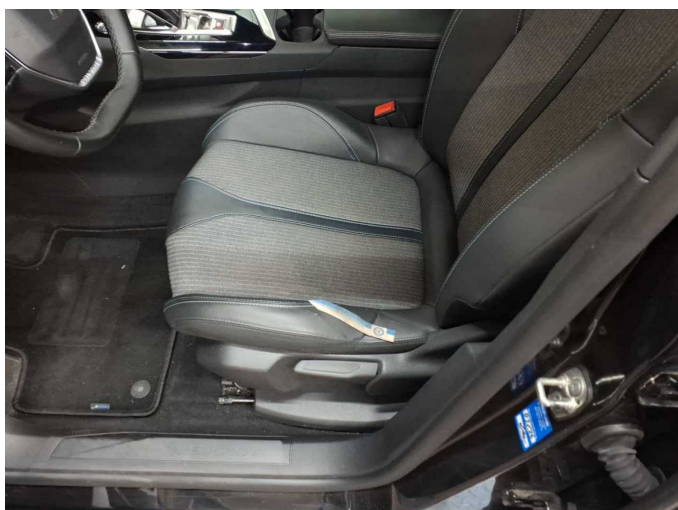


Damage 8: Seat - front: Seat cover - left side - Porous / cracked - Replace




Damage 8: Seat - front: Seat cover - left side - Porous / cracked - Replace

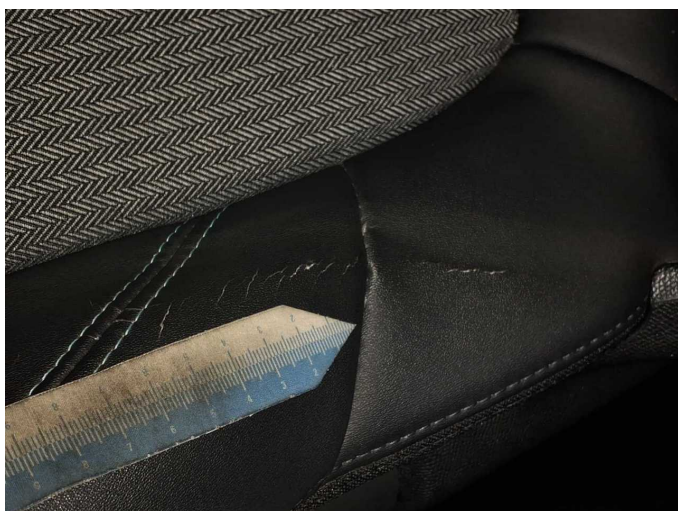


Damage 8: Seat - front: Seat cover - left side - Porous / cracked - Replace

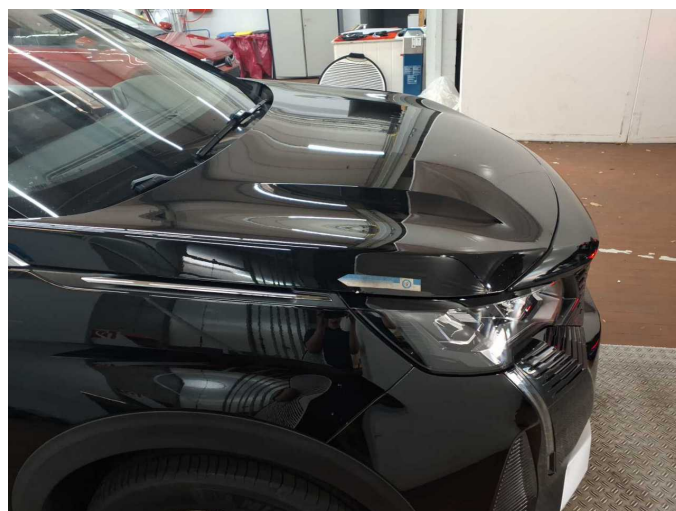

Damage 9: Bonnet: Bonnet - Paint defect - Paint

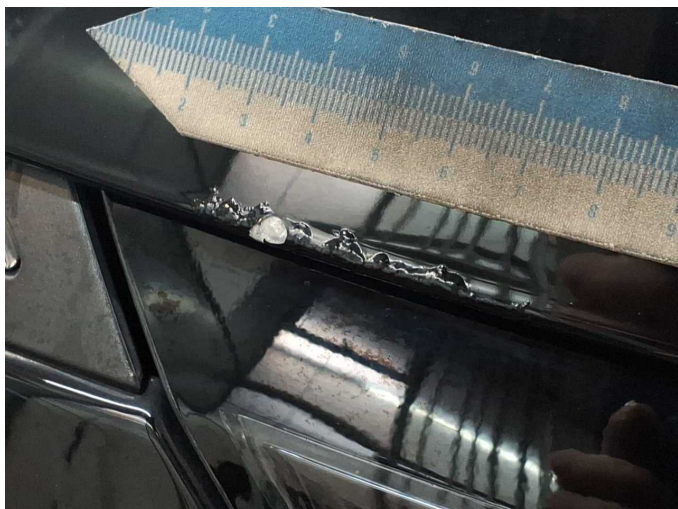

Damage 9: Bonnet: Bonnet - Paint defect - Paint

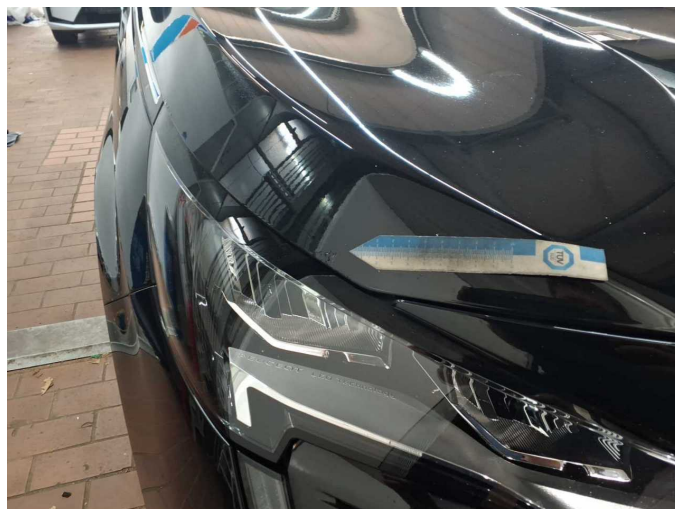


Damage 9: Bonnet: Bonnet - Paint defect - Paint



Damage 9: Bonnet: Bonnet - Paint defect - Paint



Damage 10: Vehicle glazing: Windscreen - Stone chips - Replace

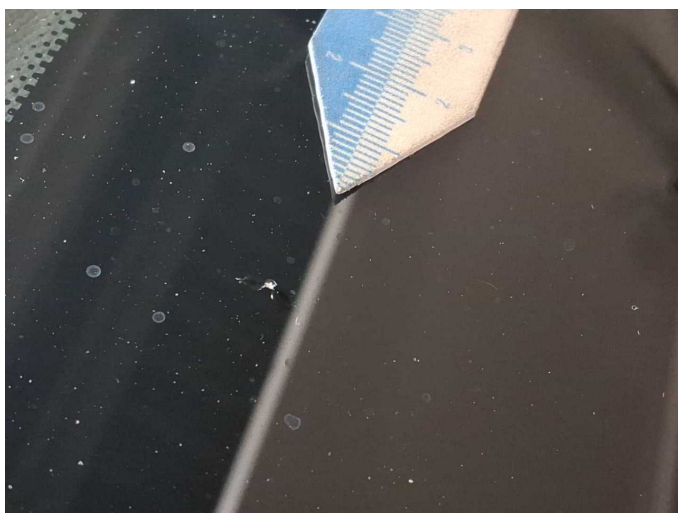

Damage 10: Vehicle glazing: Windscreen - Stone chips - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MCYHZUPS016081
Hersteller / Modell: PEUGEOT PEUGEOT 5008 BlueHDi 130 EAT8 Allure

Datum	KM-Stand	Beschreibung
03.06.2026	82.532	AU; Bremse Sonstiges; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
05.05.2025	49.283	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.05.2024	26.185	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges