TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Mosolf SE & Co.KG
August-Horch-Straße 1
04519 Rackwitz

Expertise

Protocol number: 48444690
Order No. / Reference: 27117212
Inspection date: 2 Nov 2026

Manufacturer: Ford	Model: S-Max 2.0 EcoBlue Aut. TITANIUM
VIN: WF0JXXWPCJNS01666	





Vehicle details

Manufacturer / Type / Model / Equipment	
Ford S-Max 2.0 EcoBlue Aut. TITANIUM	
Vehicle Identification number	WF0JXXWPCJNS01666
Mileage (Read)	143,155 km
First registration	23 May 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	140 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Car station wagon
Colour / colour code	Frost-Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Unknown

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	
Last service on / at	10/2025 at 124,565 km		
Key is / should be	2 / 2	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK801633
Previous damage / Accident	None detectable	**Repainting**	Detectable
Inspection conditions	sufficient	**Lifting equipment / pit**	yes
Test drive	Not performed	**Engine function test**	Performed
Manufacturer key number/ type code number	8566 / BQR 00323		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,555 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R18 101Y	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	235/50 R18 101Y	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Light alloy	Semperit	7mm / 7mm
2)	235/55 R17 103V	Winter tyres on Light alloy	Semperit	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Anti-lock braking system (ABS)
- Attachment points for safety partition grilles
- Hill start assist
- roof console
- Diesel particulate filter (DPF)
- Electronic Shifter
- Lane keeping assist including lane keeping assist and driver fatigue warning
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- luggage compartment cover
- Cruise control system with intelligent speed limiter
- Back window, heater
- Interior lighting with delay circuit
- Intelligent security system
- Electric child safety lock
- Paint finish: Solid
- Steering wheel: Multifunction leather steering wheel
- Reading lights front and rear
- MyKey key system (individually programmable second key)
- Fog light
- Emergency brake light
- Front and rear parking pilot system
- Tire repair kit (for use at a maximum speed of 80 km/h)
- LED taillights
- Headlight dipped beam with switch-off delay including "greeting function"
- Seats: Driver and passenger seats, 4-way manually adjustable
- Seats: Front seats can be heated individually and variably.
- 230 volt socket
- Bumpers painted in body color
- Trays on the front seatbacks
- Premium carpet floor mats, front and rear
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control
- Ambient lighting at the front
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- third brake light
- Roof rails "aluminum look"
- Tachometer
- Driver information system display 25.4 cm color
- Electric windows front and rear
- High Beam Assist
- Ford Easy Fuel
- Ford Power Start function
- Ford Power start function with Ford Key Free system
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission
- rear window wiper
- Interior mirror, automatically dimming
- Isofix mount
- Air conditioning with automatic temperature control
- Steering wheel: Steering column, adjustable in height and reach
- Front center console with padded armrest
- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect
- Package: Winter
- Upholstery: Cloth
- Tire Pressure Monitoring System (TMPS)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Electromechanical power steering
- Seats: Flexible seating system "FoldFlatSystem (FFS)"
- Seats: Front sports seats
- Start-stop system
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- LED daytime running lights
- Traffic sign recognition system
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Cigarette lighter

Extra equipment

- Tires: 7.5 J x 18 alloy wheels (4) with 235/50 R 18 tires (10-spoke design in pearl grey premium paint finish, diamond-turned; with glossy black pockets)
- Package: Business III (Automatic) (Sony Navigation incl. Ford SYNC 3, AppLink, Touchscreen, Voice Control, Radio/CD Player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall, DAB/DAB+, Adaptive LED headlights with glare-free high beam, ACC, Traffic Jam Assist, Pre-Collision Assist, Forward Collision Warning, Emergency Brake Assist, Front and Rear View Camera, Blind Spot Assist, Cross Traffic Alert, Dynamic Distance Control, Power Tailgate with Sensors, Ford Key Free System, Park Assist)
- Anti-theft alarm system including double locking (with interior monitoring)
- Paint finish: Frost White
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Safety partition grille, mounting behind front seats

Retrofitted equipment

- 2 kg powder fire extinguisher
- Protective film for rear bumper

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key - Empty - Replace
2	Equipment	Tirefit filler - Due - Replace
3	Seat - front	Seat cover - left side - Soiled - Clean
4	Boot lid / rear door	Stowage compartment / net - Holes - Replace
5	Braking system	Brake discs and brake pads - front - Worn - Replace
6	Front bumper	Spoiler - Deformed - Replace
7	Vehicle glazing	Windscreen - Stone chips - Replace

Missing parts

Description
Documents - Service book

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out

Paint coat thickness measurement

Roof	210 µm	Roof rail - left side	209 µm
Roof rail - right side	222 µm	Boot lid / rear door	193 µm
Mudguard - left side	204 µm	Mudguard - right side	203 µm
Bonnet	229 µm	Side panel - rear left side	217 µm
Side panel - rear right side	308 µm	Door - rear left side	202 µm
Door - rear right side	205 µm	Door - front left side	209 µm
Door - front right side	208 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Es wird kein Service Restlauf angezeigt.

Erhöhte Lackwerte am gesamten Fahrzeug.

Zustand Bremsen ist HU relevant.

Der beiliegende Winterradsatz ist nicht Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

Figure 9: Interior 360° view (Online Link)



Figure 10: Cargo area

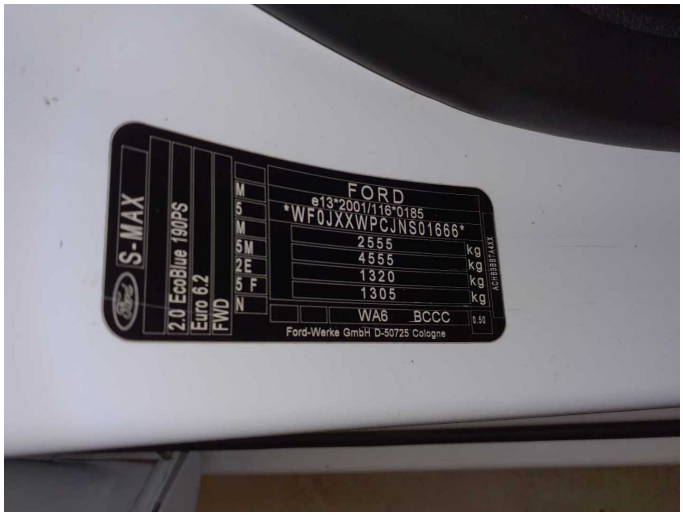


Figure 11: VIN



Figure 12: Mounted tyres

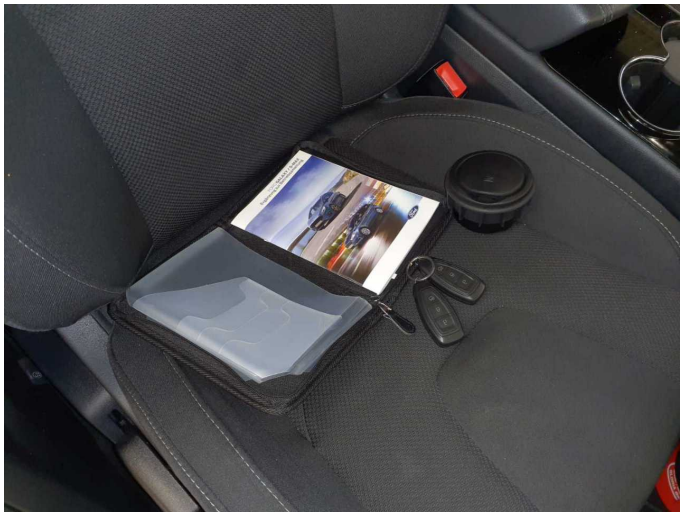


Figure 13: Documents

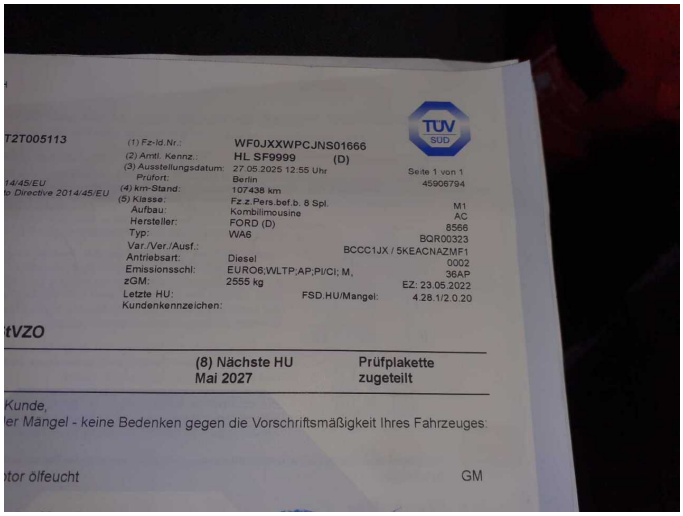


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

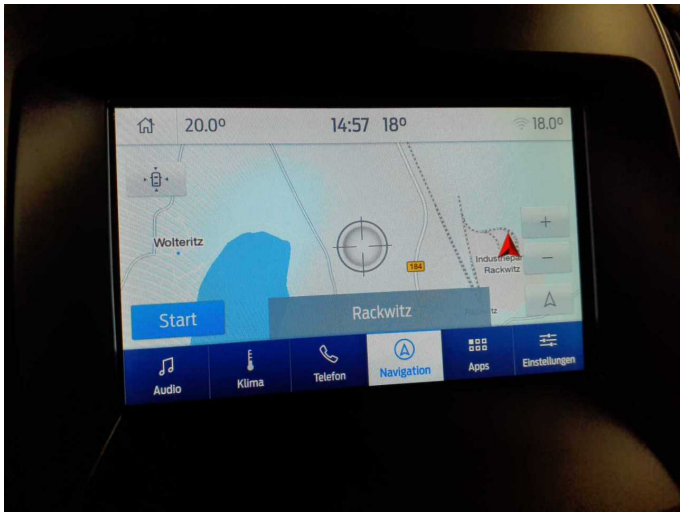


Figure 17: Navigation



Figure 18: Misc.

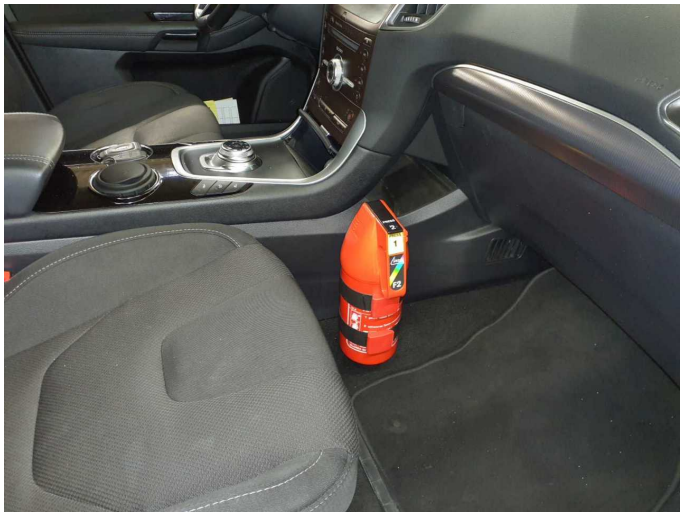


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

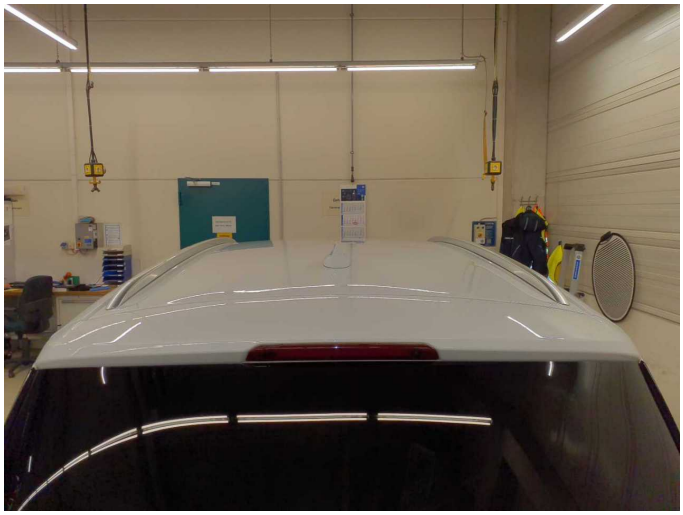


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

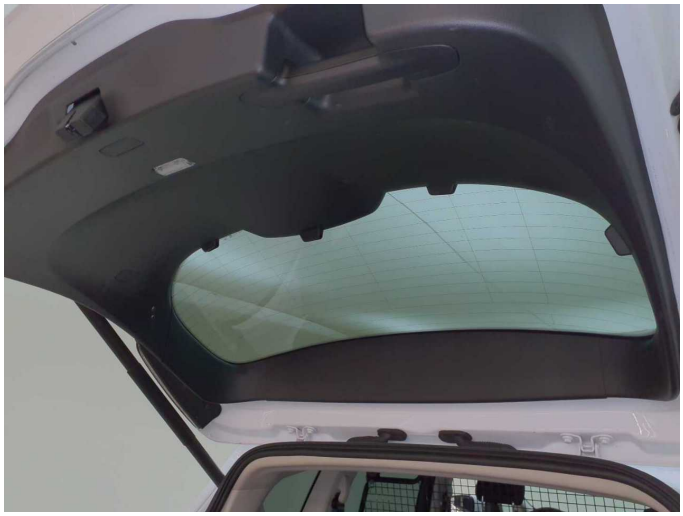


Figure 30: Misc.



Damage 1: Equipment: Vehicle key - Empty - Replace



Damage 2: Equipment: Tirefit filler - Due - Replace



Damage 3: Seat - front: Seat cover - left side - Soiled - Clean



Damage 3: Seat - front: Seat cover - left side - Soiled - Clean



Damage 3: Seat - front: Seat cover - left side - Soiled - Clean



Damage 4: Boot lid / rear door: Stowage compartment / net - Holes - Replace



Damage 4: Boot lid / rear door: Stowage compartment / net - Holes - Replace



Damage 5: Braking system: Brake discs and brake pads - front - Worn - Replace



Damage 5: Braking system: Brake discs and brake pads - front - Worn - Replace



Damage 5: Braking system: Brake discs and brake pads - front - Worn - Replace



Damage 5: Braking system: Brake discs and brake pads - front - Worn - Replace



Damage 5: Braking system: Brake discs and brake pads - front - Worn - Replace



Damage 5: Braking system: Brake discs and brake pads - front - Worn - Replace



Damage 6: Front bumper: Spoiler - Deformed - Replace




Damage 6: Front bumper: Spoiler - Deformed - Replace



Damage 6: Front bumper: Spoiler - Deformed - Replace



Damage 6: Front bumper: Spoiler - Deformed - Replace

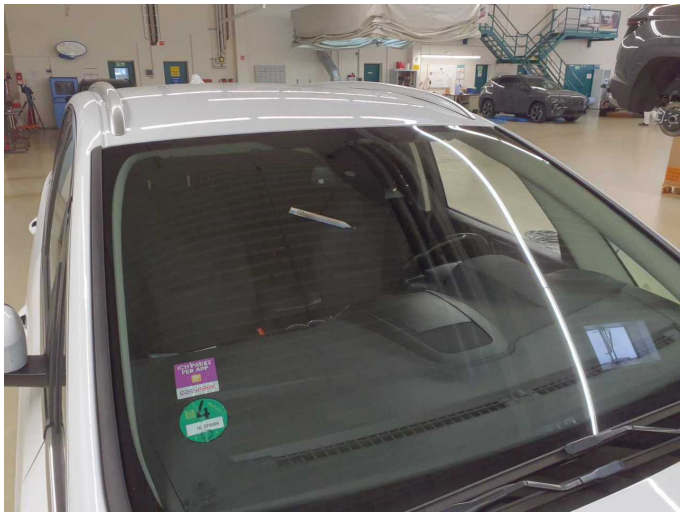

Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Missing part 1: Documents: Service book - Missing - Replace



Repainting 1: Side panel - rear right side



Roof: 210 µm



Mudguard - left side: 204 µm

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Mosolf SE & Co.KG
August-Horch-Straße 1
04519 Rackwitz



Bonnet: 229 µm



Side panel - rear right side: 308 µm



Door - front left side: 209 µm