TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula

Expertise

Protocol number: 48617505
Order No. / Reference: 27182483
Inspection date: 11 Nov 2026

Manufacturer: Ford	Model: Transit Connect 220 L1 Autm. Trend
VIN: WF0RXXWPGRPC37643	





Vehicle details

Manufacturer / Type / Model / Equipment	
Ford Transit Connect 220 L1 Autm. Trend	
Vehicle Identification number	WF0RXXWPGRPC37643
Mileage (Read)	89,077 km
First registration	18 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	73 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frost-Weiß
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	
Last service on / at	08/2026 at 84,897 km		
Key is / should be	1 / 2	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT872484
Previous damage / Accident	Detectable	**Repainting**	None detectable
Inspection conditions	sufficient	**Lifting equipment / pit**	yes
Test drive	Not performed	**Engine function test**	Performed
Manufacturer key number/ type code number	8566 / BUU 01007		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,185 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	4mm / 4mm
2)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, electrically adjustable and heated
- Battery, reinforced
- Rubberized flooring, front
- Front overhead storage compartment,
- Double-leaf rear doors without windows
- Third brake light
- Front electric windows
- FordPass Connect
- Glove compartment with lid
- Front air conditioning including semi-electronic recirculation system
- Cargo area lining, side, half-height
- Alternator/Generator
- Fog light
- Radio: Ford Audio System 2
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Electro-mechanical power steering
- Seat belts
- Seats: Seat package 4
- Front spoiler lip
- Dust and pollen filter
- Front bumper and rear bumper end caps painted in body color
- Child safety lock on sliding doors
- Lashing eyes
- Heat-insulating glazing, lightly tinted
- Driver's side airbag
- Exterior mirrors, narrow mirror format
- Hill start assist
- On-board computer including outside temperature display
- Diesel particulate filter (DPF)
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Ford Easy Fuel
- Transmission: 8-speed automatic
- Front interior lighting with delay function
- Paint finish: Solid
- Cargo area floor protection, plastic, molded
- Steering column, adjustable in height and reach
- Center console, front
- Emergency brake light
- Wheels: Tire repair kit
- Sliding door at rear, right
- Side protection strips, plastic
- Safety brake assist
- Automatic door locking mechanism (45 sec.)
- Sun visor for driver and front passenger
- Start-stop system
- Power outlet: 12-volt connection on the front center console
- Daytime running light
- Partition to the cargo area without window
- Door handles, black
- Electronic immobilizer (EPATS)
- Central locking with remote control

Extra equipment

- Fixed towbar (incl. ESP trailer stabilization and continuous power supply)
- Floor covering: FIDAE all-weather floor mats at the front
- Cargo area lighting, LED
- Seats: Seat package 35 (driver's seat, 3-way adjustable (forward/backward, backrest, height) - single passenger seat, 2-way adjustable (forward/backward, backrest) - height-adjustable headrests - seat heating for driver and passenger - manually adjustable lumbar support in driver's seat - "Capitol/City" fabric in Ebony (black))
- SORTIMO installation
- Xenon: Bi-xenon headlights with LED daytime running lights (with automatic headlight range control)
- Electrically adjustable and heated exterior mirrors with blind spot assist (blind spot assist including cross traffic alert)
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, Apple CarPlay, Android Auto, live traffic, detailed 3D visualization, Michelin travel guide for Europe)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
2	Rear bumper	Rear bumper (unpainted) - Scratched - Replace
3	Front bumper	Front bumper - Scratched - Paint
4	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Replace
5	Bonnet	Bonnet - dent(s) - Repair and paint

Missing parts

Description
Equipment - Vehicle key

Accident damages

No.	Accident
1	Rear, Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

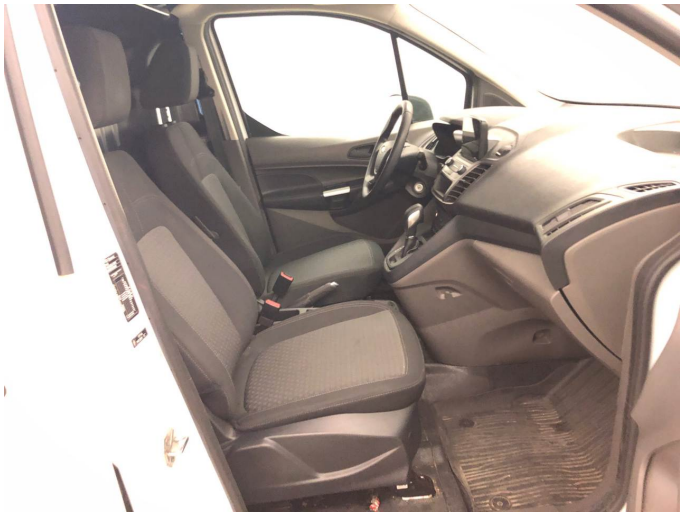


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

Figure 9: Interior 360° view (Online Link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

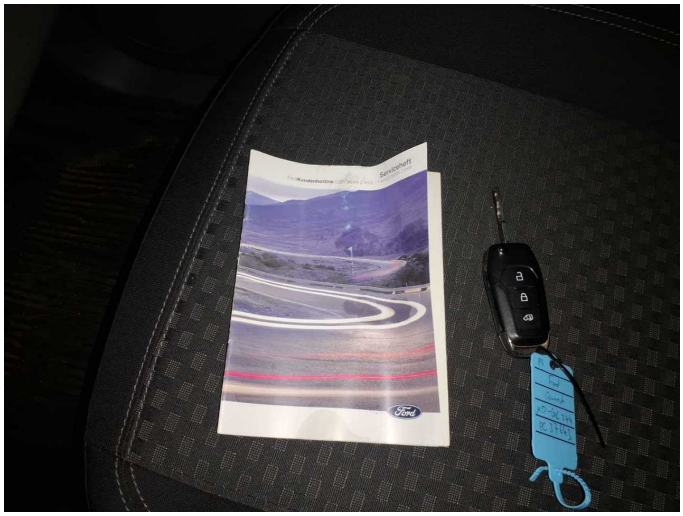


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres

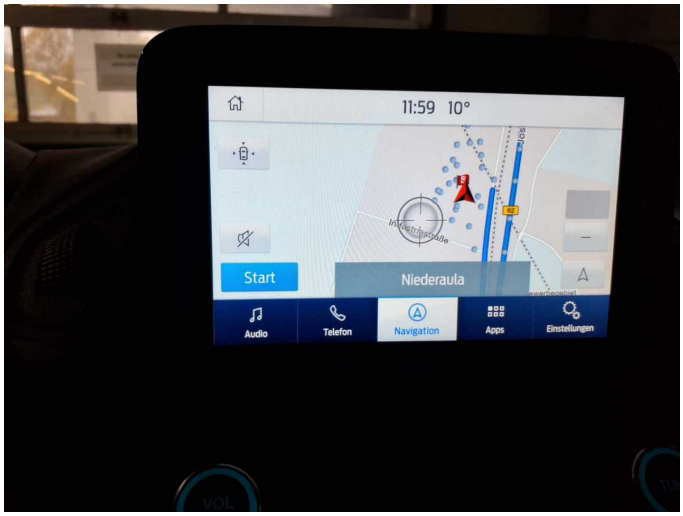


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratched - Replace



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratched - Replace



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratched - Replace



Damage 3: Front bumper: Front bumper - Scratched - Paint



Damage 3: Front bumper: Front bumper - Scratched - Paint




Damage 3: Front bumper: Front bumper - Scratched - Paint



Damage 3: Front bumper: Front bumper - Scratched - Paint




Damage 4: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace

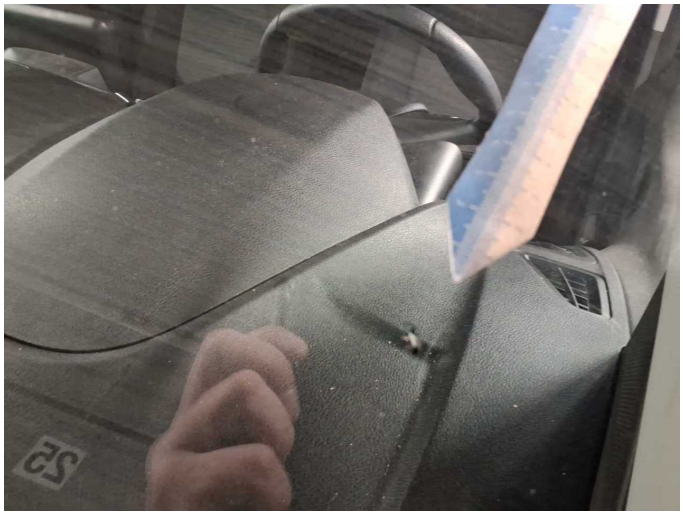

Damage 4: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace



Damage 4: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace

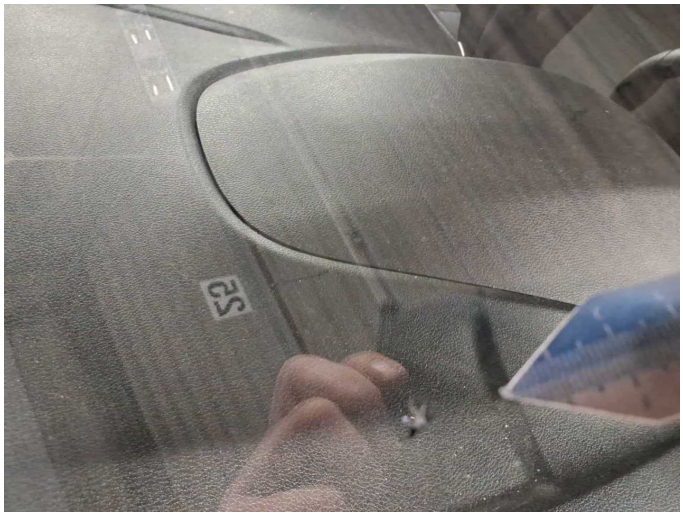

Damage 4: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace



Damage 5: Bonnet: Bonnet - dent(s) - Repair and paint

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula



Damage 5: Bonnet: Bonnet - dent(s) - Repair and paint



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right