TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Mosolf SE & Co.KG
Faberweg 25
73230 Kirchheim unter Teck

# Expertise

Protocol number: 48398811
Order No. / Reference: 27175235
Inspection date: 29 Oct 2026

| | |
|---|---|
| Manufacturer: Mercedes-Benz | Model: Vito 116 CDI Extralang HA BASE |
| VIN: W1V44760513902890 | |







## Vehicle details

| | |
|---|---|
| **Manufacturer / Type / Model / Equipment** | |
| Mercedes-Benz Vito 116 CDI Extralang HA BASE | |
| **Vehicle Identification number** | W1V44760513902890 |
| **Mileage** (Read) | 94,420 km |
| **First registration** | 1 Sept 2021 |
| **Number of holders** | 1 |
| **Next periodical technical inspection** (Report on hand) | 09/2027 |
| **Fuel type** | Diesel |
| **Engine displacement / Cylinder** | 1,950 ccm / 4 |
| **Power** | 120 kW |
| **Gearbox / Number of gears** | Automatic / 9 |
| **Type of drive** | Rear drive |
| **Type of vehicle** | Van |
| **Colour / colour code** | Navyblau MB 5610 |
| **Doors / Seats** | 4 / 2 |
| **Upholstery type** | Cloth |
| **Colour of upholstery** | Black-Anthracite |
| **Vehicle with smoke odor** | no |

## Vehicle details

| | | | |
|---|---|---|---|
| **Maintenance booklet / proof** | Available / incomplete | **Next maintenance in** | 517 Tag(e) |
| **Key is / should be** | 2 / 2 | **FZG documents** | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
| | | **Letter No.** | GD340144 |
| **Previous damage / Accident** | Detectable | **Repainting** | None detectable |
| **Inspection conditions** | sufficient | **Lifting equipment / pit** | No |
| **Test drive** | Not performed | **Engine function test** | Performed |
| **Manufacturer key number/ type code number** | 2222 / BBJ 01192 | | |
| **Emission standard** | EURO6 | **fine dust sticker** | |
| **Permitted total weight** | 2,800 kg | **Empty weight** | |

## Tyres

### Mounted tyres

| # | Tyre size | Type of tyre | Manufacturer | Tread depth |
|---|---|---|---|---|
| 1) | 205/65 R16 107T | All-season tyres on Steel rim with wheel cover | Continental | 4mm / 4mm |
| 2) | 205/65 R16 107T | All-season tyres on Steel rim with wheel cover | Continental | 5mm / 5mm |

### Replacement

| Typ | Tyre size | Type of tyre | Manufacturer | Tread depth |
|---|---|---|---|---|
| E | | | | |

**Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.**

## Equipment

### Standard equipment

- AdBlue tank (24 liters)
- ATTENTION ASSIST
- Exterior mirrors, manually adjustable (2)
- Battery: fleece battery 12 V / 92 Ah
- Hill start assist
- Brake lights, adaptive
- Ceiling light
- Electronic tachometer
- Electronic Stability Program (ADAPTIVE ESP) with integrated Anti-lock Braking System (ABS)
- Generator management
- Transmission: 6-speed manual
- Seatbelt warning device for front passenger seat
- Seatbelt warning device for driver's seat
- Main tank 57 liters
- Interior trim of cargo area, side
- Communication module (LTE) for digital services
- Paint finish: Solid color paint
- Headlight range control
- Multifunctional steering wheel
- Breakdown management
- Tires: 205/65 R 16
- Tires: Premium protection tires (3 years)
- Sliding door on the right, cargo/passenger compartment
- Crosswind Assist
- Seats: Adjustable passenger seat
- 12V socket
- continuous partition wall
- Warning triangle
- Immobiliser
- Central locking with radio remote control
- Airbag for driver and front passenger
- Attention Assistant
- Outdoor temperature display
- Fixing points in the roof frame
- third brake light
- Front cupholder
- Diesel particulate filter
- ECO start/stop function
- Electric windows, driver/passenger
- Generator 14 V / 200 A
- Speed limit 210 km/h
- Weight variant 2,800 kg
- Seatbelt warning device for driver and front passenger seat
- Lockable glove box
- Boot lid
- Instrument cluster with pixel matrix display
- Headrests (2), front
- Steering wheel adjustable for tilt and height
- Mercedes-Benz emergency call system
- Package: BlueEFFICIENCY
- Upholstery: Caluma fabric, black
- Tires: Tires without specified make
- Wheels: Steel rims 6.5 J x 16
- Key: 3-button remote control
- electromechanical power steering
- Start-stop function
- Cruise control
- Pre-installation for Remote Services Plus
- Maintenance interval indicator >>ASSYST<
- Heat-insulating glass all around

### Extra equipment

- Upgrading/downgrading (upgrading to 3.05 t GVW)
- Comfort roof control unit in conjunction with rain sensor
- Burglar and theft alarm system (without interior monitoring)
- Rear camera not foldable
- Interior lining of the cargo area up to roof height (wood)
- Large fuel tank, approx. 70 liters
- LED light strip in the cargo area
- Navigation accessories: Live Traffic Information
- Radio/Navigation: Multimedia radio and navigation system "Audio 40" (7-inch LCD touchscreen - DAB digital radio - Apple CarPlay and Android Auto - Bluetooth 3.0 - Hands-free system - Live Traffic Information - 2-way front speakers)
- High-resolution reversing camera with guide lines
- Seats: Comfort passenger seat
- Seat heating on passenger side
- Electrically adjustable and heated exterior mirrors, left and right
- Driving light assistant (automatically switching on driving lights)
- Tempmatic controlled air conditioning
- Paint finish: Special paint finish (according to sample card)
- Center console with storage compartment
- Halogen fog lights
- Radio: Radio Generation 2
- Rain sensor
- Tire pressure monitoring (on front and rear axles (wireless))
- Spare wheel under the rear of the vehicle with jack
- Keys: 2 additional master keys
- Seats: Comfort driver's seat
- Seat heating on driver's side

## Brief expert findings

| | |
|---|---|
| Documents submitted | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection. |
| Inspection | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive | No test drive/shunting maneuver was carried out during the inspection of the vehicle. |
| Engine function test | An engine test run was performed. |

## Value reducing factors

| No. | Component group | Description |
|---|---|---|
| 1 | Door - front left side | Door (Knackt beim öffnen) - Noise - Perform diagnosis |
| 2 | Wheel / tyres | Wheel rims - complete set - Corrosion - Loss in value |
| 3 | Multimedia system | Navigation system - Non-operational - Perform diagnosis |
| 4 | Body | Body - Glued / labelled - De-glue / neutralise |
| 5 | Bonnet | Bonnet - Deformed - Repair and paint |

## Wear and tear

| No. | Component group | Description |
|---|---|---|
| 1 | Misc. | Inspection / maintenance - No evidence - No deduction |
| 2 | Body | Body - Dent / paintcoat damage - No deduction |
| 3 | Vehicle glazing | Windscreen - Stone chips - No deduction |
| 4 | Boot lid / rear door | Boot lid - dent(s) - No deduction |
| 5 | Mudguard - left side | Mudguard - left side - Scratch(es) - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Previous damages

| No. | Previous damage | Extent of damage (Net) |
|---|---|---|
| 1 | Side - left, Provided by user / customer, from 9 Jan 2023 | 546,38 € |

## Accident damages

| No. | Accident |
|---|---|
| 1 | Side right |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  *(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  *(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.




**Figure 1:** Diagonal front (left)




**Figure 2:** Diagonal front (right)




**Figure 3:** Diagonal rear (left)




**Figure 4:** Diagonal rear (right)




**Figure 5:** Interior - front




**Figure 6:** Interior - rear




**Figure 7:** Instrument cluster



**Figure 8:** Instrument panel

**Figure 9:** Interior 360° view (Online Link)




**Figure 10:** Cargo area




**Figure 11:** VIN



**Figure 12:** Mounted tyres




**Figure 13:** Documents

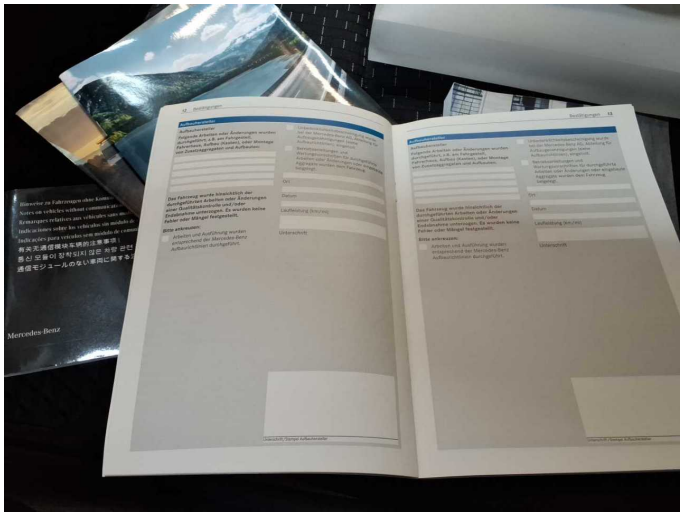


**Figure 14:** Documents

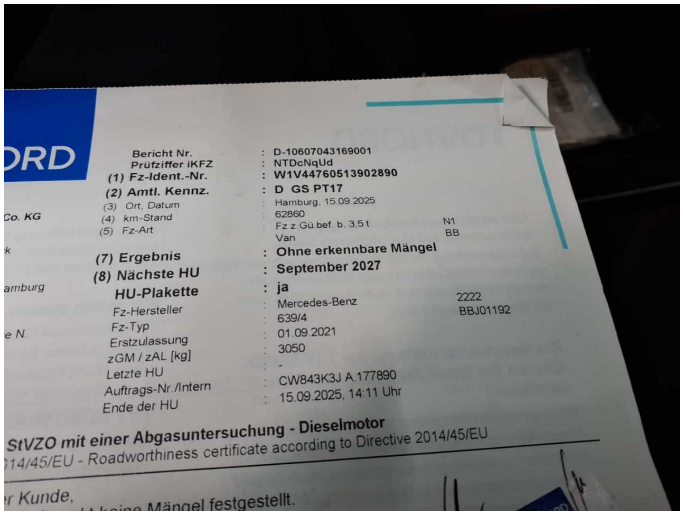



**Figure 15:** Documents



**Figure 16:** Documents




**Figure 17:** Navigation



**Figure 18:** Misc.



**Figure 19:** Misc.




**Figure 20:** Misc.



**Figure 21:** Misc.



**Figure 22:** Misc.

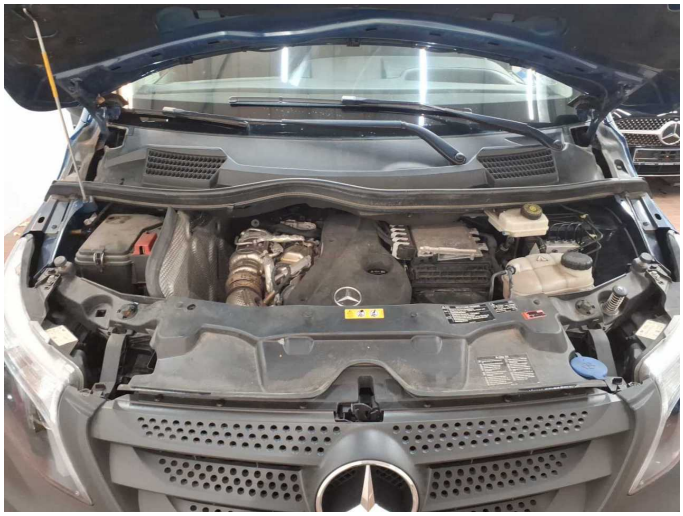


**Figure 23:** Misc.

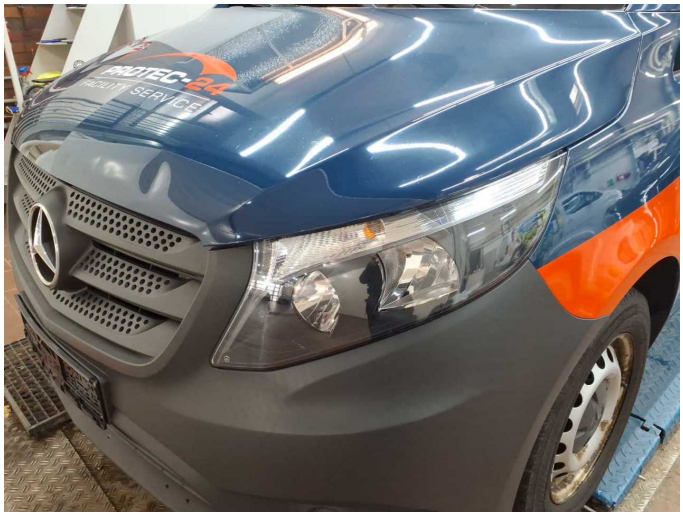


**Figure 24:** Misc.



**Figure 25:** Misc.



**Figure 26:** Misc.




**Figure 27:** Misc.



**Figure 28:** Misc.



**Damage 2:** Wheel / tyres: Wheel rims - complete set - Corrosion - Loss in value



**Damage 2:** Wheel / tyres: Wheel rims - complete set - Corrosion - Loss in value



**Damage 2:** Wheel / tyres: Wheel rims - complete set - Corrosion - Loss in value



**Damage 2:** Wheel / tyres: Wheel rims - complete set - Corrosion - Loss in value




**Damage 3:** Multimedia system: Navigation system - Non-operational - Perform diagnosis




**Damage 4:** Body: Body - Glued / labelled - De-glue / neutralise




**Damage 4:** Body: Body - Glued / labelled - De-glue / neutralise



**Damage 4:** Body: Body - Glued / labelled - De-glue / neutralise




**Damage 4:** Body: Body - Glued / labelled - De-glue / neutralise




**Damage 5:** Bonnet: Bonnet - Deformed - Repair and paint




**Damage 5:** Bonnet: Bonnet - Deformed - Repair and paint




**Accident 1:** Side right




**Accident 1:** Side right

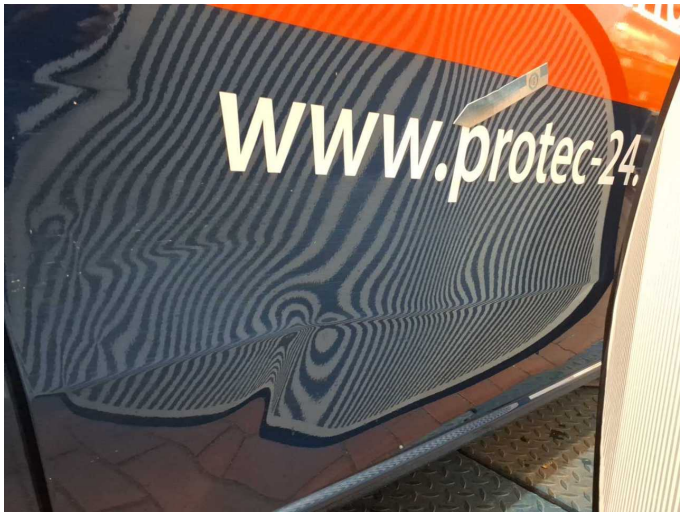


**Accident 1:** Side right




**Accident 1:** Side right



**Accident 1:** Side right




**Accident 1:** Side right

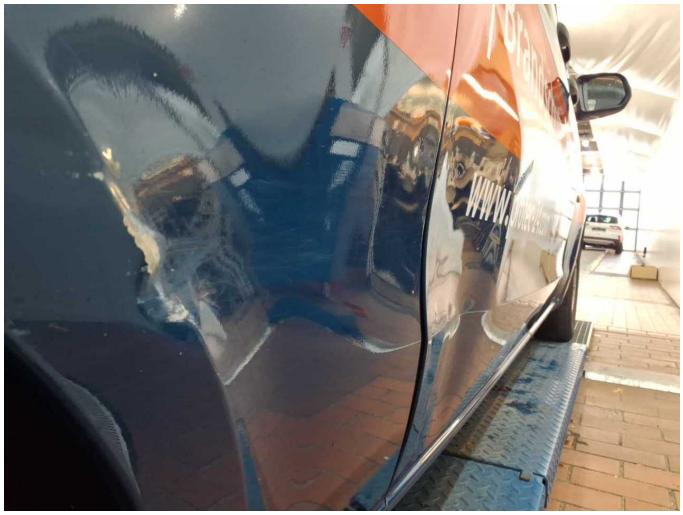

**Accident 1:** Side right



**Accident 1:** Side right

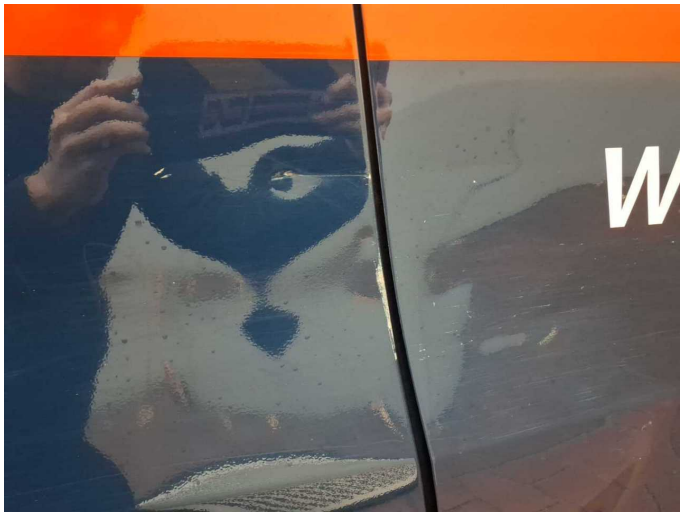

**Accident 1:** Side right

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Mosolf SE & Co.KG
Faberweg 25
73230 Kirchheim unter Teck




**Accident 1:** Side right