TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Leerenstraße 25
29683 Bad Fallingbostel

Expertise

Protocol number: 48546990
Order No. / Reference: 27279823
Inspection date: 4 Nov 2026

Manufacturer: Mercedes-Benz	Model: Vito 110 CDI Lang VA BASE
VIN: W1V44760313866951	





Vehicle details

Manufacturer / Type / Model / Equipment	
Mercedes-Benz Vito 110 CDI Lang VA BASE	
Vehicle Identification number	W1V44760313866951
Mileage (Read)	62,485 km
First registration	26 May 2021
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,750 ccm / 4
Power	75 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	brillantsilber metallic
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Leerenstraße 25
29683 Bad Fallingbostel

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	579 Tag(e)
Last service on / at	05/2026 at 55,164 km		
Key is / should be	2 / 2	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GB979941
Previous damage / Accident	Detectable	**Repainting**	Detectable
Inspection conditions	sufficient	**Lifting equipment / pit**	yes
Test drive	Not performed	**Engine function test**	With complaint
Manufacturer key number/ type code number	2222 / ARU 00295		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,800 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/65 R16 107T	Winter tyres on Steel rim with wheel cover	Michelin	6mm / 6mm
2)	205/65 R16 107T	Winter tyres on Steel rim with wheel cover	Michelin	8mm / 8mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (24 liters)
- Attention Assistant
- Hill start assist
- Brake lights, adaptive
- Diesel particulate filter
- Electronic Stability Program (ADAPTIVE ESP) with integrated anti-lock braking system (ABS) (traction control (ASR) - electronic brake force distribution (EBD) - brake assist (BAS))
- Transmission: 6-speed manual
- Lockable glove box
- Interior trim of cargo area, side
- Headrests (2), front
- Headlight range control
- Mercedes-Benz emergency call system (communication module (LTE) for digital services breakdown management)
- Tires: Tires without specified make
- Sliding door on the right, cargo/passenger compartment
- Crosswind Assist
- Front stabilizer
- Cruise control
- First aid kit
- Pre-installation for Remote Services Plus
- Maintenance interval indicator >>ASSYST<
- Heat-insulating glass all around
- Airbag for driver and front passenger
- Outdoor temperature display
- third brake light
- Ceiling interior light (in driver and passenger area)
- ECO start/stop function
- Electric window regulator driver/passenger (with anti-pinch protection, quick lowering and raising)
- Parking brake
- Speed limit 210 km/h
- Seatbelt warning device for driver and front passenger seat
- Tailgate with an opening angle of approximately 90°
- Instrument cluster (speedometer with trip odometer - quartz-controlled digital clock - fuel gauge - electronic tachometer)
- Package: BlueEFFICIENCY (Efficiency Package)
- Upholstery: Caluma fabric, black
- Wheels: Steel rims 6.5 J x 16
- Key: 3-button remote control
- electromechanical power steering
- 12V socket
- continuous partition wall
- Lashing eyes in the cargo area
- Warning triangle
- Immobiliser
- Central locking with radio remote control

Extra equipment

- Upgrading/downgrading (upgrading to 3.05 t GVW)
- Battery: fleece battery 12 V / 92 Ah
- Driving light assistant (automatically switching on driving lights)
- Paint finish: Metallic
- Steering wheel adjustable for tilt and height
- Radio: Audio 30 (DAB Digital Radio - 7" LCD touchscreen - Apple CarPlay and Android Auto - Bluetooth 3.0, hands-free system - 2-way front speakers)
- High-resolution reversing camera with guide lines
- Rear door, double-leaf, 180° opening, without window
- Seat: Lumbar support driver's seat
- Seat heating on driver's side
- Electrically adjustable and heated exterior mirrors, left and right
- Tempmatic controlled air conditioning
- Large fuel tank, approx. 70 liters
- LED light strip in the cargo area
- Package: Smoker's package
- Rain sensor
- Tires: 205/65 R 16
- Tire pressure monitoring (on front and rear axles (wireless))
- Cabinet installation
- Seats: Comfort driver's seat
- Auxiliary heater, electric

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Sliding door, right	Trim - Broken / torn - Replace
3	Boot lid / rear door	Rear door - left side - dent(s) - Smart repair
4	Vehicle glazing	Windscreen - Stone chips - Smart repair
5	Instrument panel	Indicator light (Motorkontrolle, nicht fahrbereit) - on - Perform diagnosis

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - Scratch(es) - No deduction
2	Door - front right side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 16 Jun 2021	1.926,67 €
2	Front, Provided by user / customer, from 21 Sept 2025	2.634,70 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	370 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

Figure 9: Interior 360° view (Online Link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.

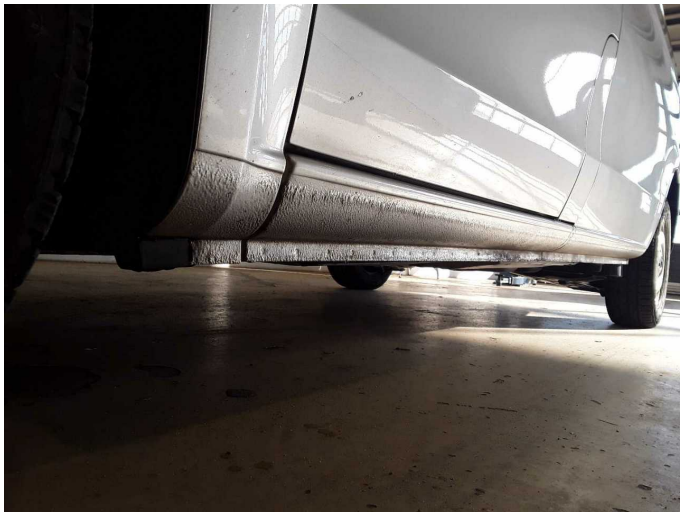


Figure 18: Misc.



Figure 19: Misc.

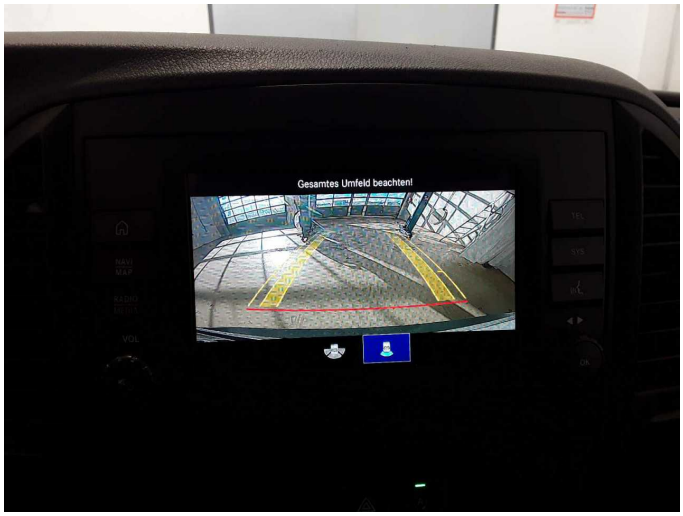


Figure 20: Misc.

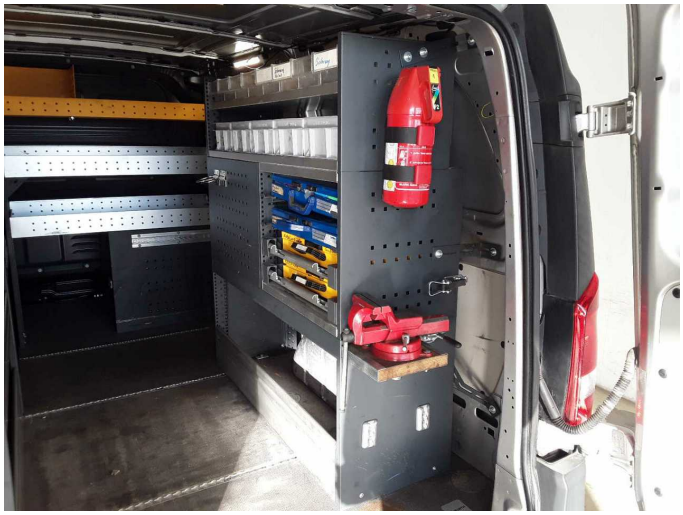


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Damage 2: Sliding door, right: Trim - Broken / torn - Replace



Damage 2: Sliding door, right: Trim - Broken / torn - Replace




Damage 3: Boot lid / rear door: Rear door - left side - dent(s) - Smart repair



Damage 3: Boot lid / rear door: Rear door - left side - dent(s) - Smart repair



Damage 4: Vehicle glazing: Windscreen - Stone chips - Smart repair

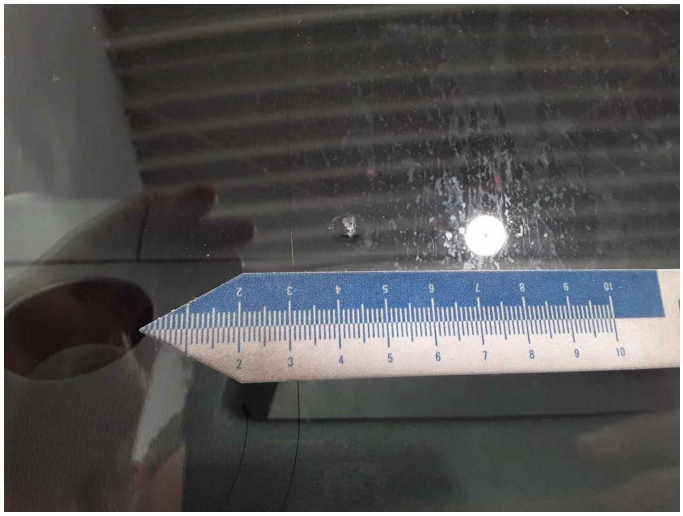

Damage 4: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 5: Instrument panel: Indicator light (Motorkontrolle, nicht fahrbereit) - on - Perform diagnosis

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Leerenstraße 25
29683 Bad Fallingbostel



Repainting 1: Bonnet



Repainting 1: Bonnet