TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Compound Professionals
Wachau 2
89584 Ehingen

Expertise

Protocol number: 48543025
Order No. / Reference: 26792265
Inspection date: 4 Nov 2026

Manufacturer: Mercedes-Benz	Model: CLA 180 180 Shooting Brake
VIN: W1K5M8EB1PN424356	





Vehicle details

Manufacturer / Type / Model / Equipment	
Mercedes-Benz CLA 180 180 Shooting Brake	
Vehicle Identification number	W1K5M8EB1PN424356
Mileage (Read)	24,373 km
First registration	21 Sept 2023
Number of holders	1
Fuel type	Petrol
Engine displacement / Cylinder	1,332 ccm / 4
Power	100 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Dark grey-Black
Vehicle with smoke odor	no

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	9 Tag(e)
Last service on / at	11/2025 at 17,908 km		
Key is / should be	2 / 2	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV 716247
Previous damage / Accident	Detectable	**Repainting**	Detectable
Inspection conditions	Conditional: Light/moisture/dirt	**Lifting equipment / pit**	yes
Test drive	short drive on the company premises	**Engine function test**	Performed
Manufacturer key number/ type code number	2222 / AGY 00063		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,000 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Michelin	6mm / 6mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Michelin	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 91W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	205/55 R17 91W	Summer tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and drying brakes in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbag for driver and front passenger
- Traction control (ASR)
- ATTENTION ASSIST
- Basic services
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Velour floor mats in black
- Transmission: 6-speed manual transmission
- Lockable glove compartment
- Interior headliner fabric crystal grey
- THERMATIC automatic climate control
- Front headrests are height-adjustable
- Steering wheel: Multifunction sports steering wheel
- Light and rain sensor
- Otto particulate filter
- Package: Seating comfort
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: USB interface in the storage compartment & 2 USB interfaces in the rear center console
- Wheels: 43.2 cm (17") alloy wheels, 4-spoke design, 5-twin-spoke design
- Seats: Rear seat backrests foldable
- Seats: Comfort seats
- Lane Keeping Assist, active
- Bumpers in body color
- Touchpad
- Electronic immobilizer
- Airbag for driver and front passenger
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Double cup holder at the front
- Third brake light in LED technology
- ECO start/stop function
- Chassis: Comfort chassis
- electric parking brake
- Speed Limit Assistant
- Halogen headlights with integrated LED daytime running lights
- KEYLESS-GO start function
- Rear headrests (3)
- Paint finish: Solid
- Steering: Direct steering
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/Bertrix fabric
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seat belts CLA-Class
- Seats: iSize child seat anchorages with top tether on the outer seats
- 12V power outlet
- Cruise control
- High-visibility vest for drivers
- Central locking

Extra equipment

- THERMOTRONIC automatic climate control with 2 zones
- Package: Business
- Package: Parking package with reversing camera
- Wheels: Winter complete wheels M+S 4-way 40.6 cm (16")
- Navigation accessories: Pre-installation for Live Traffic Information
- Wheels: Complete summer wheel sets fitted at the factory

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Hinweis: Service A3) - Due - No deduction
2	Misc.	Main inspection - No evidence - No deduction
3	Trim / covers	Boot lining - Scratch(es) - Loss in value
4	Wheel / tyres	Pressure sensor (Reifendruck) - Electrical fault - Perform diagnosis
5	Front bumper	Front bumper - Scratch(es) - Smart repair
6	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 20 Jan 2025	9.676,52 €

Repainting

No.	Repainting
1	Roof rail - left side, Boot lid / rear door, Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - left side	200 µm	Boot lid / rear door	148 µm
Side panel - rear left side	178 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Rücksprache mit Kunde, ob Rechnung zu Vorschaden bzw. Nachlackierung vorhanden ist.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Compound Professionals
Wachau 2
89584 Ehingen



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

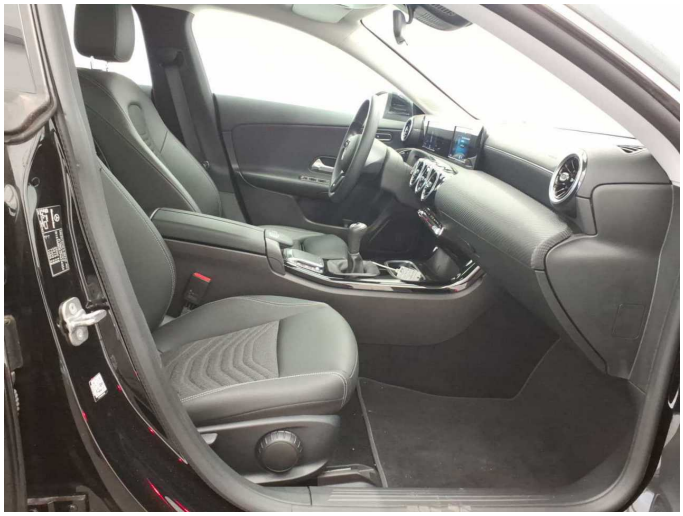


Figure 5: Interior - front

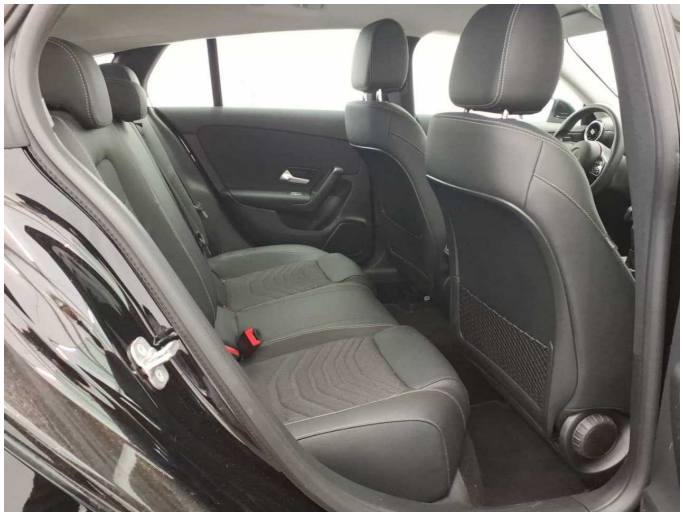


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Cargo area



Figure 10: VIN



Figure 11: Mounted tyres



Figure 12: Documents

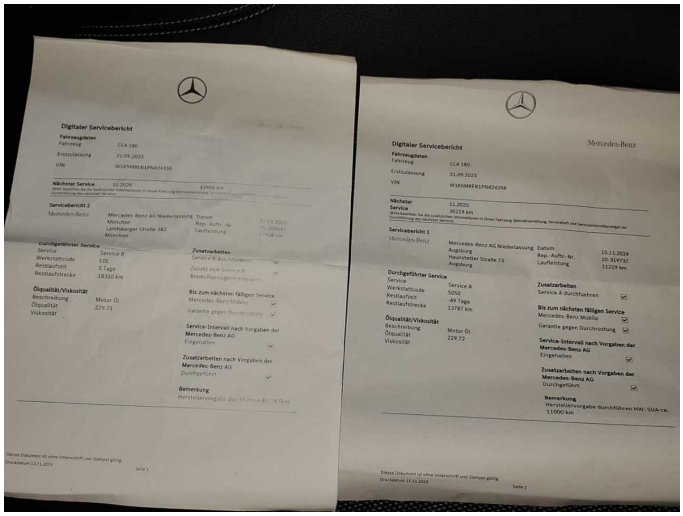


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

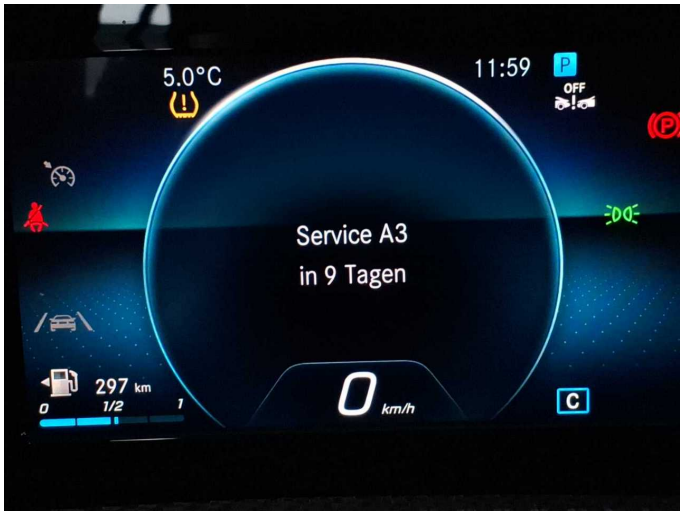


Figure 21: Misc.




Figure 22: Misc.




Damage 3: Trim / covers: Boot lining - Scratch(es) - Loss in value



Damage 3: Trim / covers: Boot lining - Scratch(es) - Loss in value

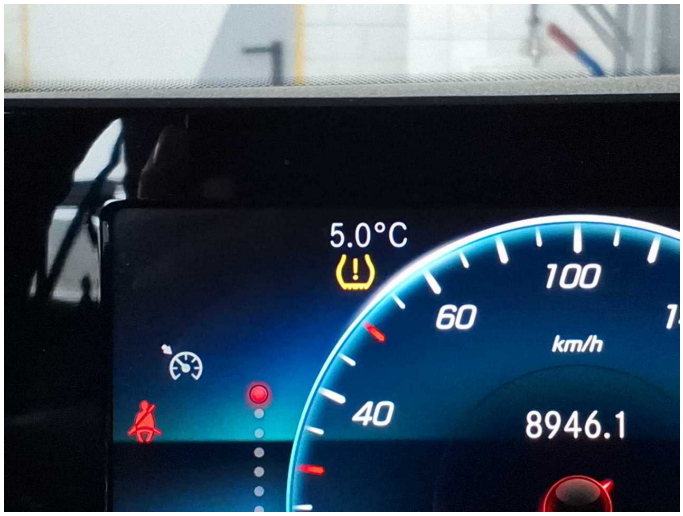


Damage 4: Wheel / tyres: Pressure sensor (Reifendruck) - Electrical fault - Perform diagnosis

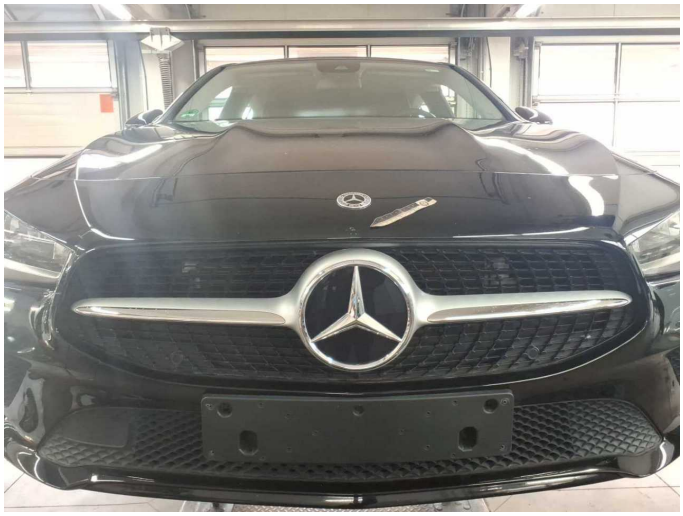


Damage 5: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 5: Front bumper: Front bumper - Scratch(es) - Smart repair

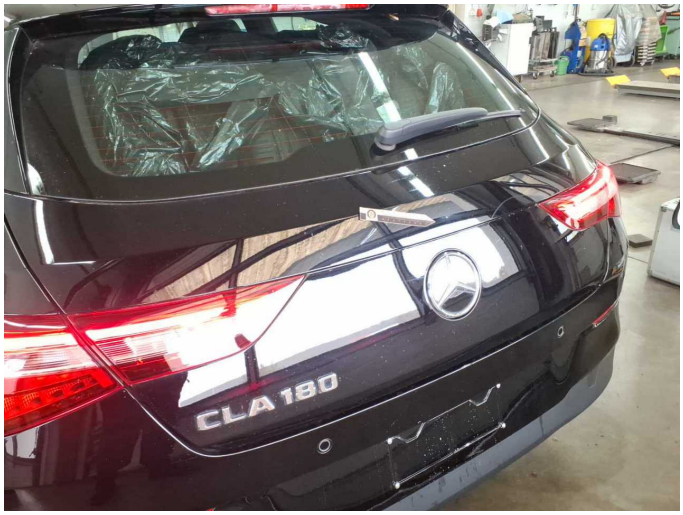

Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

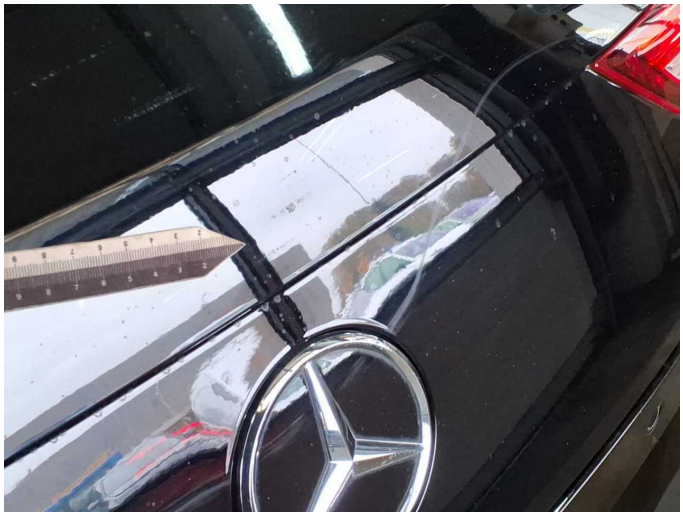

Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Compound Professionals
Wachau 2
89584 Ehingen



Roof rail - left side: 200 µm



Boot lid / rear door: 148 µm



Side panel - rear left side: 178 µm