TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Inspection location
Mosolf SE & Co.KG
August-Horch-Straße 1
04519 Rackwitz

Expertise

Protocol number: 48423423
Order No. / Reference: 27144276
Inspection date: 27 Oct 2026

Manufacturer: Mercedes-Benz	Model: Vito 116 CDI 4MATIC Mixto Lang Aut.
VIN: W1V44770313907321	





Vehicle details

Manufacturer / Type / Model / Equipment	
Mercedes-Benz Vito 116 CDI 4MATIC Mixto Lang Aut.	
Vehicle Identification number	W1V44770313907321
Mileage (Read)	239,652 km
First registration	6 Sept 2021
Number of holders	1
Next periodical technical inspection (Report on hand)	09/2027
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	120 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Van
Colour / colour code	Arktikweiss
Doors / Seats	4 / 5
Upholstery type	Cloth
Colour of upholstery	Black
readiness to drive	Not roadworthy / not moveable

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Inspection location
Mosolf SE & Co.KG
August-Horch-Straße 1
04519 Rackwitz

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	610 Tag(e)
Last service on / at	06/2026 at 216,129 km		
Key is / should be	2 / 2	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GE473562
Previous damage / Accident	Detectable	**Repainting**	Detectable
Inspection conditions	Conditional: Light/moisture/dirt	**Lifting equipment / pit**	No
Test drive	Not performed	**Engine function test**	Not possible
readiness to drive	Not roadworthy / not moveable		
Roadworthiness	not roadworthy/operational		
Manufacturer key number/ type code number	2222 / BAX 00229		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,800 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 109H	All-season tyres on Steel rim with wheel cover	Continental	7mm / 7mm
2)	225/55 R17 109H	All-season tyres on Steel rim with wheel cover	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	225/55 R17 109H C	Summer tyres on Steel	Continental	8 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS, ESP, ASR, EBV, BAS
- Passenger side airbag
- Permanent all-wheel drive
- Exterior mirrors, manually adjustable (2)
- Battery: fleece battery 12 V / 92 Ah
- Hill start assist
- Brake lights, adaptive
- Standard roof lining, pillars B to D
- Electronic tachometer
- Front left window fixed in SW/ cargo area sliding door
- Electric windows, driver/passenger
- Generator management
- Seatbelt warning device for driver and front passenger seat
- Lockable glove box
- HOLD function
- Interior lights in the rear
- Interior trim of cargo area, side
- Instrument cluster
- Headrests (2), front
- Steering wheel adjustable for tilt and height
- Mercedes-Benz emergency call system
- Package: BlueEFFICIENCY
- Upholstery: Caluma fabric, black
- Tires: Premium protection tires (3 years)
- Headlights: halogen technology
- Crosswind Assist
- Seats: Adjustable passenger seat
- Start-stop function
- Cruise control
- Warm air duct to the passenger compartment
- ASSYST maintenance interval indicator
- Central locking with radio remote control
- Screw-in towing eye front/rear
- Driver's side airbag
- ATTENTION ASSIST
- Outdoor temperature display
- Fixing points in the roof frame
- third brake light
- Front cupholder
- Diesel particulate filter and SCR
- Chassis: Standard chassis
- Front right window fixed in SW/ cargo area sliding door
- Generator 14 V / 200 A
- Transmission: 9G-TRONIC
- Seatbelt warning device for driver's seat
- Boot lid
- Wooden floor (cargo area)
- Interior mirror
- Child safety locks on doors in the passenger compartment
- Communication module (LTE) for digital services
- Paint finish: Solid color paint
- Headlight range control
- Multifunction steering wheel with trip computer
- Breakdown management
- Tires: 225/55R17
- Wheels: Steel rims 6.5 J x 17
- Sliding door on the right, cargo/passenger compartment
- electromechanical power steering
- Seats: Driver's seat
- 12V socket
- Pre-installation for Remote Services Plus
- Windshield washer fluid level warning light
- Immobiliser

Extra equipment

- Towing capacity 2500 kg
- Upgrading/Downgrading
- Increased ground clearance
- Tinted rear windows, black glass
- Entry grab handle for the cargo area sliding door
- Driving light assistant (automatically switching on driving lights)
- Front right window fixed in SW/ sliding door (in conjunction with thermal glazing)
- Grab handle for entry of driver and passenger
- Windscreen washer system heater
- semi-automatic air conditioning system controlled by TEMPMATIC
- Large fuel tank, approx. 70 liters
- Load anchoring rail system
- Center console with 1-DIN slot
- Halogen fog lights
- Package: Smoker's package
- Radio/Navigation: Multimedia DAB Digital Radio and Navigation System Audio 40 (7-inch LCD touchscreen - Apple CarPlay and Android Auto - Bluetooth 3.0 - Hands-free system - 2-way front speakers)
- Spare wheel with jack
- Seat: Lumbar support, passenger seat
- Seats: Passenger compartment armrest in conjunction with seat mounting (per row)
- Seats: Comfort passenger seat
- Seats: Seat mounting (for facing rear row seats)
- Seat heating on driver's side
- Doors: active locking mechanism for sliding doors
- Pre-installation for intelligent tachograph
- Towbar (fixed ball head)
- Electrically adjustable and heated exterior mirrors, left and right
- Overhead control unit Comfort in conjunction with air conditioning and driving light assistant
- Window front left fixed in SW/ sliding door (in conjunction with thermal glass)
- Fleet Comfort Package
- Wireless remote control for auxiliary heater
- Rear camera not foldable
- Terminal block for electrical connections on the driver's seat box
- Comfort locking system with IR remote control (comfort opening and closing)
- LED light strip in the cargo area
- Motor run-on circuit (MWS)
- Package: Park (front and rear parking aid, visual and acoustic warning, parking space detection, automatic steering - reversing camera)
- Rain sensor
- Tires: M+S 225/55 R 17
- Tire pressure monitoring
- Key: Multi-button radio remote control
- Seat: Lumbar support driver's seat
- Seats: Passenger compartment 1st row, 3-seater bench / Comfort (outer seat foldable)
- Seats: Comfort driver's seat
- Seat heating on passenger side
- Partition wall with 1 continuous window
- Lashing rails on side wall to parapet strap
- Auxiliary heating (hot water)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run could not be performed. This is due to the following reason.: Getriebeschaden
readiness to drive	The vehicle was not roadworthy at the time of inspection, but only capable of being towed.
Roadworthy/operationally safe	Due to the damage characteristic listed under accident or value-reducing factors, the vehicle was not roadworthy or safe to operate at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Interior	Interior (Ablage Mitte) - Differs from the original configuration - Un- / install
2	Seat - front	Seat cover - left side (Sitze) - Soiled - Clean
3	Sill - left side	Sill - Scratched - Smart repair
4	Door - front left side	Door - Scratch(es) - Smart repair
5	Sliding door, right	Sliding door - Scratch(es) - Smart repair
6	Body	Body - Glued / labelled - De-glue / neutralise
7	Seat belts - front	Seat belt - front left side (Gurtrollo ohne Funktion) - Non-operational - Replace
8	Wing mirror - left side	Mirror housing - Broken / torn - Replace
9	Bonnet	Bonnet - Deformed - Repair and paint
10	Side panel - rear left side	Side panel - Scratched - Repair and paint
11	Gearbox	Gearbox (siehe KV) - Non-operational - Replace

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 28 Feb 2025	4.014,97 €

Repainting

No.	Repainting
1	Mudguard - left side, Door - rear right side, Professionally carried out

Paint coat thickness measurement

Mudguard - left side	152 µm	Bonnet	110 µm
Door - rear right side	191 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

Figure 9: Interior 360° view (Online Link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

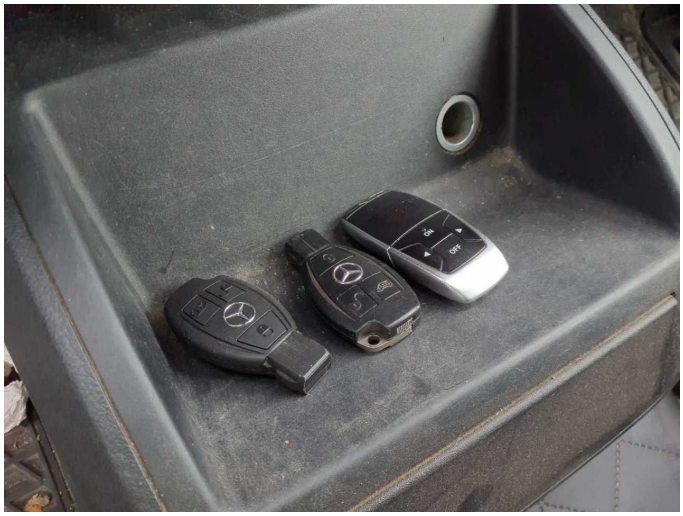


Figure 13: Documents

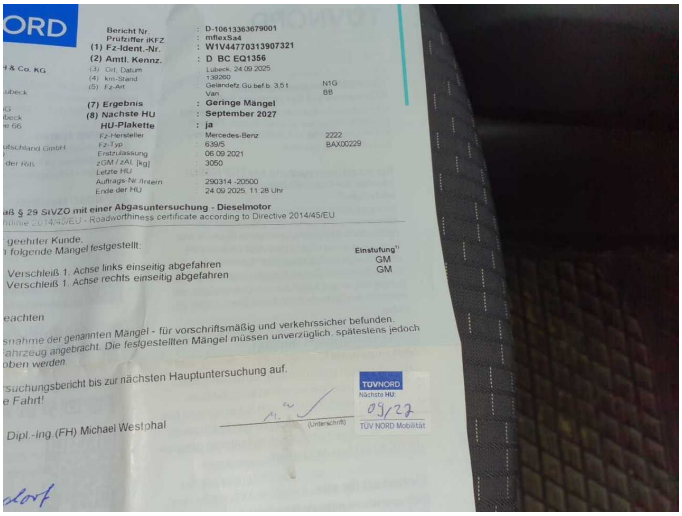


Figure 14: Documents



Figure 15: Documents

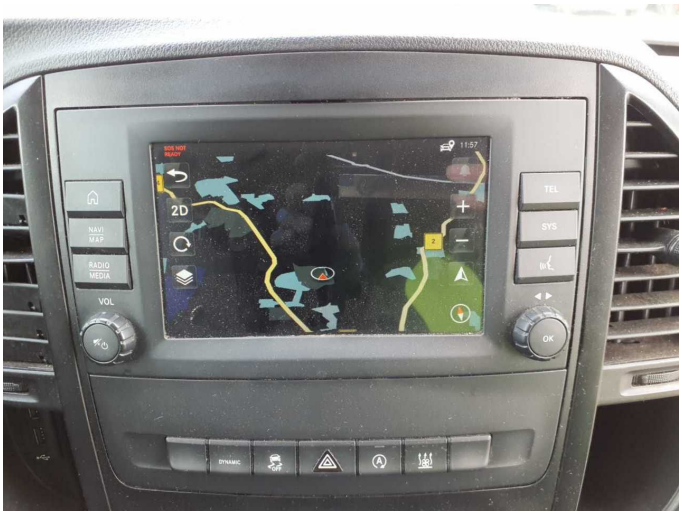


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

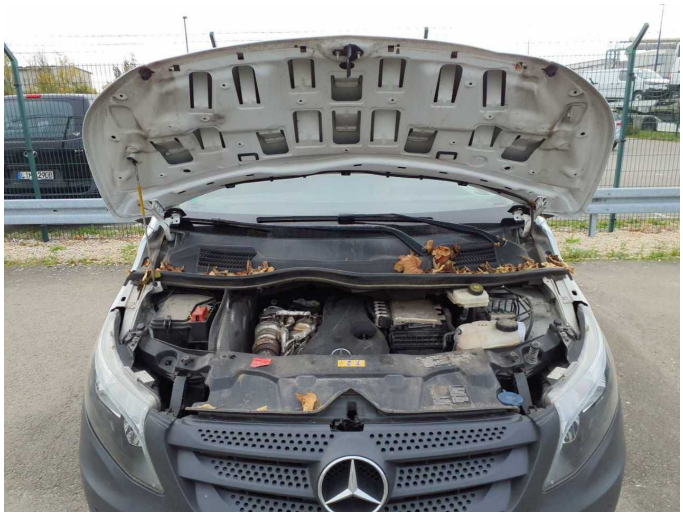


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

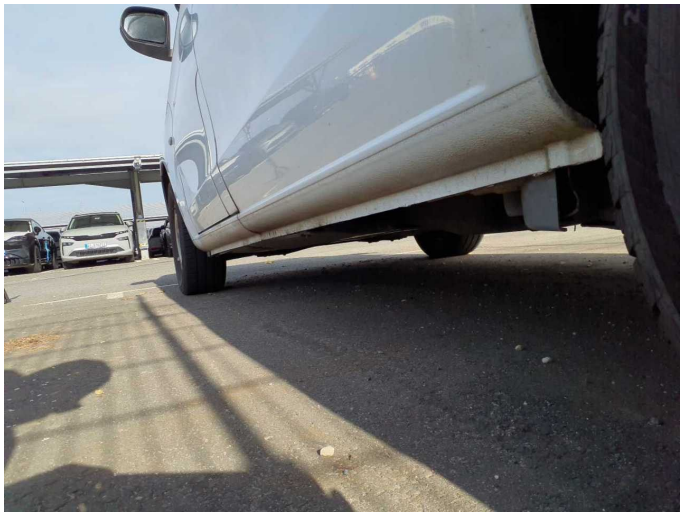


Figure 25: Misc.



Figure 26: Misc.

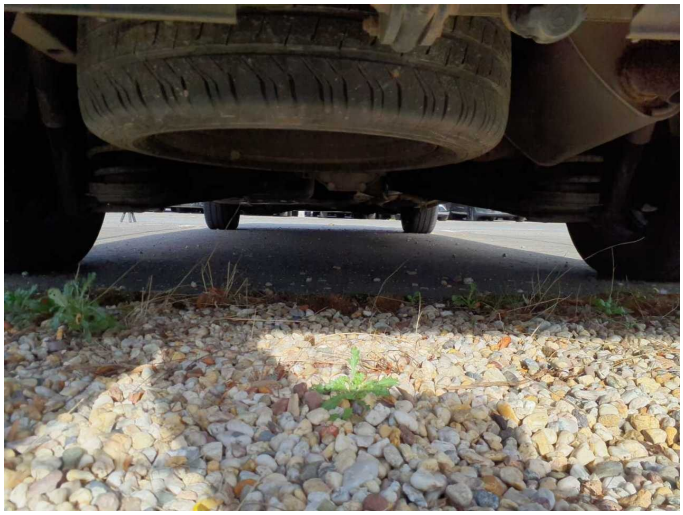


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



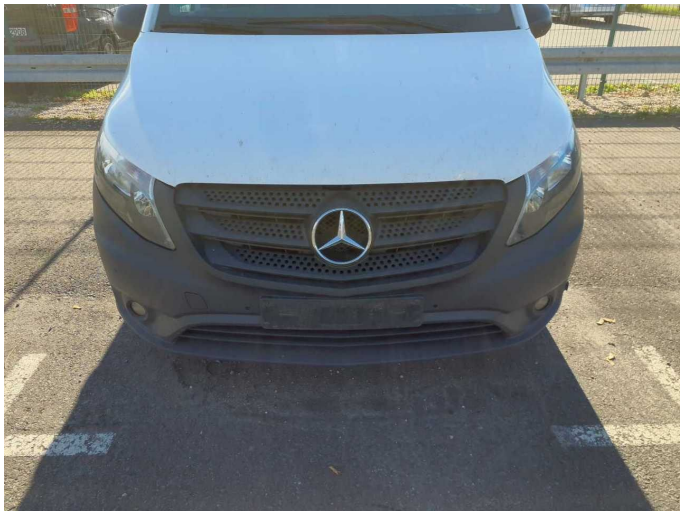


Figure 40: Misc.

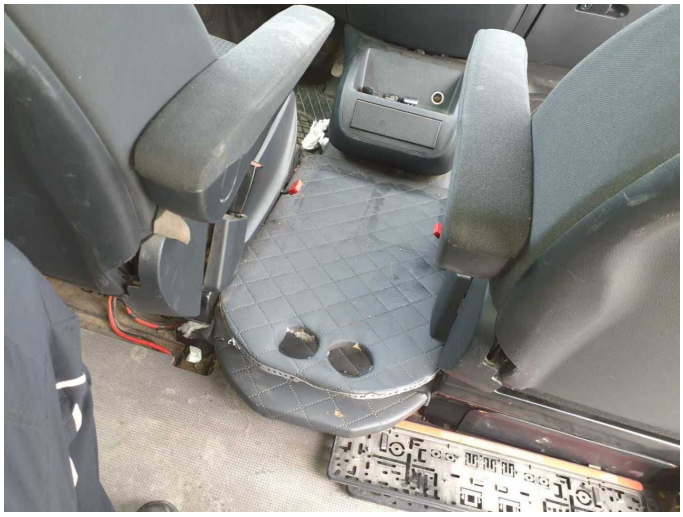


Damage 1: Interior: Interior (Ablage Mitte) - Differs from the original configuration - Un- / install

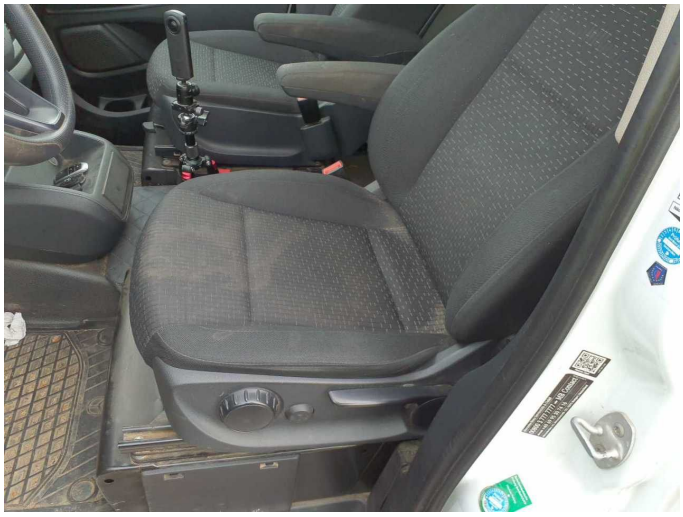


Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean

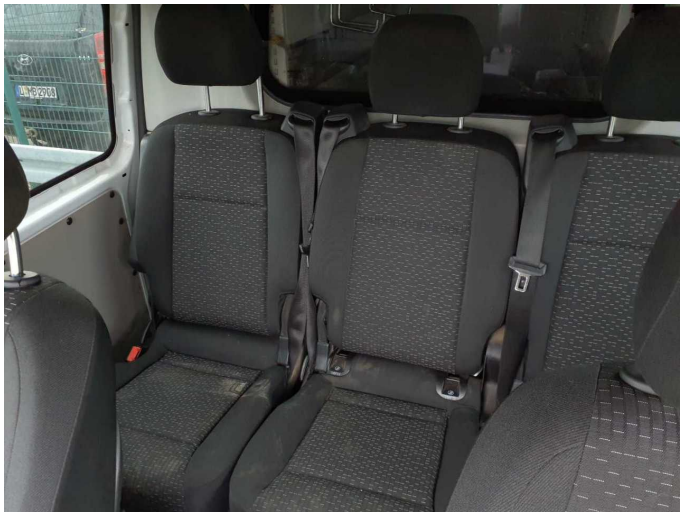

Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean

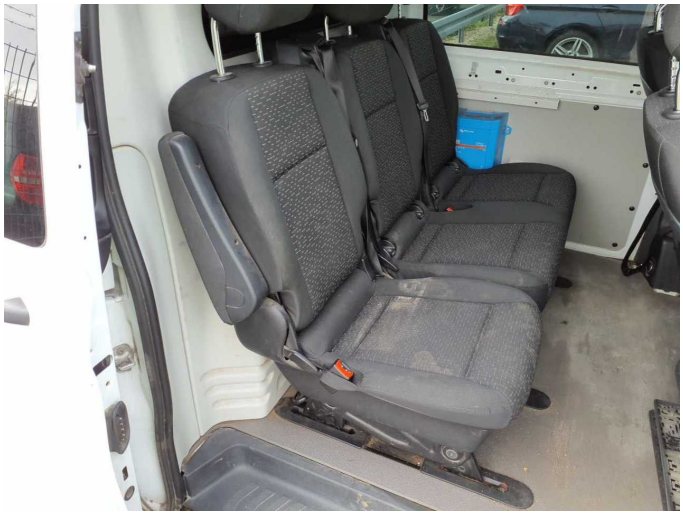


Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 3: Sill - left side: Sill - Scratched - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair

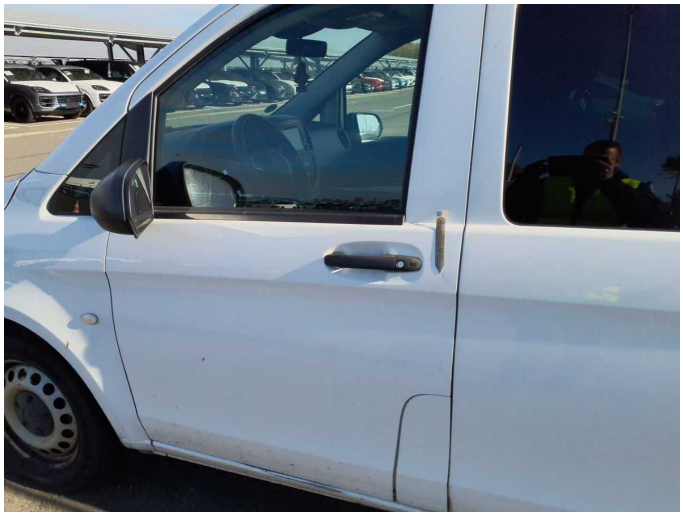

Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 5: Sliding door, right: Sliding door - Scratch(es) - Smart repair




Damage 5: Sliding door, right: Sliding door - Scratch(es) - Smart repair




Damage 6: Body: Body - Glued / labelled - De-glue / neutralise




Damage 6: Body: Body - Glued / labelled - De-glue / neutralise

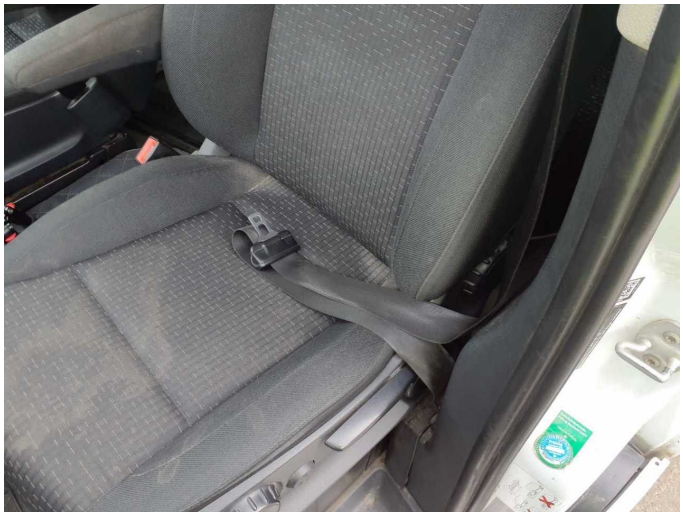

Damage 7: Seat belts - front: Seat belt - front left side (Gurtrollo ohne Funktion) - Non-operational - Replace

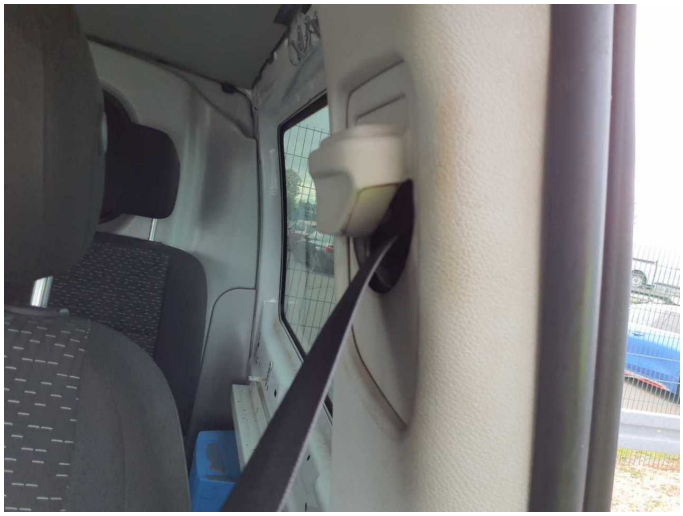

Damage 7: Seat belts - front: Seat belt - front left side (Gurtrollo ohne Funktion) - Non-operational - Replace

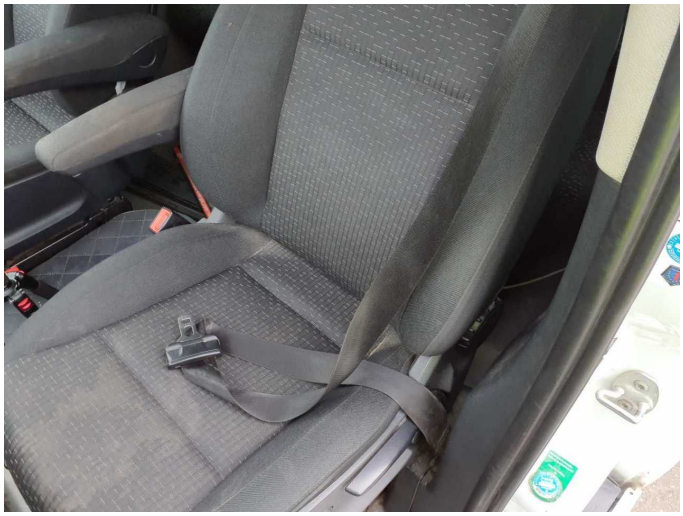


Damage 7: Seat belts - front: Seat belt - front left side (Gurtrollo ohne Funktion) - Non-operational - Replace



Damage 8: Wing mirror - left side: Mirror housing - Broken / torn - Replace



Damage 8: Wing mirror - left side: Mirror housing - Broken / torn - Replace

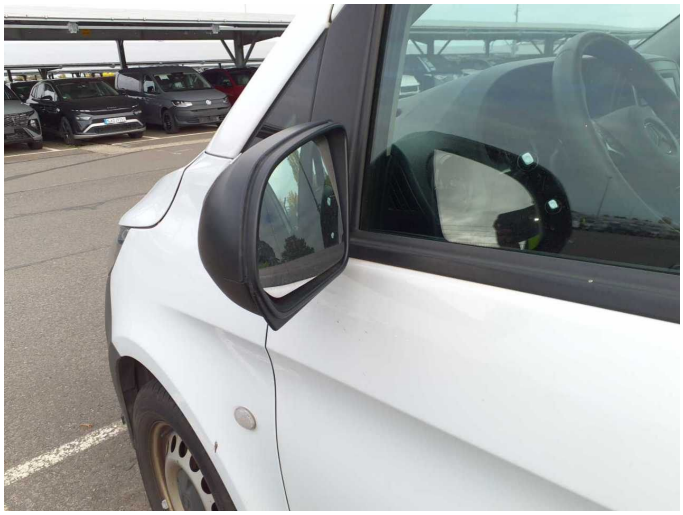

Damage 8: Wing mirror - left side: Mirror housing - Broken / torn - Replace




Damage 9: Bonnet: Bonnet - Deformed - Repair and paint



Damage 9: Bonnet: Bonnet - Deformed - Repair and paint



Damage 9: Bonnet: Bonnet - Deformed - Repair and paint

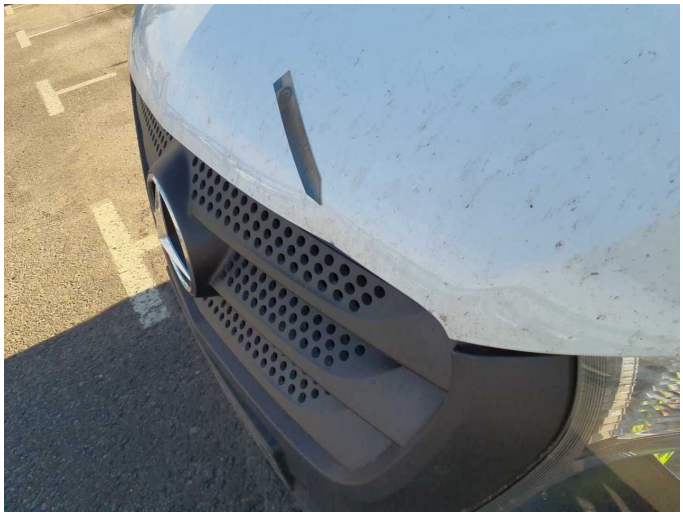

Damage 9: Bonnet: Bonnet - Deformed - Repair and paint



Damage 10: Side panel - rear left side: Side panel - Scratched - Repair and paint



Damage 10: Side panel - rear left side: Side panel - Scratched - Repair and paint




Damage 10: Side panel - rear left side: Side panel - Scratched - Repair and paint



Damage 11: Gearbox: Gearbox (siehe KV) - Non-operational - Replace



Damage 11: Gearbox: Gearbox (siehe KV) - Non-operational - Replace

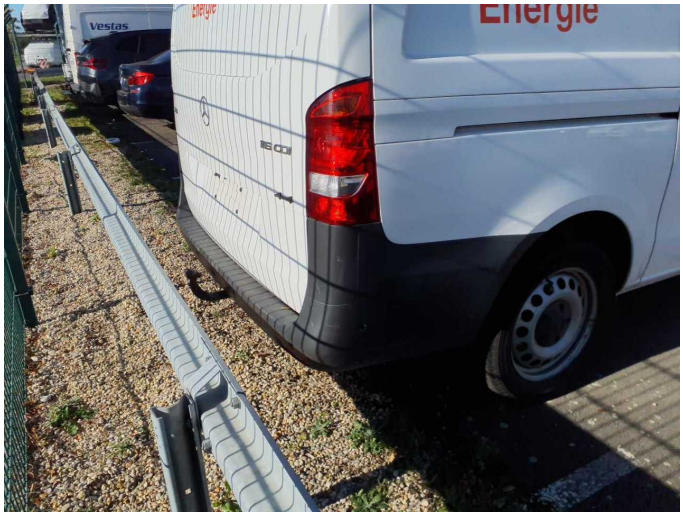

Wear and tear 1: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Wear and tear 1: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Wear and tear 1: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Mudguard - left side: 152 µm



Bonnet: 110 µm

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Inspection location
Mosolf SE & Co.KG
August-Horch-Straße 1
04519 Rackwitz



Door - rear right side: 191 µm