DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	VR3UPHNEK P5180671	Registration date	24/07/2024	Exterior Color	Inconnu
Brand	PEUGEOT	Licence Plate	HAM-FO 208	Odometer	33 338 km
Model	208 PureTech 100 Allure				

Inspection Details

Arrival Date	19/08/2026	Inspection ID	7121478	Inspection date	24/08/2026
Assign Date	19/08/2026	Fleet owner	Leasys Privat Leasing	Inspection loc.	Leasys SLC Essen

















Generic equipment

Removable element

Spare wheel kit	✓
Toolkit	✓
Rear parcel shelf	✓


Technical Document

User manual	✓
Warranty booklet	✓
Log books	✓
Spare key	✓
Key	✓
Remote key	✓
Service	✓

Tyres

Nexen 195/55/16 H All seasons 4.0 mm

Nexen 195/55/16 H All seasons 4.0 mm

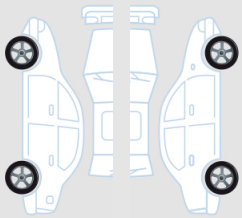

Nexen 195/55/16 H All seasons 6.0 mm

Nexen 195/55/16 H All seasons 6.0 mm

Exception / Damage

1



Part	Bumper	Repair Time	2.30	Part Cost	-
Position	Front	Repair Cost	322.00€	Gross Cost	682.00€
Damages	Scratched	Paint Time	2.40	Depreciation %	15.00%
Severity	-	Paint cost	360.00€	Depreciation	- 102.30
Repair mode	Repair	Flat Rate	-	**Net Cost**	**579.70€**

DEKRA

DEKRA Automotive Solutions

Appraisal Report

2

Part	Windscreen	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Stone impact	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

3



Part	Bonnet	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Stone impact	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

Motorhaube Nachlackiert

4



Part	Rear parcel shelf rail	Repair Time	0.10	Part Cost	0.39€
Position	Back right	Repair Cost	14.00€	Gross Cost	14.39€
Damages	Broken	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	- 2.16
Repair mode	Replace	Flat Rate	-	**Net Cost**	**12.23€**

5



Part	Monogramme de pare-chocs	Repair Time	0.20	Part Cost	53.55€
		Repair Cost	28.00€	Gross Cost	81.55€
Position	Front	Paint Time	-	Depreciation %	15.00%
Damages	Broken	Paint cost	-	Depreciation	- 12.23
Severity	-	Flat Rate	-	**Net Cost**	**69.32€**
Repair mode	Replace				

6



Part	Service 2	Repair Time	-	Part Cost	250.00€
Position	-	Repair Cost	-	Gross Cost	250.00€
Damages	Missing	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**250.00€**

7

Part	Paint preparation	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	150.00€
Damages	-	Paint Time	1.00	Depreciation %	15.00%
Severity	-	Paint cost	150.00€	Depreciation	- 22.50
Repair mode	Plastic paint	Flat Rate	-	**Net Cost**	**127.50€**

Comments

Motorhaube eventuell wegen Steinschläge Nachlackiert

Summary Inspection

Gross Price	1,177.94€	Depreciation	-139.19€	Net Price	1,038.75€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	140.00€	2.60	364.00€	15.00 %	-54.60€	309.40€
Paintwork	150.00€	2.40	360.00€	15.00 %	-54.00€	306.00€
Paint preparation	150.00€	1.00	150.00€	15.00 %	-22.50€	127.50€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	303.94€	2.66 %	-8.09€	295.85€
Flat Rate	-250.00€	-	-	-250.00€