TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Leerenstraße 25
29683 Bad Fallingbostel

Expertise

Protocol number: 48406584
Order No. / Reference: 27205215
Inspection date: 28 Oct 2026

Manufacturer: Ford	Model: Transit Connect 230 L2 LKW S&S Autm. Trend
VIN: WF07XXWPG7LY82375	





Vehicle details

Manufacturer / Type / Model / Equipment	
Ford Transit Connect 230 L2 LKW S&S Autm. Trend	
Vehicle Identification number	WF07XXWPG7LY82375
Mileage (Read)	172,993 km
First registration	4 Jan 2021
Number of holders	1
Next periodical technical inspection	03/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	88 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frost Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Leerenstraße 25
29683 Bad Fallingbostel

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	92 %
Last service on / at	10/2026 at 171,428 km		
Key is / should be	2 / 3	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FZ435140
Previous damage / Accident	Detectable	**Repainting**	Detectable
Inspection conditions	sufficient	**Lifting equipment / pit**	yes
Test drive	Not performed	**Engine function test**	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BMN 01683		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,445 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Goodyear	8mm / 8mm
2)	205/60 R16 96H	Winter tyres on Steel	unterschiedliche Hersteller	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, narrow mirror format
- Hill start assist
- Floor covering: Carpet (1st and 2nd row)
- On-board computer including outside temperature display
- Third brake light
- Fixed rear windows, right and left (at the height of the 3rd row of seats)
- Rear electric windows, right and left (at the height of the 2nd row of seats)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- Heated windscreen (including electrically adjustable and heated exterior mirrors)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Transmission: 8-speed automatic
- Heated rear windows
- Interior lighting in the passenger/cargo area with delay function
- Paint finish: Solid
- Center console, front (open with storage area)
- Wheels: Alloy wheels 6.5 J x 16 with 205/60 R16 tires (5x2-spoke design in Sparkle Silver look)
- Sliding door, right and left
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Automatic security door lock (45 sec.) (Automatic relocking if no door is opened within 45 seconds of unlocking via remote control)
- Front spoiler lip
- Start-stop system
- Dust and pollen filter
- Power outlet: 12-volt connection on the center console, front and rear
- Front bumper and rear bumper end caps painted in body color
- Child safety lock on sliding doors
- Lashing eyes
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front
- Driver's side airbag
- Battery, reinforced
- Floor covering: Front floor mats, carpet floor mats (2-piece set)
- Tachometer
- Electronic Stability Program (ESP) (with Traction Control (TCS) including Torque Vectoring Control and Adaptive Load Control)
- Front electric windows (with one-touch down function for driver's side)
- FordPass Connect (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - incl. live traffic information in real time (in conjunction with Ford navigation system incl. Ford SYNC 3) - incl. Wi-Fi hotspot)
- Rubberized luggage compartment floor mat
- Glove compartment with lid
- Rear window wiper/washer system
- Front interior lighting with delay function
- Isofix mounting (on the outer seats of the 2nd row)
- Steering column, adjustable in height and reach
- Emergency brake light (hazard warning flashing activated during heavy braking)
- Wheels: Tire repair kit
- Side protection strips, plastic
- Emergency Brake Assist (EBA)
- Front seat belts are height-adjustable (front seat belt tensioners and force limiters - warning system for unfastened driver's seat belt)
- Passenger compartment seats: 2nd row (bench seat, 60:40 split, foldable, can be lowered into the footwell - ISOFIX mounting on the outer seats)
- Concealed storage compartment on dashboard
- Power outlet: 12-volt connection in storage compartment on dashboard (driver's side)
- Daytime running light
- Partition wall: Grid partition wall (movable (to positions behind the 1st and 2nd rows))
- Electronic immobilizer (EPATS)
- Central locking with remote control (door lock only on driver's door - 2 keys, one of which is a remote control key)

Extra equipment

- Adaptive cruise control (with intelligent speed limiter - including radar- and camera-based pre-collision assist with pedestrian and cyclist detection, lane keeping assist including lane keeping assist and driver drowsiness detection - including traffic sign recognition system - leather multifunction steering wheel with 4 spokes in aluminum trim)
- Electrically folding exterior mirrors (including electric front and rear windows with quick-up/down function - mirrors fold in automatically when the vehicle is locked)
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, TMCpro live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- Remote control: 2nd remote control key for central locking (instead of conventional key)
- Advanced Active Park Assist
- Air conditioning with automatic temperature control (2 zones) (for driver and passenger side, separately adjustable)
- Crosswind Assist and Roll Stability Control (RSC)
- DPF regenerator, manual
- Fixed towbar (incl. ESP trailer stabilization and continuous power supply)
- Fog lights with static cornering lights
- Front and rear parking pilot system
- High beam assist (including windscreen wipers with rain sensor and automatically dimming interior mirror)
- Inductive charging station for mobile devices (according to Qi standard, compatibility depends on the device)
- Rear swing door with heated rear window
- Seats: Seat package 25
- Tire pressure monitoring system
- Windows: Side windows from the 2nd row of seats and rear window, dark tinted.

Retrofitted equipment

- 3. Key/ Rubber mats/ Covers

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Equipment	Vehicle key (Schlüsselbart fehlt) - Differs from the original configuration - Replace
3	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
4	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Seat - front	armrests - Worn - No deduction
2	Steering system	Steering wheel - Worn - No deduction
3	Roof	Roof - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key (3. Schlüssel)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 12 Nov 2025	1.370,64 €
2	Front, Side - left, Provided by user / customer, from 4 Jun 2021	1.427,44 €

Repainting

No.	Repainting
1	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	173 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

Figure 9: Interior 360° view (Online Link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

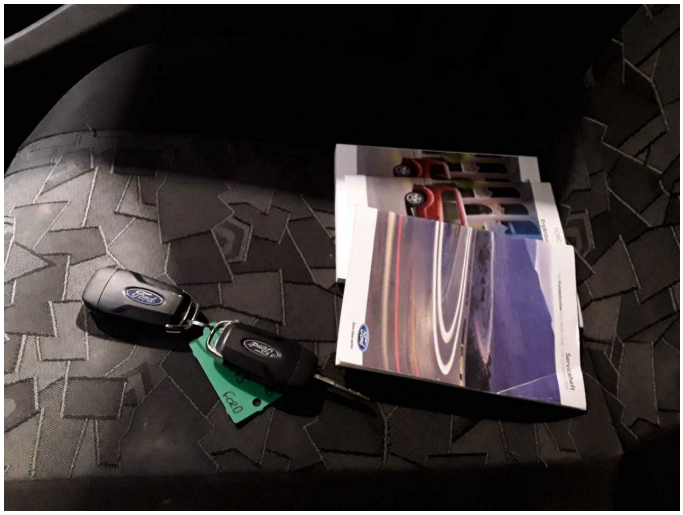


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

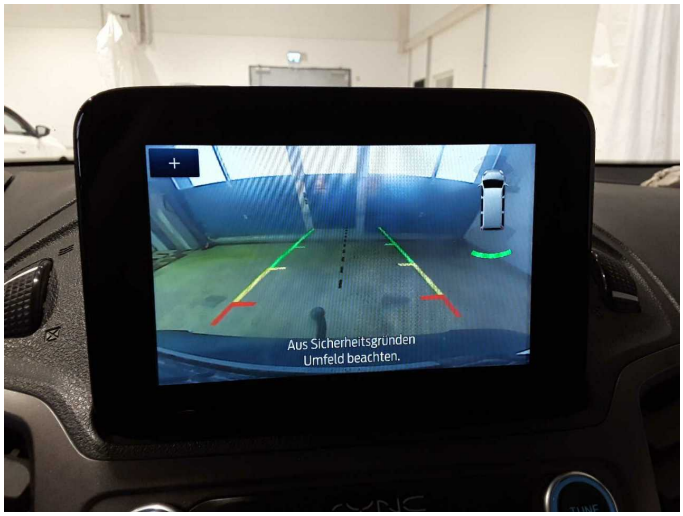


Figure 18: Misc.



Figure 19: Misc.

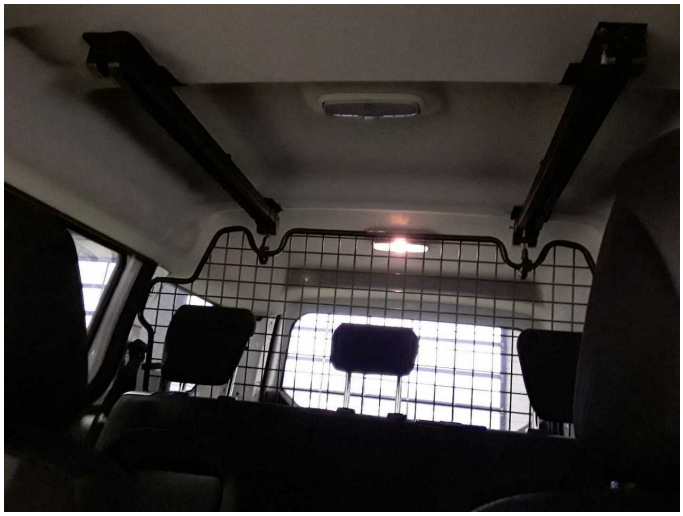


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Equipment: Vehicle key (Schlüsselbart fehlt) - Differs from the original configuration - Replace



Damage 3: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 3: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 3: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 3: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 4: Vehicle glazing: Windscreen - Broken / torn - Replace

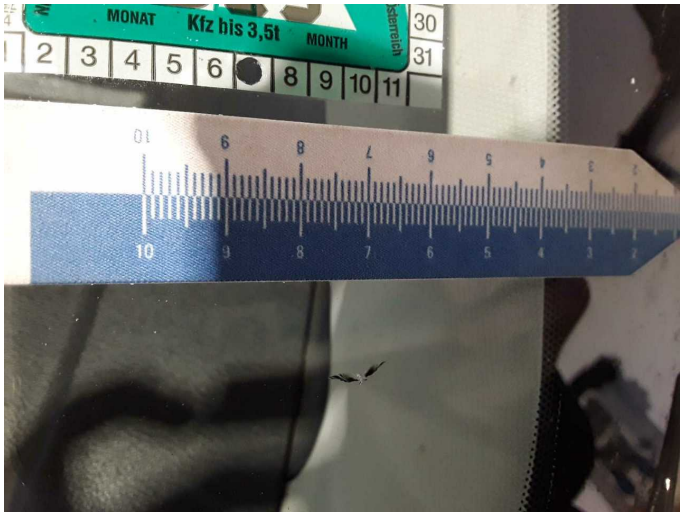

Damage 4: Vehicle glazing: Windscreen - Broken / torn - Replace



Repainting 1: Mudguard - left side

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Leerenstraße 25
29683 Bad Fallingbostel



Repainting 1: Mudguard - left side