

## INFORME DE INSPECCIÓN

**VEHÍCULO**

5849NHK / WBA11HC000FV95051 / FV95051

**Datos vehículo:**

Marca:	BMW	Combustible:	DIESEL
Modelo:	420I GRAN CO G26	Transmisión:	NO DETERMINADO
Versión:	420i Gran Co G26	Color:	NO DETERMINADA
Tapicería:	NO DETERMINADA	Kilómetros:	21.030

**Controles específicos:**

Llaves principales:	1	Llaves secundarias:	0
Llaves especiales:	0	Tipo transmisión:	Automática
Revisión:	Sin libro		

 CARPETA MANUALES

 DOCUMENTACION ORIGINAL

 MANUAL PROPIETARIO

 TUERCA ANTIRROBO

**Información neumáticos**

5849NHK   Neumático	Marca	Medidas	Índice carga	Índice velocidad	Runflat
DD	HANKOOK	245/45/18	100	Y	-
DI	HANKOOK	245/45/18	100	Y	-
RP					-
TD	HANKOOK	245/45/18	100	Y	-
TI	HANKOOK	245/45/18	100	Y	-

**Datos Inspección:**

Tipo Inspección:	COMERCIAL	Ubicación Inspección:	BAL CIEMPOZUELOS
Fecha Inspección:	02/06/2026	RaC:	SIXT RENT A CAR
Comentarios:			

**Daños no valorables:**

5849NHK   COMPONENTE	ACCIÓN		COMENTARIO						
5849NHK   COMPONENTE	TIPO DAÑO	ACCIÓN	CARROC.	MONTAJE	PINTURA	MAT. PINTURA	RECAMBIO	%DTO	IMPORTE
1. Jgo pegado sensor lluvia	-	REEMPLAZAR				0,00	29,44	10,00	26,49 €
2. Luna parabrisas	-	REEMPLAZAR	2.34 h.	0.08 h.		0,00	464,79	40,00	372,04 €
3. Jgo pegado lunas - PEGADO FRIO 300ML - Nueva	-	REEMPLAZAR				0,00	61,68	10,00	55,51 €
4. Juego fijación luna parabrisas	-	REEMPLAZAR				0,00	25,22	10,00	22,69 €
5. Moldura sup luna parabrisas	-	REEMPLAZAR				0,00	32,19	10,00	28,97 €
6. Guarnecido faldón tr	-	REEMPLAZAR				0,00	77,99	10,00	70,19 €
7. Neumático tr iz - GOODYEAR UG PERFORMANCE + - Nueva	-	REEMPLAZAR	0.46 h.			0,00	208,33	10,00	205,20 €
8. Neumático tr dr - GOODYEAR UG PERFORMANCE + - Nueva	-	REEMPLAZAR	0.46 h.			0,00	208,33	10,00	205,20 €
9. Embellecedor iz paragolpes dl	-	DESMONTAR Y MONTAR		0.17 h.		0,00	0,00		6,54 €
10. Embellecedor dr paragolpes dl	-	DESMONTAR Y MONTAR		0.17 h.		0,00	0,00		6,54 €
11. Embellecedor rejilla iz paragolpes dl	-	DESMONTAR Y MONTAR		1.25 h.		0,00	0,00		48,12 €
12. Paragolpes tr (zona sup)	Pintar Reparado Combinada no	DESMONTAR Y MONTAR	0.20 h.	0.58 h.	1.83 h.	7,75	0,00		108,23 €
13. Paragolpes tr (zona inf)	Pintar Reparado Combinada no	DESMONTAR Y MONTAR	0.30 h.	0.50 h.	1.83 h.	7,75	0,00		109,00 €
14. Retrovisor iz	-	DESMONTAR Y MONTAR		0.17 h.		0,00	0,00		6,54 €
15. Moldura estribo dr	Pintar Reparado Pieza desmontada	DESMONTAR Y MONTAR		0.75 h.	1.67 h.	7,07	0,00		100,24 €
16. Puerta dl iz	Pintar Reparado Pieza montada	REPARAR	0.20 h.		2.17 h.	9,19	0,00		100,43 €
17. Manilla exterior puerta dl iz	-	DESMONTAR Y MONTAR		1.50 h.		0,00	0,00		57,75 €
18. Carcasa retrovisor iz	Pintar Sustitución Combinada no	-			0.17 h.	0,72	0,00		7,26 €
19. Capó dl	Pintar Reparado Pieza montada	-			5.58 h.	23,63	0,00		238,46 €
20. Paragolpes dl	Pintar Reparado Combinada no	-			1.67 h.	7,07	0,00		71,36 €
21. Faro iz	-	PULIDO POLICARBONATO				0,00	0,00		50,00 €
22. Emblema paragolpes dl	-	Recuperación Emblemas	0.10 h.			0,00	0,00		3,85 €
23. Embellecedor iz paragolpes dl	-	Pintura plásticos pequeños				0,00	0,00		19,25 €
24. Faro dr	-	PULIDO POLICARBONATO				0,00	0,00		50,00 €
25. Embellecedor rejilla iz paragolpes dl	-	Pintura plásticos pequeños				0,00	0,00		19,25 €
26. Embellecedor dr paragolpes dl	-	Pintura plásticos pequeños				0,00	0,00		19,25 €

5849NHK   COMPONENTE	TIPO DAÑO	ACCIÓN	CARROC.	MONTAJE	PINTURA	MAT. PINTURA	RECAMBIO	%DTO	IMPORTE
27. Llanta rueda dl dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
28. Llanta rueda tr dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
29. Puerta dl dr	-	SR Pintura				0,00	0,00		40,00 €
<b>TOTAL INSPECCIÓN</b>								(IVA no incluido)	<b>2348,36 €</b>

\* Faltantes en color naranja

(IVA no incluido)

5849NHK   RESUMEN PERITACIÓN	TIEMPO	EUROS
Total Mano de Obra Carrocero	9,23 h.	355,33 €
Total material pintura	-	63,18 €
Total Mano de Obra Pintura	14,92 h.	574,39 €
Total Recambios	-	857,74 €
Descuento recambios aplicado	-	250,23 €
Total Faltantes	-	0,00 €
Total Smart Repair	-	497,75 €















Values since Individual

1.1 l/h



Total 21030 km → 9481.4 km



Door open.


320 km 9:24

10



P

+24.5 °C





Instrument cluster display showing speedometer (0-250 km/h), tachometer, and various vehicle status indicators. The text 'Value since inhibited' is visible.

Infotainment screen displaying 'PARKING AND MANOEUVRING' menu. The screen shows a 360-degree camera view of the car and surrounding environment. The temperature is 16.5°C and the gear is in 'LOW'.

Horizontal LED light strip with a red glow, located below the infotainment screen.

Center console controls including the gear selector, handbrake, and a rotary controller. The gear selector has 'SPORT', 'COMFORT', 'ECONOMY', and 'AUTO' modes. The rotary controller is labeled 'MODE' and 'OFF ROAD'.









BMW

TwinPower Turbo



BMW  
BMW Group  
BMW Group of North America, LLC  
BMW of North America, LLC  
BMW Group of North America, LLC

Ⓢ WBA11HC000FV95051 Ⓢ











← Door open.

10

0 km/h



OUTSIDE

inch/mm  
4.58  
OFF ON ZERO





39.5

OFF ON ZERO

PSI




4.44  
mm  
OFF ON







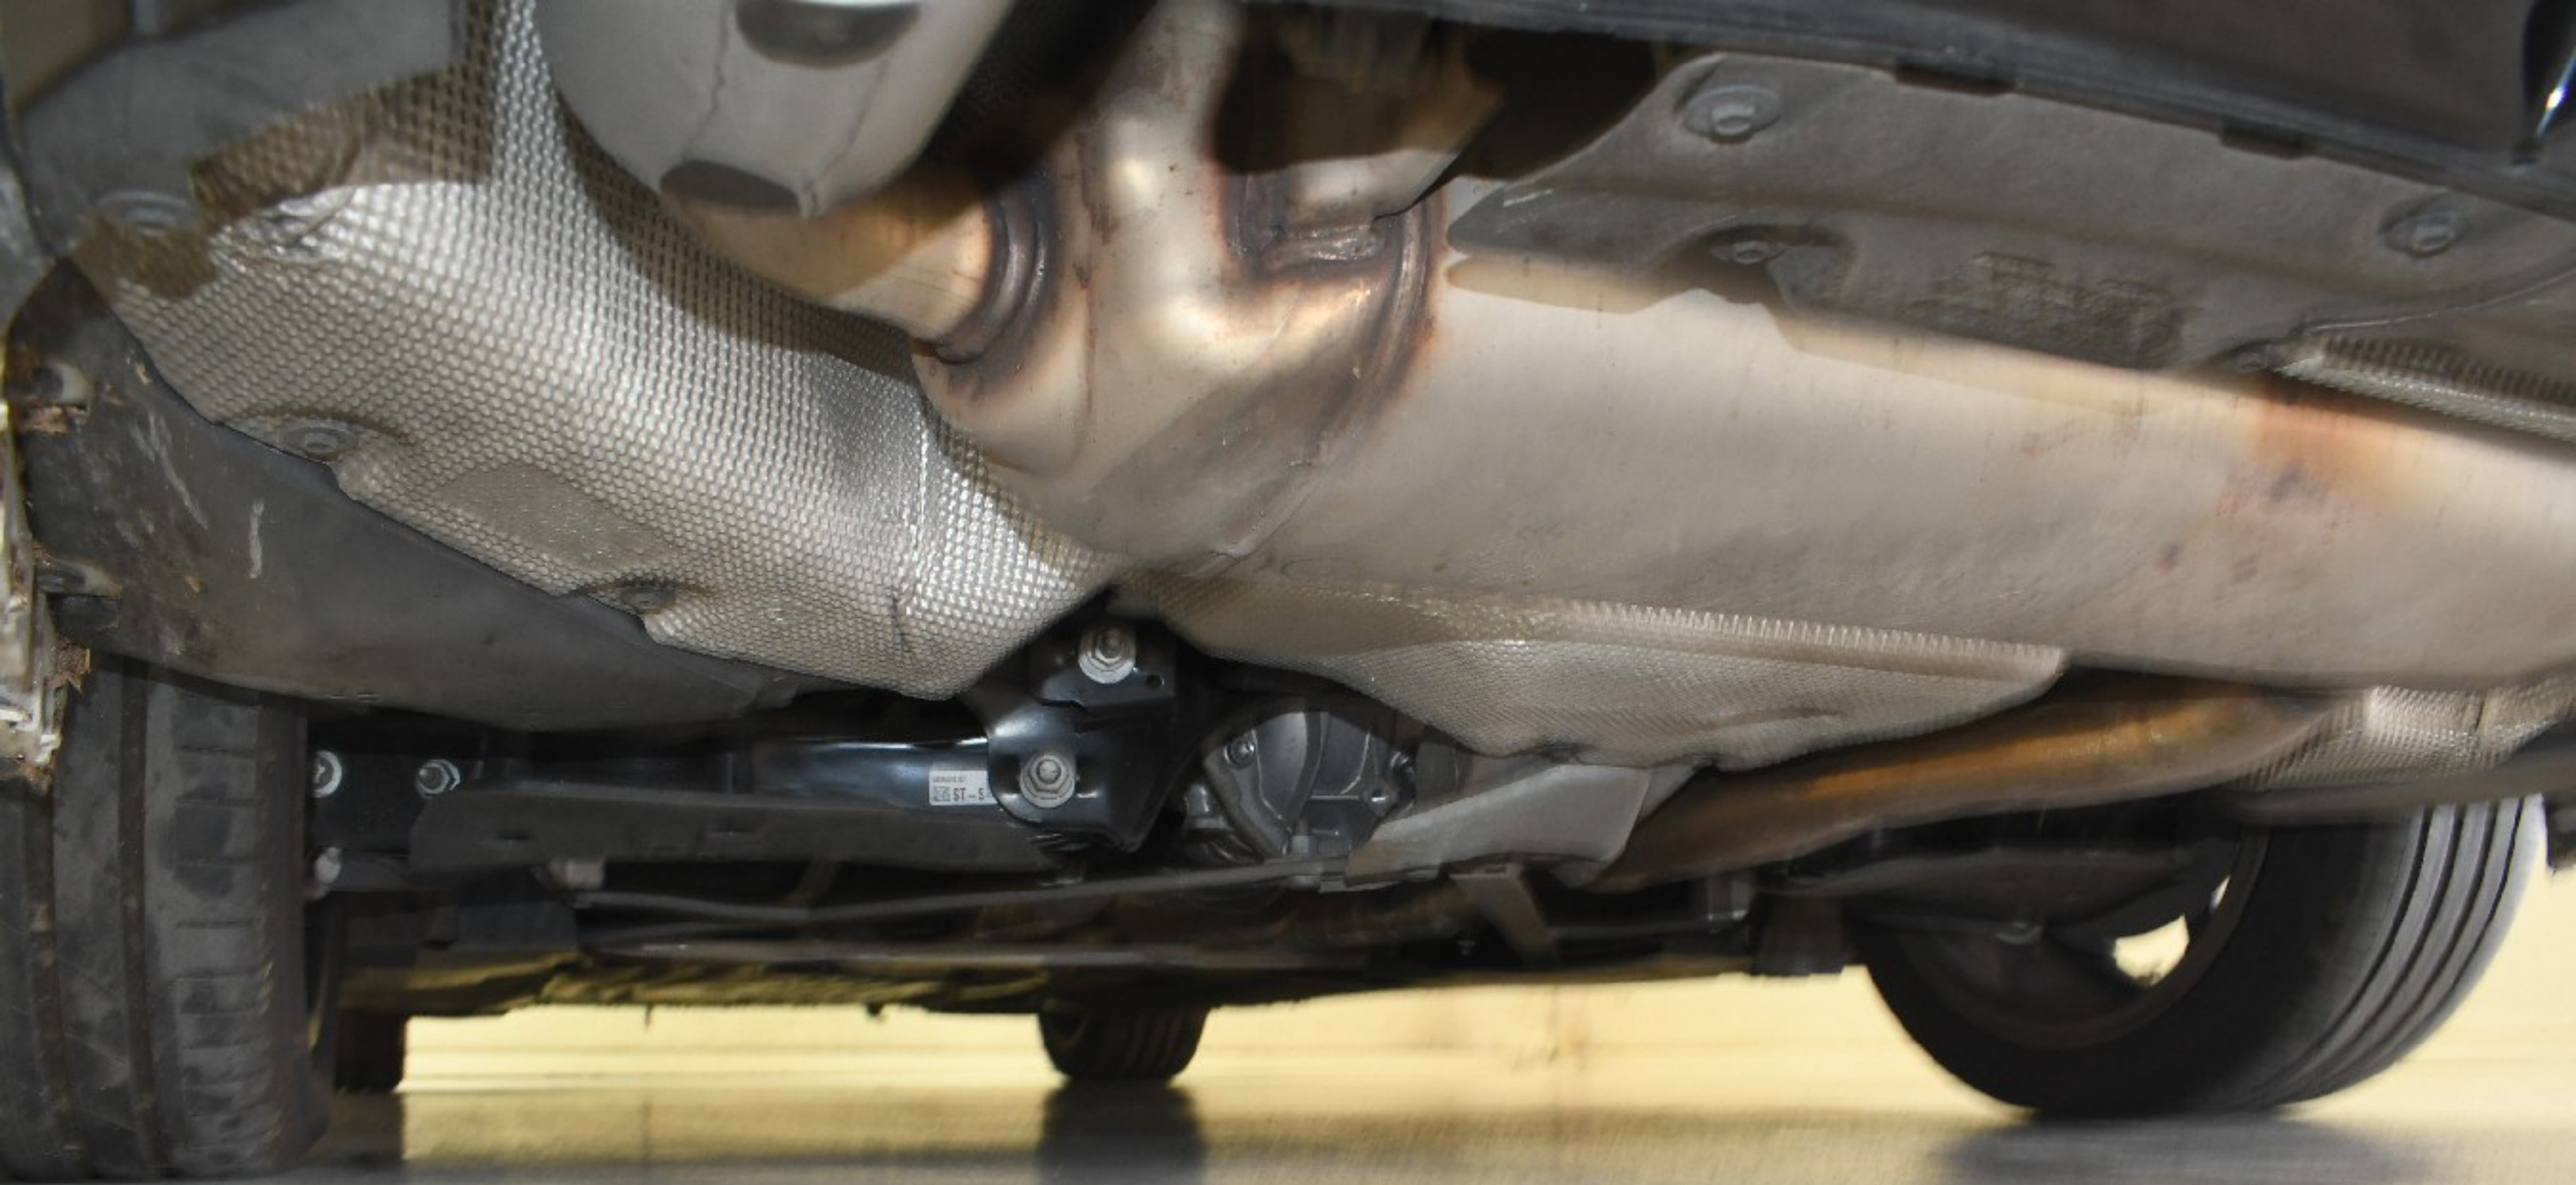

















10  
9  
8  
7  
6  
5  
4  
3  
2

 **Manheim**  
COX AUTOMOTIVE



0 1 2 3 4 5 6 7 8 9 10  
Manheim  
COL. AUTOMOTIVE







Manheim  
COX AUTOMOTIVE



Manheim  
Auction  
All Seasons





P18  
PLIESTREAD 2STEEL + 2RAYON + 1POLYAMIDE  
SIDEWALL 3RAYON

DOT  
12XEEF 2B H0  
25225

0 1 2 3 4 5 6 7 8 9 10  
0 1 2 3 4 5 6 7 8 9 10  
Manheim  
COX AUTOMOTIVE



Manheim

















Manheim  
CO-OPERATIVE







Manheim  
COLLEGE



0 cm 1 2 3 4 5 6 7 8 9 10  
Manheim  
COX AUTOMOTIVE

YU-G  
LIMITED EDITION  
DOTS&3 AS1 M64R  
43 R-001853  
TIS 2602-2556



HUD



0 CM 1 2 3 4 5 6 7 8 9 10  
Manheim  
COV. ALTERNATIVE

