



Expertise

Protocol number: 46405005
Order No. / Reference: 26690452
Inspection date: 8 Jul 2026

Manufacturer: Audi

Model: A1 35 TFSI Sportback S tronic

VIN: WAUZZZGB0SR014971



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A1 35 TFSI Sportback S tronic	
Vehicle Identification number	WAUZZZGB0SR014971
Mileage (Read)	17,377 km
First registration	19 Feb 2025
Number of holders	1
Power / Engine displacement	110 kw / 1,498 ccm
Fuel type / Cylinder	Petrol / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Cortinaweiss
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	12,700 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HG180160
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BNP 00453		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	1,705 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91V	Summer tyres on Light alloy	Goodyear	7mm / 7mm
2)	195/55 R16 91V	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/45 R17 91W	Winter tyres on Light alloy	Hankook	5mm / 5mm
2)	215/45 R17 91W	Winter tyres on Light alloy	Hankook	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Distraction and fatigue detection
- Airbag: Front side airbags and head airbag system
- Audi connect navigation & infotainment plus
- Audi pre sense front
- Exterior mirror housing black
- On-board computer
- Roof: Roof dome in vehicle color
- Roof edge spoiler
- Digital instrument cluster - fully digital instrument cluster in 10.25 inches
- Electronic Stability Control (ESC) with brake assist
- Electric windows front and rear
- front and rear floor mats
- Transmission: S tronic 7-speed
- Heated rear window
- i-Size child seat attachments on the front passenger side and the outer rear seats
- Paint finish: Solid
- Light/rain sensor
- Otto particulate filter
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus
- Radio accessories: USB interface with charging function
- Electromechanical power steering
- Seats: Driver's seat manually height-adjustable
- Seats: Rear seat backrest foldable
- Start-stop system with recuperation
- Glazing: Heat-insulating glazing, windshield
- Airbag for driver and front passenger
- Accent areas in glossy black
- Audi connect Emergency Call & Service
- Electrically adjustable exterior mirrors
- Hill start assist
- third brake light
- Headliner in titanium grey fabric
- Decorative inlays, polygon structure, black
- Tachometer
- Rear parking sensors
- Chassis: Standard chassis
- Remote key (without Safe-Lock)
- Speed limiter
- Seat belts: Three-point automatic seat belts
- rear window wiper
- air conditioning, manual
- Headrests (5)
- Steering wheel: 3-spoke design steering wheel with multifunction controls
- Wheel: Alloy wheels - 16 inch - 10-spoke
- Wheel: Tire repair kit
- Radio: Preparation for MMI Navigation plus
- Headlight
- Seat covers in Delta fabric
- Seats: Standard front seats
- Lane Departure Warning
- Glazing: Thermal insulation glazing
- Electronic immobilizer

Extra equipment

- Accentuation surfaces in diamond lacquer silver grey (in the insert of the air vents and the center console as well as in the handle recess of the interior door handle)
- Parking aid plus (supports the driver with acoustic signals and a display in the MMI when parking and maneuvering. The parking aid is activated by engaging reverse gear or via a button in the center console, or automatically when the distance to a detected object is less than 90 cm. Automatic activation can be switched on and off.)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction controls (height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 6 multifunction buttons. Includes a leather gearshift/selector lever knob and a leatherette handbrake grip).
- Seat covers in Debut fabric (seat center panel in Debut fabric black - seat side bolsters in solid black fabric - contrast stitching in steel grey - door panel inserts in black - comfort center armrest (if ordered) in solid black fabric)
- Audi connect Remote & Control
- Decorative inlays, polygon structure, fine lacquer, slate grey (in the dashboard)
- Camera-based traffic sign recognition
- 2-zone automatic climate control (electronically regulates air temperature, volume and distribution - separate temperature distribution for driver and passenger side - dust and odor-removing cabin air filter, which ensures a lower burden of dust particles, odors and allergens in the vehicle interior - separate defroster button for faster defrosting of the front and side windows)
- Wheel: Audi new car tire warranty
- Wheel: On-board tools and jack (in the luggage compartment)
- Wheel: Alloy wheels - 17 inch - 5-spoke star with winter tires (7.5 J x 17, winter tires 215/45 R 17 not suitable for snow chains, maximum permissible speed 240 km/h)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Engine	Engine cover - Damage caused by marten / rodent - Replace
2	Interior	Rear shelf - Broken / torn - Replace
3	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
4	Rear bumper	Rear bumper - Scratch(es) - Paint

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 9 Jul 2025	1.500,86 €

Repainting

No.	Repainting
1	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	243 µm
-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

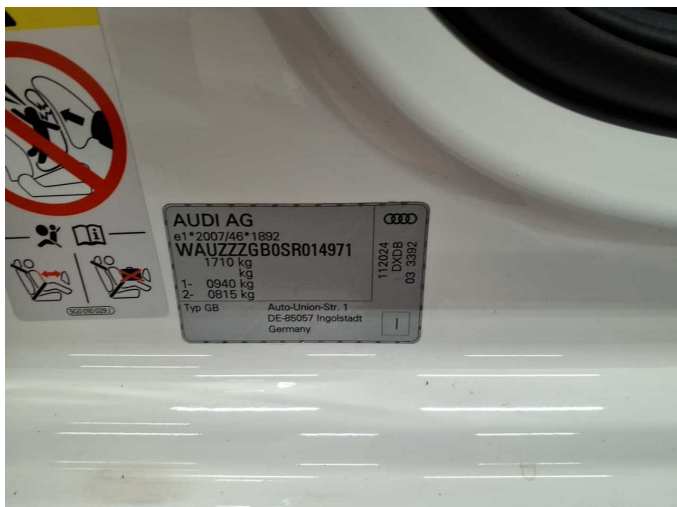


Figure 11: VIN



Figure 12: Mounted tyres

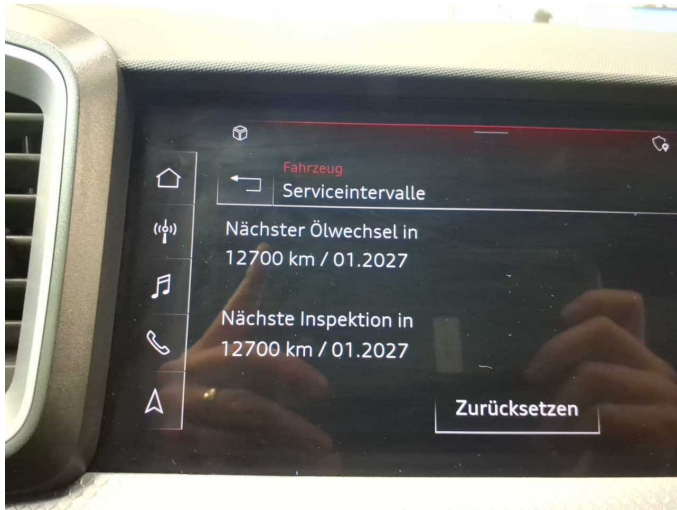


Figure 13: Documents

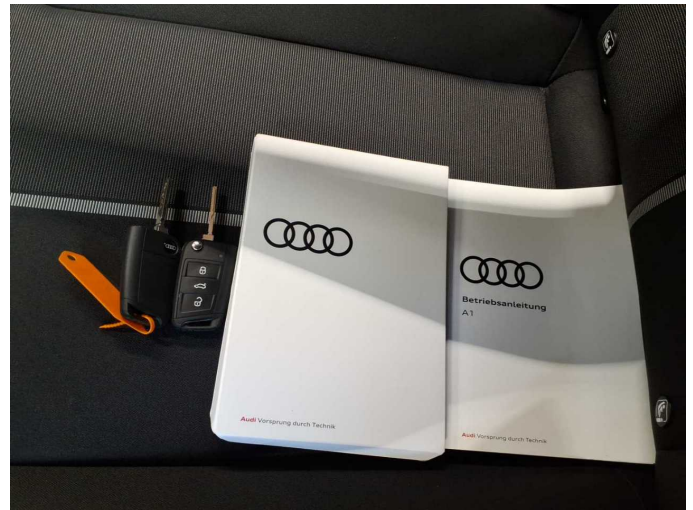


Figure 14: Documents



Figure 15: Additional tyres

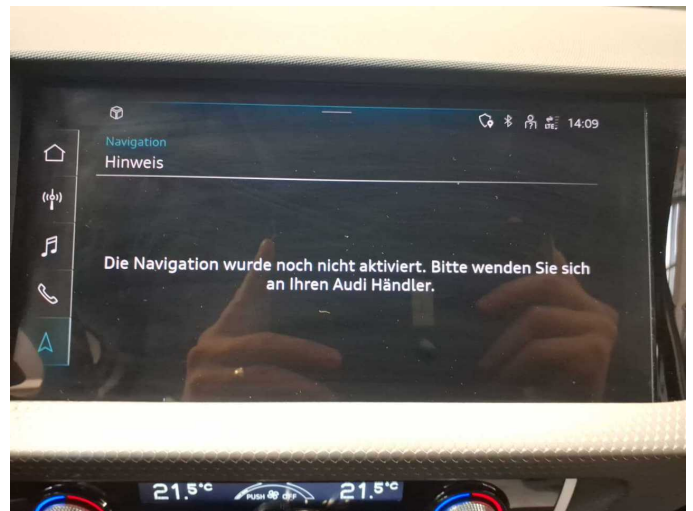


Figure 16: Navigation



Figure 17: Misc.

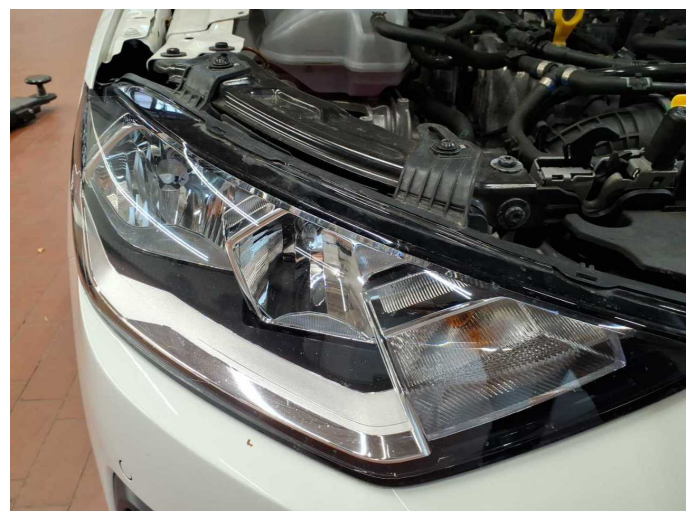


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

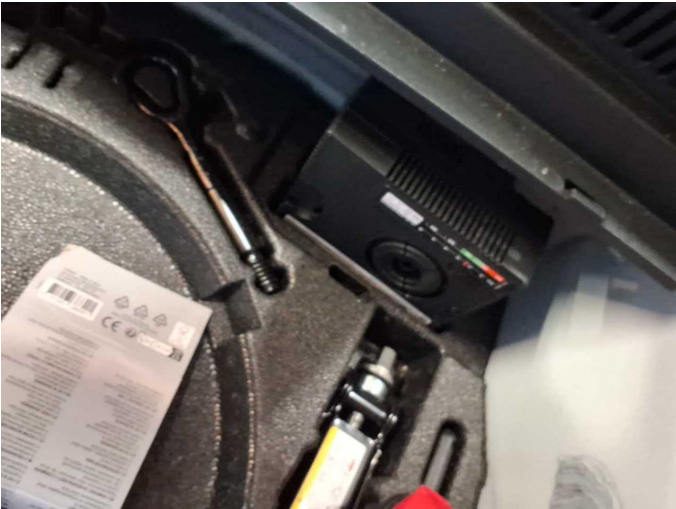


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Damage 1: Engine: Engine cover - Damage caused by marten / rodent - Replace

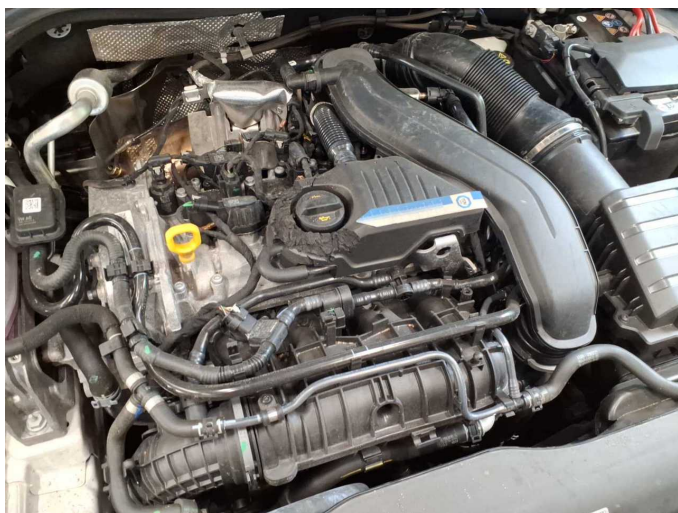

Damage 1: Engine: Engine cover - Damage caused by marten / rodent - Replace



Damage 2: Interior: Rear shelf - Broken / torn - Replace



Damage 2: Interior: Rear shelf - Broken / torn - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Repainting 1: Mudguard - right side