



Expertise

Protocol number: 46162936
Order No. / Reference: 26479760
Inspection date: 25 Jun 2026

Manufacturer: Skoda
VIN: TMBLJ7NU2M5049515

Model: Karoq 2.0 TDI SCR 4x4 DSG Clever



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Karoq 2.0 TDI SCR 4x4 DSG Clever	
Vehicle Identification number	TMBLJ7NU2M5049515
Mileage (Read)	129,996 km
First registration	19 May 2021
Number of holders	2
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Quarz-Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,600 km
Last service on / at	02/2026 at 126,152 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD041156
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ASQ 01749		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,116 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 95H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	215/60 R16 95H	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment on the left wheel arch
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Extended warranty for 3 years, max. 50,000 km
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist
- Cargo elements in the trunk
- Clever decorative inlay
- Diesel particulate filter
- Third brake light
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (start/stop system and brake energy recuperation)
- Aero rear window wiper including windshield washer system
- Kessy - keyless entry and start-stop system
- Climatronic air conditioning (2-zone)
- Trunk cover, fixed
- LED headlights with LED daytime running lights
- Steering wheel: Leather steering wheel with multifunction buttons
- Front center armrest, including storage compartment
- Multifunction display with Maxi-Dot display
- Package: LED lighting package
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink (Apple CarPlay)
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Electromechanical power steering
- Seats: Heated front and outer rear seats
- Seats: Front seats, height adjustable
- Speed limiter
- Bumpers partially painted in body color
- Front and rear door sill trims
- Immobiliser
- Storage compartment on the dashboard (closed)
- Storage compartments
- Removable waste bin for the door panel
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Permanent all-wheel drive
- Anti-lock braking system (ABS)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, silver
- Anti-theft alarm system
- Tachometer
- EASY START, keyless start-stop system
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Floor mats
- Cruise control
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- Automatic interior mirror dimming
- ISOFIX preparation on the outer rear seats
- Electric child safety lock (door opening)
- Reversible boot mat
- Front and rear headrests are height-adjustable.
- LED taillights in crystal glass look
- Rear center armrest with cup holders and pass-through option
- MSR (Motor drag torque control)
- Network program in the trunk
- Rear parking sensors
- Radio accessories: 8 speakers
- Radio accessories: USB port in the center console
- Tire Mobility Kit
- Wheels: 17" alloy wheels "Aronia AERO Platinum" (4X4)
- Heated windshield washer nozzles, front
- Karoq seat belts
- Seats: Adjustable lumbar support in the front seats
- Skoda Care Connect
- 12V socket - in the center console and in the trunk
- SUNSET
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- Option to opt out of standard extended warranty
- Traveller Plus (DSG) assistance system (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist, Blind Spot Detection and Parking Assist, Exit Warning - Adaptive Lane Guidance - Traffic Sign Recognition - Park Assist - Traffic Jam and Emergency Assist)
- Heated steering wheel (DSG)
- Rear view camera
- Engine underbody protection
- Winter wheel set, 16 inch
- Swiveling trailer hitch with electric release (including trailer stabilization)
- Digital instrument cluster (Virtual Cockpit)
- Electric tailgate operation
- High beam assist
- Paint finish: Metallic
- Package: Business Amundsen (Clever) (Amundsen dynamic radio navigation system - Color multifunction display in the instrument cluster - Driver fatigue detection - Luggage net partition - Infotainment Online (3-year term))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Front bumper	Front bumper - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction
4	Sill - left side	Sill - Scratch(es) - No deduction
5	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 18 Mar 2024	2.975,18 €
2	Front, Provided by user / customer, from 2 Jun 2023	11.480,19 €

Accident damages

No.	Accident
1	Front, Side - left



Repainting

No. Repainting

- 1 Mudguard - left side
- 2 Door - front left side
- 3 Door - front right side

Paint coat thickness measurement

Mudguard - left side	161 µm	Door - front left side	202 µm
Door - front right side	172 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Comments

- Fahrzeugmodellbezeichnung laut Rechnung: "Skoda Karoq 2.0 TDI SCR 4x4 DSG Clever".
- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

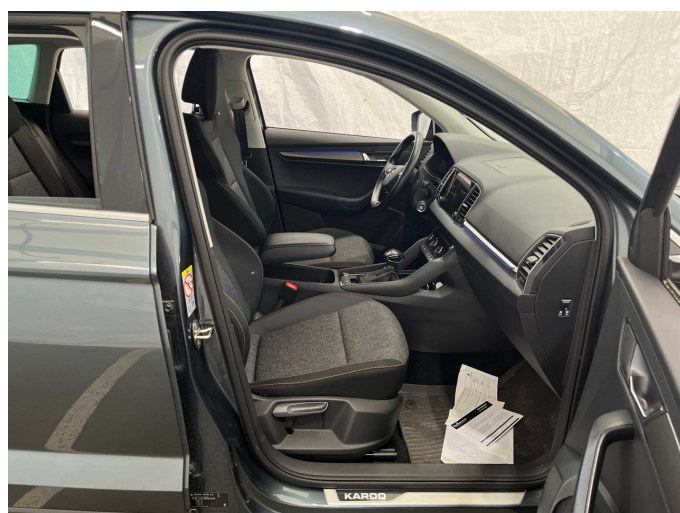


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

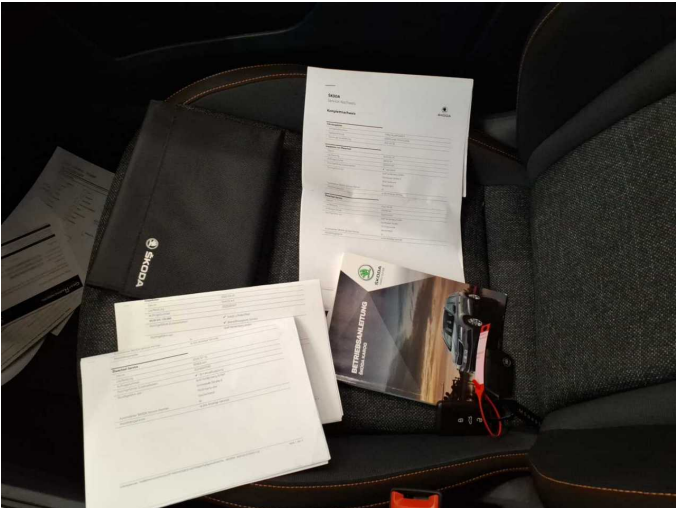


Figure 13: Documents

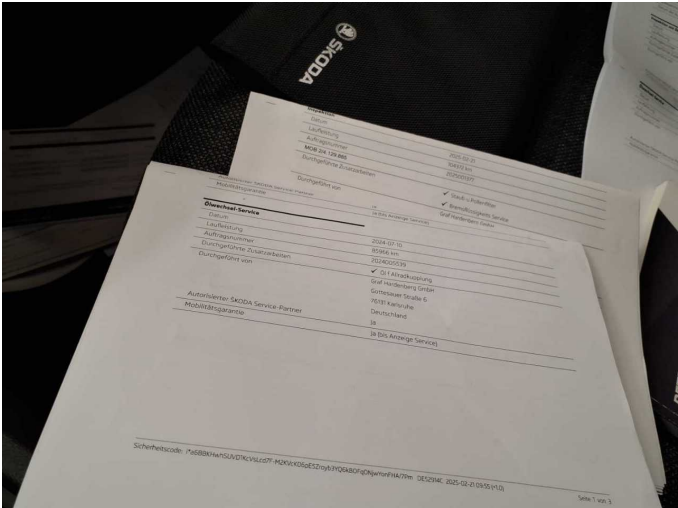


Figure 14: Documents

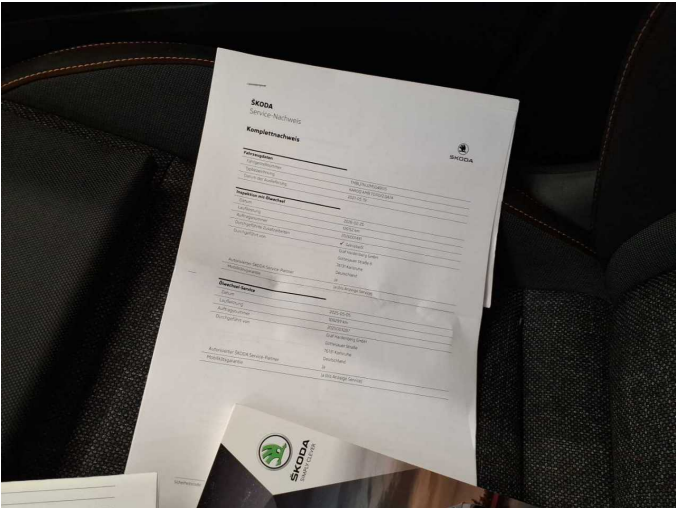


Figure 15: Documents



Figure 16: Documents

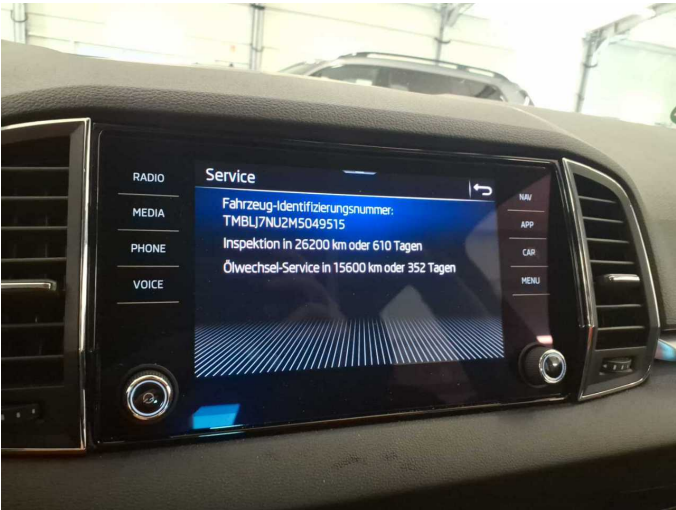


Figure 17: Documents

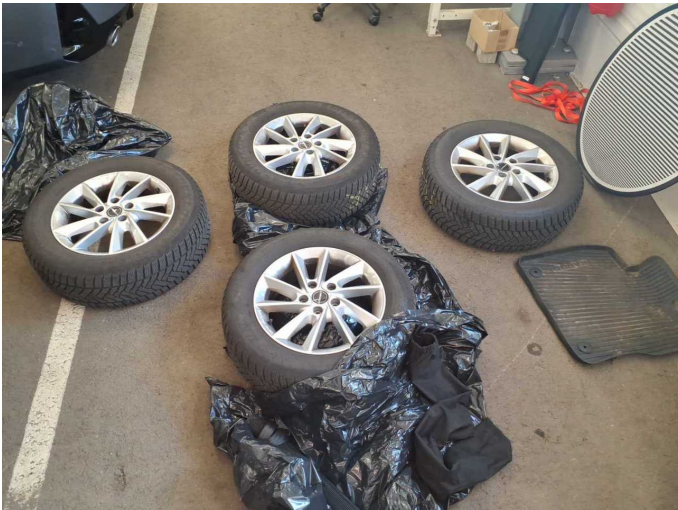


Figure 18: Additional tyres



Figure 20: Misc.

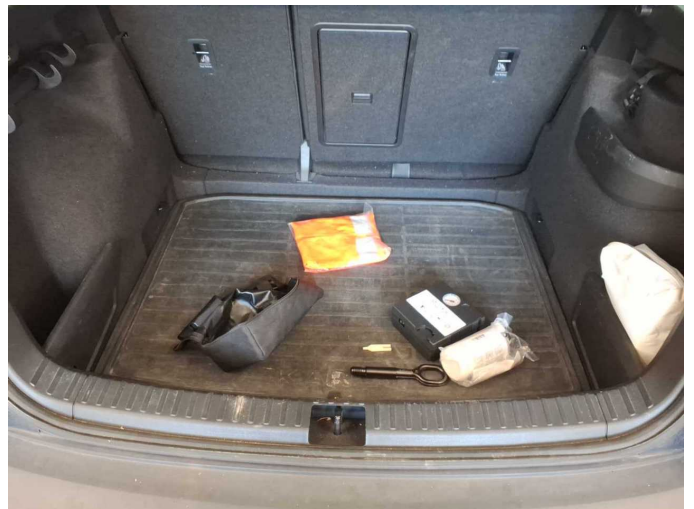


Figure 22: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.




Figure 35: Misc.



Figure 36: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

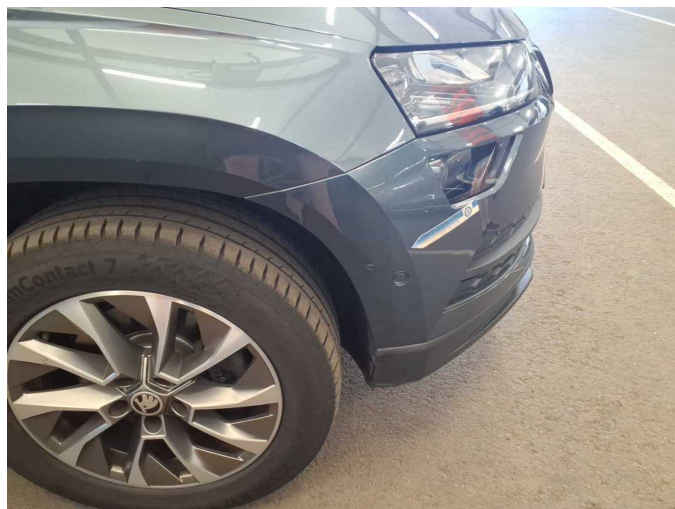


Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

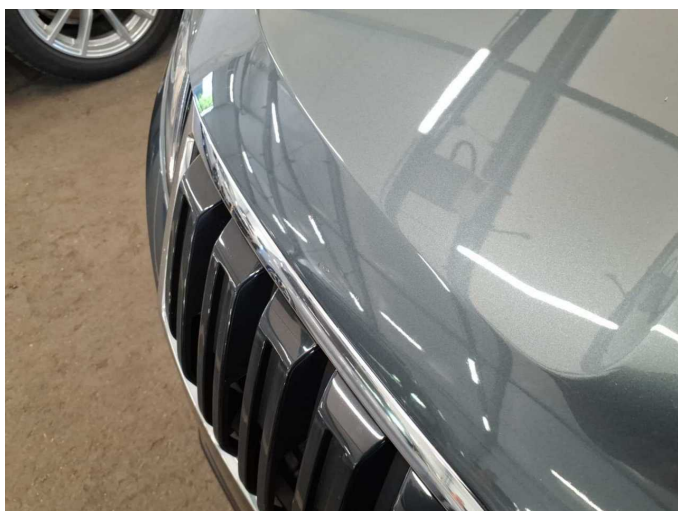

Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 5: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction




Wear and tear 5: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction

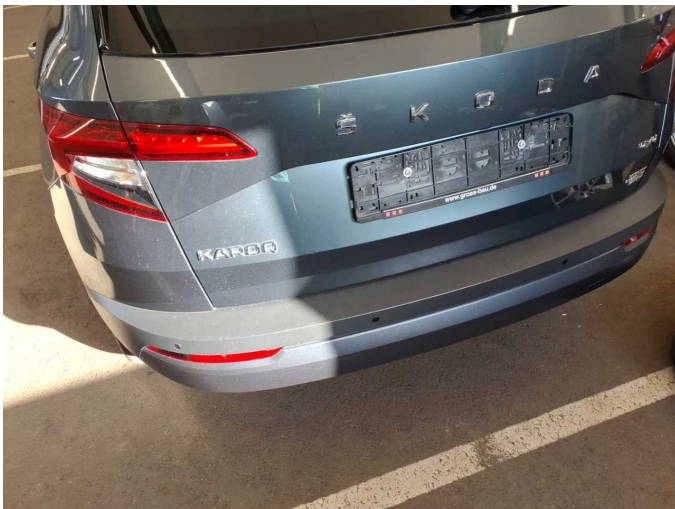

Wear and tear 5: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Accident 1: Front, Side - left

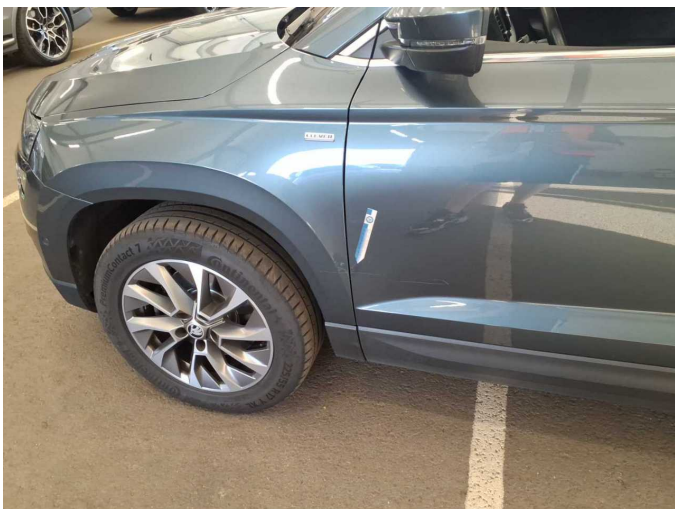

Accident 1: Front, Side - left



Accident 1: Front, Side - left




Accident 1: Front, Side - left




Accident 1: Front, Side - left




Accident 1: Front, Side - left

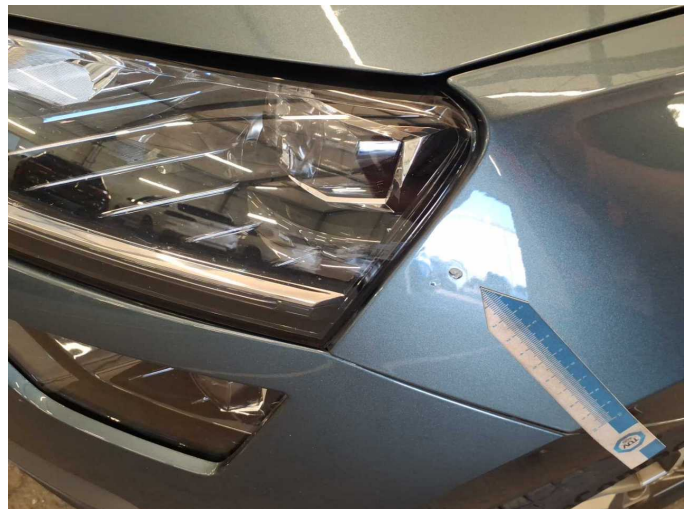

Accident 1: Front, Side - left

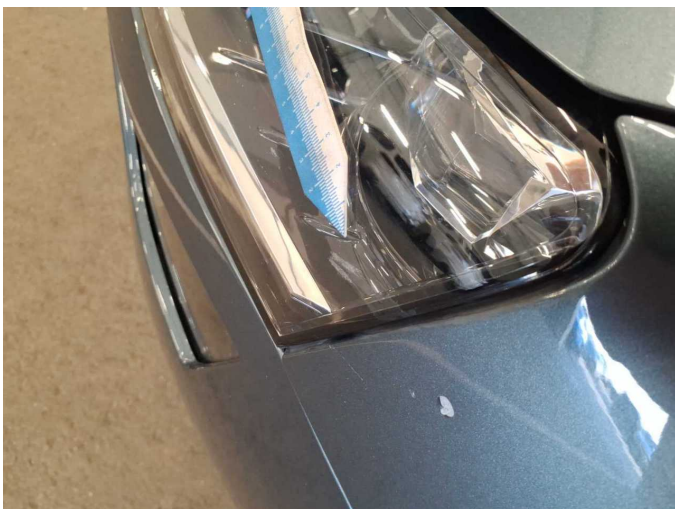

Accident 1: Front, Side - left

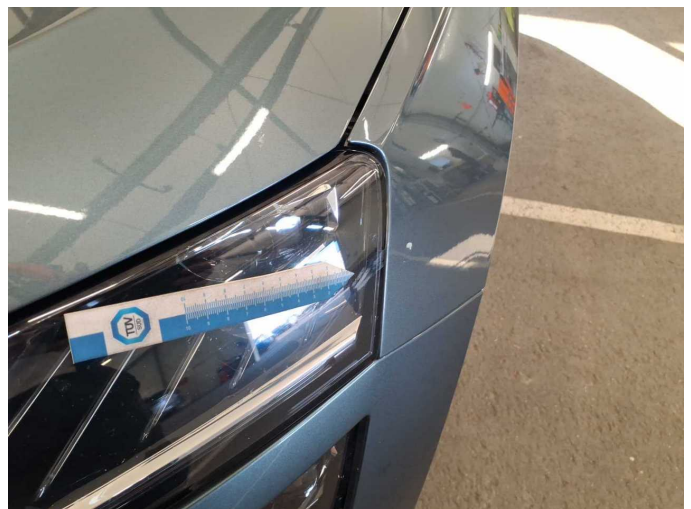


Accident 1: Front, Side - left




Accident 1: Front, Side - left




Accident 1: Front, Side - left

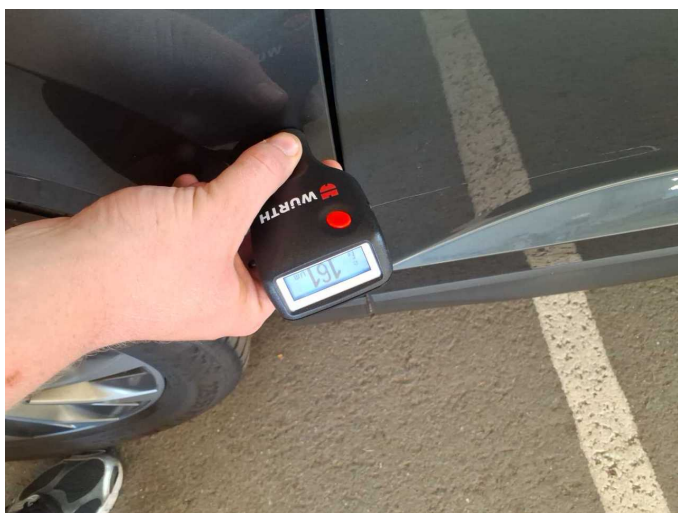


Repainting 1: Mudguard - left side

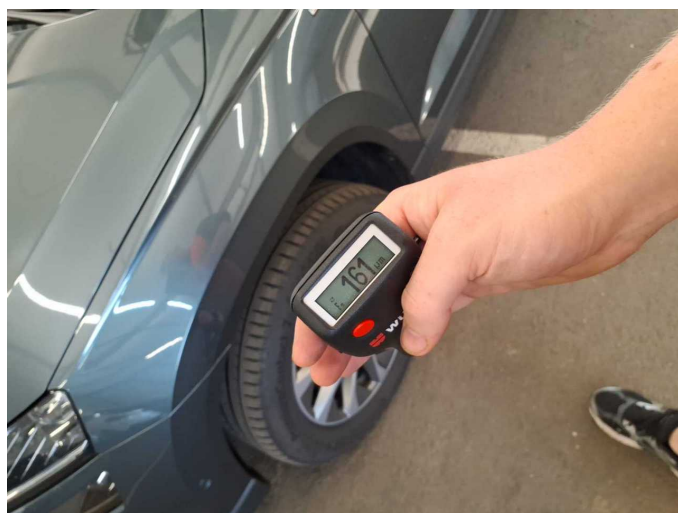


Repainting 1: Mudguard - left side

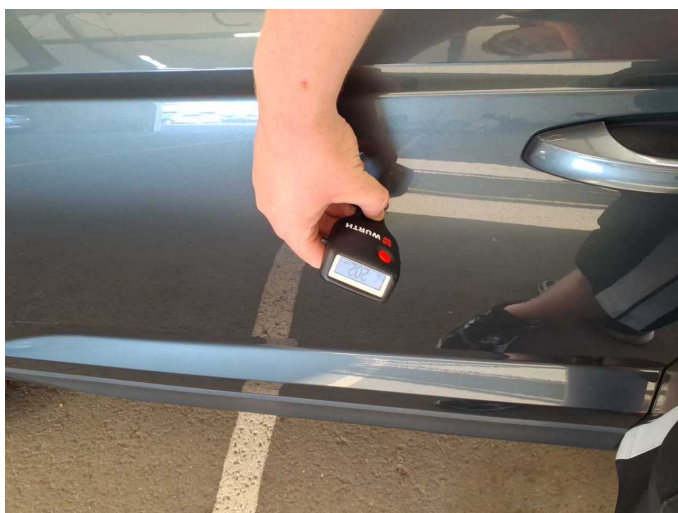


Repainting 2: Door - front left side

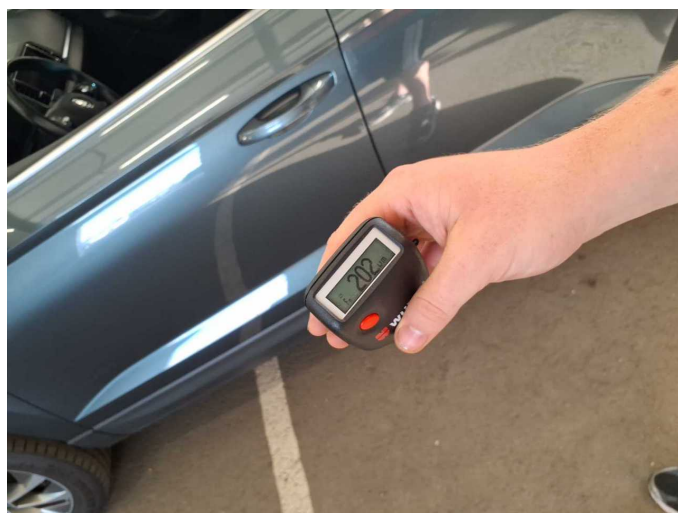

Repainting 2: Door - front left side

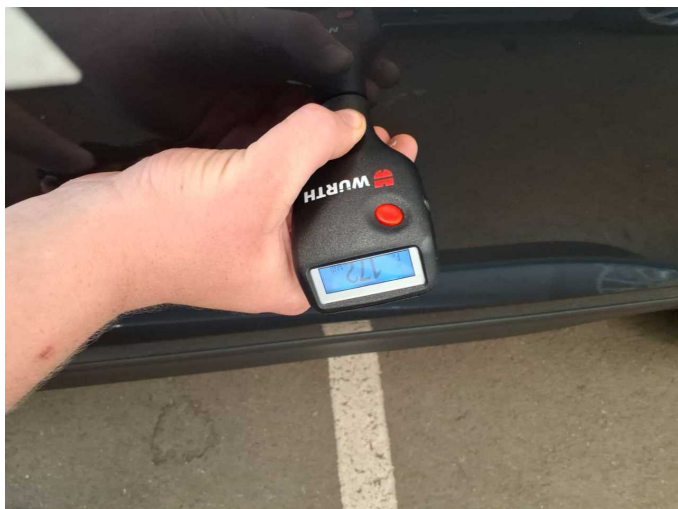

Repainting 3: Door - front right side

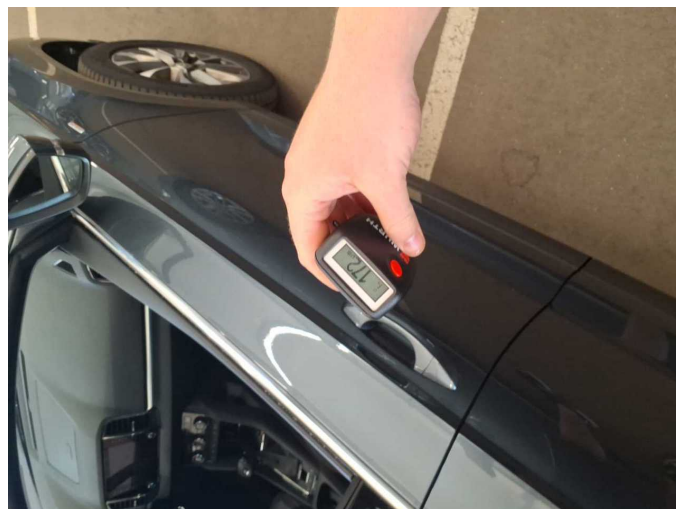

Repainting 3: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLJ7NU2M5049515

Hersteller / Modell: SKODA SKODA Karoq 2.0 TDI SCR 4x4 DSG Drive 125

Datum	KM-Stand	Beschreibung
25.02.2026	126.152	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.06.2025	112.041	Systemtest/Eigendiagnose
05.05.2025	108.299	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
21.02.2025	104.372	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
29.08.2024	91.683	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern
10.07.2024	85.966	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Ölwechsel - Hinterachse; Reparatur Sonstiges; Wartung Sonstiges
16.04.2024	70.000	AU
09.01.2024	66.384	Batterie ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.05.2023	45.666	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
18.08.2022	29.835	Regelwartungsdienst
29.03.2022	19.961	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges