

MACDAM

Ford Mustang '19 BEV


Vehicle information




Make:	Ford	License:	
Gearbox:	Automatic	Body color:	
Model:	Mustang '19 BEV	VIN:	WF0TK3SU7MMA15103
Fuel type:	Electric	Power:	248 kW
Version:	Mustang EV 99kWh AWD ER F.E.	First registration	04/06/2021
Mileage:	158478 km	N° of doors:	

Damage summary

Front	4
Interior	1
Left	3
Rear	2
Right	3

Commercial pictures

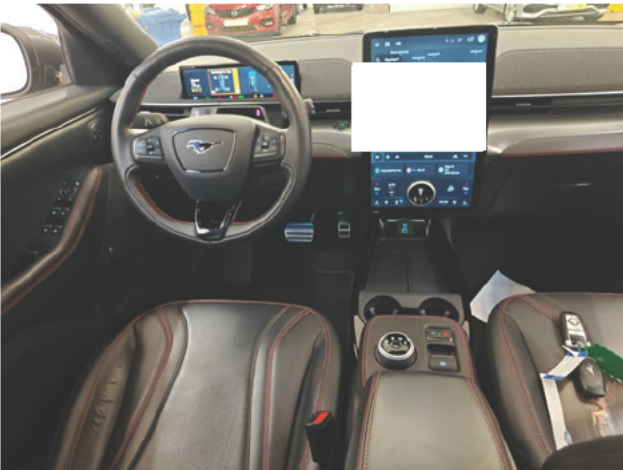

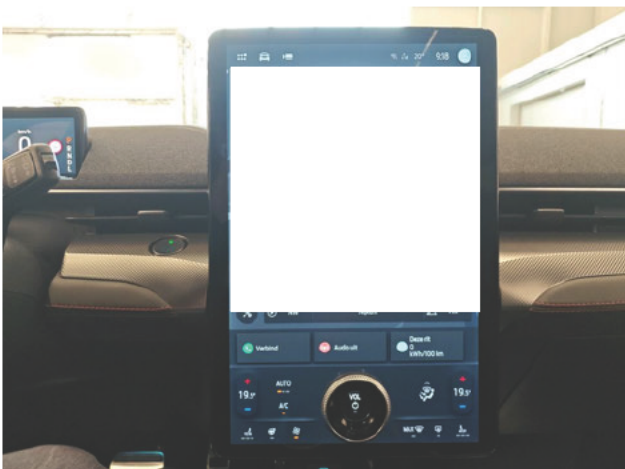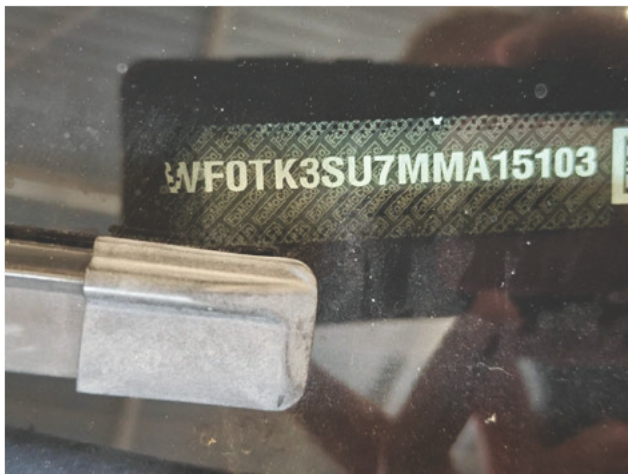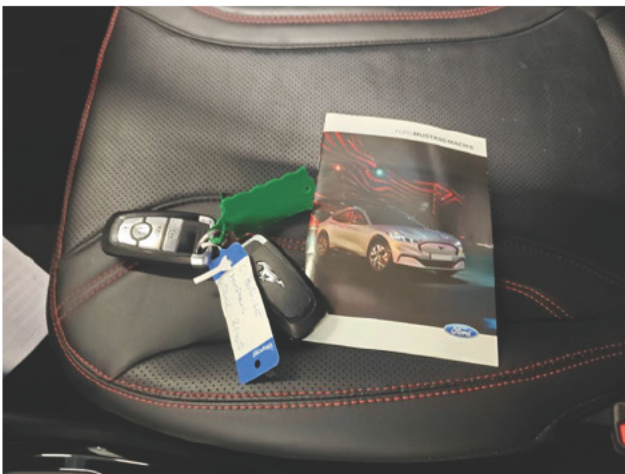

Options according to the inspector				
Central consol F	Yes	GPS	Yes	Headlights Xenon/LED/Laser
Panoramic roof	Yes	Radio multimedia	Yes	Rear view camera
Telephone equipment	Yes			

Damages

Bonnet
Stone chip(s)
Repair and paint (complete)
Front



Bumper F
Scratch(es)
Repair and paint (complete)
Front



Bumper R
Scratch(es)
Repair and paint (complete)
Rear




Bumper RM
Scratch(es)
Repair and paint (complete)
Rear



Bumper spoiler F
Deformed / Strained
Replace and paint
Front




Door FL
Scratch(es)
Repair and paint (complete)
Left

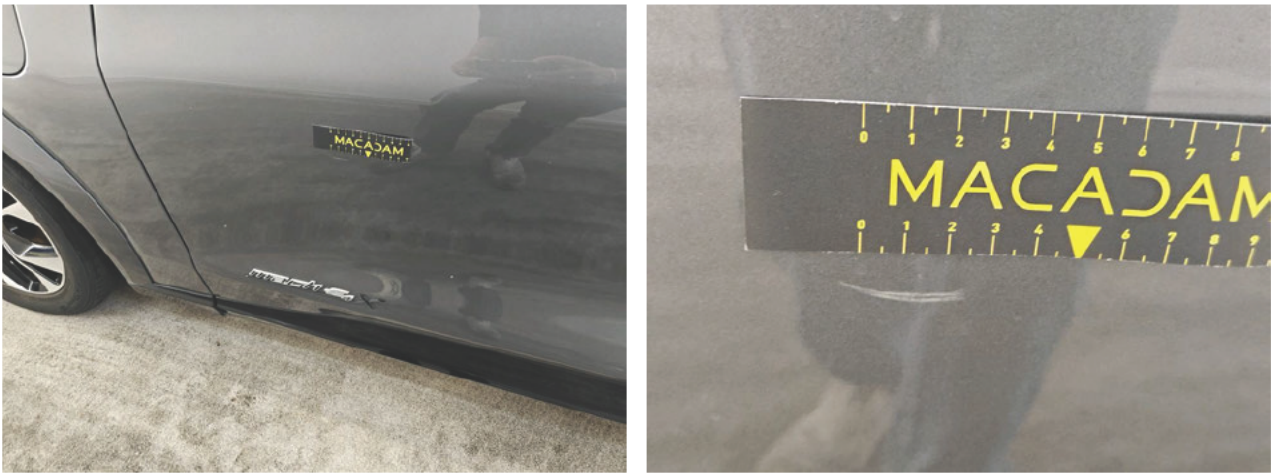

Door FR
Dent(s) and scratch(es)
Repair and paint (complete)
Right



Door RR
Scratch(es)
Repair and paint (complete)
Right

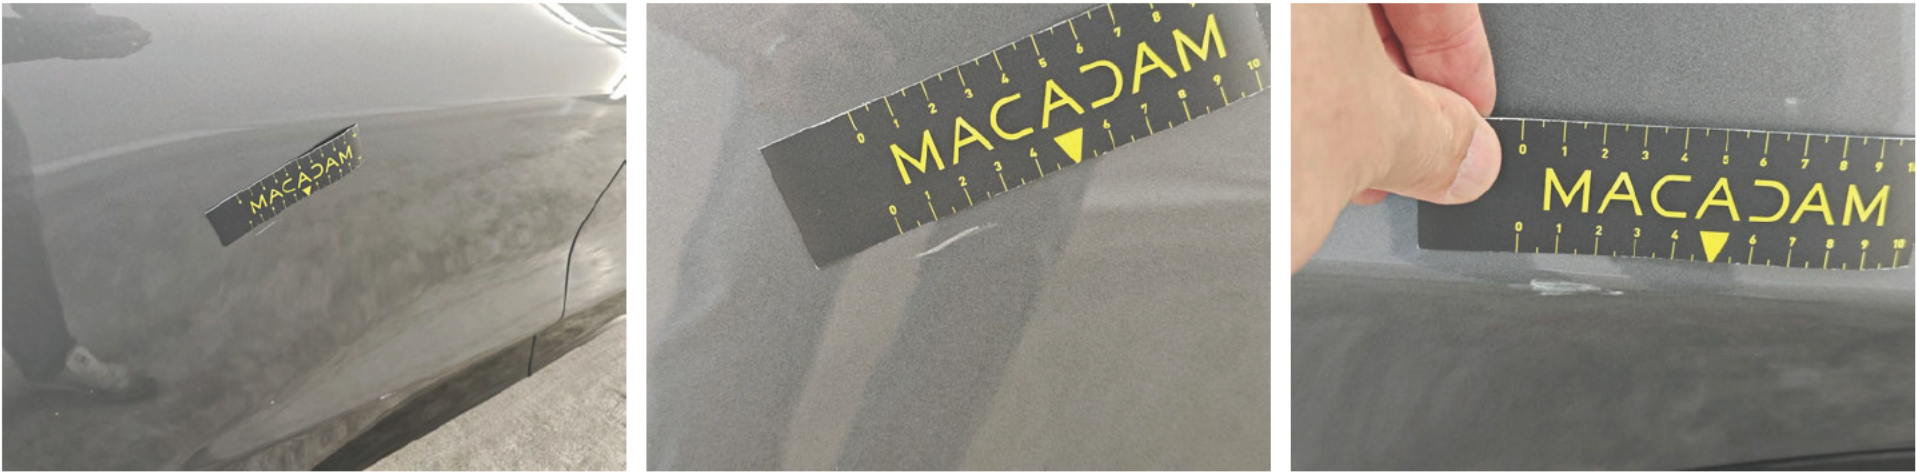


Seat cover FL
Worn
Replace
Interior



Wheel arch cover FL
Scratch(es)
Replace
Left



Windscreen
Stone chip(s)
Windscreen repair
Front

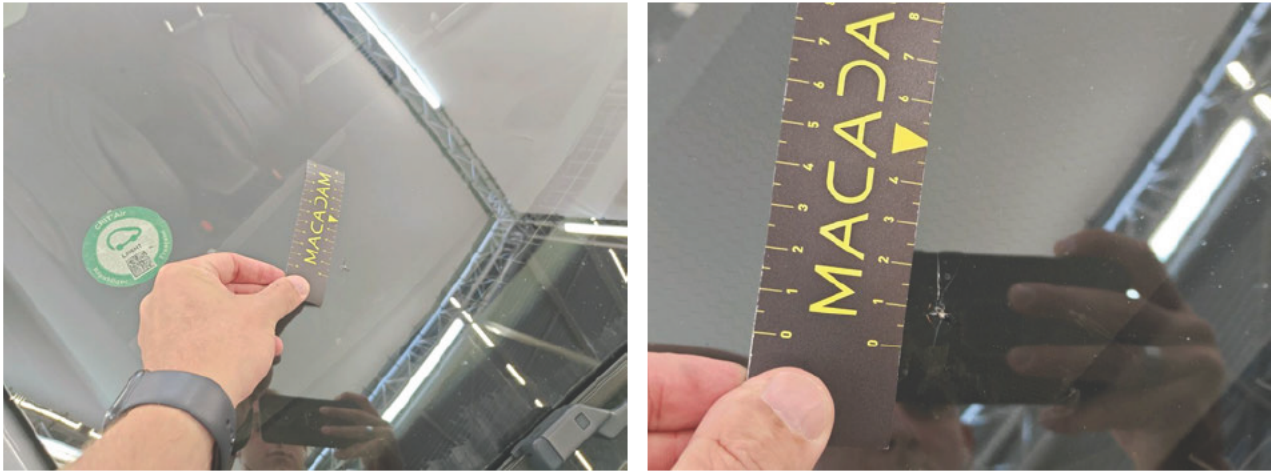

Wing RR
Scratch(es)
Repair and paint (complete)
Right



Wing trim RL
Scratch(es)
Replace and paint
Left



Tyres			
Front Left			
Summer			
225/55/19/103/Y			
Hankook			
3.9 mm			
Front Right			
Summer			
225/55/19/103/Y			
Hankook			
4.0 mm			
Rear Left			
Summer			
225/55/19/103/Y			
Hankook			
3.0 mm			
Rear Right			
Summer			
225/55/19/103/Y			
Hankook			
2.3 mm			

Checks			
CO2 Emission	0	Digital maintenance	N/A
GPS storage	Yes	Luggage cover	Yes
Number head rests	5	Number of charging cables (rapid charge)	1
Number of keys total	2	Reset to factory settings	Yes, vehicle is reset to factory settings
Service book	No	User's manual	Yes

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.