



Expertise

Protocol number: 46086268
Order No. / Reference: 26543854
Inspection date: 23 Jun 2026

Manufacturer: Skoda
VIN: TMBJR9NP4P7053161

Model: Superb Combi 2.0 TDI DSG Sportline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG Sportline	
Vehicle Identification number	TMBJR9NP4P7053161
Mileage (Read)	157,607 km
First registration	17 May 2023
Number of holders	1
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Alcantara / cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	8,200 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT099317
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWB 00536		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,237 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R19 96W	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	235/40 R19 96W	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R19 96W	Winter tyres (Without wheel rim)	Michelin	3mm / 3mm
2)	235/40 R19 96W	Winter tyres (Without wheel rim)	Michelin	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver and switchable passenger airbag
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Dashboard in black / black, door panels in black, headliner in black
- Electrically adjustable and heated exterior mirrors
- Exterior mirrors painted black, door handles in body color
- Illuminated glove compartment
- Hill start assist
- black headliner
- Dark Carbon decorative inlay
- Digital Cockpit Plus 10.2"
- Third brake light
- stainless steel pedals
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (Easy Light Assist) (Coming and Leaving Home function and tunnel light)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front and rear footwell lighting
- Cruise control system including speed limiter
- Transmission: 7-speed dual-clutch transmission (DSG)
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Child safety lock for rear doors & windows, electric
- Boot cover, roll-up and removable, semi-automatic
- Headrests integrated into front seats, rear headrests height-adjustable
- Radiator grille slats, frame, side moldings and window surrounds in black
- LED ambient lighting (dashboard and decorative trim with selectable color climate, reading lamps, door handles and footwell as well as sun visors with LED lighting - projection of the SKODA lettering from the underside of the door onto the ground (front doors))
- Steering wheel: Height and reach adjustable leather steering wheel
- Rear center armrest with cup holders and pass-through option
- Front center armrest with storage compartment
- Multifunctional storage compartment under the boot cover
- LED fog lights with integrated cornering lights
- Upholstery: Alcantara trim in sport black
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, holder for the warning vests in the front doors, glasses compartment in the headliner, storage compartments in the door panels (front and rear) with 1.5l bottle holders, cup holder in the front center console with easy-open bottle opening, storage pockets on the front seat backrests, storage compartments behind the wheel arches in the trunk including cargo elements, illuminated trunk)
- Exterior mirrors with memory function
- Electrically folding exterior mirrors (with boarding lights - automatically dimming on the driver's side)
- Hydraulic brake assist (HBA)
- Roof rails, painted in glossy black
- Diesel particulate filter and SCR catalyst
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electric tailgate opening (with multi-function storage compartment under the boot cover)
- Electronic Stability Control (ESC)
- Chassis: Adaptive chassis DCC (10 mm lowering, adjustable damper setting) (including driving profile selection (Normal, Comfort, Eco, Sport, Individual))
- Front radar assist including city emergency braking function (The front radar assist warns of impending collisions and initiates braking to reduce the force of an unavoidable impact. The front radar assist continuously monitors the distance to the vehicle ahead using a radar sensor integrated into the radiator grille.)
- Rear spoiler
- ISOFIX preparation on the outer rear seats, including top tether
- Air Care Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter and air-conditioned glove compartment)
- Metal loading sill protector
- LED reading lights at the front and rear of the headliner
- LED taillights in crystal glass look and animated turn signals
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Heated steering wheel in sport design with multifunction buttons including paddle shifters.
- Matrix LED headlights (dynamic high beam assist - automatic headlight range control - headlight cleaning system - LED taillights in crystal glass look - animated turn signals)
- Engine drag torque control (MSR)
- Multi-collision brake
- Rear parking sensors
- Radio: Bolero infotainment system (capacitive 8" touch display in glass design - Wireless Smartlink (Apple CarPlay, Android Auto))
- Radio accessories: Wireless SmartLink (Apple CarPlay, Android Auto)
- Tire pressure monitoring



- Radio accessories: USB ports at the front (Type-C) and USB charging port (Type-A) in the center armrest
- Umbrella compartments in the front side doors
- Tire mobility kit (tire repair spray incl. compressor)
- Gearshift and handbrake levers in leather
- Heated windshield washer nozzles
- Superb safety belts (Height-adjustable three-point front seat belts with belt tensioners - Three three-point rear seat belts - Belt fastening indicator for all seats)
- Seats: Height-adjustable front seats
- Seats: Rear seat backrest split 60:40, foldable
- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Chrome-plated elements (on air vents, light switches, music or navigation systems, air conditioning)
- Immobiliser

- Wheels: 19" Vega alloy wheels, diamond-cut/anthracite (8J x 19" ET 44 with 235/40 R19 tires)
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats with memory function
- Seats: Front sports seats
- Sun visor on driver and passenger side with illuminated make-up mirror
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Sunset (rear window and rear side windows tinted dark)
- Telephone: Bluetooth hands-free system
- Textile floor mats
- Door sill plates
- Glazing: Acoustic glazing in the front side windows
- Lashing eyes in the trunk
- Central locking with remote control

Extra equipment

- Electric panoramic sunroof including sunshade (elimination of the glasses compartment in the headliner)
- Package: Assistance Plus (Lane Change Assist - Area View - Trailer Maneuvering Assist & Park Assist - Trailer Hitch - (Active Tire Pressure Monitoring System) - Driver Fatigue Detection)
- Package: Comfort Plus (Combi) (3-zone Climatronic - heated front and rear seats - KESSY - 3rd vehicle key - comfort opening for the tailgate - heated steering wheel (with shift paddles) - sunshade for the rear side windows)
- Package: Safety (Proactive occupant protection - rear side airbags - Isofix anchorage for passenger seat)
- Seats: Manual seat length adjustment for the electric front seats
- Luggage net partition
- Paint finish: Pearl effect
- Package: Business Columbus (Columbus navigation system - voice control - Wi-Fi hotspot - Wireless Smartlink for Apple CarPlay - 9.2" capacitive touchscreen in glass design - Phonebox - Traveller assistance system (traffic sign recognition, predictive lane keeping assist ACC, adaptive lane keeping assist, emergency and traffic jam assist, capacitive steering wheel with hands-off detection) - 230 V socket and 3 USB ports, tablet holder - Infotainment Online (3-year subscription))
- Progressive steering (adjustment of the steering angle depending on the speed)
- Auxiliary heater with radio remote control

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection (Kein Nachweis) - No evidence - No deduction
2	Equipment	Vehicle key - Empty - Replace
3	Front bumper	Front bumper - Scratch(es) - Smart repair
4	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratched - Repair and paint
6	Wheel / tyres	Alloy rim - rear left side (Wurde bearbeitet) - Unprofessionally repaired - Replace
7	Wheel / tyres	Alloy rim - rear right side (Wurde bearbeitet) - Unprofessionally repaired - Replace
8	Wheel / tyres	Alloy rim - front left side (Wurde bearbeitet) - Unprofessionally repaired - Replace
9	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	2nd wheel set	Tyres - complete set - Does not meet the leasing specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description
Heating system - Remote control auxiliary heating

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 20 Feb 2026	1.740,47 €
2	Side right, Provided by user / customer, from 28 Nov 2024	5.624,05 €

Repainting

No.	Repainting
1	Mudguard - left side, Mudguard - right side, Side panel - rear right side, Door - rear right side, Professionally carried out

Paint coat thickness measurement

Mudguard - left side	209 µm	Mudguard - right side	171 µm
Side panel - rear right side	363 µm	Door - rear right side	359 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterreifensatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

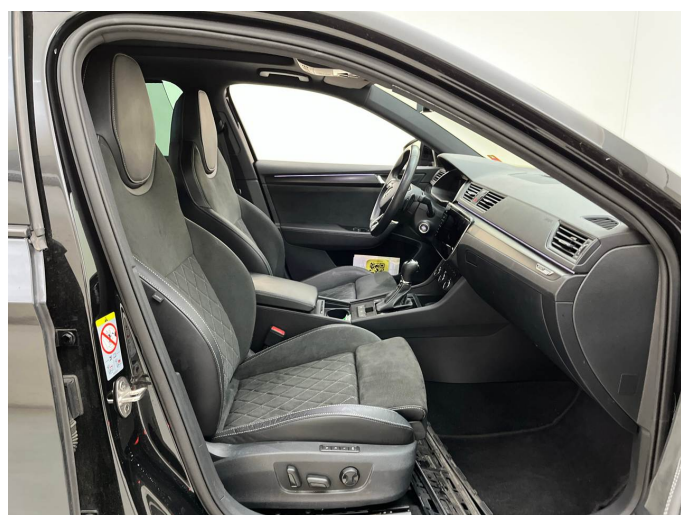


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

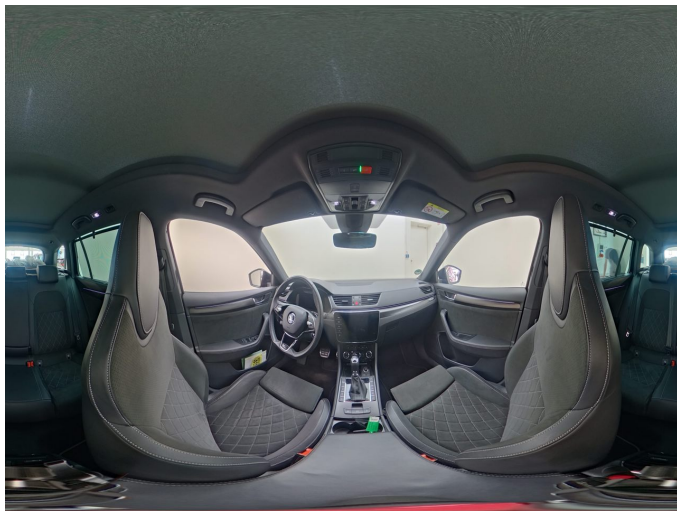


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres

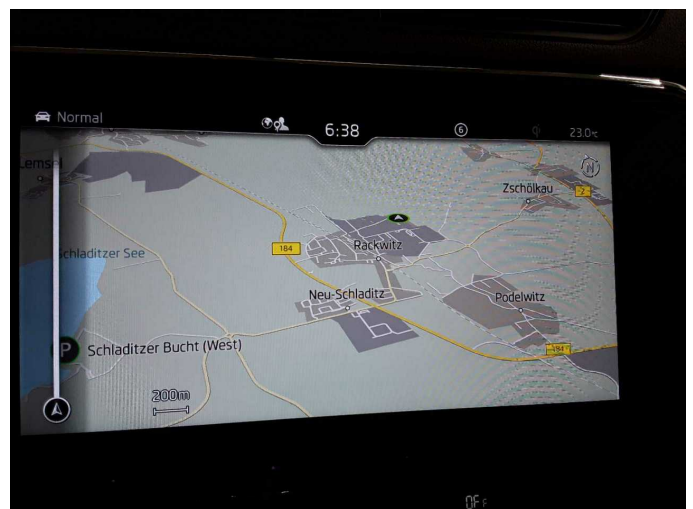


Figure 18: Navigation



Figure 19: Misc.

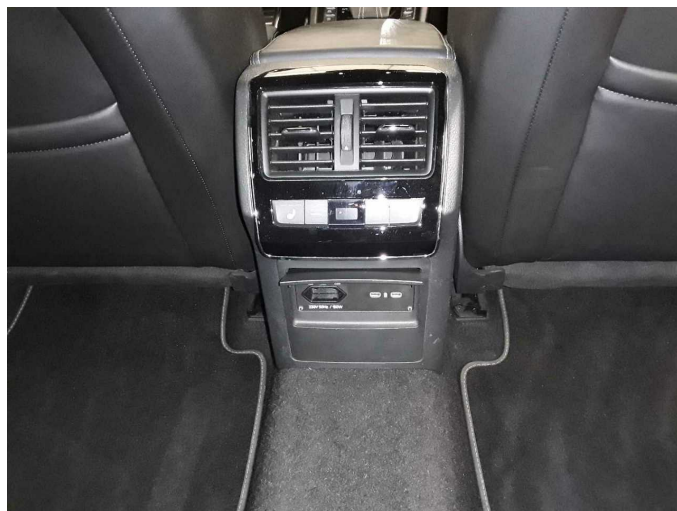


Figure 20: Misc.

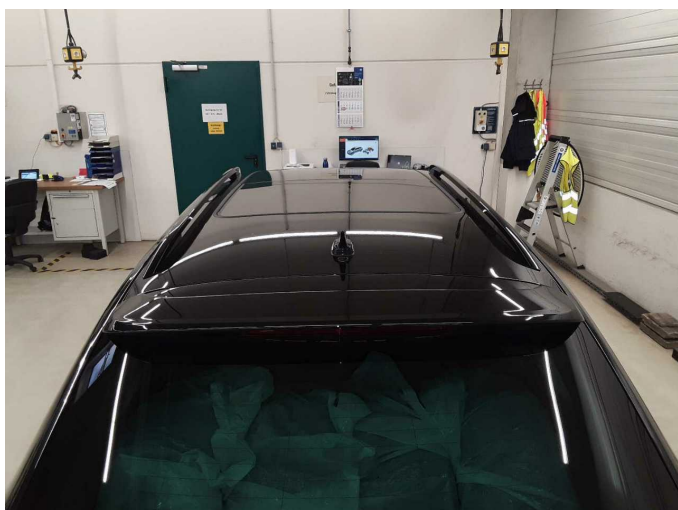


Figure 21: Misc.



Figure 22: Misc.

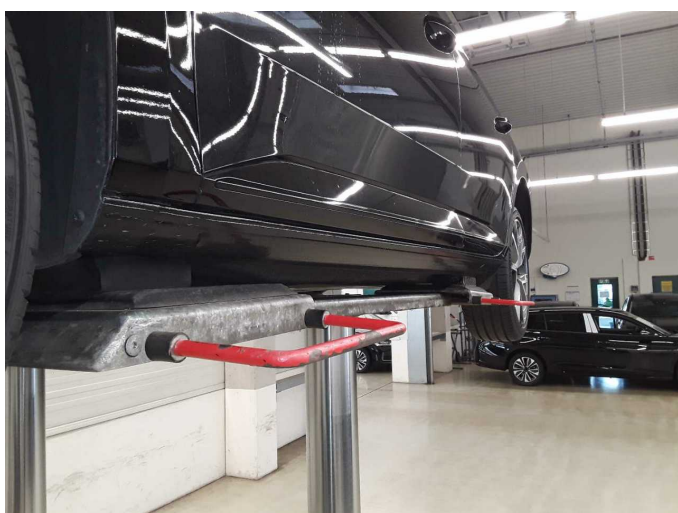


Figure 23: Misc.

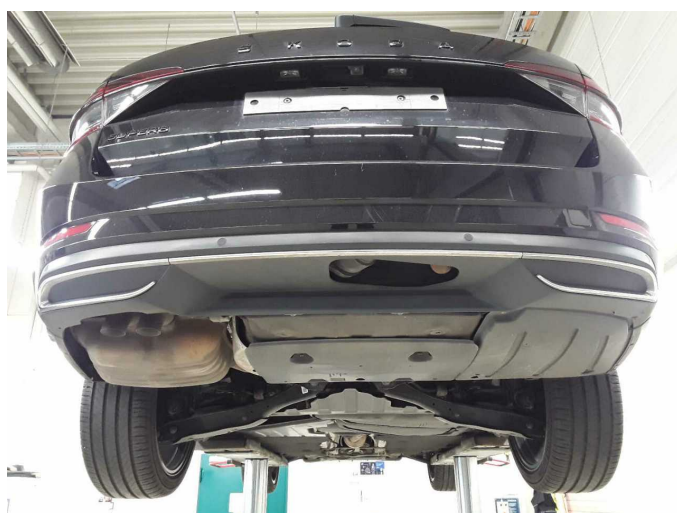


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

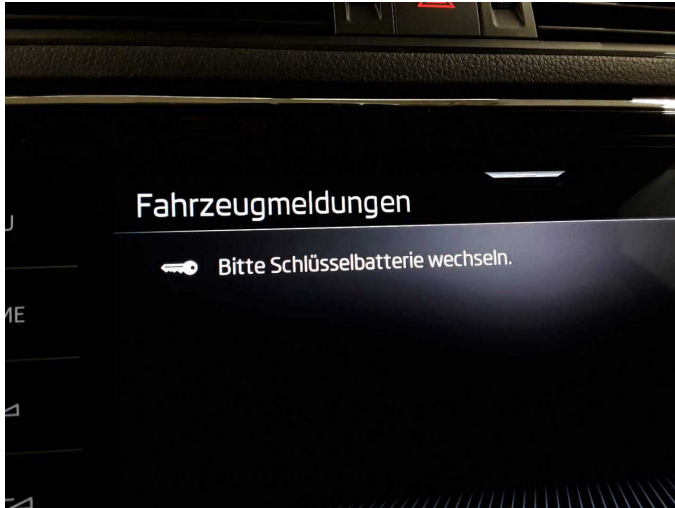

Damage 2: Equipment: Vehicle key - Empty - Replace




Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

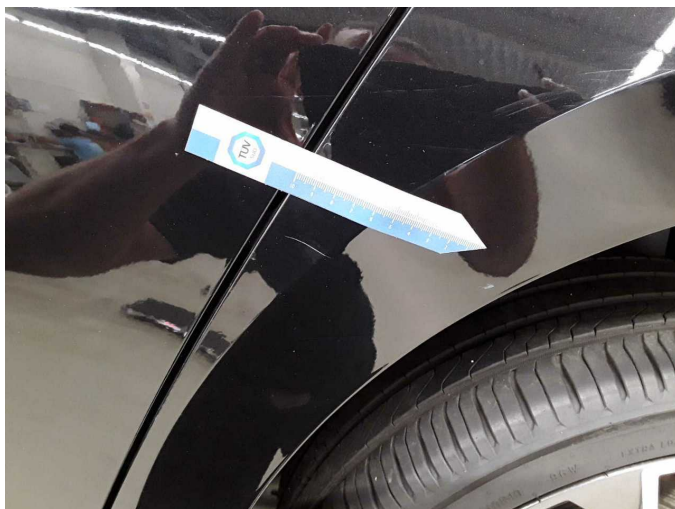

Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 5: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 5: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 5: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 5: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 6: Wheel / tyres: Alloy rim - rear left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 6: Wheel / tyres: Alloy rim - rear left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 6: Wheel / tyres: Alloy rim - rear left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 6: Wheel / tyres: Alloy rim - rear left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 6: Wheel / tyres: Alloy rim - rear left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Wurde bearbeitet) - Unprofessionally repaired - Replace



Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction

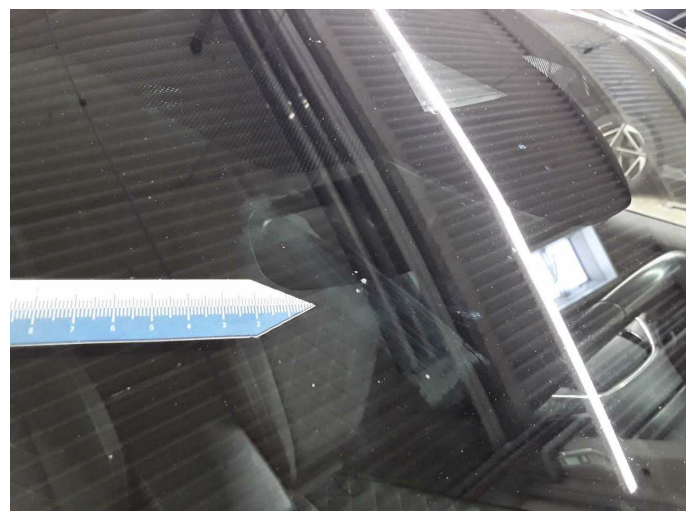

Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction



Mudguard - left side: 209 µm



Mudguard - right side: 171 µm



Side panel - rear right side: 363 µm



Door - rear right side: 359 µm