



Expertise

Protocol number: 46053710
Order No. / Reference: 26520525
Inspection date: 19 Jun 2026

Manufacturer: Audi
VIN: WAUZZZFZ4NP037507

Model: Q4 e-tron 40 Sportback



ALPHABET



ALPHABET

Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q4 e-tron 40 Sportback	
Vehicle Identification number	WAUZZZFZ4NP037507
Mileage (Read)	106,470 km
First registration	5 May 2022
Number of holders	1
Power / Engine displacement	70 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Mondsteingrau
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	-2 Monat(e)
Last service on / at	05/2024 at 53,233 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ110934
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BZT 00034		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,625 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 104T	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	255/45 R20 105T	Summer tyres on Light alloy	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/50 R19 107T	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	255/50 R19 107T	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Acoustic vehicle warning system
- Anti-lock braking system (ABS)
- Audi connect Remote & Control for MMI basic
- Audi pre sense front
- Electrically adjustable/heated exterior mirrors
- third brake light
- Decorative inlay, black tactile lacquer
- Rear parking sensors
- Chassis: Comfort chassis
- Luggage compartment lid, electrically opening and closing without sensor-controlled luggage compartment release
- rear window wiper
- Interior mirror dimming
- Comfort stationary air conditioning
- Comfort center armrest in front
- Combo 2 charging socket (EU)
- LED taillights
- Steering wheel: Double-spoke leather steering wheel with multifunction
- On-board charger up to 11 kW (AC)
- Wheel: Tire pressure monitoring system
- Power steering
- Seats: Front seats manually adjustable
- 12-volt socket
- Electronic immobilizer
- Central locking
- Airbag: Front side airbags, with head airbag and front interaction airbag
- Audi connect emergency call and service
- Audi drive select
- Evasive steering assist and turning assist
- Vehicle tool kit
- Fabric headliner
- Tachometer
- Electronic Stability Control (ESC)
- front and rear floor mats
- Adjustable speed limiter
- Transmission: 1-speed direct drive
- Interior lighting
- i-Size child seat anchors on the front passenger side, i-Size and Top Tether anchors on the outer rear seats
- Headrests (5)
- Mode 3 charging cable for public charging
- LED headlights
- Light and rain sensor
- Model name and performance/technology lettering
- Package: Gloss Package
- Radio: MMI Radio
- Seats: Rear seat backrest foldable
- Lane Departure Warning
- First aid kit with warning triangle
- Green thermal insulation glazing



Extra equipment

- Audi connect Navigation & Infotainment plus (e-tron route planner - Online points of interest - On-street parking - Online traffic information - Hazard information - Online traffic sign information - Weather information - Wi-Fi hotspot - Online news - User profiles - Navigation with Google Satellite Map - Online search for navigation destinations - Online voice input - Online traffic information plus - Highly detailed 3D city display - Online radio - Hybrid radio - Amazon Alexa integration)
- Comfort key without Safelock (The vehicle can be unlocked at all doors and the tailgate via wireless communication. The comfort key simply needs to be carried and does not need to be actively used. The vehicle can be locked again using the sensors on the door handles. The engine is started and stopped using the engine start/stop button.)
- Navigation: MMI Navigation plus (11.6-inch MMI Navigation plus with MMI touch including Audi connect Navigation & Infotainment - camera-based traffic sign recognition - 10.25-inch Audi virtual cockpit with two display options "Classic" and "Sport" - voice control)
- Package: Climate Control Package (The 3-zone automatic climate control electronically regulates the air temperature, volume, and distribution. An additional function is sun-position-dependent control. The temperature setting for the driver and front passenger can be adjusted separately. Separate temperature control and air vents are available in the rear. The 3-zone automatic climate control features automatic recirculation in combination with a dust- and odor-removing cabin air filter.)
- Package: Comfort package (electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides, with integrated LED turn signals and curb view function for the passenger-side exterior mirror, aspherical mirror glass on the left, convex on the right, including heated windshield washer nozzles - automatically dimming, frameless interior mirror - 4-way lumbar support for the front seats - projection lights in the exterior mirrors)
- Front seat heating (heats seat and backrest center section (standard seats in fabric), otherwise seat and backrest center section as well as seat side bolsters - individually adjustable in 3 stages for driver and front passenger via direct selection button on the climate control unit)
- Chassis: Sport chassis (The sport chassis, with a 15 mm lower ride height compared to the standard chassis and more dynamic spring and damper tuning, uses a McPherson strut axle with lower wishbones, shock absorbers, coil springs, subframe and stabilizer bar at the front. At the rear, a 4-link axle with separate spring and damper arrangement, shock absorbers, coil springs, subframe and stabilizer bar is used.)
- High Beam Assist (The High Beam Assist uses a camera system to automatically detect oncoming traffic, vehicles ahead, and urban light sources within the system's limitations. Based on this information, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Paint finish: Solid
- Package: Assistance package (Parking aid plus, supports the driver when parking and maneuvering forwards and backwards with acoustic signals and visual display with virtual lane guidance. - Cruise control with speed limiter)
- Package: Interior with sport seats in black fabric (front sport seats with integrated headrests, manual adjustment of seat height, seat fore/aft position, seat tilt, backrest tilt and belt height - fabric upholstery in black/silver, seat center panels in black/silver fabric - double-spoke leather steering wheel with multifunction controls, with chrome-look trim - door sill trims with aluminum inlays - black haptic-finish decorative inlays for instrument panel inserts - glossy black accent surfaces - aluminum look in the interior - steel gray fabric headliner)
- Package: S line exterior (S line bumpers with bottom line all around in contrasting paint finish Manhattan Grey Metallic - Wheels, 5-Y-spoke, 8.0 J / 9.0 J x 20, tires 235/50 / 255/45 R 20 - S line exterior differentiations with S line emblem on the fenders - Sport suspension)
- Wheels: Light alloy wheels (4 pieces) in 5-Y-spoke design (front size: 8.0 J x 20 with 235/50 R 20 tires, rear size: 9.0 J x 20 with 255/45 R 20 mobility tires)
- Heat pump (Within the system limits, the heat pump uses the waste heat from the electric drive components and the outside air to heat the vehicle interior. This supports the provision of the required heating power at low outside temperatures. The electrical energy not needed for heating can, for example, also have a positive effect on the vehicle's range.)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Engine	Engine cover - Damaged - Replace
2	Door - front left side	Door - Dent / paintcoat damage - Smart repair
3	Rear bumper	Rear bumper - Scratch(es) - Smart repair
4	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 12 Aug 2022	6.179,85 €

Repainting

No.	Repainting
1	Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	178 µm	Mudguard - left side	161 µm
Door - rear left side	162 µm	Door - front left side	172 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Der beiliegende Winterradsatz ist nicht Bestandteil der Ausstattung



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

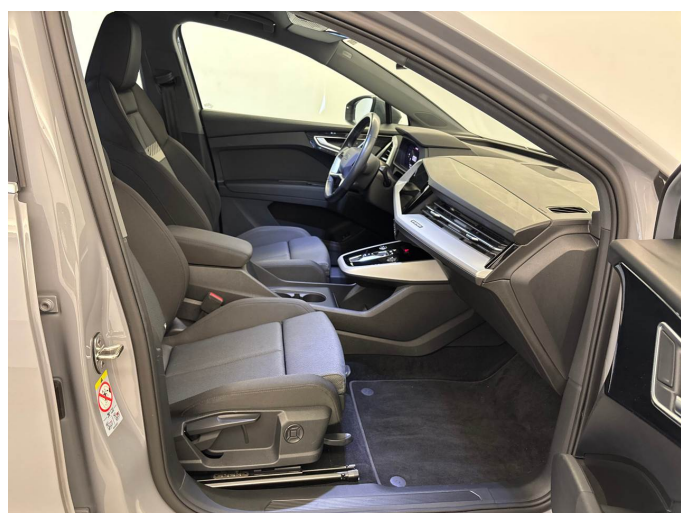


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

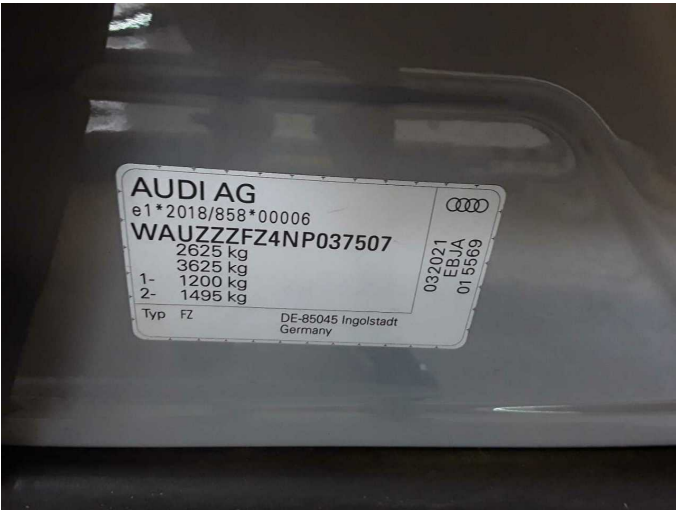


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

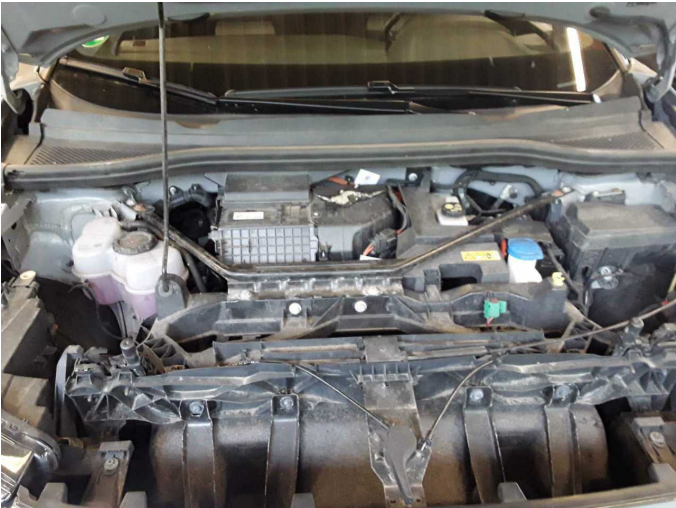


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

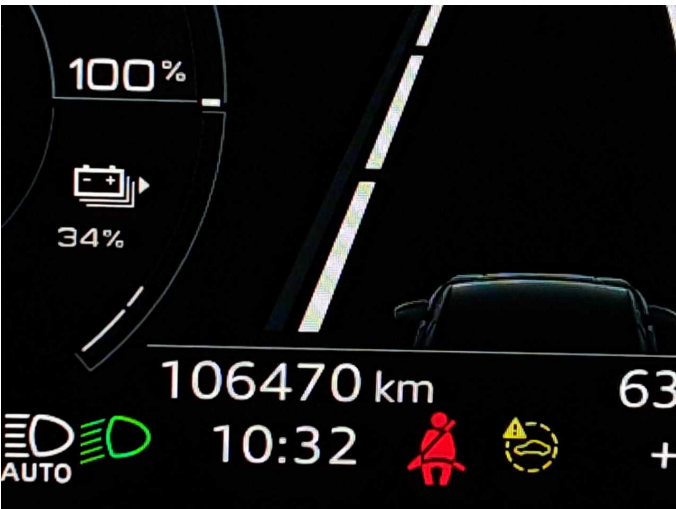


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Engine: Engine cover - Damaged - Replace



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 4: Misc.: Inspection / maintenance - Due - Perform



Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction




Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side

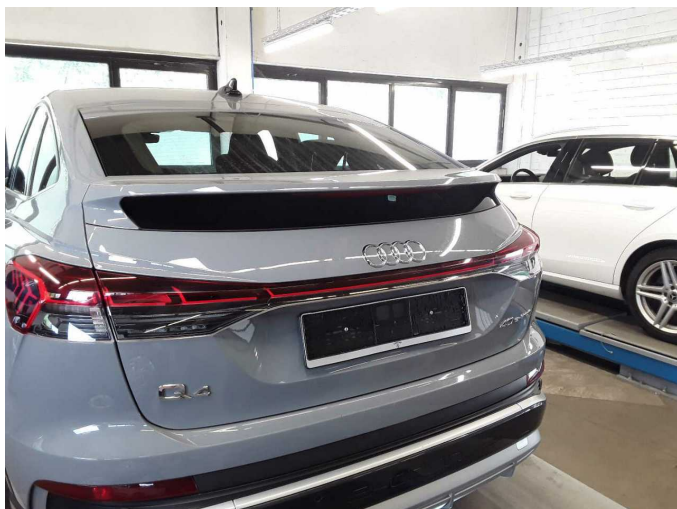

Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side




Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side

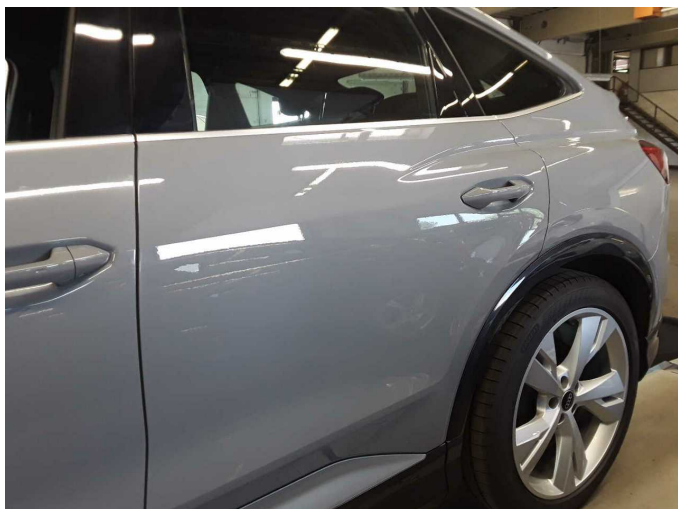

Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side



Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side

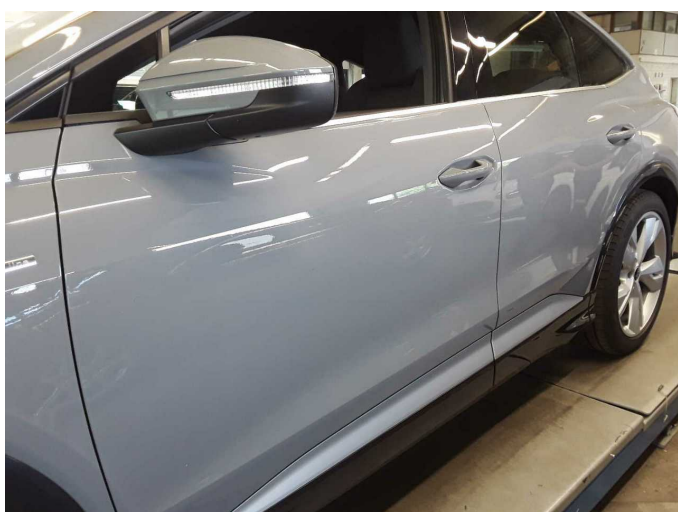

Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side



Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side



Repainting 1: Boot lid / rear door, Mudguard - left side, Door - rear left side, Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZFZ4NP037507

Hersteller / Modell: AUDI AUDI Q4 e-tron 40 Sportback

Datum	KM-Stand	Beschreibung
29.01.2026	100.142	Reparatur Sonstiges; Reparatur Sonstiges; Systemtest/Eigendiagnose
12.12.2025	97.499	Reparatur Sonstiges; Systemtest/Eigendiagnose
18.02.2025	74.314	Systemtest/Eigendiagnose
22.05.2024	53.233	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
30.04.2024	53.233	Reparatur Sonstiges