



SKODA KAROQ: GA-927-WL

Vinnumber:	TMBJJ7NU7M5058685	Versionname:	SKODA KAROQ 2.0 TDI 150ch SCR Sportline VP [5P] bvm 6-150CH-8cv (SUV)
First Registrationdate:	21/07/2021	Fiscalpower:	
Expertise Mileage:	146681	Power Kw:	110
Bodytype:	SUV	Body colour:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Steering wheel leather		Rear view camera	
Type of climate control	Autom climate control	Seat cover lining	Lining Other

Tyres

	215/50/18/92 W			
Summer tyres:	Fr.L.	Goodyear: 30%	Fr.R.	Goodyear: 35%
	Re.L.	Bridgestone: 50%	Re.R.	Bridgestone: 55%
Tyre profile depth FL				6.2
Tyre profile depth FR				6.0
Tyre profile depth RL				4.8
Tyre profile depth RR				4.6
Tyre size FL				215/50 R 18 92 W
Tyre size FR				215/50 R 18 92 W
Tyre size RL				215/50 R 18 92 W
Tyre size RR				215/50 R 18 92 W
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Interior trim, Missing, Replace



Floor mat F, Hole, Smart repair



Interior, Stain, Cleaning



Wing RL, Scratch(es), Paint



Door RL, Dent(s), Repair and paint (complete)




Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Bumper spoiler F, Unclashed, Dismount/Mount



Bumper moulding FL, Unclashed, Dismount/Mount

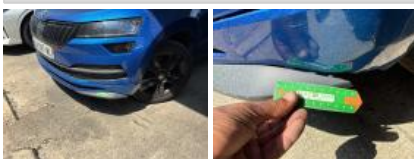

Bonnet, Scratch(es), Polish



Windscreen, Stone chip(s), Replace



Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Door FR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Dent(s), Repair and paint (complete)



Wing RR, Chemical polution, Polish



Rear upper boot lining, Scratch(es), Replace



Rubber seal for boot lid, Tear, Replace



Bumper R, Scratch(es), Polish



Historique Maintenance

Immatriculation: GA-927-WL Date de 1ère immatriculation: 21/07/2021

Modèle: Skoda KAROQ 2.0 TDI 150ch SCR Sportline VP [5P] bvm 6-150CH-8cv (SUV)

Date	Kilométrage	Fournisseur	Descriptif
05/05/2026	143.524	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS ETE
	0		REPLACEMENT PNEUS ETE
21/04/2026	142.011	SCALA PERPIGNAN	LIQUIDE DE FREIN
	0		BALAI ESSUIE GLACE AV
	0		REVISION
	0		DISQUES PLAQUETTES AR RPLT
	0		DISQUES PLAQUETTES AV RPLT
	0		BALAI ESSUIE GLACE AR
20/10/2025	123.279	SCALA PERPIGNAN	REVISION
01/10/2025	120.141	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS ETE
29/11/2024	102.596	SCALA PERPIGNAN	REVISION ET CLIM
	0		AMORTISSEURS AV RPLT
	0		BATTERIE RPLT
	0		BALAI ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
	0		DISQUES PLAQUETTES AV RPLT
13/02/2024	75.026	SCALA PERPIGNAN	PLAQUETTES AV RPLT
	0		DISQUES PLAQUETTES AR RPLT
	0		REVISION
15/12/2023	68.724	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS 4 SAISONS
12/06/2023	49.294	SCALA PERPIGNAN	LIQUIDE DE FREIN
	0		REVISION
	0		BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
	0		FILTRE CLIM RPLT
20/12/2022	35.622	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS ETE
18/10/2022	28.857	SCALA PERPIGNAN	REVISION
	0		ADBLUE
	0		BALAI ESSUIE GLACE AV