



Expertise

Protocol number: 46526656
Order No. / Reference: 26543099
Inspection date: 9 Jul 2026

Manufacturer: Mercedes-Benz

Model: C 220 d 4Matic T 9G-TRONIC Avantgarde Advanced

VIN: W1KAH0FBXRF144581



Vehicle details

Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 220 d 4Matic T 9G-TRONIC Avantgarde Advanced	
Vehicle Identification number	W1KAH0FBXRF144581
Mileage (Read)	132,788 km
First registration	5 Dec 2023
Number of holders	1
Power / Engine displacement	147 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Schwarz
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	301 Tag(e)
Last service on / at	04/2026 at 125,055 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY547717
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BBU 00231		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,410 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	225/50 R17 94Y	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Sonstige	4mm / 4mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Sonstige	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Adaptive Highbeam Assist
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- 4MATIC all-wheel drive
- ATTENTION ASSIST
- Basic services
- Brake assist, active
- Diesel particulate filter
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- Heated rear window
- ISOFIX child seat attachment with top tether in the rear
- Mechanical child safety lock for the rear doors
- Rear headrests (3)
- Fuel tank with larger volume 66 l
- Cargo area cover including EASY-PACK safety net
- Steering wheel: Multifunction sports steering wheel in leather
- Navigation: MBUX Navigation Premium (Pre-installation for navigation services - Package (control code) - Multimedia / Digital content - Hard disk navigation - Pre-installation for Live Traffic Information - Communication module (LTE) for the use of Mercedes me connect services)
- Package: Mirror package
- Upholstery: ARTICO leatherette/fabric
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services
- Power steering
- Seats: Rear seat backrests foldable
- Phone accessories: Wireless charging system for mobile devices
- TIREFIT with tire inflation compressor
- Pre-installation for digital key handover
- Electronic immobilizer
- Decorative elements in diamond pattern, silver-grey
- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- Ambient lighting with 64 light colors
- Left and right exterior mirrors are heated and electrically adjustable
- Roof rails in polished aluminum
- Double cup holder at the front
- EASY-PACK tailgate
- Driver display
- Electric windows (4-way)
- Fingerprint scanner
- Speed Limit Assistant
- rear window wiper
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- THERMATIC automatic climate control with 2 climate zones
- Front headrests
- Paint finish: Solid
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Package: Storage
- Package: Interior lighting package
- Package: Trunk Comfort
- Package: Parking package with reversing camera
- Package: Seating comfort
- Package: USB
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seats: Heated seats for driver and front passenger
- Lane Keeping Assist, active
- Phone accessories: Smartphone integration
- Cruise control
- Fully digital instrument display
- High-visibility vest for drivers
- Central locking with remote control



Extra equipment

- Towbar with ESP trailer stabilization
- Package: Avantgarde Advanced (00U Remote Services - 70B
Warning vest for driver - P14 AVANTGARDE Interior - P15
AVANTGARDE Exterior - PBG MBUX Navigation Premium - PDA
Advanced Package)
- Wheels: 43.2 cm (17") light alloy wheels in 5-spoke design (black
painted and polished with 225/50 R 17 on 7 J x 17 ET 44.5)
- Traffic Sign Assist (Networked system consisting of a camera behind
the windshield and navigation maps - Early detection of maximum
speed limits and display of prohibitions as well as their cancellation in
the driver display and in the optionally available head-up display -
Visual and, if desired, additional acoustic warning when exceeding
the maximum speed limit - Can recognize no-entry signs, providing a
visual and acoustic warning)
- Center console diamond pattern silver grey
- Radio accessories: Advanced sound system (4 midrange speakers -
2 tweeters - 2 front bass speakers - 1 center speaker - 225 W
amplifier power)
- Radio accessories: Pre-installation for MBUX Entertainment
(integration of music streaming services (user account required):
Spotify, Amazon Music, Apple Music, TIDAL, TuneIn (no user
account required) - Extended radio information - Extended radio
station tracking - Internet radio - Third-party convenience data
volume)
- Type designation removed from trunk lid
- Heat and noise insulating acoustic glass (for windshield and front
doors)
- Heat-insulating dark tinted glass

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Mudguard - rear left side - Scratch(es) - Smart repair
2	Side panel - rear right side	Mudguard - rear right side - Scratch(es) - Smart repair
3	Door - rear left side	Door edge - Scratch(es) - Smart repair
4	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
5	Door - front right side	Door - Scratch(es) - Paint
6	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
7	Bonnet	Bonnet (Übermäßige Steinschläge) - Stone chips - Paint
8	Vehicle glazing	Windscreen (Mit Rissbildung) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Mudguard - left side	Mudguard - left side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 31 Oct 2025	5.996,45 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Ein Nachweis über die Zulässigkeit des beiliegenden Radsatzes wurde nicht erbracht.
- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

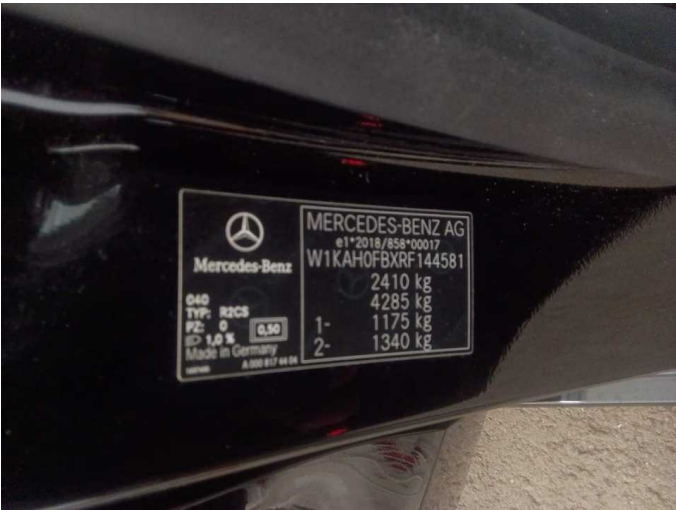


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

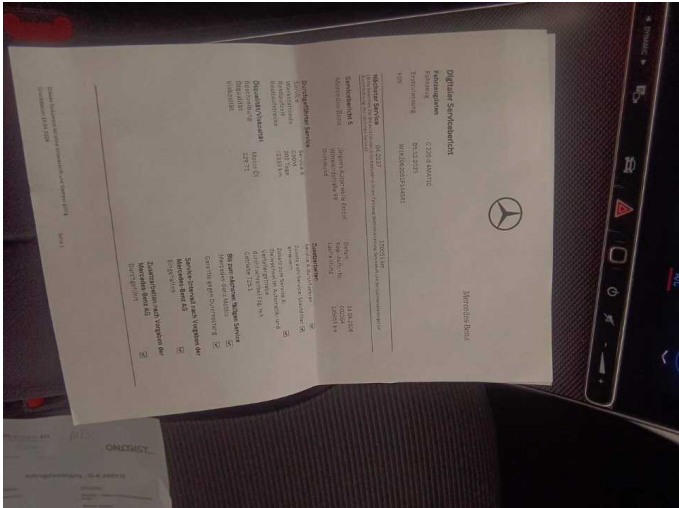


Figure 14: Documents

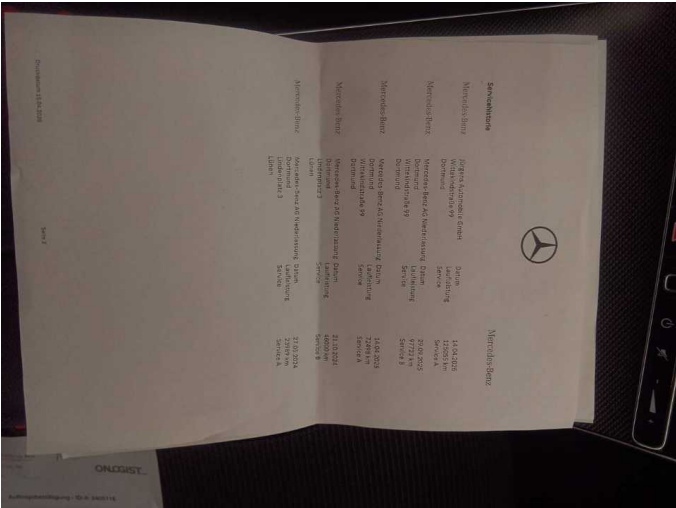


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres

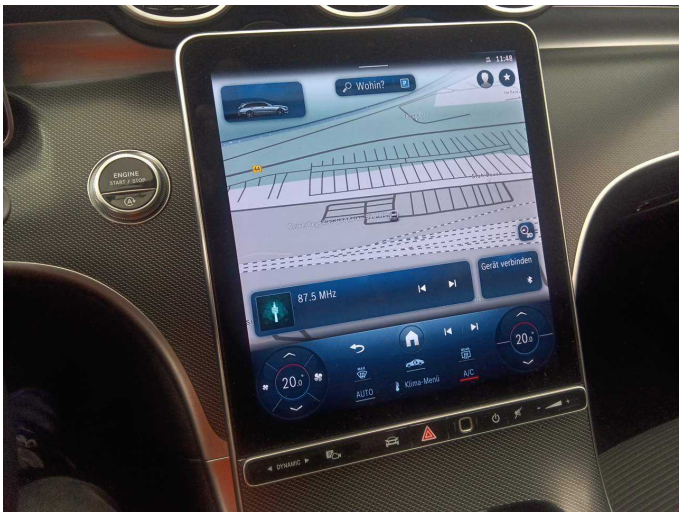


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

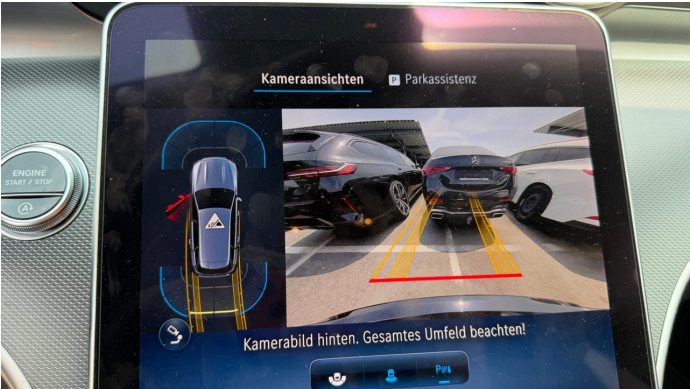


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

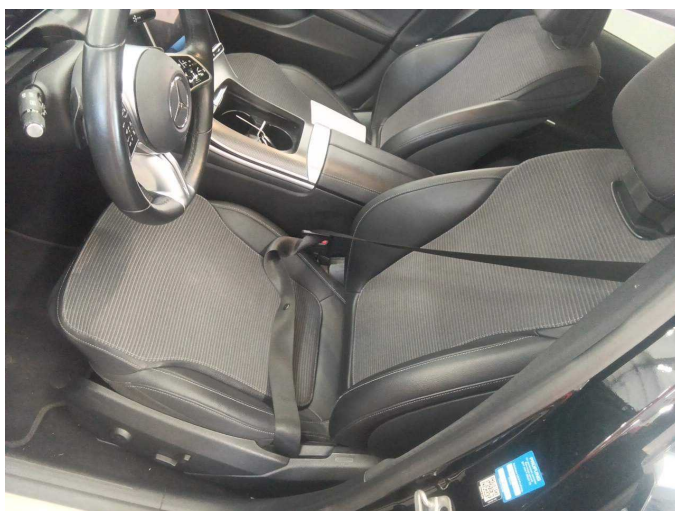


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.



Figure 35: Misc.



Damage 1: Side panel - rear left side: Mudguard - rear left side - Scratch(es) - Smart repair

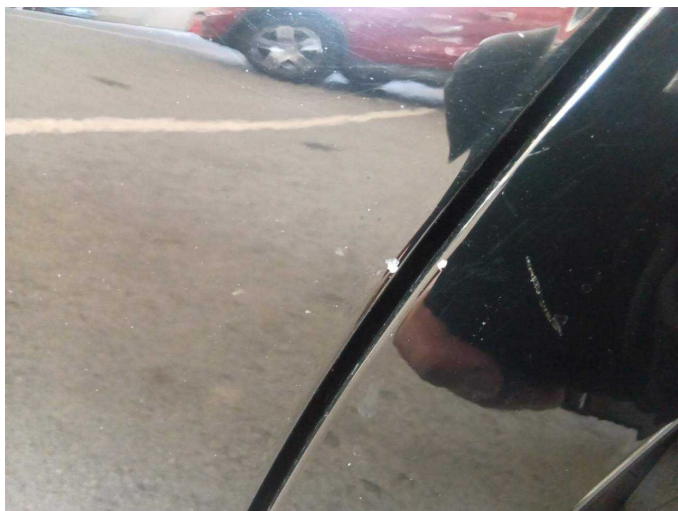

Damage 1: Side panel - rear left side: Mudguard - rear left side - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Mudguard - rear right side - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Mudguard - rear right side - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Mudguard - rear right side - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair




Damage 4: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 4: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 5: Door - front right side: Door - Scratch(es) - Paint

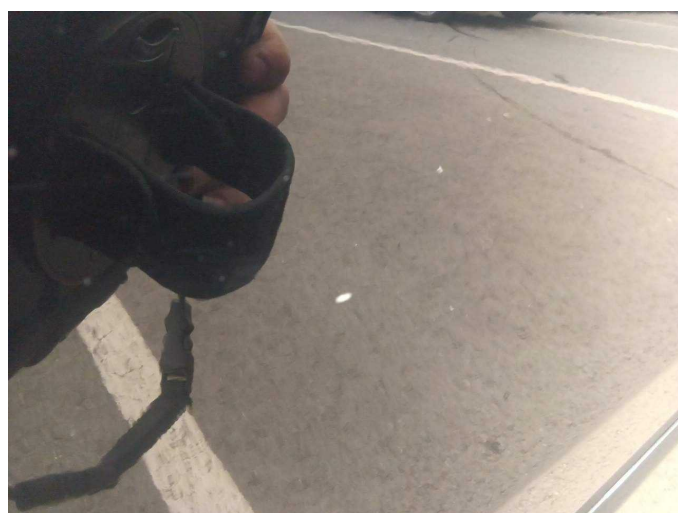

Damage 5: Door - front right side: Door - Scratch(es) - Paint




Damage 5: Door - front right side: Door - Scratch(es) - Paint



Damage 5: Door - front right side: Door - Scratch(es) - Paint



Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

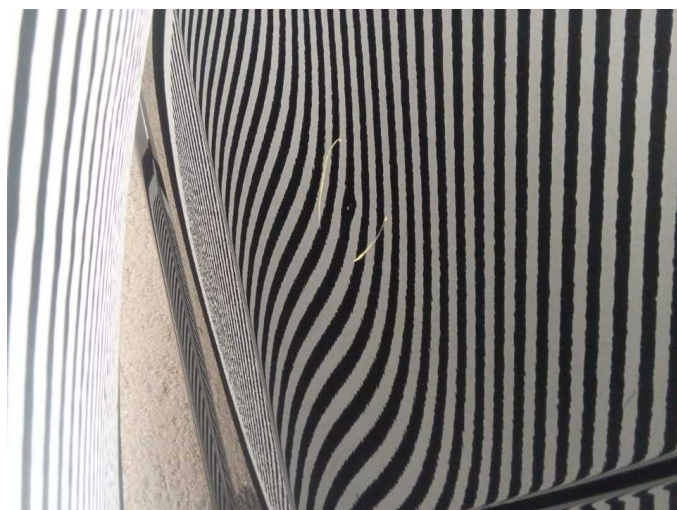

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint

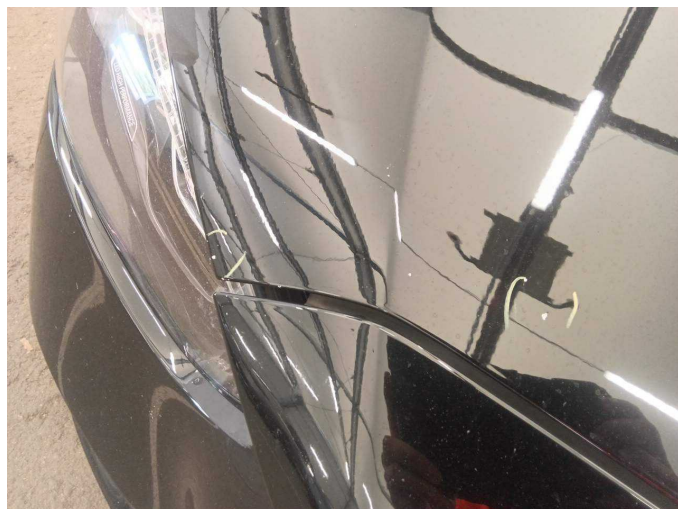

Damage 7: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint

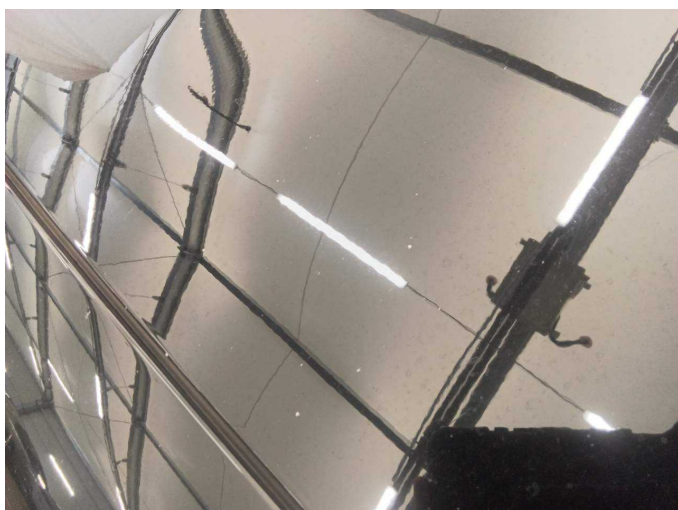


Damage 7: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint



Damage 8: Vehicle glazing: Windscreen (Mit Rissbildung) - Stone chips - Replace



Damage 8: Vehicle glazing: Windscreen (Mit Rissbildung) - Stone chips - Replace

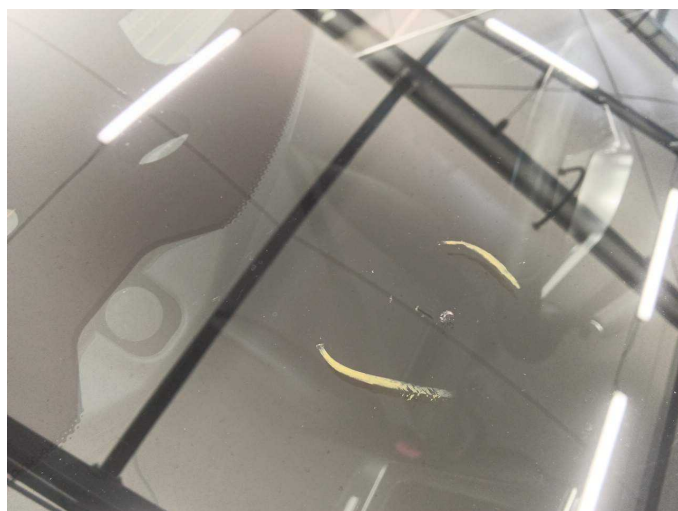

Damage 8: Vehicle glazing: Windscreen (Mit Rissbildung) - Stone chips - Replace



Wear and tear 1: Mudguard - left side: Mudguard - left side - Stone chips
- No deduction



Wear and tear 1: Mudguard - left side: Mudguard - left side - Stone chips
- No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KAH0FBXRF144581

Hersteller / Modell: MERCEDES-BENZ MB C 220 d 4Matic T 9G-TRONIC Avantgarde
Advanced

Datum	KM-Stand	Beschreibung
14.04.2026	125.055	Bremsklötze hinten; Regelwartungsdienst
09.09.2025	97.722	Bremsklötze vorne; Regelwartungsdienst
17.03.2025	72.498	Regelwartungsdienst
09.10.2024	47.975	Bremsklötze hinten; Regelwartungsdienst
13.05.2024	23.989	Regelwartungsdienst