



CITROËN BERLINGO: FP-988-RY

Vinnumber:	VR7EFYHYCLN506020	Versionname:	CITROËN BERLINGO M 650kg BlueHDi 100 S&S BVM Driver VU [4P] bvm 5-100CH-5cv (fourgonnettesimple cabine)
First Registrationdate:	6/05/2020	Fiscalpower:	
Expertise Mileage:	74346	Power Kw:	75
Bodytype:	Transporter	Body colour:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Grey
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	1	Radio	
Number keys remote	1	Front parking sensors	
GPS big screen color		Rear parking sensors	
GPS storage		Roof rack	
GPS storage	HD	Sliding door right-side	
Windows electric F		Rear view camera	
Cruise Control		Seat cover lining	Lining Other
Steering wheel multifunctional			
Type of climate control	Manual climate control		

Tyres

195/65/15/95 H				
Summer tyres:	Fr.L.	Michelin: 80%	Fr.R.	Michelin: 85%
	Re.L.	Michelin: 75%	Re.R.	Michelin: 85%
Tyre profile depth FL				3.1
Tyre profile depth FR				2.5
Tyre profile depth RL				3.2
Tyre profile depth RR				2.5
Tyre size FL				195/65 R 15 95 H
Tyre size FR				195/65 R 15 95 H
Tyre size RL				195/65 R 15 95 H
Tyre size RR				195/65 R 15 95 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Spare wheel	Yes	Jack	Yes
Remote ignition key, Missing, Repair/replace (lump sum)			



Malfunction indicator, Blinking, Check



Interior trim, Broken, Replace



Door panel FR, Scratch(es), Replace



Dashboard cladding, Scratch(es), Replace



Glove compartment lid, Scratch(es), Replace




Gear shift lever cover, Tear, Replace



Steering wheel, Scratch(es), Replace



Interior, Dirty, Cleaning

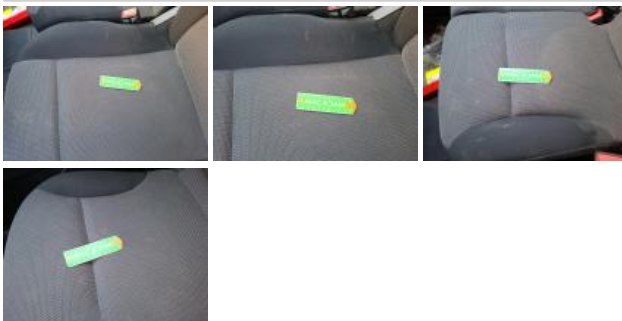

Tyre FR, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace



Tyre RL, Out of tolerance, Replace




Tyre FL, Out of tolerance, Replace



Side wall RL, Dent(s) and scratch(es), Repair and paint (complete)



Windscreen, Stone chip(s), Replace

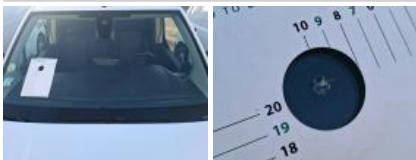

Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Roof pillar R, Dent(s) and scratch(es), Repair and paint (complete)



Door FR, Dent(s), Repair and paint (complete)



Rubber seal for boot lid, Tear, Replace



Rear light L, Broken, Replace



Bumper R, Deformed / Strained, Repair and paint (complete)



Boot door panel RL, Dent(s) and scratch(es), Repair and paint (complete)



Boot door panel RR, Dent(s) and scratch(es), Repair and paint (complete)



Rear light R, Scratch(es), Replace



Historique Maintenance

Immatriculation: **FP-988-RY** Date de 1ère immatriculation: **06/05/2020**

Modèle: **Citroen BERLINGO M 650kg BlueHDi 100 S&S BVM Driver VU [4P] bvm 5-100CH-5cv (fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
14/11/2024	59.591	GARAGE JEAN PIERRE TARDY	FILTRE CLIM RPLT
	0		REVISION
	0		RECYCLAGE
	0		ADBLUE
	0		BALAIS ESSUIE GLACE AV
	0		DIVERS CLIM
	0		REVISION
	0		FILTRE A AIR RPLT
	0		LIQUIDE DE FREIN
15/12/2022	41.155	EUROMASTER FRANCE	REMPLACEMENT PNEUS HIVER
16/09/2022	39.660	GARAGE ESCOFFIER	ADBLUE
	0		LAMPE AR RPLT
06/07/2022	36.992	GARAGE ESCOFFIER	REVISION ET CLIM ET AIR ET CARBURANT
	0		LAMPE RPLT
	0		LIQUIDE DE FREIN
28/04/2022	34.387	GARAGE ESCOFFIER	DISQUES PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT
05/04/2022	33.237	GARAGE ESCOFFIER	BALAIS ESSUIE GLACE AV
	0		ADBLUE
	0		LAMPE CODE AVD RPLT
14/12/2021	26.916	GARAGE ESCOFFIER	ADBLUE
	0		LAMPE AR RPLT
12/11/2021	25.615	EUROMASTER FRANCE	REMPLACEMENT PNEUS HIVER
13/07/2021	20.888	GARAGE ESCOFFIER	LAMPE CODE AVD RPLT
	0		PILE DE CLE RPLT
06/07/2021	20.323	EUROFLEET TYRES AND SERVICES	PERMUTATIONS PNEUS
24/06/2021	19.417	EUROMASTER FRANCE	REPARATION DE ROUE
16/04/2021	15.209	GARAGE ESCOFFIER	ADBLUE
23/12/2020	6.376	GARAGE ESCOFFIER	ADBLUE
16/11/2020	2.956	EUROMASTER FRANCE	REMPLACEMENT PNEUS HIVER