



MERCEDES-BENZ GLB: GE-705-AQ

Vinnumber:	W1N2476121W164505	Versionname:	MERCEDES-BENZ GLB 200 d Business Line VP
First Registrationdate:	7/01/2022	Fiscalpower:	[5P] bva 8-150CH-8cv (SUV)
Expertise Mileage:	118194	Power Kw:	110
Bodytype:	SUV	Body colour:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Roof bar black	
Steering wheel leather		Rear view camera	
Type of climate control	Autom climate control	Seat cover lining	Lining Other
			Lining Leather

Tyres

	235/55/18/100 W			
Summer tyres:	Fr.L.	Pirelli: 65%	Fr.R.	Pirelli: 70%
	Re.L.	Bridgestone: 40%	Re.R.	Bridgestone: 45%
Tyre profile depth FL				3.9
Tyre profile depth FR				3.6
Tyre profile depth RL				5.5
Tyre profile depth RR				5.3
Tyre size FL				235/55 R 18 100 W
Tyre size FR				235/55 R 18 100 W
Tyre size RL				235/55 R 18 104 H
Tyre size RR				235/55 R 18 104 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				264
Tyre make FR				264
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Remote ignition key (no insert), Missing, Repair/replace (lump sum)




Armrest F M, Tear, Repair/replace (lump sum)



Door seal FL, Tear, Replace



Interior, Stain, Cleaning

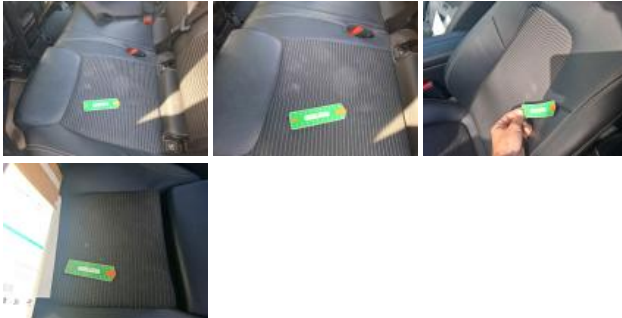

Tyre FL, Out of tolerance, Replace



Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Tyre RL, Out of tolerance, Replace



Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)




Tyre RR, Out of tolerance, Replace



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Tyre FR, Out of tolerance, Replace

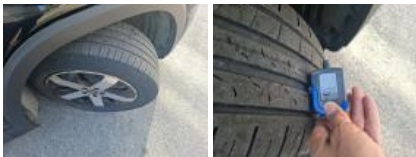

Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Side repeater L, Crack, Replace



Door RL, Dent(s), Repair and paint (complete)



Door trim FL, Scratch(es), Replace



Door trim RL, Scratch(es), Replace



Wing trim FL, Scratch(es), Replace



Bumper F, Bad repair, Paint



Bumper moulding FR, Scratch(es), Replace



Bumper moulding F, Scratch(es), Replace



Bumper moulding FL, Scratch(es), Replace



Door FR, Bad repair, Paint



Door RR, Bad repair, Paint



Wing trim FR, Unclasp(ed), Dismount/Mount



Wing FR, Bad repair, Paint



Door trim FR, Scratch(es), Replace



Bumper moulding R, Crack, Replace



Tailgate / Boot, Dent(s), Repair and paint (complete)



Bumper R, Bad repair, Paint



Bumper moulding R, Scratch(es), Replace



Historique Maintenance

Immatriculation: **GE-705-AQ** Date de 1ère immatriculation: **07/01/2022**

Modèle: **Mercedes GLB GLB 200 d Business Line VP [5P] bva 8-150CH-8cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
29/06/2026	118.193	MECANIQUE AUTOMOBILE SA	REVISION ET CLIM
			DISQUES PLAQUETTES AV RPLT
			AMORTISSEURS AV RPLT
			DISQUES PLAQUETTES AR RPLT
			BALAIS ESSUIE GLACE AV AR
			BALAIS ESSUIE GLACE AV AR
10/09/2025	103.712	EUROFLEET TYRES AND SERVICES	PERMUTATIONS PNEUS
15/11/2024	83.730	MECANIQUE AUTOMOBILE SA	BALAIS ESSUIE GLACE AV
			BALAI ESSUIE GLACE AR
			REVISION
			LIQUIDE DE FREIN
			FILTRE A AIR RPLT
			REVISION
15/04/2024	69.003	CONTITRADE FRANCE	ADBLUE
			PLAQUETTES AR RPLT
			REPLACEMENT PNEUS HIVER
29/02/2024	65.755	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS 4 SAISONS
20/09/2023	55.980	MECANIQUE AUTOMOBILE SA	PLAQUETTES AV RPLT
			REVISION ET CLIM
13/10/2022	25.530	MECANIQUE AUTOMOBILE SA	REVISION