



Kia Niro:			
Vinnumber:	KNACC81GFM5091838	Versionname:	KIA NIRO e-Niro 150kW e-Xtra 204PK 5d/pAUT
First Registrationdate:	27/04/2021	Fiscalpower:	
Expertise Mileage:	168558	Power Kw:	150
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	2713
Fueltype:	Electric		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	No		

Options			
Number of keys total	2	Luggage cover	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Type of GPS storage	HD		

Limited Technical Inspection

Tyres


215/55/17/98 H					
Winter tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 4 mm	
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm	
Tyre profile depth FL					5.0
Tyre profile depth FR					4.0
Tyre profile depth RL					5.0
Tyre profile depth RR					5.0
Tyre size FL					215/55 R 17 98 H
Tyre size FR					215/55 R 17 98 H
Tyre size RL					215/55 R 17 98 H
Tyre size RR					215/55 R 17 98 H
Tyre type FL					Winter
Tyre type FR					Winter
Tyre type RL					Winter
Tyre type RR					Winter
Tyre make FL					256
Tyre make FR					256
Tyre make RL					256
Tyre make RR					256

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	1		
Number of charging cables (rapid charge)	1		


Total cost ex VAT	2243,64
Bonnet, Scratch(es), Acceptable	0,00



Bumper moulding F, Scratch(es), Acceptable 0,00

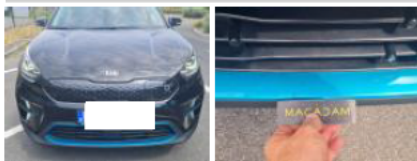

Windscreen, Stone chip(s), Windscreen repair 75,44

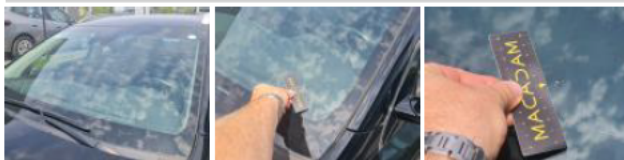

Bumper F, Scratch(es), Acceptable 0,00



Wing FL, Scratch(es), Repair and paint (complete) 308,32



Alloy rim FL polished, Scratch(es), Repair and paint (complete) 204,21



Door FL, Scratch(es), Repair and paint (complete) 445,79




Wing trim FL, Scratch(es), Replace 126,08



Alloy rim RL polished, Scratch(es), Repair and paint (complete) 204,21



Wing RL, Scratch(es), Repair and paint (complete) 431,58

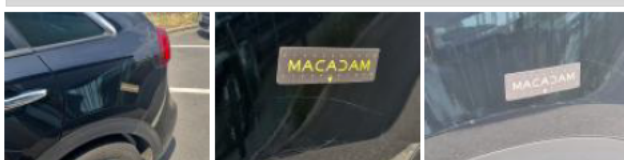

Internal boot lining L, Scratch(es), Acceptable 0,00



Internal boot lining R, Scratch(es), Acceptable	0,00
---	------



Wheel aperture RR, Dent(s) and scratch(es), Spot repair	148,33
---	--------



Alloy rim FR polished, Scratch(es), Repair and paint (complete)	204,21
---	--------



Door FR, Dent(s), Paintless dent repair	95,47
---	-------

