



Expertise

Protocol number: 46436649
Order No. / Reference: 26598245
Inspection date: 9 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1V9076331P329928

Model: 316 CDI Sprinter 4x4 Standard HA 7G-TRONIC Plus



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz 316 CDI Sprinter 4x4 Standard HA 7G-TRONIC Plus	
Vehicle Identification number	W1V9076331P329928
Mileage (Read)	145,800 km
First registration	2 Mar 2021
Number of holders	1
Next periodical technical inspection	03/2027
(Report on hand)	
Power / Engine displacement	120 kw / 2,143 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Van
Colour / colour code	ARKTIKWEISS
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	267 Tag(e)
Last service on / at	03/2025 at 113,847 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FZ160367
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AQU 00812		
Emission standard	EUROVI; D; M, N	fine dust sticker	
Permitted total weight	3,500 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/75 R16 121R	Winter tyres on Steel	Sonstige	7mm / 7mm
2)	225/75 R16 121R	Winter tyres on Steel	Sonstige	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E				

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment above windshield
- Rear towing eye
- Driver's side airbag
- Switchable all-wheel drive
- Electrically adjustable and heated exterior mirrors, left and right
- Outdoor temperature display
- Battery: fleece battery 12 V / 70 Ah
- Hill start assist
- third brake light
- Brake lights, adaptive
- Tachometer
- Driving light assistant
- Generator 14 V / 200 A
- Seatbelt warning device for driver's seat
- Grab handle for entry of driver and passenger
- Main tank 93 liters
- HOLD function
- KEYLESS start
- Child safety locks on doors in the passenger compartment
- Communication module (LTE) for digital services
- Paint finish: Solid color paint
- Headlight range control
- OBD (On Board Diagnosis) Level D
- Breakdown Management (By pressing the breakdown button or via the phone book entry in the vehicle's address book, the disabled vehicle automatically establishes a voice connection with the Customer Assistance Center (CAC). It transmits the current location and all relevant vehicle information. The CAC staff immediately inform the nearest Mercedes-Benz Service24h, which dispatches a repair service.)
- Sliding door on the right side
- Power steering
- Seats: Driver's seat armrest
- Daytime running light
- First aid kit
- Warning triangle
- Immobiliser
- Central locking with radio remote control
- Storage compartment under cockpit
- ADAPTIVE ESP (latest generation) with load- and speed-dependent driving dynamics control (Anti-lock Braking System (ABS) - Traction Control System (ASR) - Electronic Brakeforce Distribution (EBD) - Hydraulic Brake Assist (BAS) - Load Adaptive Control (LAC) - Roll Over Mitigation (ROM) - Roll Movement Intervention (RMI) - Enhanced Understeering Control (EUC) - Brake Disc Wiping/Drying (BDW) - Electronic Brake Prefill (EBP) - Easy Lane Change (ELC))
- Diesel particulate filter and SCR
- Entry handle on rear right corner pillar
- Electric window regulator for driver and passenger door
- 7G-TRONIC PLUS automatic transmission
- Grab handle for entry to the cargo area sliding door on the partition wall
- Rear lights with partial LED technology
- Instrument panel and instrument cluster with various storage options (and optimized operating and display elements)
- Headrests (2), front
- Steering wheel adjustable for tilt and height
- Mercedes-Benz emergency call system
- Without weight increase/decrease: 3,500 kg
- Upholstery: Cloth
- Radio: Radio pre-installation (2 speakers)
- Radio: Pre-installation for digital radio DAB
- Radio accessories: Communication module (LTE) for digital services
- Tires: Premium protection tires (3 years)
- Wheels: Steel rims 6.5 J x 16 (with tires 225/75 R16 C low rolling resistance tires)
- Crosswind Assist
- Seats: Passenger seat armrest
- Seats: Adjustable passenger seat
- continuous partition wall
- Lashing eyes (according to DIN 7510-3 in the floor and in the B-pillars)
- Heat-insulating glass
- Approval N1



Extra equipment

- 1-DIN slot at the front (under the headliner)
- Switchable all-wheel drive with gear reduction
- 13-pin trailer socket
- Battery master switch, single pole
- Battery: fleece battery 12 V / 92 Ah
- Mounting rails for roof racks
- Front cupholder
- Digital operating instructions
- Lockable compartment in storage area above windshield
- Front right window fixed in SW/ cargo area sliding door
- Generator 14 V / 180 A
- Seatbelt warning device for front passenger seat
- Hinged lid for storage compartment
- Tempmatic controlled air conditioning
- LED light strip in the cargo area
- Cable duct on side wall
- Marker lights, side
- Navigation (linguatron voice control, Wi-Fi hotspot, multimedia connection unit for connecting portable devices via an additional USB-C interface, center fill speaker for improved sound and voice output, improved hands-free function, dual-phone operation, digital operating instructions)
- Navigation: Live Traffic capability
- Package: Acoustics in conjunction with MBUX
- Package: Instrument panel charging package in conjunction with MBUX (The charging package expands the charging options in the cockpit with two 5V USB-C ports and one 12V socket. One USB port and the 12V socket are installed in the center storage compartment of the instrument panel, and another USB port is located in the lower part of the center console. This allows for the charging of electronic devices such as mobile phones within easy reach of the driver and front passenger.)
- Rear view camera
- Rear mud flaps
- Seats: Comfort passenger seat
- Seats: Lumbar support, passenger seat
- Seat heating on passenger side
- Cruise control
- Pre-installation for intelligent tachograph EU
- Parking light removed
- Heat-insulating glass with band filter on the windshield
- Thermal insulation of the cargo/passenger compartment
- Passenger side airbag
- Towbar (for increased towing capacity 2.8 t / 3.0 t)
- Exterior mirrors without turn signals
- Battery: Disconnect relay for additional battery.
- Battery: Auxiliary battery for retrofitted devices, interior
- Front side indicator lights
- Ceiling light in the cargo/passenger compartment (with door contact)
- Fixed front left window in SW/ load compartment sliding door in conjunction with tinted rear windows, black
- Speed limit 130km/h
- Wooden floor (cargo area)
- Terminal block for electrical connections on the driver's seat box
- Cable duct at rear portal
- Steering wheel: Multifunction steering wheel
- MBUX multimedia system with 7-inch touchscreen (High-resolution 7-inch touchscreen (960 x 540 pixels), AM/FM radio with dual tuner, Bluetooth connectivity with audio streaming and hands-free function, smartphone integration via Android Auto or Apple CarPlay, multimedia connection unit for connecting portable devices via a USB-C interface, 4 x 25 W output power, sound adjustment, separate volume control for audio and telephone, 2-way front speakers)
- Package: SMOKER
- Parameterizable special module
- Crossbeam with step
- Radio: Digital Radio DAB
- Tires: M+S tires
- Tires: Continental brand
- Tires: Tire brand, special request
- Spare wheel
- Spare wheel carrier with jack (under frame end)
- Double-leaf rear door, opening to side wall
- Front mud flaps
- Seats: Comfort driver's seat
- Seats: Lumbar support for driver's seat
- Seat heating on driver's side
- Cargo area lining up to the beltline
- Warm air auxiliary heater with timer
- Long-throw nozzles in I-panel
- Thermal insulation driver's compartment



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Rear door - left side (Verkleidung) - Broken / torn - Replace
2	Boot lid / rear door	Rear door - right side (Verkleidung) - Broken / torn - Replace
3	Side panel - rear left side	Interior trim - Broken / torn - Replace
4	Side panel - rear right side	Interior trim - Broken / torn - Replace
5	Body	Body - Glued / labelled - De-glue / neutralise
6	Front bumper	Front bumper - Damaged - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Soiled - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Body	Body - Scratch(es) - No deduction
4	Body	Body - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

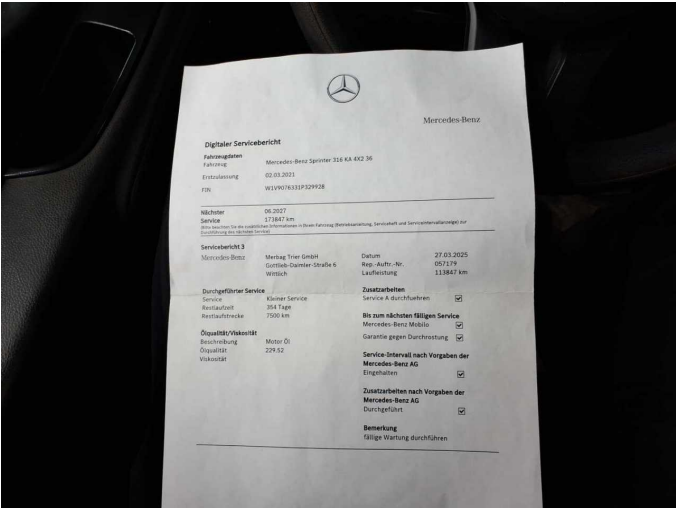


Figure 15: Documents

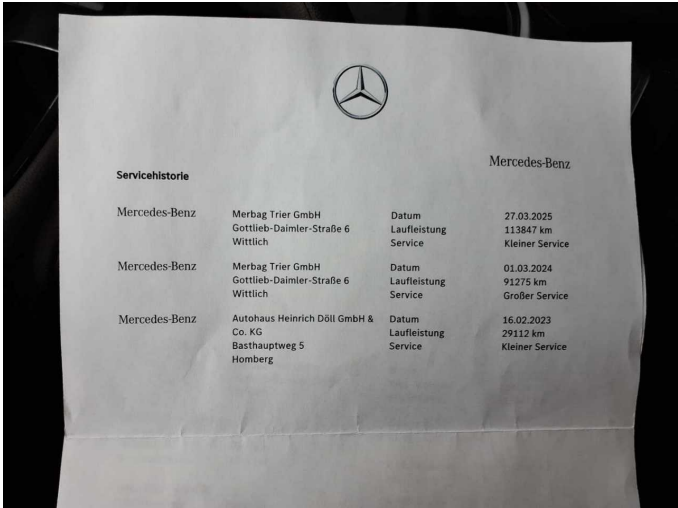


Figure 16: Documents



Figure 17: Documents



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

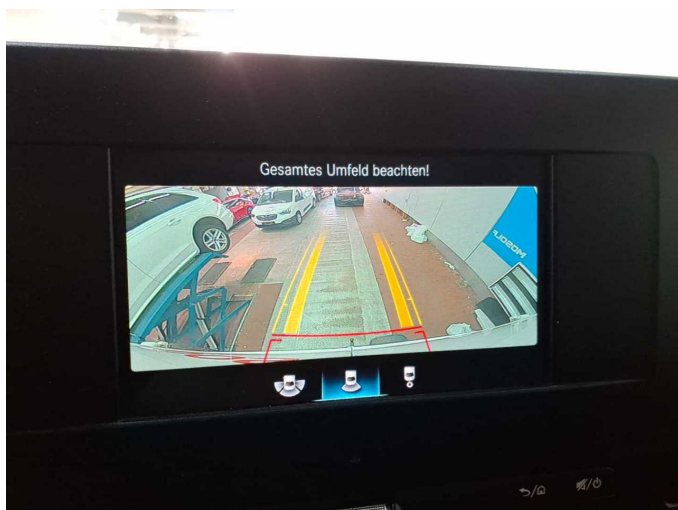


Figure 21: Misc.

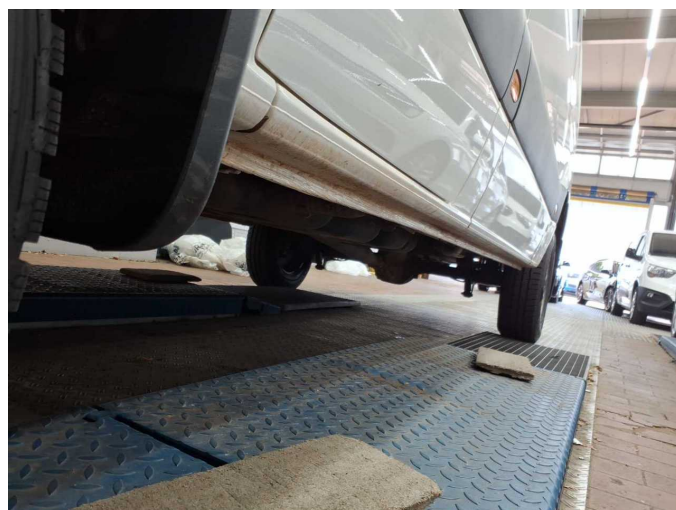


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

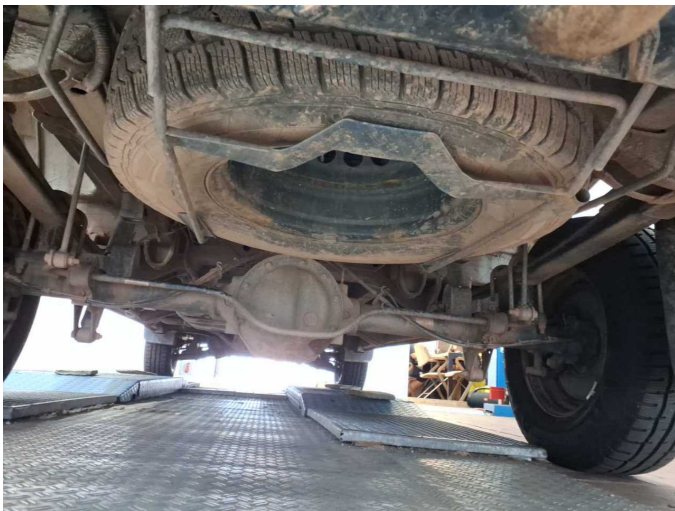


Figure 27: Misc.



Figure 28: Misc.



Damage 1: Boot lid / rear door: Rear door - left side (Verkleidung) - Broken / torn - Replace



Damage 1: Boot lid / rear door: Rear door - left side (Verkleidung) - Broken / torn - Replace




Damage 2: Boot lid / rear door: Rear door - right side (Verkleidung) - Broken / torn - Replace



Damage 2: Boot lid / rear door: Rear door - right side (Verkleidung) - Broken / torn - Replace



Damage 3: Side panel - rear left side: Interior trim - Broken / torn - Replace

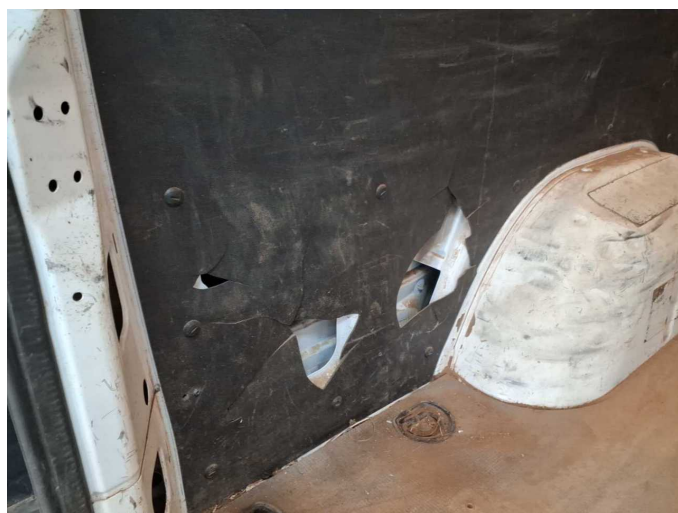

Damage 3: Side panel - rear left side: Interior trim - Broken / torn - Replace



Damage 4: Side panel - rear right side: Interior trim - Broken / torn - Replace



Damage 4: Side panel - rear right side: Interior trim - Broken / torn - Replace



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Front bumper: Front bumper - Damaged - Replace



Damage 6: Front bumper: Front bumper - Damaged - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1V9076331P329928

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ 316 CDI Sprinter 4x4
Standard HA 7G-TRONIC Plus

Datum	KM-Stand	Beschreibung
21.07.2025	123.345	Systemtest/Eigendiagnose
07.05.2025	113.847	AU
02.04.2025	113.847	Batterie ern
27.03.2025	113.847	Regelwartungsdienst
29.02.2024	91.275	Bremsklötze hinten; Regelwartungsdienst
18.10.2023	77.303	Bremsklötze vorne
03.03.2023	30.034	AU
16.02.2023	29.112	Regelwartungsdienst