

MACDAM

Volkswagen ID.3 '20 BEV


Vehicle information


Make:	Volkswagen	License:	
Gearbox:	Automatic	Body color:	
Model:	ID.3 '20 BEV	VIN:	WVWZZZE1ZMP032074
Fuel type:	Electric	Power:	107 kW
Version:	ID.3 58kWh 145 Business	First registration	23/12/2020
Mileage:	94656 km	N° of doors:	

Damage summary

Left	2
Rear	3
Right	1

Commercial pictures

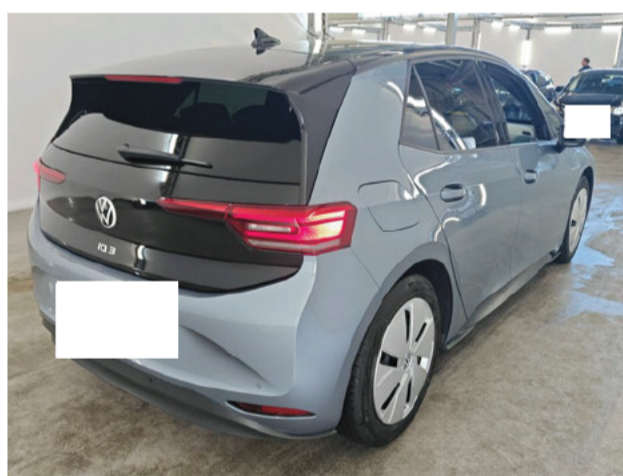

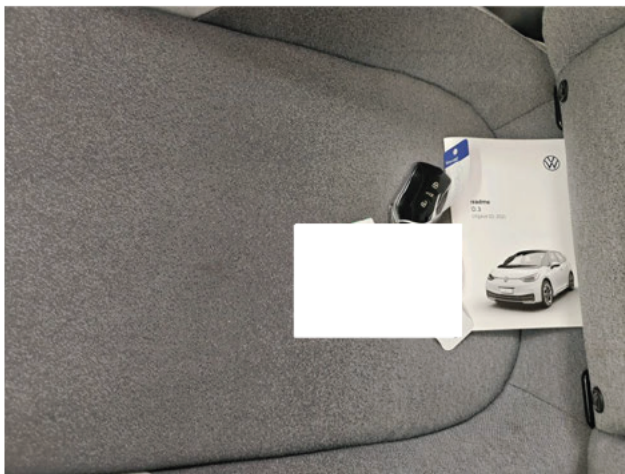

Batterijcertificaat
Datum van diagnose: 19/06/2026

90,43%
Status van de gezondheid (SOH)*

Volkswagen ID3
VIN : WVVZZZE1ZMP032074
Kilometerstand : 94.655 km

*SOH berekend op basis van fabrieksgegevens, informatie om rekening mee te houden voor de fabrieksgarantie

Meer weten over: www.get-moba.com

CARA



Options according to the inspector

Central consol F	Yes	GPS	Yes	Headlights Xenon/LED/Laser	Yes
Radio multimedia	Yes	Telephone equipment	Yes		

Damages

Boot lid covering R

Scratch(es)

Smart repair

Rear




Bumper R

Scratch(es)

Repair and paint (complete)

Rear

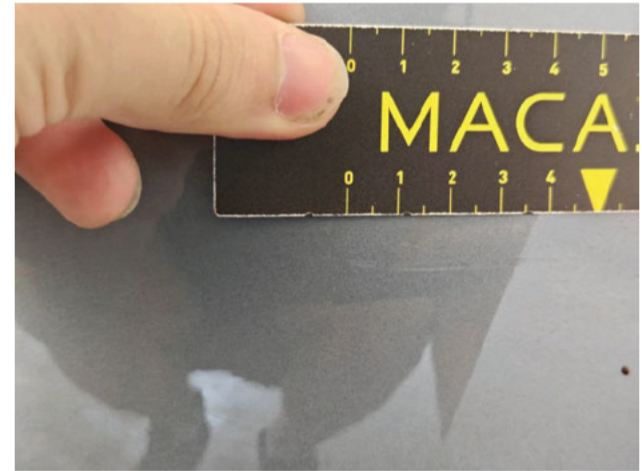

Charging cable (normal)

Missing

Replace

Rear




Door FL

Scratch(es)

Repair and paint (complete)

Left

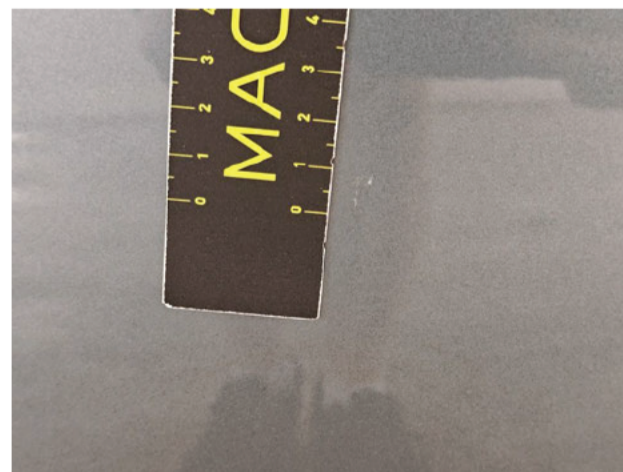

Wing RL
 Scratch(es)
 Repair and paint (complete)
 Left



Wing RR
 Dent(s) and scratch(es)
 Repair and paint (complete)
 Right



Tyres

Front Left

Summer

215/55/18/95/T

Continental

4.2 mm

Front Right

Summer

215/55/18/95/T

Continental

4.1 mm

Rear Left

Summer

215/55/18/95/T

Continental

3.7 mm

Rear Right

Summer

215/55/18/95/T

Continental

3.8 mm

Checks

Certificate of Conformity	No	CO2 Emission	0
Digital maintenance	Yes	GPS storage	Yes
GPS storage	HD	Luggage cover	Yes
Number head rests	5	Number of charging cables (rapid charge)	1
Number of keys total	2	Service book	N/A
User's manual	Yes		

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.