TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula

Expertise

Protocol number: 48237250
Order No. / Reference: 27143384
Inspection date: 21 Oct 2026

Manufacturer: Volkswagen	Model: Golf Variant 2.0 TDI SCR DSG R-Line
VIN: WVWZZZCDZNW504158	





Vehicle details

Manufacturer / Type / Model / Equipment	
Volkswagen Golf Variant 2.0 TDI SCR DSG R-Line	
Vehicle Identification number	WVWZZZCDZNW504158
Mileage (Read)	116,723 km
First registration	8 Sept 2021
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Car station wagon
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Grey-Black

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	4,300 km
Last service on / at	12/2025 at 104,546 km		
Key is / should be	2 / 2	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC450176
Previous damage / Accident	Detectable	**Repainting**	Detectable
Inspection conditions	sufficient	**Lifting equipment / pit**	yes
Test drive	Not performed	**Engine function test**	Performed
Manufacturer key number/ type code number	0603 / CNN 00699		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,060 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/40 R18 92Y	Summer tires (with run-flat tires) on Light alloy	Goodyear	5mm / 5mm
2)	225/40 R18 92Y	Summer tires (with run-flat tires) on Light alloy	Goodyear	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93V	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/50 R17 93V	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- 30-color ambient lighting
- App-Connect
- Exterior mirror housings and door handles in body color
- third brake light
- Car2X
- Decorative inlays "Carbon Grey"
- Digital Cockpit Pro, multicolor
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster
- Driving profile selection
- Electric windows, front and rear
- Pedestrian protection measures expanded
- luggage compartment cover
- Transmission: 7-speed DSG
- Rear window wiper with intermittent function
- ISOFIX mounting points
- Rear headrests (3)
- LED reading lights at the front (2) and 2 at the rear
- LED headlights
- Dynamic headlight range control
- Fatigue detection
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Brushed stainless steel pedals
- Radio "Composition"
- Wheels: Tire Mobility Set
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Top sports seats in the front
- Start-stop system
- Bumpers in body color
- Textile floor mats front and rear
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- black roof rails
- Diesel particulate filter and SCR catalyst
- Parking assistance
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights
- Chassis: Sport chassis
- Windscreen made of laminated safety glass, heat and sound insulating
- Speed limiter
- Rear window heated
- Rear spoiler in car color
- "Climatronic" air conditioning system
- Front headrests
- LED taillights
- Steering wheel: Multifunction sports steering wheel in leather, with touch controls and paddle shifters
- Non-smoking version
- Emergency call service
- Package: Seat Comfort Package
- Progressive steering
- Tire pressure monitoring system (passive)
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in "R-Line" fabric
- Seats: Lumbar support in the front
- Lane keeping assistant “Lane Assist”
- 12-volt power outlet in the luggage compartment
- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Green thermal insulation glazing, sides and rear

Extra equipment

- Air conditioning "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Package: Business Premium incl. navigation system (R-Line DSG) (6+1 speakers, App-Connect incl. App-Connect Wireless for Apple CarPlay, Android Auto, automatic distance control, adaptive cruise control (ACC) stop/go, speed limiter, emergency brake, pedestrian detection, travel assist, lane assist, emergency assist, multifunction sports steering wheel with LED and heated steering wheel, paddle shifters, multifunction camera, Discover Media navigation incl. streaming & internet (MP3, touchscreen, USB), cargo net, radio, heated windshield washer system, voice control, telephone interface, comfort with inductive charging, textile floor mats, traffic sign recognition, heated front seats)
- Paint finish: Pearl effect
- Steering wheel: Multifunction sports steering wheel in leather, heated, with touch controls and paddle shifters
- Engine underbody protection including stone chip protection
- IQ.LIGHT - LED matrix headlights, including Light and Sight package (Dynamic Light Assist high beam control for LED matrix headlights - Automatically dimming interior mirror - IQ.LIGHT - LED matrix headlights with LED daytime running lights, cornering lights and dynamic turn signals - LED taillights with dynamic turn signals - Dynamic headlight range control with dynamic cornering lights - Multifunction camera - Rain sensor - Bad weather lights and cornering lights)
- Rear side windows and rear window tinted
- Rear View reversing camera
- Towbar, foldable with electric release
- Wheels: Alloy wheels (4) "Bergamo" 7.5 J x 18 (in black, polished surface - with individual installation - wheel locks with enhanced theft protection - tires 225/40 R 18)
- Wheels: Winter wheels LM 6.5Jx17 "Belmont" PWC

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key with remote control (Batterie) - Empty - Replace
2	Equipment	Tirefit filler - Expired - Replace
3	Electrical system	Lighting system (Kurvenlicht) - Functional / admissibility - Perform diagnosis
4	Indicator - front	Mirror - left side (Materialabtrag) - Scratch(es) - Replace
5	Wheel / tyres	Tyre - front right side (Flanke) - Damaged - Replace
6	Sill - right side	Trim - Scratched - Paint
7	Bonnet	Emblem (Rissbildung) - Stone chips - Replace
8	Wheel / tyres	Alloy rim - front left side (Geschliffen) - Unprofessionally repaired - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 9 Aug 2024	2.278,38 €

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
2	Bonnet, Professionally carried out, Invoice of repair done Non-existent
3	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
4	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
5	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
6	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
7	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
8	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	154 µm	Bonnet	274 µm
Side panel - rear left side	157 µm	Side panel - rear right side	198 µm
Door - rear left side	214 µm	Door - rear right side	233 µm
Door - front left side	173 µm	Door - front right side	162 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

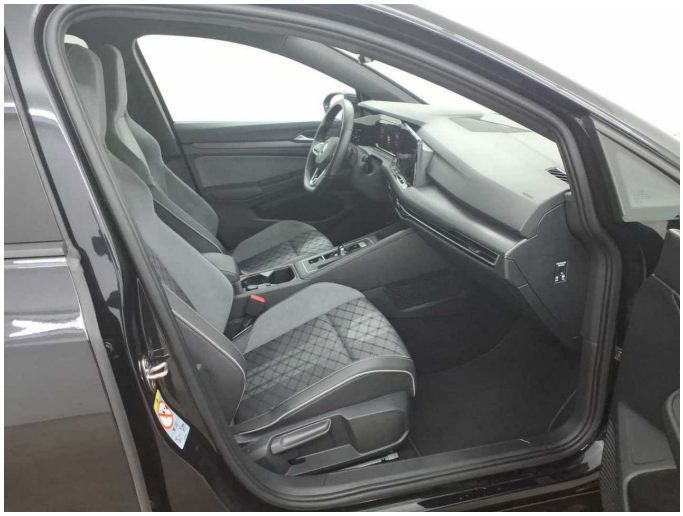


Figure 5: Interior - front

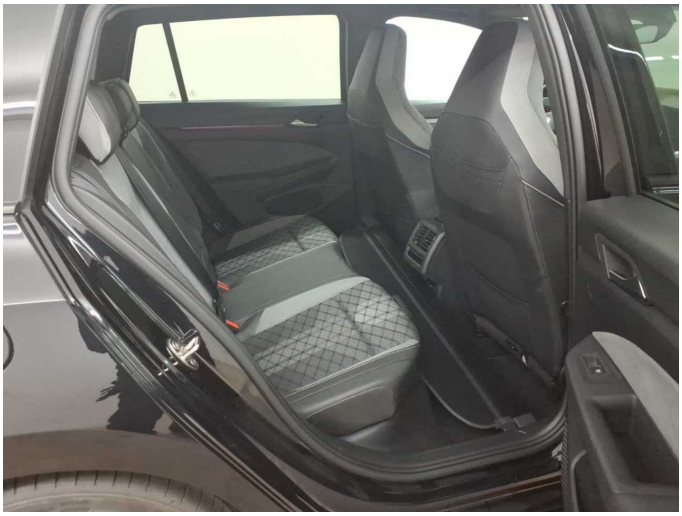


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

Figure 9: Interior 360° view (Online Link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

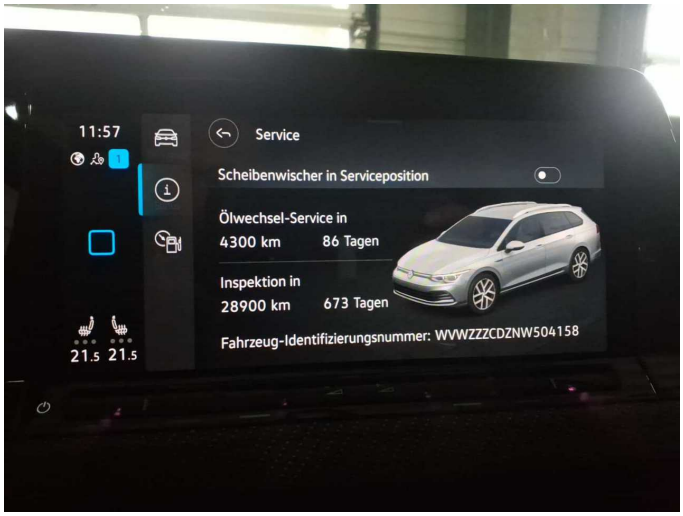


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

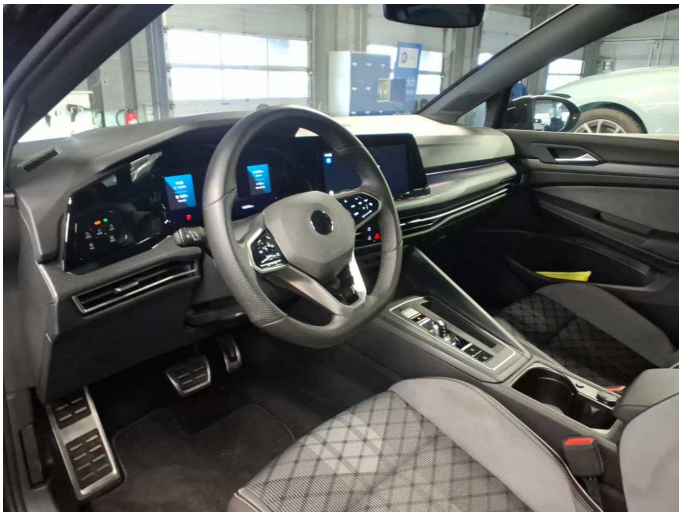


Figure 20: Misc.

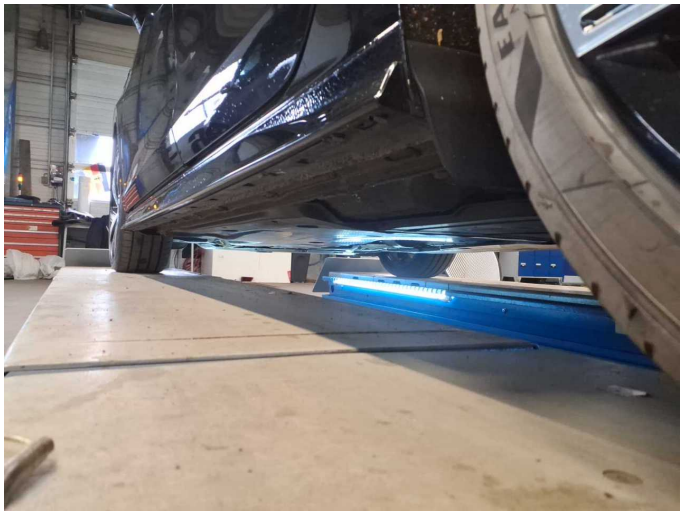


Figure 21: Misc.

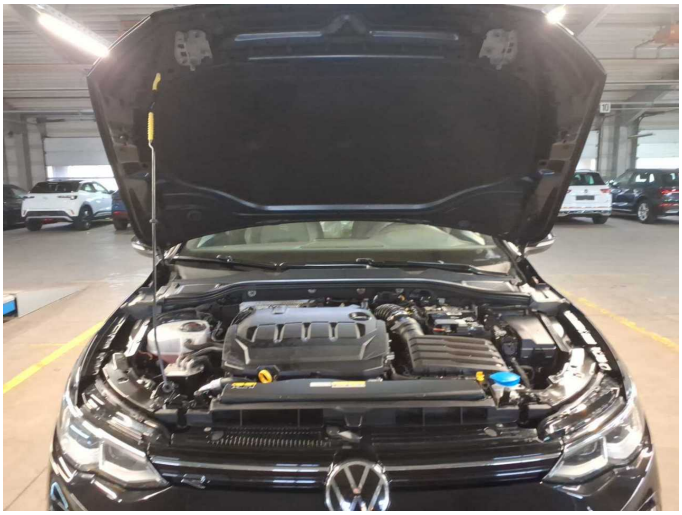


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

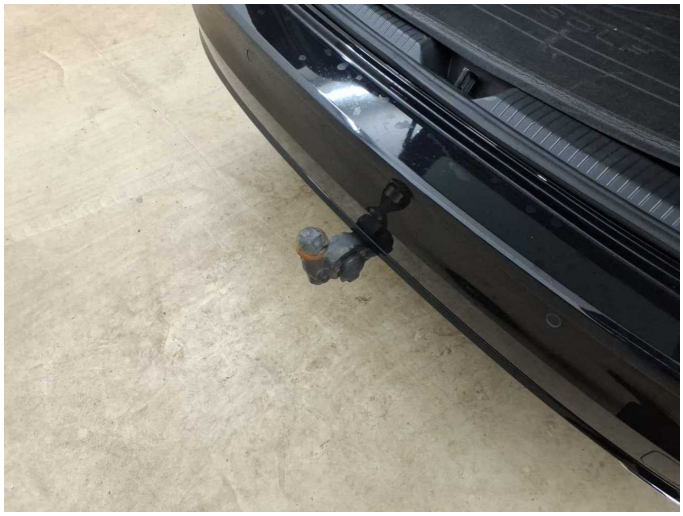


Figure 26: Misc.



Figure 27: Misc.



Damage 1: Equipment: Vehicle key with remote control (Batterie) - Empty - Replace



Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Electrical system: Lighting system (Kurvenlicht) - Functional / admissibility - Perform diagnosis



Damage 4: Indicator - front: Mirror - left side (Materialabtrag) - Scratch(es) - Replace



Damage 4: Indicator - front: Mirror - left side (Materialabtrag) - Scratch(es) - Replace



Damage 5: Wheel / tyres: Tyre - front right side (Flanke) - Damaged - Replace



Damage 5: Wheel / tyres: Tyre - front right side (Flanke) - Damaged - Replace



Damage 6: Sill - right side: Trim - Scratched - Paint




Damage 6: Sill - right side: Trim - Scratched - Paint



Damage 6: Sill - right side: Trim - Scratched - Paint



Damage 6: Sill - right side: Trim - Scratched - Paint

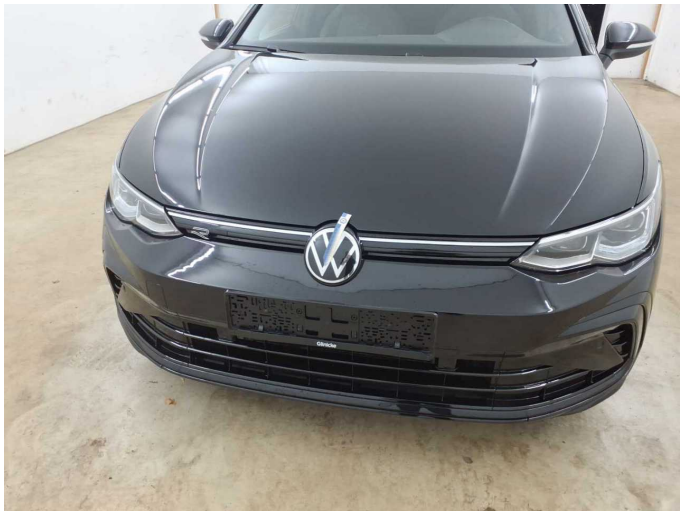

Damage 7: Bonnet: Emblem (Rissbildung) - Stone chips - Replace



Damage 7: Bonnet: Emblem (Rissbildung) - Stone chips - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Geschliffen) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Geschliffen) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Geschliffen) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Geschliffen) - Unprofessionally repaired - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Geschliffen) - Unprofessionally repaired - Replace



Repainting 1: Boot lid / rear door



Repainting 2: Bonnet



Repainting 3: Side panel - rear left side



Repainting 4: Side panel - rear right side



Repainting 5: Door - rear left side



Repainting 6: Door - rear right side



Repainting 7: Door - front left side



Repainting 8: Door - front right side