TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center
Nürnberg
Edisonstraße 15
90431 Nürnberg

Besichtigungsdatum: 24.09.2026
Protokollnummer: 48020688
Erstellt durch: Markus Böttcher
Besichtigt durch: Philipp Vitzthum

TMAH351DGNJ194377

Angaben zum Fahrzeug

Halter		**Besichtigungszustand**	ausreichend
Kennzeichen		**Laufleistung (abgelesen)**	53.477 km
Hersteller	Hyundai	**Restlauf bis Service**	4 Monat(e)
Typ/Modell	i 30	**HU (Bericht lag vor)**	10/2027
Vehicle Identification number	TMAH351DGNJ194377	**Leistung**	118 kW
Hubraum	1.482 ccm	**Zylinder**	4
Erstzulassung	17.11.2022	**Polster/Farbe**	Stoff / Anthrazit-Schwarz
Letzte Wartung	01/2026, 43.659 km	**Lackierung**	Weiß
Kraftstoffart	Hybr.Benzin/E	**Getriebe**	Automatik

Zustandsbericht

Wertmindernde Faktoren

Nr.	Bauteilgruppe	Beschreibung
1	Rad/Reifen	Reifen hinten rechts - beschädigt - erneuern
2	Sonstiges	Inspektion/Wartung (01/2026 - kein Nachweis - Garantieverlust) - entspricht nicht den Herstellervorgaben

Gebrauchsspuren

Nr.	Bauteilgruppe	Beschreibung
1	Verkleidungen/Abdeckungen	Heckdeckel, Innenverkleidung - Kratzer - kein Abzug
2	Rad/Reifen	Leichtmetallfelge vorn links - Kratzer - kein Abzug
3	Motorhaube	Motorhaube - Delle(n) - kein Abzug
4	Tür vorn links	Tür - Delle(n) - kein Abzug
5	Rad/Reifen	Leichtmetallfelge hinten rechts - Kratzer - kein Abzug

Fehlteile

Fehlteil

Festgestellte Nachlackierungen

Nr.	Ort
Keine feststellbar	

Hauptbereifung

Achse	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Verktgl.	Zul.
1	225/45 R17 91W	Michelin	Sommerreifen	5mm - 5mm	i.O.	i.O.
2	225/45 R17 91W	Michelin	Sommerreifen	5mm - 5mm	n.i.O.	i.O.

Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center Nürnberg
Edisonstraße 15
90431 Nürnberg

Besichtigungsdatum:	24.09.2026
Protokollnummer:	**48020688**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Philipp Vitzthum

Angaben zum Fahrzeug

Hersteller	Hyundai	**Besichtigungszustand**	ausreichend
Typ/Modell	i 30	**Laufleistung (abgelesen)**	53.477 km
Vehicle Identification number	TMAH351DGNJ194377	**Erstzulassung**	17.11.2022

Angaben zum Auftrag:
Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

Fahrzeug-Identifizierung:
Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

Besichtigungsbedingungen:
Die Besichtigungsbedingungen waren zur Beurteilung des Fahrzeuges ausreichend.

Allgemeinzustand:
Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.



Unterschrift Sachverständiger (Markus Böttcher)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center Nürnberg
Edisonstraße 15
90431 Nürnberg

Besichtigungsdatum:	24.09.2026
Protokollnummer:	**48020688**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Philipp Vitzthum

Übersichtsfotos

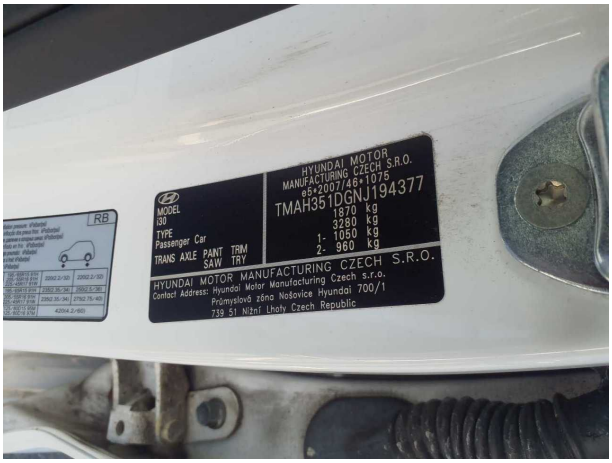


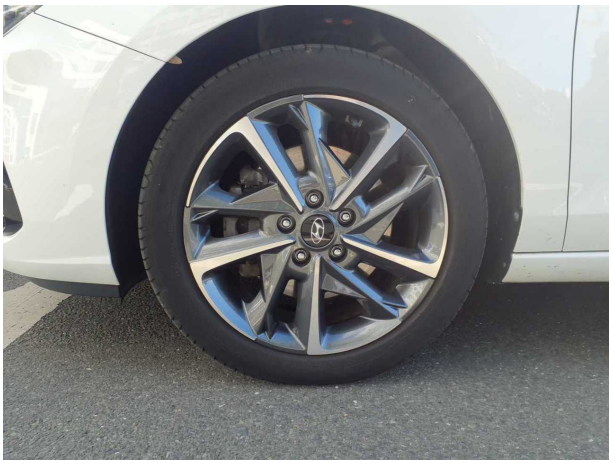
Abbildung 1: FIN


Abbildung 2: Schräg vorne


Abbildung 3: Schräg vorne


Abbildung 4: Schräg hinten


Abbildung 5: Schräg hinten


Abbildung 6: Montierte Bereifung

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center Nürnberg
Edisonstraße 15
90431 Nürnberg

Besichtigungsdatum:	24.09.2026
Protokollnummer:	**48020688**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Philipp Vitzthum

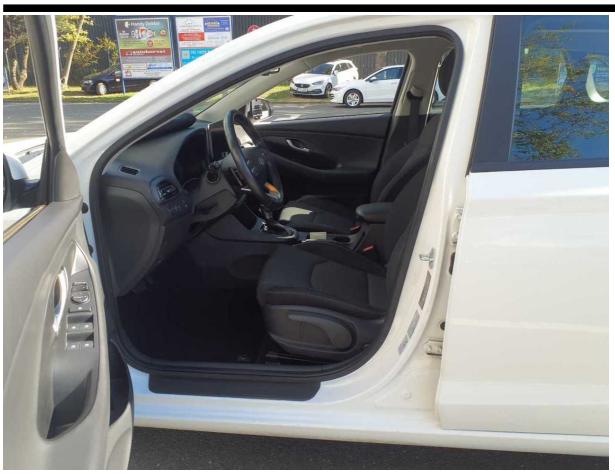


Abbildung 7: Innenraum vorne



Abbildung 8: Laderaum



Abbildung 9: Kombiinstrument



Abbildung 10: Kombiinstrument

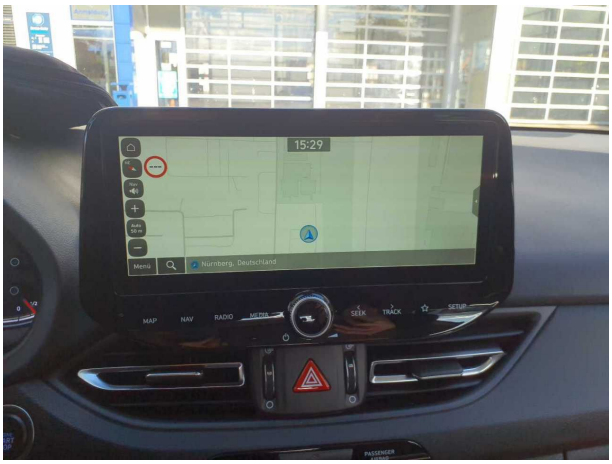


Abbildung 11: Instrumententafel



Abbildung 12: Instrumententafel

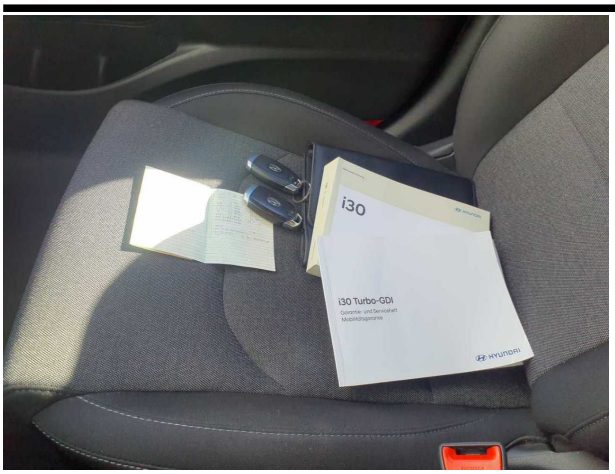


Abbildung 13: Dokumente

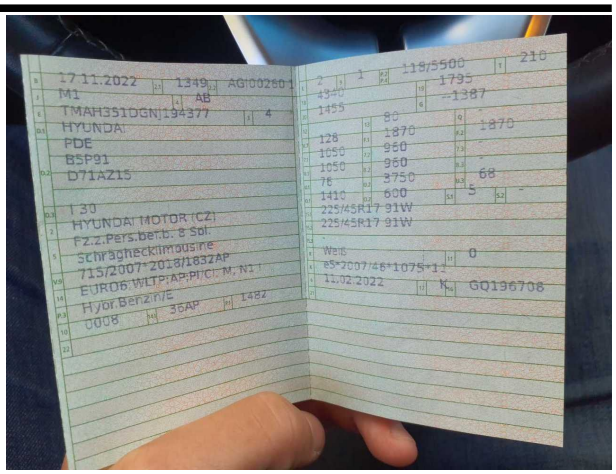



Abbildung 14: Dokumente

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center Nürnberg
Edisonstraße 15
90431 Nürnberg

Besichtigungsdatum:	24.09.2026
Protokollnummer:	**48020688**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Philipp Vitzthum

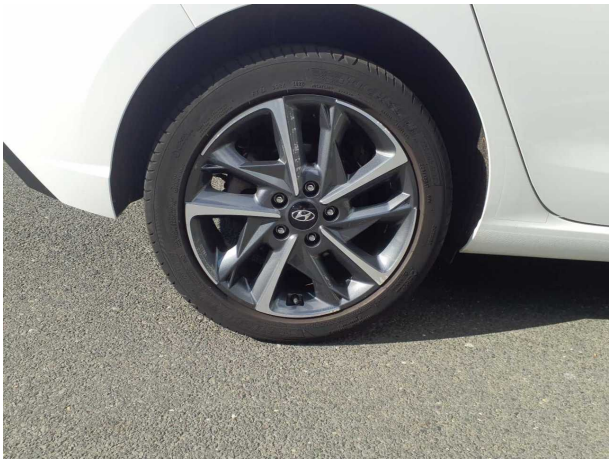Beschädigungsfotos



Beschädigung #1: Rad/Reifen: Reifen hinten rechts - beschädigt - erneuern



Beschädigung #1: Rad/Reifen: Reifen hinten rechts - beschädigt - erneuern

HYUNDAI

Übereinstimmungsbescheinigung
Πιστοποιητικό Συμμόρφωσης
Certificat de Conformité
Certificate of Conformity
Certificato di Conformità
Conformiteitscertificaat
Świadectwo Zgodności
Certifikat o skladnosti
Certificado de Conformidad

046CC0136436

www.PS-Team.de

COMPLETE VEHICLES
CERTIFICATE OF CONFORMITY

Part 1

The undersigned M. KNOPIK GENERAL MANAGER hereby certifies that the vehicle:

0.1. Make (Trade name of manufacturer):	Hyundai
0.2. Type:	PDE
- Variant:	B5P91
- Version:	D71AZ15
0.2.1. Commercial name(s):	i 30
0.2.3. Identifiers:	
0.2.3.1. Interpolation family's identifier:	IP-050629-TMA-1
0.2.3.2. ATCT family's identifier:	AT-050628-TMA-1
0.2.3.3. PEMS family's identifier:	05-HMM-20-0
0.2.3.4. Roadload family's identifier:	RL-050629-TMA-1
0.2.3.5. Roadload Matrix family's identifier:	-
0.2.3.6. Periodic regeneration family's identifier:	-
0.2.3.7. Evaporative test family's identifier:	EV-000003-TMA-1
0.4. Vehicle category:	M1
0.5. Company name and address of manufacturer:	
Hyundai Motor Manufacturing Czech s.r.o.,Prumyslova zona Nosovice,Hyundai 700/1,73951 Nizni Lhoty,CZ	
0.6. Location and method of attachment of the statutory plates:	
On the left hand B-post, bonded	
Location of the vehicle identification number:	
Under the right front seat	
0.9. Name and address of the manufacturer's representative:	
Hyundai Motor Europe Technical Center GmbH; Hyundai Platz, 65428 Rüsselsheim, Germany	
0.10. Vehicle identification number:	TMAH351DGNJ194377
0.11. Date of manufacture of the vehicle:	16.08.2022

conforms in all respects to the type described in approval e5*2007/46*1075*11 granted on 11.02.2022
and can be permanently registered in Member States having right hand traffic and using metric
units for the speedometer and metric units for the odometer

Place , Date and Signature HMC 29.08.2022

Part 2

General construction characteristics

1. Number of axles:	2 and wheels 4
3. Powered axles (number, position, interconnection):	1, Front
3.1. Specify if the vehicle is non-automated/automated/fully automated	non-automated

Main dimensions

4. Wheelbase:	2650 mm
4.1. Axle spacing:	1-2: 2650 mm 2-3: mm 3-4: mm
5. Length:	4340 mm
6. Width:	1795 mm
7. Height:	1455 mm

Masses

13. Mass in running order:	1387 kg
13.2. Actual mass of the vehicle:	1431 kg
16. Technically permissible maximum masses	
16.1. Technically permissible maximum laden mass:	1870 kg
16.2. Technically permissible mass on each axle:	1. 1050 kg 2. 960 kg
16.4. Technically permissible maximum mass of the combination:	3280 kg
18. Technically permissible maximum towable mass in case of:	
18.1. Drawbar trailer:	- kg
18.3. Centre-axle trailer:	1410 kg
18.4. Unbraked trailer:	600 kg
19. Technically permissible maximum static vertical mass at the coupling point:	80 kg

4186426

GQ196708

Power plant

20. Manufacturer of the engine: Hyundai or Kia
21. Engine code as marked on the engine: G4LK
22. Working principle: Spark ignition / 4-stroke
23. Pure electric: no
23.1. Class of Hybrid [electric] vehicle: NOVC-HEV
24. Number and arrangement of cylinders: 4; Inline
25. Engine capacity: 1482 cm3
26. Fuel: Hybrid Petrol/Electric
26.1. Mono fuel/Bi fuel/Flex fuel/Dual-fuel: Mono fuel
26.2. (Dual-fuel only)
27. Maximum power
27.1. Maximum net power: 117,50 kW at 5500min-1
(internal combustion engine) :
27.3. Maximum net power: 12.20 kW (electric motor)
27.4. Maximum 30 minutes power: 7.94 kW (electric motor)

28. Gearbox (type): Automatic
28.1. Gearbox ratios

1st gear	2nd gear	3rd gear	4th gear	5th gear	6th gear	7th gear	8th gear
-	-	-	-	-	-	-	-

28.1.1. Final drive ratio: -
28.1.2. Final drive ratios

1st gear	2nd gear	3rd gear	4th gear	5th gear	6th gear	7th gear	8th gear
-	-	-	-	-	-	-	-

Maximum speed

29. Maximum speed: 210 km/h

Axles and suspension

30. Axle(s) track: 1. 1559 mm 2. 1567 mm
35. Fitted tyre/wheel combination/energy efficiency class of rolling resistance coefficients (RRC) and tyre category used for CO2 determination:
Axle1 : 225/45R17 91W 7.0Jx17/ET53 / B/C1
Axle2 : 225/45R17 91W 7.0Jx17/ET53 / B/C1

Brakes

36. Trailer brake connections -

Bodywork

38. Code for bodywork: AB(hatchback)
40. Colour of vehicle: white
41. Number and configuration of doors: 5; 2 left, 2 right, 1 rear
42. Number of seating positions (including the driver): 5
42.1. Seat(s) designated for use only when the vehicle is stationary: -
42.3. Number of wheelchair user accessible position: -

Environmental performances

46. Sound level
- Stationary: 76,30 dB(A) at engine speed : 3750 min-1
- Drive-by: 68,00 dB(A)

47. Exhaust emission level: Euro 6 AP
47.1. Parameters for emission testing of Vind
47.1.1. Test mass, kg: 1506
47.1.2. Frontal area, m2: 2.23
47.1.2.1. Projected frontal area of air entrance of the front grille, cm2: -
47.1.3. Road load coefficients
47.1.3.0. f0, N: 105.1
47.1.3.1. f1, N/(km/h): 0.621
47.1.3.2. f2, N/(km/h) 2: 0.03205
47.2. Driving cycle
47.2.1. Driving Cycle class: 3b
47.2.2. Downscaling factor (fdsc): -
47.2.3. Capped speed: no
48. Exhaust emissions: EC715/2007*2018/1832AP
1.2. Test procedure: Type 1 (NEDC average values, WLTP highest values) or WHSC (EURO VI)
CO: 621,7 mg/km
THC: 53,2 mg/km
NMHC : 46.6 mg/km
NOx: 25,2 mg/km
THC+NOx: - mg/km
NH3 :
Particulates (mass) : 0,270 mg/km
Particles (number) : 1.25E + 11
2.2. test procedure: WHTC (EURO VI)
48.1. Smoke corrected absorption coefficient: -(m-1)

48.2. Declared maximum RDE values

	Complete RDE trip:	Urban RDE trip:
NOx:	60mg/km	60mg/km
Particles (number) :	6E+11	6E+11

49. CO2 emissions/fuel consumption/electric energy consumption:
1. All power trains, except pure electric vehicles

NEDC Values	CO2 emissions	Fuel consumption
Urban conditions:	137 g/km	5,9 l/100 km
Extra-urban conditions :	101 g/km	4,4 l/100 km
Combined:	114 g/km	5 l/100 km
Weighted, combined :	- g/km	- l/100km
Deviation factor		N/A
Verification factor		N/A

2. Pure electric vehicles and OVC hybrid electric vehicles

Electric energy consumption (weighted, combined)	Wh/km
Electric range	km

3. Vehicle fitted with eco-innovation(s): Yes
3.1. General code of the eco-innovation(s): e5 32+ e5 37
3.2. Total CO2 emissions savings due to the eco-innovation(s)

3.2.1. NEDC savings: - g/km
3.2.2. WLTP savings: 1.76 g/km
4. All power trains, except pure electric vehicle, under Commission Regulation(EU) 2017/1151

WLTP values	CO2 emissions	Fuel consumption
Low:	170 g/km	7.5 l/100 km
Medium:	122 g/km	5.4 l/100 km
High:	108 g/km	4.8 l/100 km
Extra High	132 g/km	5.8 l/100 km
Combined:	128 g/km	5.6 l/100 km
Weighted, combined	- g/km	- l/100 km

5. Pure electric vehicles and OVC hybrid electric vehicles, under Commission Regulation (EU) 2017/1151
5.1. Pure electric vehicles

Electric energy consumption	- Wh/km
Electric range	- km
Electric range city	- km

5.2. OVC hybrid electric vehicles

Electric energy consumption (ECAC,weighted) :	- Wh/km
Electric range (EAER)	- km
Electric range city (EAER city)	- km

Miscellaneous

51. For special purpose vehicles: designation in accordance with point 5 of Part A of Annex I to Regulation (EU) 2018/858 of the European Parliament and of the Council:
52. Remarks:
13:1387*30:A1:1573;A2:1581*35:195/65R15 91H,6.0Jx15/ET46;205/55R16 91H,LM-Rad 6.5Jx16/ET50;225/45R17 91W,LM-Rad 7.0Jx17/ET53*Use of 15" wheels not in combination with electronic parking brake and/or rear disc diameter of 284mm*Vehicle equipped with a 24 GHz short-range radar equipment(Narrow band only)*